


.

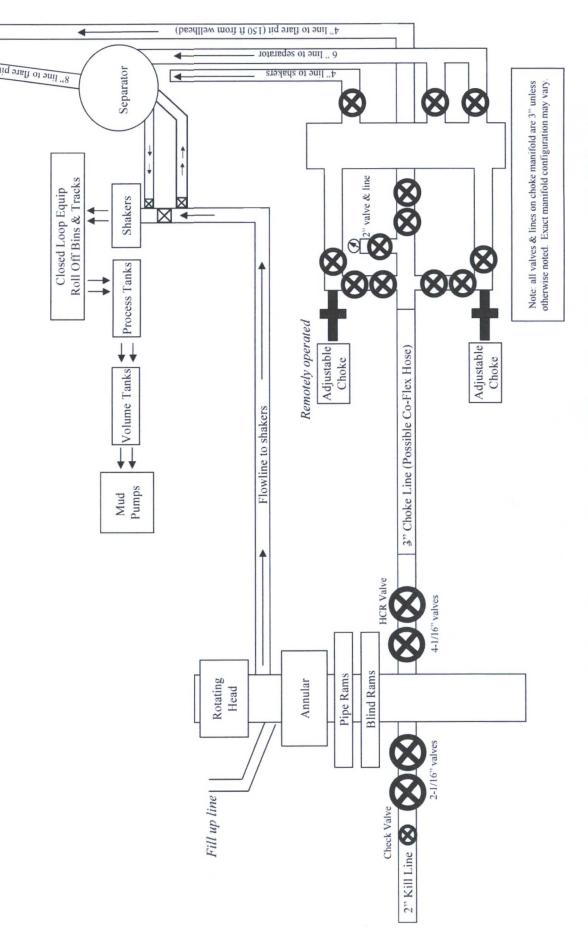


NOTES REGARDING BLOWOUT PREVENTERS

Devon Energy Production Company, L.P. COTTON DRAW UNIT 319H

- 1. Drilling Nipple will be constructed so it can be removed mechanically without the aid of a welder. The minimum internal diameter will equal BOP bore.
- 2. Wear ring will be properly installed in head.
- 3. Blowout preventer and all associated filings will be in operable condition to withstand a minimum of 3000psi working pressure.
- 4. All fittings will be flanged.


.

- 5. A fill bore safety valve tested to a minimum of 3000psi WP with proper thread connections will be available on the rotary rig floor at all times.
- 6. All choke lines will be anchored to prevent movement.
- All BOP equipment will be equal to or larger in bore than the internal diameter of the last casing string.
- 8. Will maintain a kelly cock attached to the kelly.
- 9. Hand wheels and wrenches will be properly installed and tested for safe operation.
- 10. Hydraulic floor control for blowout preventer will be located as near in proximity to driller's controls as possible.
- 11. All BOP equipment will meet API standards and include a minimum 40 gallon accumulator having two independent means of power to initiate closing operation.

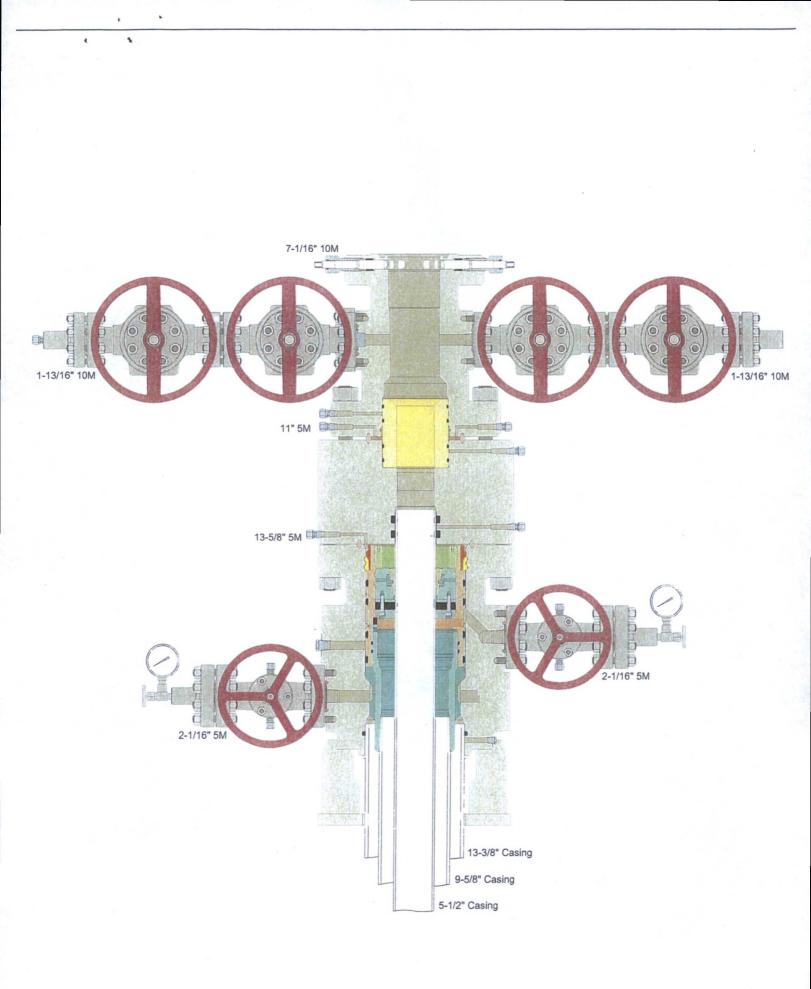



Commitment Runs Deep

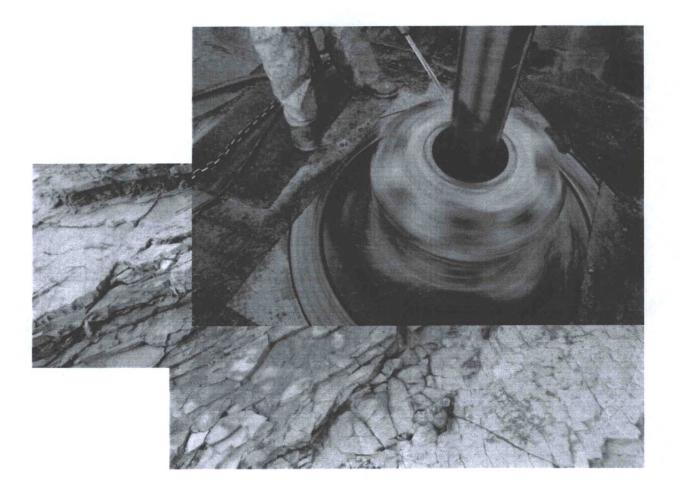

Design Plan Operation and Maintenance Plan Closure Plan

SENM - Closed Loop Systems June 2010

I. Design Plan

.

Devon uses MI SWACO closed loop system (CLS). The MI SWACO CLS is designed to maintain drill solids at or below 5%. The equipment is arranged to progressively remove solids from the largest to the smallest size. Drilling fluids can thus be reused and savings is realized on mud and disposal costs. Dewatering may be required with the centrifuges to insure removal of ultra fine solids.

The drilling location is constructed to allow storm water to flow to a central sump normally the cellar. This insures no contamination leaves the drilling pad in the event of a spill. Storm water is reused in the mud system or stored in a reserve fluid tank farm until it can be reused. All lubricants, oils, or chemicals are removed immediately from the ground to prevent the contamination of storm water. An oil trap is normally installed on the sump if an oil spill occurs during a storm.

A tank farm is utilized to store drilling fluids including fresh water and brine fluids. The tank farm is constructed on a 20 ml plastic lined, bermed pad to prevent the contamination of the drilling site during a spill. Fluids from other sites may be stored in these tanks for processing by the solids control equipment and reused in the mud system. At the end of the well the fluids are transported from the tank farm to an adjoining well or to the next well for the rig.


Prior to installing a closed-loop system on site, the topsoil, if present, will be stripped and stockpiled for use as the final cover or fill at the time of closure.

Signs will be posted on the fence surrounding the closed-loop system unless the closed-loop system is located on a site where there is an existing well, that is operated by Devon.

II. Operations and Maintenance Plan

Primary Shakers: The primary shakers make the first removal of drill solids from the drilling mud as it leaves the well bore. The shakers are sized to handle maximum drilling rate at optimal screen size. The shakers normally remove solids down to 74 microns.

Mud Cleaner: The Mud Cleaner cleans the fluid after it leaves the shakers. A set of hydrocyclones are sized to handle 1.25 to 1.5 times the maximum circulating rate. This ensures all the fluid is being processed to an average cut point of 25 microns. The wet discharged is dewatered on a shaker equipped with ultra fine mesh screens and generally cut at 40 microns.

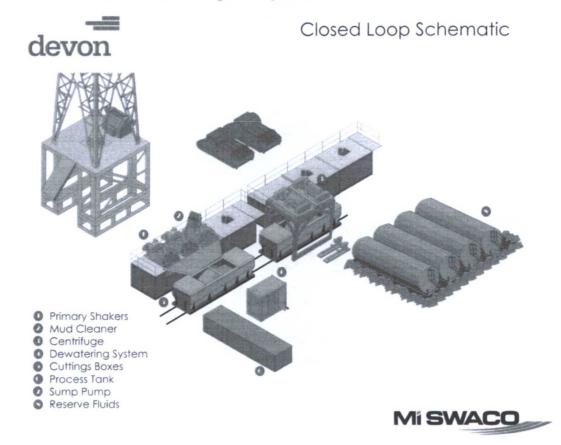

Centrifuges: The centrifuges can be one or two in number depending on the well geometry or depth of well. The centrifuges are sized to maintain low gravity solids at 5% or below. They may or may not need a dewatering system to enhance the removal rates. The centrifuges can make a cut point of 8-10 microns depending on bowl speed, feed rate, solids loading and other factors.

The centrifuge system is designed to work on the active system and be flexible to process incoming fluids from other locations. This set-up is also dependant on well factors.

Dewatering System: The dewatering system is a chemical mixing and dosing system designed to enhance the solids removal of the centrifuge. Not commonly used in shallow wells. It may contain pH adjustment, coagulant mixing and dosing, and polymer mixing and dosing. Chemical flocculation binds ultra fine solids into a mass that is within the centrifuge operating design. The dewatering system improves the centrifuge cut point to infinity or allows for the return of clear water or brine fluid. This ability allows for the ultimate control of low gravity solids.

.

•

.

Cuttings Boxes: Cuttings boxes are utilized to capture drill solids that are discarded from the solids control equipment. These boxes are set upon a rail system that allows for the removal and replacement of a full box of cuttings with an empty one. They are equipped with a cover that insures no product is spilled into the environment during the transportation phase.

Process Tank: (Optional) The process tank allows for the holding and process of fluids that are being transferred into the mud system. Additionally, during times of lost circulation the process tank may hold active fluids that are removed for additional treatment. It can further be used as a mixing tank during well control conditions.

Sump and Sump Pump: The sump is used to collect storm water and the pump is used to transfer this fluid to the active system or to the tank for to hold in reserve. It can also be used to collect fluids that may escape during spills. The location contains drainage ditches that allow the location fluids to drain to the sump.

Reserve Fluids (Tank Farm): A series of frac tanks are used to replace the reserve pit. These are steel tanks that are equipped with a manifold system and a transfer pump. These tanks can contain any number of fluids used during the drilling process. These can include fresh water, cut brine, and saturated salt fluid. The fluid can be from the active well or reclaimed fluid from other locations. A 20 ml liner and berm system is employed to ensure the fluids do not migrate to the environment during a spill.

If a leak develops, the appropriate division district office will be notified within 48 hours of the discovery and the leak will be addressed. Spill prevention is accomplished by maintaining pump packing, hoses, and pipe fittings to insure no leaks are occurring. During an upset condition the source of the spill is isolated and repaired as soon as it is discovered. Free liquid is removed by a diaphragm pump and returned to the mud system. Loose topsoil may be used to stabilize the spill and the contaminated soil is excavated and placed in the cuttings boxes. After the well is finished and the rig has moved, the entire location is scrapped and testing will be performed to determine if a release has occurred.

All trash is kept in a wire mesh enclosure and removed to an approved landfill when full. All spent motor oils are kept in separate containers and they are removed and sent to an approved recycling center. Any spilled lubricants, pipe dope, or regulated chemicals are removed from soil and sent to landfills approved for these products.

These operations are monitored by Mi Swaco service technicians. Daily logs are maintained to ensure optimal equipment operation and maintenance. Screen and chemical use is logged to maintain inventory control. Fluid properties are monitored and recorded and drilling mud volumes are accounted for in the mud storage farm. This data is kept for end of well review to insure performance goals are met. Lessons learned are logged and used to help with continuous improvement.

A MI SWACO field supervisor manages from 3-5 wells. They are responsible for training personnel, supervising installations, and inspecting sites for compliance of MI SWACO safety and operational policy.

III. Closure Plan

A maximum 340' X 340' caliche pad is built per well. All of the trucks and steel tanks fit on this pad. All fluid cuttings go to the steel tanks to be hauled by various trucking companies to an agency approved disposal.



Fluid Technology

ContiTech Beattle Corp. Website: <u>www.contitechbeattle.com</u>

Monday, June 14, 2010

RE:

٠

.

•

Drilling & Production Hoses Lifting & Safety Equipment

To Heimerich & Payne,

A Continental ContiTech hose assembly can perform as intended and suitable for the application regardless of whether the hose is secured or unsecured in its configuration. As a manufacturer of High Pressure Hose Assemblies for use in Drilling & Production, we do offer the corresponding lifting and safety equipment, this has the added benefit of easing the lifting and handling of each hose assembly whilst affording hose longevity by ensuring correct handling methods and procedures as well as securing the hose in the unlikely event of a failure; but in no way does the lifting and safety equipment affect the performance of the hoses providing the hose handled and installed correctly. It is good practice to use lifting & safety equipment but not mandatory.

Should you have any questions or require any additional information/clarifications then please do not hesitate to contact us.

ContiTech Beattie is part of the Continental AG Corporation and can offer the full support resources associated with a global organization.

Best regards,

Robin Hodgson Sales Manager ContiTech Beattie Corp

ContiTech Beattis Corp, 11535 Brittmoore Park Drive, Houston, TX 77041 Phone: +1 (832) 327-0141 Fax: +1 (832) 327-0148 www.contitechbeattis.com



R16212



÷

PHOENIX RUBBER

-)672/3 Szeged, Budapesti út 10. Hungary + H–6701 Szeged, P. O. Box 152 hone: (3662) 566-737 • Pax: (3662) 566-738

OUALITY DOCUMENT

.

è

INDUSTRIAL LTD. -SALES & MARKETING: H-1092 Budapest, Råday u. 42-44. Hungary • H-1440 Budapest, P. O. Box 26 Phone: (361) 456-4200 · Fax: (361) 217-2972, 456-4273 · www.taurusemerge.hu

QUAL INSPECTION	CERT. N														
PURCHASER:	Phoenix Beat	tie Co.			P.O. Nº-	151	9FA-871								
PHOENIX RUBBER order No-	170466	HOSE TYPE:	3"	ID ·	Cho	ke and Ki	Il Hose								
HOSE SERIAL Nº	34128	NOMINAL / AC	CTUAL LE	ENGTH:		11,43 n	n								
W.P. 68,96 MPa 1	0000 psi	T.P. 103,4	MPa	1500	0 psi	Duration:	60	min.							
Pressure test with water at ambient temperature		•					*								
					•										
:	See atta	achment. (1	page)	·. ·				34.6							
								h 6, 1							
↑ 10 mm = 10 Min. → 10 mm = 25 MPa	* <i>i</i>	COUPLE	NGS					1 1000 1 							
Туре		Serial Nº	1		Quality		Heat N°								
3" coupling with	72			A	ISI 4130		C7626								
4 1/16" Flange end				A	ISI 4130		47357								
					:										
				pec 16 erature	B C e rate:"E	3"									
All metal parts are flawless WE CERTIFY THAT THE ABOVE PRESSURE TESTED AS ABOVE			ed in ac	CORDAN	ICE WITH	THE TERMS	OF THE ORDE	R AND							
Date:	Inspector		Qual	ity Contr	THOE Ind	HOENIX RUBBER									
29. April. 2002.			De	Daca Hose Inspection and											
					PHC	ENIKAU	BER Q.C.								

S	1
9-1	۱
60	1
4	I
	t
	İ
	1
2	۱
800	Į
Z	I
5	1
000	1
9	1

252.003 .

ŏ

RD

1 1

~	
140	l
	1
20	1
18000	1
2	-
:0	1
-0-0001	1
0	
20-	1
40920-0	1
. 4	1

40920-0-00015 NB000	44	I
0-0-00015 NB		t
0-0-00015 NB		İ
0-0-00015 NB		1
0-0-00015 NB	30	I
	180	ł
-0-0001	~	ł
0-0-0	5	1
40920-0-(8	1
40920-	5	۱
400	20-	1
1	601	ł
	V	I

ł

ţ 1000 3

2

1	1	1	1	1	1	1			1	1	i	I	1	l	I	1	ł	1	1	1	-	1	1	1	t	E	-	1	ļ	1	1	1	1	1	1	1	1	
	100-1-1-		- SON	T M M T	100		0 0 1	008									000	000																				
	-00-		1001	- LENIEL	ENG		000	00							338		***	1000		6	0							8	0		- Comments		ţ	しまし			一の代明ード	
				000	00	A manual statement of the statement of t	0.0	800						man in the second second second	-333-0		- 2020				and a second of the second							the second second			- det	The Keymond	ak	- K	si.	13		
			- WAR	0.0.0	100		000	CC							-0000-0		000					The second secon										stream - was streamed and	and a support of the					
																																					-	
					4	- V	N	00		2	3		- Stutter																	-								

3.0. 15

1 13

Industrial Ltd. Industrial Ltd. Inspection and Certification Dept.

VERIFIED TRUE CO. PHOENIX RUBBER Q.C.

*1

Stand Service

N.


P1

1,5

14-1

sy y ep. 5 ÷

RIG LOCATION LAYOUT 6 WELL PAD

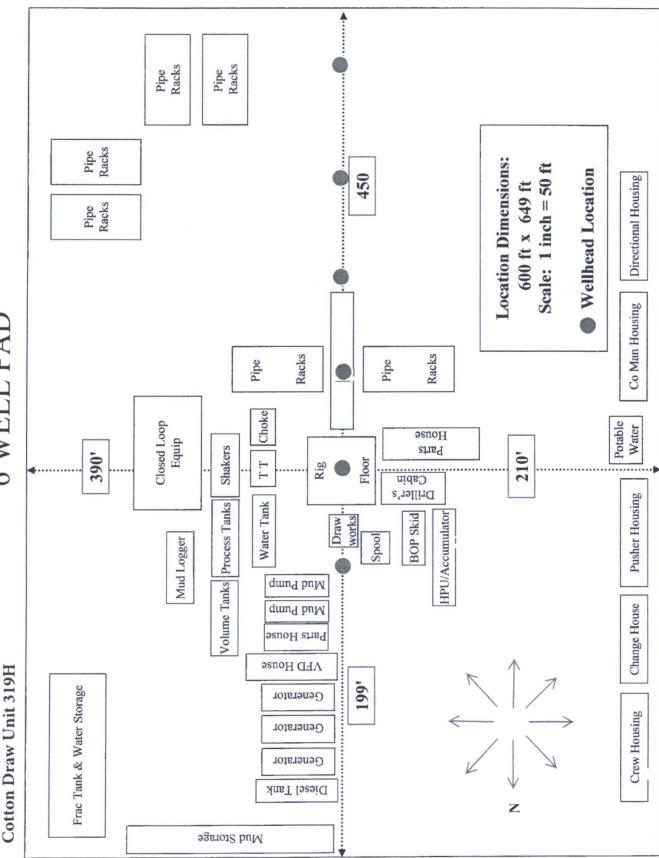

.

•

,