

District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM 87505

HOBBS
JUL 05 2016
RECEIVED

Energy, Minerals and Natural Resources
OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO. 30- 025-36444 ✓
5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
6. State Oil & Gas Lease No.
7. Lease Name or Unit Agreement Name Byers B ✓
8. Well Number 8 ✓
9. OGRID Number 192463 ✓
10. Pool name or Wildcat Nadine Paddock-Blueberry, W. Nadine Dinkant, W. Skaggs Abo, E. ✓
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3563' ✓

SUNDRY NOTICES AND REPORTS ON WELLS
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☒ Gas Well ☐ Other

2. Name of Operator
OXY USA WTP Limited Partnership ✓

3. Address of Operator
P.O. Box 50250 Midland, TX 79710

4. Well Location
Unit Letter I : 1650 feet from the South line and 660 feet from the East line
Section 7 Township 20S Range 38E NMPM County Lea ✓

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3563'

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

PEI **E-PERMITTING <SWD INJECTION>**
TEI **CONVERSION** RBDMS MB
PU **RETURN TO** TA
DO **CSNG** **ENVIRO** **CHG LOC**
CL **INT TO PA** **P&A NR** **P&A R**
Other

SUBSEQUENT REPORT OF:
REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐
OTHER: TA & MIT ☒

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

- 6/22/2016 MIRU PU, Start to POOH & LD rods & pump.
- 6/23/2016 Continue to POOH & LD rods & pump. NDWH, NU BOP, POOH w/ tbg. RIH w/ gauge ring, POOH. RIH w/ CIBP & set @ 5860'. RIH w/ dump bailer, made three runs to dump cmt, POOH, WOC.
- 6/27/2016 RIH & tag cmt @ 5830', circ hole w/ pkr fluid, pressure csg to 500# for 15 min, held good. POOH & LD tbg, ND BOP NUWH. Notify NMOCD of TA & MIT.
- 6/28/2016 RU pump truck to run MIT. Pressure test csg to 530# for 30min, tested good. Witnessed by Mark Whitaker-NMOCD.

This Approval of Temporary Abandonment Expires 6/28/2019

Spud Date: Rig Release Date:


I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE David Stewart TITLE Sr. Regulatory Advisor DATE 6/30/16

Type or print name David Stewart E-mail address: david_stewart@oxy.com PHONE: 432-685-5717

For State Use Only

APPROVED BY: Marky Brown TITLE Dist. Supervisor DATE 7/9/2016
Conditions of Approval (if any):

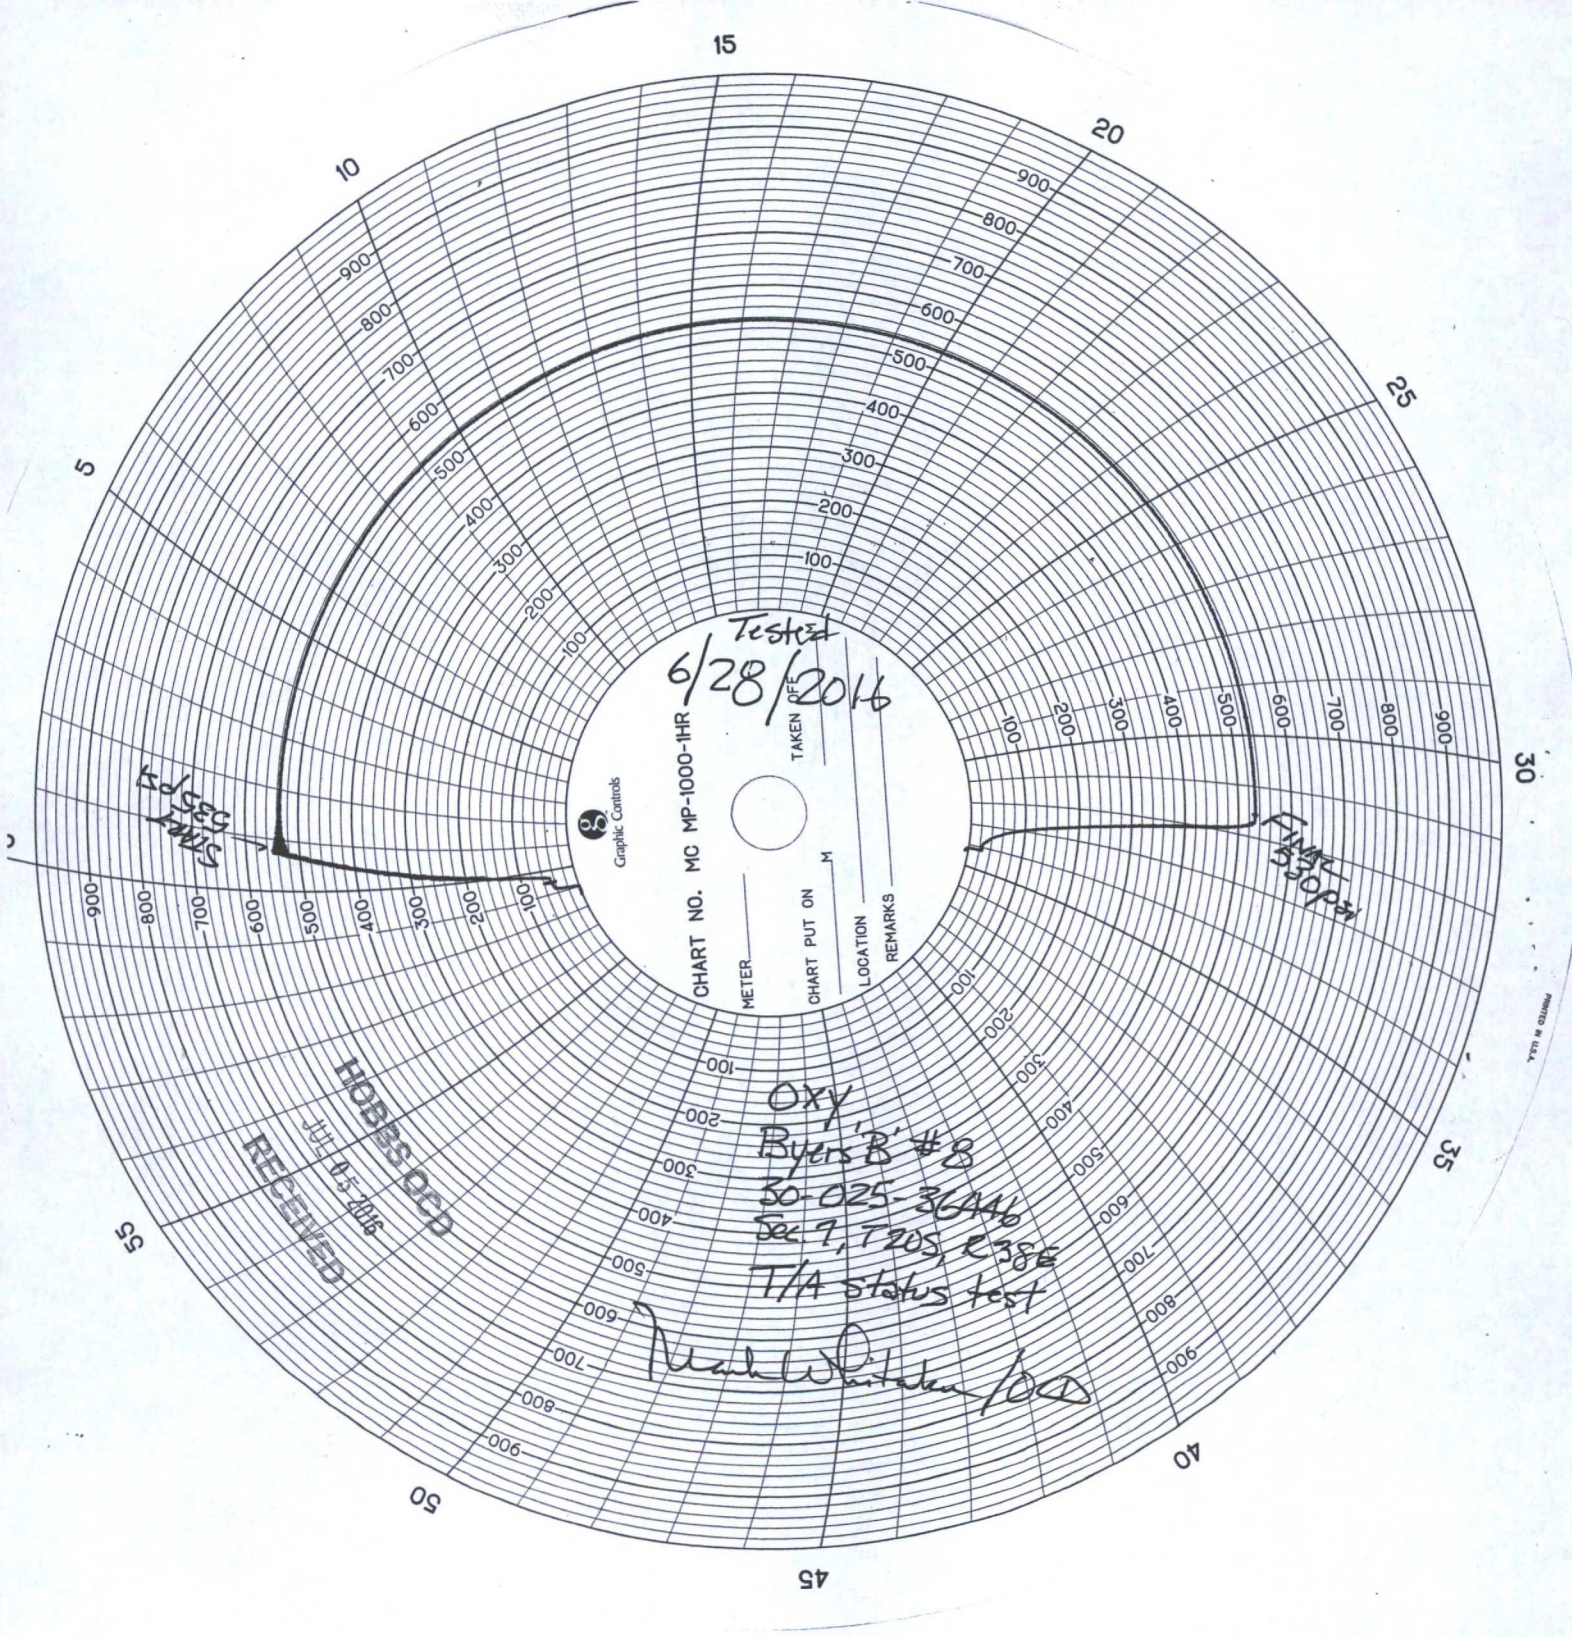

Tested
6/28/2016

CHART NO. MC MP-1000-1HR

METER

CHART PUT ON

LOCATION

REMARKS



OXY
Byers B #8
30-025-36446
Sec 7, T20S, R38E
T/A status test

Michael W. Whitaker

HOBBS OGD
JUL 13 2016
RECEIVED