

Devon Energy Center 333 West Sheridan Avenue Oklahoma City, Oklahoma 73102-5015

HOBBS OCD
NOV 0 6 2017
RECEIVED

Hydrogen Sulfide (H₂S) Contingency Plan

For


Gaucho 21 Fed 6H


Sec-21 T-22S R-34E 175' FSL & 185 FEL LAT, = 32.3704127' N (NAD83) LONG = 103.4670535 W

Lea County NM

Gaucho 21 Fed 6H

This is an open drilling site. H₂S monitoring equipment and emergency response equipment will be used within 500' of zones known to contain H₂S, including warning signs, wind indicators and H₂S monitor.

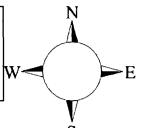

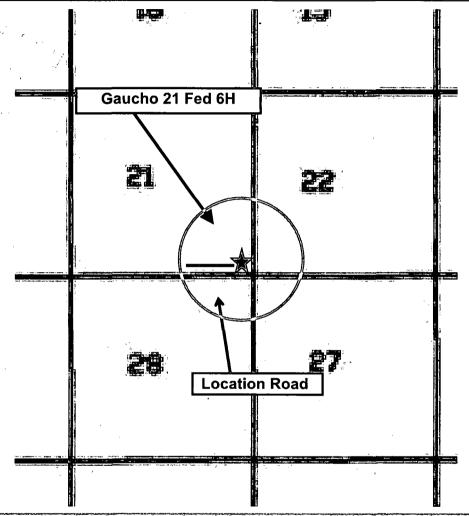

Assumed 100 ppm 3000' (Radius of Exposure)
100 ppm H2S concentration shall trigger activation of this plan.

Escape

Crews shall escape upwind of escaping gas in the event of an emergency release of gas. Escape can be facilitated from the location entrance road. Crews should then block the entrance to the location from the lease road so as not to allow anyone traversing into a hazardous area. The blockade should be at a safe distance outside of the ROE. There are no homes or buildings in or near the ROE.

Assumed 100 ppm ROE = 3000'

100 ppm H₂S concentration shall trigger activation of this plan.

Emergency Procedures

In the event of a release of gas containing H2S, the first responder(s) must

- Isolate the area and prevent entry by other persons into the 100 ppm ROE.
- Evacuate any public places encompassed by the 100 ppm ROE.
- Be equipped with H₂S monitors and air packs in order to control the release.
- Use the "buddy system" to ensure no injuries occur during the response
- Take precautions to avoid personal injury during this operation.
- Contact operator and/or local officials to aid in operation. See list of phone numbers attached.
- Have received training in the
 - o Detection of H₂S, and
 - o Measures for protection against the gas,
 - Equipment used for protection and emergency response.

Ignition of Gas Source

Should control of the well be considered lost and ignition considered, take care to protect against exposure to Sulfur Dioxide (SO₂). Intentional ignition must be coordinated with the NMOCD and local officials. Additionally the NM State Police may become involved. NM State Police shall be the Incident Command on scene of any major release. Take care to protect downwind whenever there is an ignition of the gas

Characteristics of H₂S and SO₂

onaracteris	1103 01 1120 1	1114 002			
Common Name	Chemical Formula	Specific Gravity	Threshold Limit	Hazardous Limit	Lethal Concentration
Hydrogen Sulfide	H ₂ S	1.189 Air = 1	10 ppm	100 ppm/hr	600 ppm
Sulfur Dioxide	SO ₂	2.21 Air = 1	2 ppm	N/A	1000 ppm

Contacting Authorities

Devon Energy Corp. personnel must liaison with local and state agencies to ensure a proper response to a major release. Additionally, the OCD must be notified of the release as soon as possible but no later than 4 hours. Agencies will ask for information such as type and volume of release, wind direction, location of release, etc. Be prepared with all information available. The following call list of essential and potential responders has been prepared for use during a release. Devon Energy Corp. Company response must be in coordination with the State of New Mexico's 'Hazardous Materials Emergency Response Plan' (HMER)

Hydrogen Sulfide Drilling Operation Plan

I. HYDROGEN SULFIDE (H₂S) TRAINING

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on this well:

- 1. The hazards and characteristics of hydrogen sulfide (H₂S)
- 2. The proper use and maintenance of personal protective equipment and life support systems.
- 3. The proper use of H₂S detectors, alarms, warning systems, briefing areas, evacuation procedures, and prevailing winds.
- 4. The proper techniques for first aid and rescue procedures.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H₂S metal components. If high tensile tubulars are to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling or reworking a well and blowout prevention and well control procedures.
- 3. The contents and requirements of the H₂S Drilling Operations Plan and Public Protection Plan.

There will be an initial training session just prior to encountering a known or probable H₂S zone (within 3 days or 500 feet) and weekly H₂S and well control drills for all personnel in each crew. The initial training session shall include a review of the site specific H₂S Drilling Operations Plan and the Public Protection Plan.

II. HYDROGEN SULFIDE TRAINING

Note: All H_2S safety equipment and systems will be installed, tested, and operational when drilling reaches a depth of 500 feet above, or three days prior to penetrating the first zone containing or reasonably expected to contain H_2S .

1. Well Control Equipment

- A. Flare line
- B. Choke manifold Remotely Operated
- C. Blind rams and pipe rams to accommodate all pipe sizes with properly sized closing unit
- D. Auxiliary equipment may include if applicable: annular preventer and rotating head.
- E. Mud/Gas Separator

2. Protective equipment for essential personnel:

30-minute SCBA units located at briefing areas, as indicated on well site diagram, with one escape unit available in the top doghouse. As it may be difficult to communicate audibly while wearing these units, hand signals shall be utilized.

3. H₂S detection and monitoring equipment:

Portable H₂S monitors positioned on location for best coverage and response. These units have warning lights which activate when H₂S levels reach 10 ppm and audible sirens which activate at 10 ppm. Sensor locations:

Bell nipple

Shale shaker

Trip tank

Suction pit

Rig floor

Cellar

Choke manifold

 Living Quarters (usually the company man's trailer stairs.)

Visual warning systems:

- A. Wind direction indicators as shown on well site diagram
- B. Caution/ Danger signs shall be posted on roads providing direct access to locations. Signs will be painted a high visibility yellow with black lettering of sufficient size to be reasonable distance from the immediate location. Bilingual signs will be used when appropriate.

4. Mud program:

The mud program has been designed to minimize the volume of H₂S circulated to surface. Proper mud weight, safe drilling practices and the use of H₂S scavengers will minimize hazards when penetrating H₂S bearing zones.

Contraditual

2000年的1900年高期 新加强 1. 字

5. Metallurgy:

可能的感觉的复数形式 经外股票

A. All drill strings, casings, tubing, wellhead, blowout preventer, drilling spool, kill lines, choke manifold lines, and valves shall be H₂S trim.

B: All elastomers used for packing and seals shall be H₂S trim.

6. Communication:

A. Company personnel have/use cellular telephones in the field.

on the same of the

may ship a firm of a

B. Land line (telephone) communications at Office

Sanding the rest of a real of a few attention

7. Well testing:

海洋的原 一个一种种特别在正规是不

and the figure factor of

ন বিবাহন ওয়াই কেন্দ্ৰবিক্ষিত হ'ব। এই নাম বিক্ষা সম্পন্ন কৰিছিল বিবাহ এই নাম বিবাহন কৰিছিল বিবাহ

HOLE NOTES IN CHEET THE COMME

on a set of harman

A. There will be no drill stem testing.

	illing Supervisor – Basin – Mark Kramer					
Je	ry Matthews – Day: 575-748-0161 Cell: 57	5-748-5234				
EHS Profe	ssional – Jason Robison		405-541-2841			
Agency	Call List					
<u>Lea</u>	Hobbs					
<u>County</u>	Lea County Communication Authority	393-3981				
<u>(575)</u>	State Police	392-5588				
	City Police	397-9265				
	Sheriff's Office	393-2515				
	Ambulance	911				
	Fire Department	397-9308				
	LEPC (Local Emergency Planning Commit	393-2870				
	NMOCD	393-6161				
	US Bureau of Land Management	393-3612				
Eddy	Carlsbad					
County	State Police	885-3137				
<u>(575)</u>	City Police	885-211				
	Sheriff's Office	887-755				
	Ambulance	911				
	Fire Department	885-3125				
	LEPC (Local Emergency Planning Commit	887-3798				
	US Bureau of Land Management	887-6544				
	NM Emergency Response Commission (S	(505) 476-9600				
	24 HR	(505) 827-9126				
	National Emergency Response Center	(800) 424-8802				
	National Pollution Control Center: Direct	(703) 872-6000				
	For Oil Spills	(800) 280-7118				
	Emergency Services	(000) 200 7 1 10				
	Wild Well Control		(281) 784-4700			
		(015) 600	(915) 563-3356			
	Cudd Pressure Control	(915) 699- 0139	(919) 563-3356			
	Halliburton	(575) 746-2757				
	B. J. Services	(575) 746-3569				
Give GPS position:	Native Air – Emergency Helicopter – Hobb	(575) 392-6429				
	Flight For Life - Lubbock, TX	(806) 743-991				
	Aerocare - Lubbock, TX	(806) 747-8923				
	Med Flight Air Amb - Albuquerque, NM	(575) 842-4433				
	Lifeguard Air Med Svc. Albuquerque, NM	(800) 222-1222				
	Poison Control (24/7)	(575) 272-3115				
	Oil & Gas Pipeline 24 Hour Service	(800) 364-4366				
	NOAA – Website - www.nhc.noaa.gov					

Prepared in conjunction with Dave Small COMMUNICATIONS & CONSULTING, LLC

