UNITED STATES DEPARTMENT OF THE INTERIOR **BUREAU OF LAND MANAGEMENT**

OCD Hobbs

FORM APPROVED OMB NO. 1004-0137 expires: January 31, 2018

Expires: January
Lease Serial No.
NMNM85937


											WELLS	
Do	not	use	this	form	for	propo	sals	to o	irili o	r to	re-enter	an


Do not use thi abandoned wel	I. Use form 3160-3 (APD)	for such proposals	OCA	6. If Indian, Allottee or	Tribe Name		
SUBMIT IN 1	FRIPLICATE - Other Instru	ctions on page 2	8 5013	7. If Unit or CA/Agree	ment, Name and/or No.		
1. Type of Well		- M. v	-WED	8. Well Name and No. PROHIBITION FE	DERAL 01		
2. Name of Operator	er Contact: AB	SIGAIL ANDERSORES	Elan	9. API Well No.	/		
COG OPERATING LLC	E-Mail: abbym@bcma	andassociates.com		30-025-31137-0			
3a. Address ONE CONCHO CENTER 60 MIDLAND, TX 79701-4287	0 W ILLINOIS AVENUE P	b. Phone No. (include area code) h: 432-580-7161)	10. Field and Pool or Exploratory Area BOOTLEG RIDGE-DELAWARE, NW			
4. Location of Well (Footage, Sec., T.	, R., M., or Survey Description)			11. County or Parish, State			
Sec 12 T22S R32E SWNW 19	980FNL 660FWL			LEA COUNTY, I	NM		
12. CHECK THE AF	PROPRIATE BOX(ES) TO) INDICATE NATURE O	F NOTICE,	REPORT, OR OTH	ER DATA		
TYPE OF SUBMISSION		TYPE O	F ACTION				
Notice of Intent ₽	☐ Acidize	□ Deepen	☐ Product	ion (Start/Resume)	☐ Water Shut-Off		
	☐ Alter Casing	☐ Hydraulic Fracturing	□ Reclam	ation	■ Well Integrity		
☐ Subsequent Report	☐ Casing Repair	■ New Construction	□ Recomp	olete	□ Other		
☐ Final Abandonment Notice	☐ Change Plans	Plug and Abandon	□ Tempor	arily Abandon			
	□ Convert to Injection	□ Plug Back	■ Water I	Disposal			
testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection. 1. Tag 7" CIBP @ 8480'.Cap w/ 35' dump beil. Not Require 2. 2. Set 7" CIBP @ 8410'. Circ hole w/ MLF. Pressure test csg. Spot 25 sx cmt @ 8410-8340'. 8230 3. Spot 35 sx cmt @ 5700-5550'. (Cherry Canyon) 4. Spot 35 sx cmt @ 4776-4626'. WOC & Tag (9 5/8" Shoe) 4500 Top Del. B/3 Lt 5. Perf & Sqz 70 sx cmt @ 1270-1970'. WOC & Tag (T/Salt & 13 3/8" Shoe) 1170-900 6. Perf & Sqz 70 sx cmt @ 200'-Surface. 7. Cut off well head, verify cmt to surface, & install a Below Ground Dry Hole Marker. SEE ATTACHED FOR CONDITIONS OF APPROVAL							
	Electronic Submission #457	ERATING LLC, sent to the	Hobbs on 03/06/2019	•			
The state of the s		7,02,77	<u> </u>		······		
Signature (Electronic S	Submission)	Date 03/06/2	2019				
THIS SPACE FOR FEDERAL OR STATE OFFICE USE							
	600	1	11-		3.9-19		
Approved By	DIE Tema	\mathcal{T} _ Title \mathcal{L}	El		Date		
Conditions of approval of any, are attached certify that the applicant holds legal or equivalent would entitle the applicant to condu-	itable title to those rights in the su		0				
No. 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.							

(Instructions on page 2)
** BLM REVISED ** BLM REVISED ** BLM REVISED ** BLM REVISED **

NMOCD 4-25-19

FOR RECORD UNL

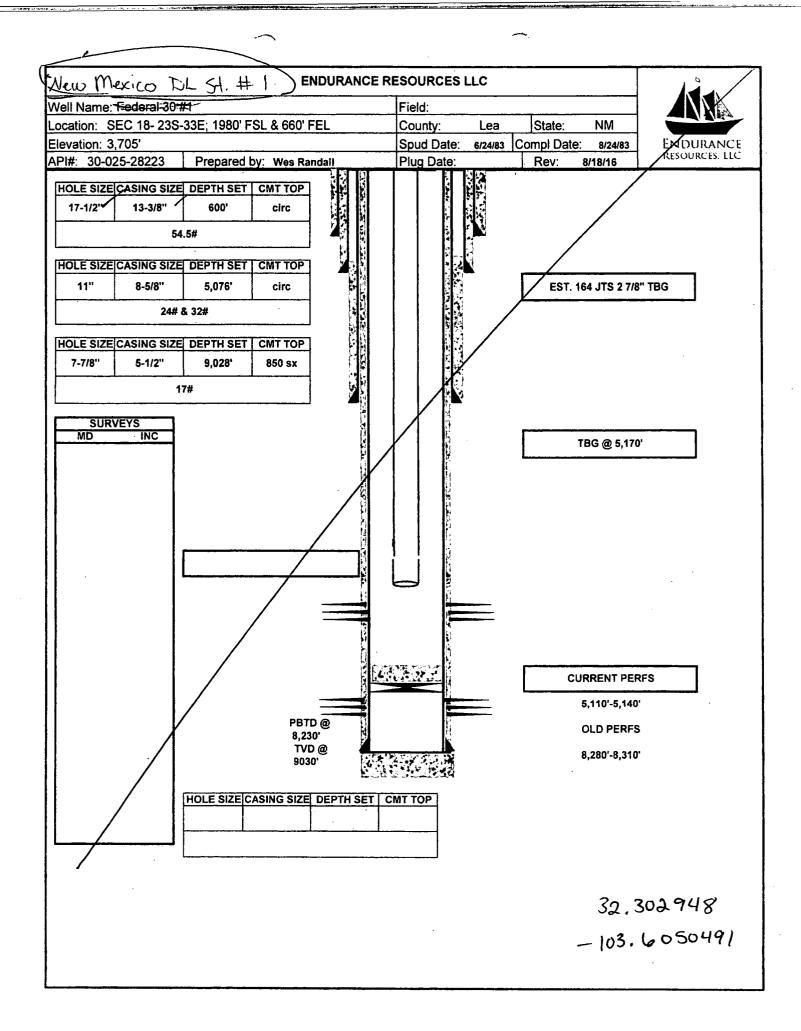

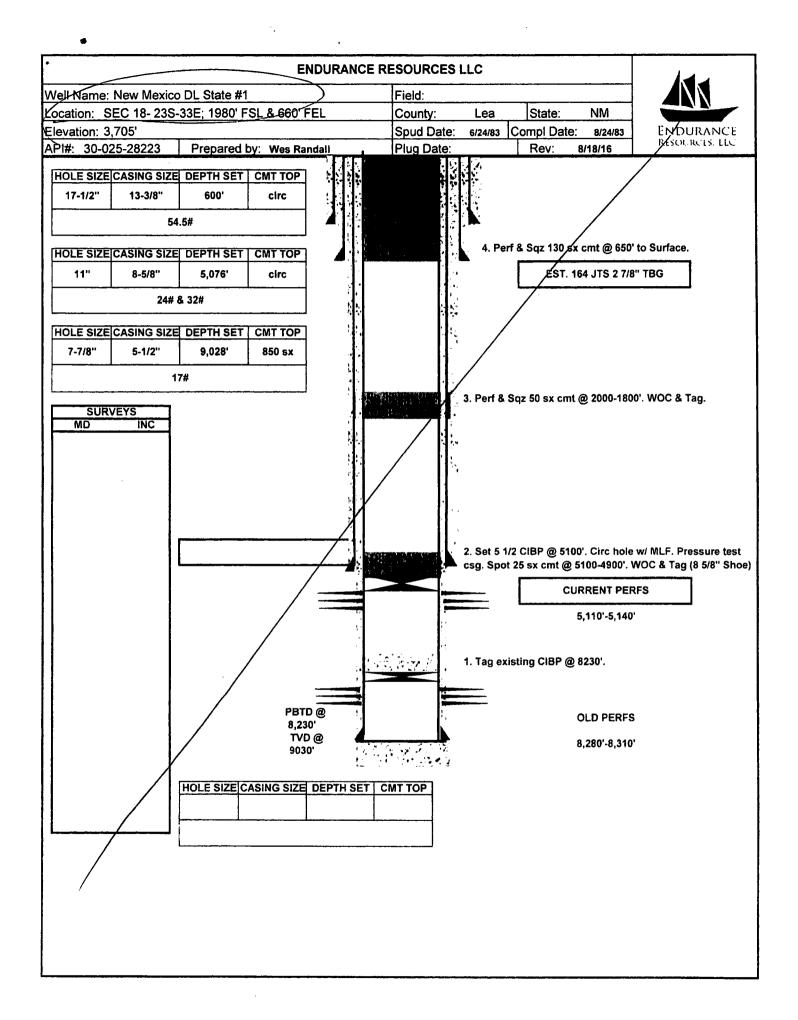

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted