

Submit 1 Copy To Appropriate District
Office
District I - (575) 393-6161
1625 N. French Dr., Hobbs, NM 88240
District II - (575) 748-1283
811 S. First St., Artesia, NM 88210
District III - (505) 334-6178
1000 Rio Brazos Rd., Aztec, NM 87410
District IV - (505) 476-3460
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

WELL API NO.
30-025-07960

5. Indicate Type of Lease
STATE ☐ FEE ☒

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name
East Hobbs San Andres Unit

8. Well Number 905

9. OGRID Number 372000

10. Pool name or Wildcat
Hobbs; San Andres, East

SUNDRY NOTICES AND REPORTS ON WELLS

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)

1. Type of Well: Oil Well ☐ Gas Well ☐ INJECTION ☒ **CD**

2. Name of Operator Pogo Oil and Gas Operating

3. Address of Operator
P.O. Box 3217 Hobbs, NM 88240

4. Well Location

Unit Letter B : 330 feet from the North line and 2310 feet from the East line
Section 31 Township 18S Range 39E NMPM Lea County

11. Elevation (Show whether DR, RKB, RT, GR, etc.)
3595

MAY 28 2019

RECEIVED

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:

PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ P AND A ☐
CASING/CEMENT JOB ☐

OTHER: ☐

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

1. Test anchors

2. RU WSU. NU BOP. Unseat pkr and TOH w/ tubing.

3. RU WL. Run gauge ring to 4475'. Run and set CIBP @4475' w/WL dump 35' class C cement on top of CIBP. WOC 4 hrs.

4. TIH w/ 2-3/8" tbg, circulate hole w/ 10# gelled brine.

5. TOH, RU wireline, perf 7" Prod csg 2 squeeze holes @ 1910'.

6. TIH w/pkr&tbg. Pump 50sxs Class C cmt, 50 in & 50 out.

7. Perf 2 holes @ 60', Squeeze w/50sxs class C cmt. and cement to surface.

8. Put 5sxs @ surface. Install dry hole marker.

9. Cut the well head, RD, cut anchors, clean location, and move out.

10. Rehab within 90 days per NMOCD & surface owner requirements.

P.S. No earthen pit, all fluids will be contained in steel pit & hauled off to approved disposal facility.

Spud Date:

Rig Release Date:

See Attached
Conditions of Approval

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Production Manager DATE 5/24/19

Type or print name M.Y. Merchant E-mail address: mymerch@penrocoil.com PHONE: 575-492-1236
For State Use Only

APPROVED BY: Kenny Joch TITLE Compliance Officer A DATE 6-7-19
Conditions of Approval (if any):


East Hobbs San Andres Unit #905

30-025-07960

unit B sec 31 T18s R39E

Lea County, New Mexico

WBD (Before P & A)

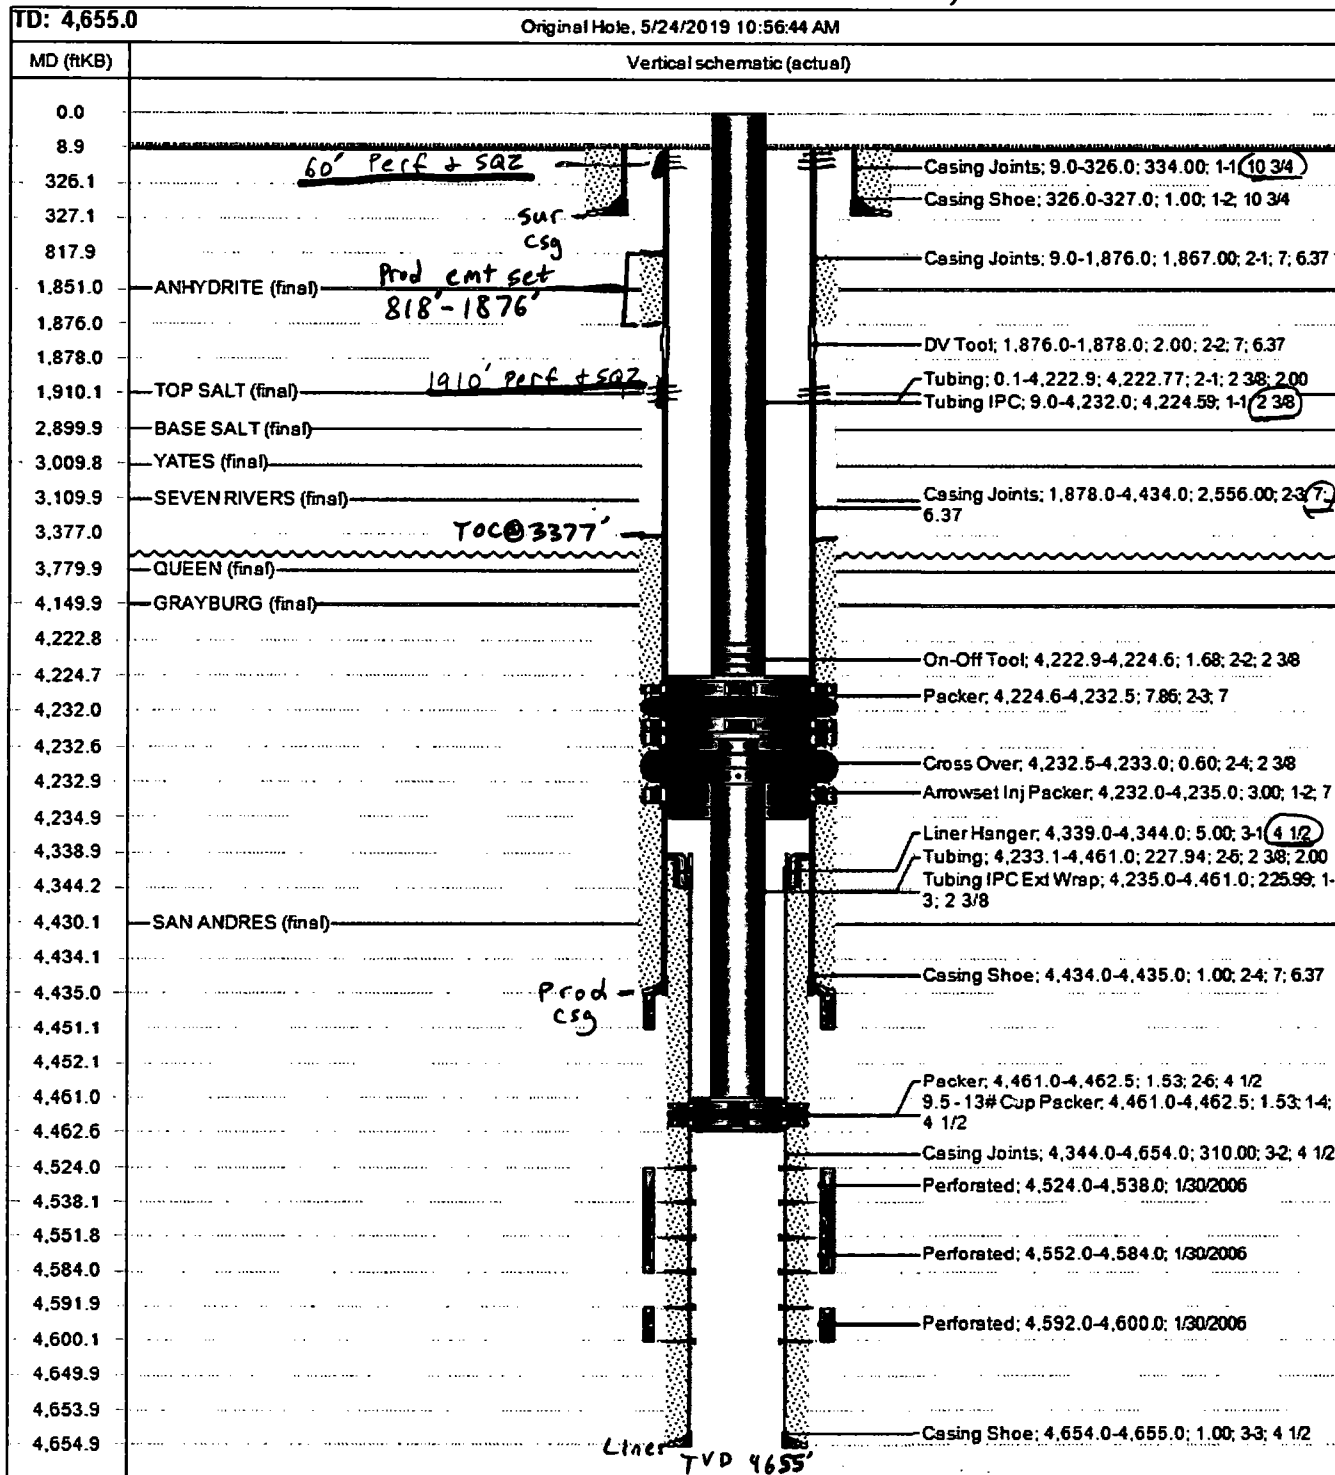

Casing Strings					Set Depth
Csg Des	OD in	Weight lb/ft	Grade	Top Thread	Set Depth (ftKB)
Surface	10 3/4	32.00		Surf	327.0
Production	7	23.00	J-65	3377	4,435.0
Liner	4 1/2			4334	4,655.0
Perforations					
Date	Top (ftKB)	Bottom (ftKB)	Uncon Zone	Our Test Date	Current Status
1/30/2006	4,524.0	4,538.0			
1/30/2006	4,552.0	4,584.0			
1/30/2006	4,592.0	4,600.0			

Drawn by: Dillon Salas (5/24/2019)


East Hobbs San Andres Unit #905

30-025-07960

Unit B Sec 31 T18S R39E

Lea County, New Mexico

WBD(After P+A)

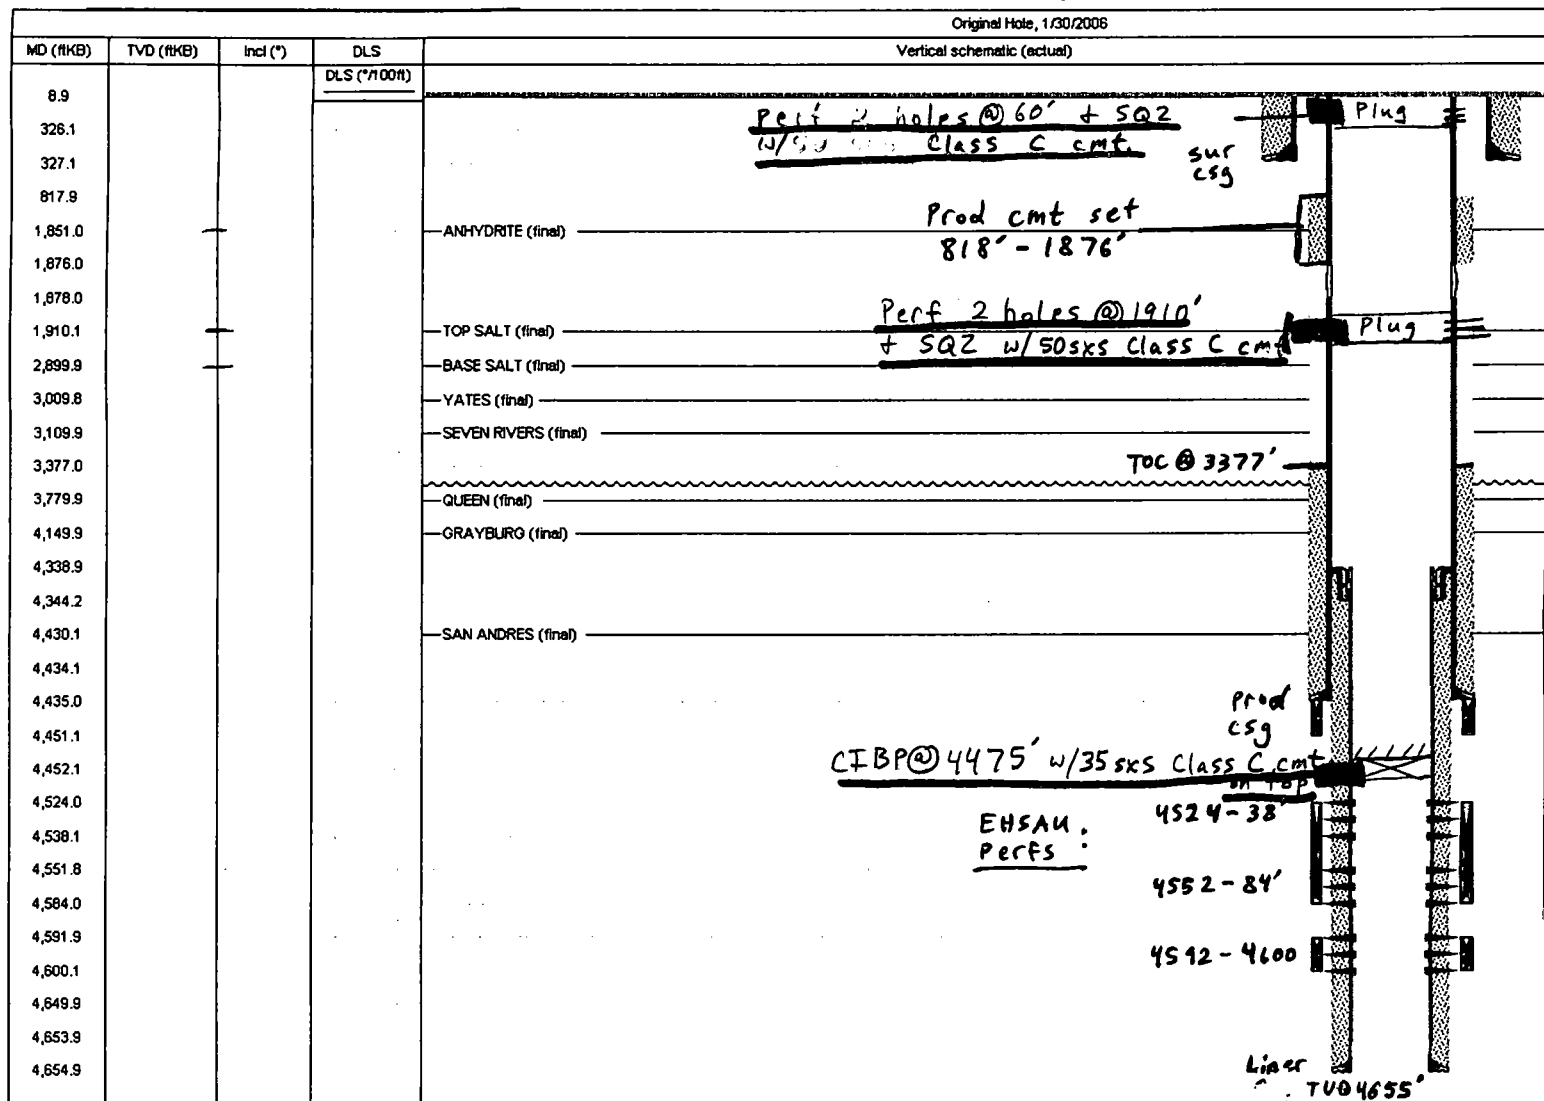

Casing Strings				Set Depth	
Csg Des	OD (in)	Wall Thk (in)	Grade	Top Thread	Set Depth (ftKB)
Surface	10 3/4	32.00		SUR	327.0
Production	7	23.00	J-55	3377	4,435.0
Liner	4 1/2			4334	4,655.0

Perforations					
Date	Top (ftKB)	Bot (ftKB)	Linear Zone	Csg Bkt Date	Current Status
1/30/2006	4,524.0	4,538.0			
1/30/2006	4,552.0	4,584.0			
1/30/2006	4,592.0	4,600.0			

Drawn By: Dillon Salas (5/24/2019)

GENERAL CONDITIONS OF APPROVAL:

- 1) Insure all bradenheads have been exposed, identified, and valves are operational prior to rigging up on well.
- 2) Contact the appropriate NMOCD District Office no later than 24 hours prior to moving in and rigging up.
- 3) A copy of the approved C103 intent to P&A should be distributed to the onsite company and plugging representatives. Approved procedures are good for a period of one year from approved date, unless otherwise specified on the C103 intent. Approvals past this date will require the submission and approval of a new C103 intent.
- 4) A company representative is required to be present to witness all operations including setting CIBP's, circulation of mud laden fluids, perforating, squeezing or spotting cement plugs, tags, or any other operations approved on the C103 intent to P&A. Company representative should contact the NMOCD and report all operations.
- 5) Any changes that may be required during plugging operations should be approved by the NMOCD before proceeding.
- 6) A closed loop system is to be used for all plugging operations. Contents of the steel pits to be hauled to a NMOCD permitted disposal facility.
- 7) Mud laden fluids must be placed between all cement plugs mixed at 25 sacks of salt gel per 100 barrels of brine.
- 8) All cement plugs will be 100' or 25 sacks cement, whichever is greater. Class 'C' cement will be used above 7500' and Class 'H' below 7500'. Plugs should be no more than 3000' apart
- 9) Site remediation due within one year of well plugging completion.