UNITED STATES

FORM APPROVED

-	EPARTMENT OF THE IN					O. 1004-0137 muary 31, 2018
BUREAU OF LAND MANAGEMENT SUNDAY NOTICES AND REPORTS ON WELLS Bo Golds of this form for proposals to drill or to re-enter an Beandoned well. Use form 3160-3 (APD) for such proposals.					5. Lease Serial No. NMNM110835	
					6. If Indian, Allottee or Tribe Name	
AUG 2 TURNIT IN TRIPLICATE - Other Instructions on page 2					7. If Unit or CA/Agreement, Name and/or No.	
1. Type of Well Other: INJECTION					8. Well Name and No. BLUE QUAIL SWD 1	
Name of Operator Contact: GREG BRYANT MESQUITE SWD INCORPORATED E-Mail: greg.bryant@basicenergyservices.com					9. API Well No. 30-025-42717-00-\$1	
P			(include area code) 3-3355		10. Field and Pool or Exploratory Area DELAWARE SWD	
CARLSBAD, NM 88221 4. Location of Well (Footage, Sec.,	11. County or			State		
Sec 11 T25S R32E SENW 2			LEA COUNTY, NM			
12. CHECK THE A	PPROPRIATE BOX(ES)	TO INDICA	TE NATURE O	F NOTICE,	REPORT, OR OTH	IER DATA
TYPE OF SUBMISSION	TYPE OF ACTION					
Notice of Intent	☐ Acidize	Deep Deep	en	☐ Product	ion (Start/Resume)	☐ Water Shut-Off
☐ Subsequent Report	☐ Alter Casing		raulic Fracturing	☐ Reclamation		☐ Well Integrity
	☐ Casing Repair			Recomplete		Other
☐ Final Abandonment Notice	☐ Change Plans				☐ Temporarily Abandon	
	l. — —		ug Back Water		<u> </u>	
13. Describe Proposed or Completed O If the proposal is to deepen directio Attach the Bond under which the w following completion of the involve testing has been completed. Final A determined that the site is ready for	nally or recomplete horizontally, ork will be performed or provide and operations. If the operation res abandonment Notices must be file	give subsurface the Bond No. on sults in a multiple	locations and measu file with BLM/BIA completion or reco	red and true ve Required sul mpletion in a r	rtical depths of all perting sequent reports must be new interval, a Form 316	nent markers and zones. filed within 30 days 0-4 must be filed once
1) MIRU. NU WH, ND BOP, 2) Set 7" CIBP @ 4740'. Circ 3) Spot 25sx cmt @ 4740' - 4 4) Spot 25sx cmt @ 4347' 5) Perf/Sqz 45sx cmt @ 233 6) Perf/Sqz 45sx cmt @ 120 7) Perf/Sqz 45sx cmt @ 989 8) Perf/Circ 20sx cmt @ 60' 9) RDMO. Cut off WH & and	hole w/ MLF. Pressure tes 1649'. WOC-Tag 440 1247'. WOC-Tag 440 3'-2233'. WOC-Tag 3'-1403'. WOC-Tag -762'. WOC-Tag 3'. Verify	0. 42			TACHED FO	
Below grow	nd day ho	le m	arker	regui	red.	
14. I hereby certify that the foregoing	Electronic Submission #	SWD INCORP	ORATED, sent to	the Hobbs	•	
Name(Printed/Typed) GREG B	Title AGENT					
Signature (Electronic	Submission)		Date 08/07/20	019		
	THIS SPACE FO	R FEDERA	L OR STATE	OFFICE U	SE	
Approved By James	Q. and	3	Title SAS	17		8-11-19 Date
Conditions of approval, if any, are attach	ed. Approval of this notice does					

Title 18 U.S.O. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.


Office

which would entitle the applicant to conduct operations thereon.

(Instructions on page 2) ** BLM REVISED ** BLM REVI

Lease Name: Blue Quail SWD # / 30-025-42717 API #:_ Rustler 812 Cast: 1c 1203 Sala do 2286 730 54 4347 Blast TOC_ciec Circ 235 Sx 4793 4865 Del DV Tool 2283' . DU Tool 4670'4718 95/8 -@ 4778 / TOC LIFE Pers 4840'-5988' TOC_3000 TD:_6274

Operator Name: Messuite SWD

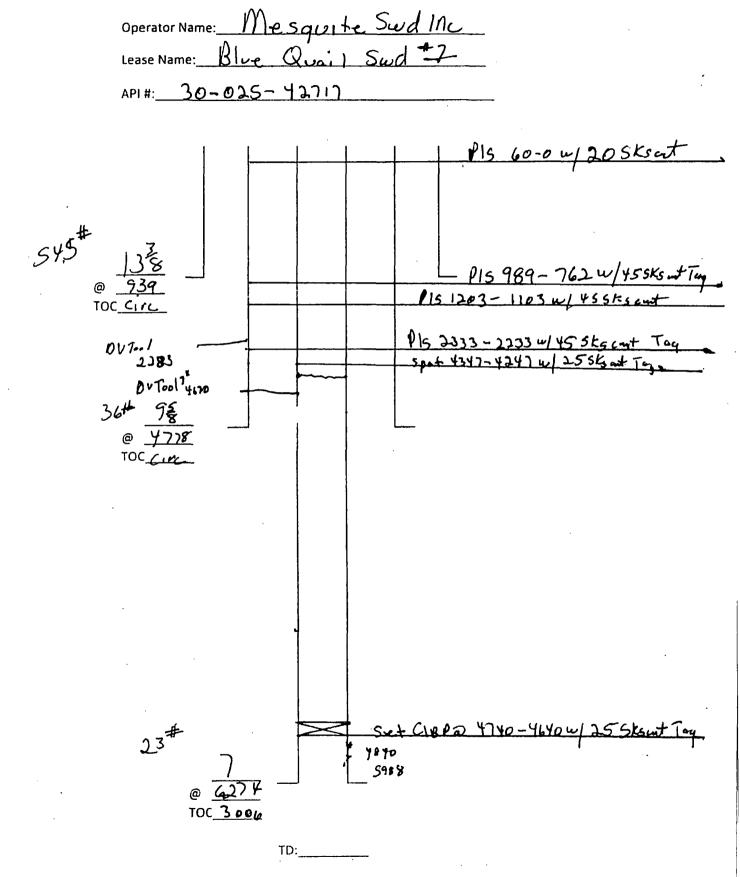

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ½ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1st through June 15th annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted