Form 3160-5	UNITED STATE	\$	/	· · · ·	FORM A	APPROVED	
(June 2015) DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT OCD Hobbs					OMB NO. 1004-0137 Expires: January 31, 2018		
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an					5. Lease Serial No. NMLC068281B		
abandoned we	ll. Use form 3160-3 (AP	D) for such p	vonocale		6. If Indian, Allottee or		
SUBMIT IN	TRIPLICATE - Other ins	tructions on	page 2 88	20	7. If Unit or CA/Agree	ment, Name and/or No.	
1. Type of Well Oil Well Gas Well 🛛 Otl	ner: INJECTION		OCT 21		<ol> <li>If Unit or CA/Agree</li> <li>Well Name and No. BUCK 17 FEDER/</li> <li>API Well No.</li> </ol>	AL SWD 1	
2. Name of Operator CONOCOPHILLIPS COMPAN	Contact: NY E-Mail: greg.bryar	GREG BRYA	service Con	-ojg	9. API Well No. 30-025-40482-0		
3a. Address 925 N ELDRIDGE PARKWAY HOUSTON, TX 77079		3b. Phone No. (include area code CD Ph: 432-563-3355			10. Field and Pool or Exploratory Area SWD		
4. Location of Well (Footage, Sec., T., R., M., or Survey Description		)			11. County or Parish, State		
Sec 17 T26S R32E SENW 2284FNL 1950FWL					LEA COUNTY, NM		
12. CHECK THE A	PROPRIATE BOX(ES)	TO INDICA	TE NATURE OF	F NOTICE	, REPORT, OR OTH	ER DATA	
TYPE OF SUBMISSION		<b>k-</b> .	TYPE OF	ACTION		<u> </u>	
Notice of Intent	🗆 Acidize	Dee	pen	Produc	tion (Start/Resume)	UWater Shut-Off	
Subsequent Report	Alter Casing		raulic Fracturing			Well Integrity	
☐ Final Abandonment Notice	Casing Repair Change Plans	—	Construction	Recom	piete rarily Abandon	Other	
	Convert to Injection Plug Back Water				-		
2) Set 7" CIBP @ 5310'. Circ 3) Spot 25sx cmt @ 5310' - 64 4) Spot 40sx cmt @ 4500' - 43 5) Spot 25sx cmt @ <del>2550' 24</del> 6) Spot 55sx cmt @ 1324' - 10 7) Spot 15sx cmt @ 60' - 3'. V 8) RDMO. Cut off WH & anch	2 <del>16</del> '. <b>5160</b> 300'. WOC-Tag <b>#96</b> '. <b>2627 - 29</b> 044'. WOC-Tag 'erify	_			FACHED FOI	•	
Below groun	d level d.	y ho	ke ma	rker	required		
14. I hereby certify that the foregoing is	Electronic Submission #	486276 verifie	d by the BLM Well MPANY, sent to tl	I Informatio	n System		
Comm Name(Printed/Typed) GREG BR	itted to AFMSS for proces	sing by DEBO	Title AGENT	on 10/03/201	9 (20DLM0006SE)		
Signature (Electronic S	Submission)		Date 10/02/20	019	·		
	THIS SPACE FO	OR FEDERA	L OR STATE (	OFFICE U	ISE	· · · ·	
Approved By	a a. am	<u>ہ</u>	Title SA4	ÉT		10-12-19 Date	
Conditions of approval of any, are attache certify that the applicant holds legal or equ which would entitle the applicant to condu	d. Approval of this notice does uitable title to those rights in the act operations thereon.	s not warrant or e subject lease	Office CFC	e e e e e e e e e e e e e e e e e e e	rop .		
Title 18 U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent	U.S.C. Section 1212, make it a statements or representations as	crime for any person of the store of the sto	rson knowingly and ithin its jurisdiction.	willfully to m	nake to any department or	agency of the United	
(Instructions on page 2) ** BLM REV	ISED ** BLM REVISE	D ** BLM R	EVISED ** BLM		D ** BLM REVISE	Re la	
$\chi 4$	d. Approval of this notice does intable title to those rights in the operations thereon. U.S.C. Section 1212, make it a statements or representations as ISED ** BLM REVISE	D ]	0-25-	19		WLY	

## WELLBORE SKETCH ConocoPhillips Company -- Permian Basin Business Unit

1


. •

100

RKB @ <u>3189 6</u> DF @ <u>3189 6</u> GL @ <u>3176</u> IZ 1/4 " hole Surfaco 9.5/8 36/11 to 1094 Cmt d w/810 SX TOC - Circid to surfaco	Subaroa <u>Red Hi</u> Loaso & Weit No Logal Description County <u>LEA</u> Fiold <u>Red Hi</u> Dato Spudaed API Number <u>30-025</u>	Buck Federal 17-1 SWD SEC 17F. T-265 R-32E 2284' FN State New Is Wast 47/2012		
B/10/2012 - SQZ work - 1090 SXs - Circld to Surface Production 7* 26#/ht to 6268' Cmit a wi 1500 SX TOC - 4665' By TS See Tubing & Rods Tab for string details		Rustler Castile Dal	1028 2577 4326	.o •
Cherry Curyon Perf d 5410 · 593?		Pamsay Ford Sh Olds Charoy	4360 4419 4432	
PBTD (2 6167		Cheroy	SC 8 4	

ConocoPhillips Company -- Permian Basin Business Unit

, -- •**-**

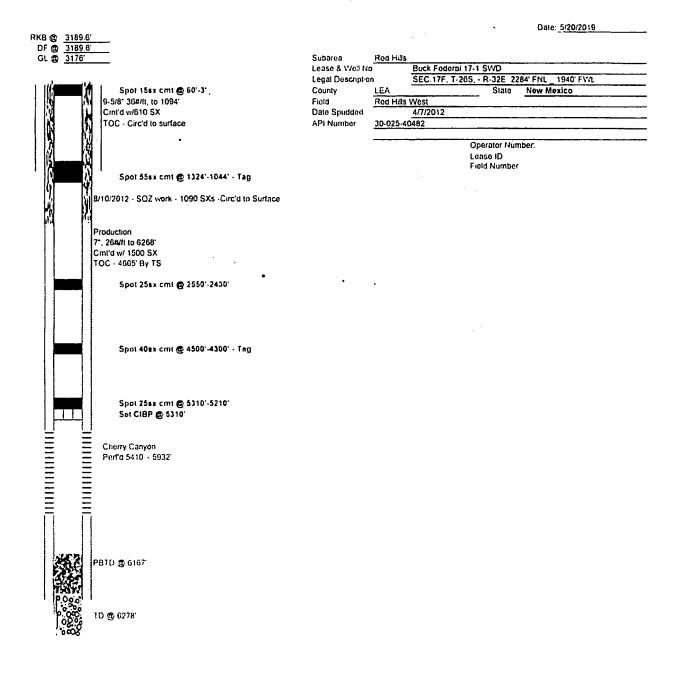

WELLBORE SKETCH

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. <u>Notification</u>: Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of brine water. Minimum nine (9) pounds per gallon.

5 <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In heu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. <u>Subsequent Plugging Reporting</u>: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date well was plugged.</u>

8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

6