☐ Final Abandonment Notice

KP

(June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use form 3160-3 (APD) for such proposals

6. If Indian, Allottee or Tribe Name

5. Lease Serial No. NMSF078064

☐ Temporarily Abandon

■ Water Disposal

abandoned we	ii. Use ioiiii s ioo-s (Ai	b) for such proposals.			
SUBMIT IN	TRIPLICATE - Other ins	structions on page 2	7. If Unit or CA/	Agreement, Name and/or No.	
Type of Well Oil Well	ner		8. Well Name and BISTI COAL		
Name of Operator DJR OPERATING LLC	Contact: E-Mail: sford@djı	SHAW-MARIE FORD Ilc.com	9. API Well No. 30-045-276	72-00-S1	
3a. Address 1600 BROADWAY SUITE 196 DENVER, CO 80202	JITE 1960 Ph: 505-632-3476			10. Field and Pool or Exploratory Area BASIN FRUITLAND COAL	
4. Location of Well (Footage, Sec., T Sec 12 T25N R12W NWNE 0 36.420670 N Lat, 108.061890	790FNL 2510FEL	n)	11. County or Pa	rrish, State COUNTY, NM	
12. CHECK THE AF	PPROPRIATE BOX(ES) TO INDICATE NATURE O	F NOTICE, REPORT, OR	OTHER DATA	
TYPE OF SUBMISSION	TYPE OF ACTION				
☑ Notice of Intent☐ Subsequent Report	☐ Acidize ☐ Alter Casing ☐ Casing Repair	☐ Deepen ☐ Hydraulic Fracturing ☐ New Construction	☐ Production (Start/Resum ☐ Reclamation ☐ Recomplete	e)	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

☐ Plug Back

□ Plug and Abandon

DJR Operating LLC requests permission to Plug & Abandon the subject well per the attached Procedure, Current & Proposed Wellbore Diagram and Reclamation Plan.

□ Change Plans

☐ Convert to Injection

Notify NMOCD 24hrs Prior to beginning operations

14. I hereby certify that the	ne foregoing is true and correct. Electronic Submission #522023 verifie For DJR OPERATING LLC Committed to AFMSS for processing by	c, sent	to the Farmington	
Name (Printed/Typed)	SHAW-MARIE FORD	Title	REGULATORY SPECIALIST	
Signature	(Electronic Submission)	Date	07/15/2020	
	THIS SPACE FOR FEDERA	AL OR	STATE OFFICE USE	
Approved By JOE KIL	LINS	Title	NGINEER	Date 11/12/2020
Conditions of approval, if a certify that the applicant ho	ny, are attached. Approval of this notice does not warrant or lds legal or equitable title to those rights in the subject lease licant to conduct operations thereon.		Farmington	
T':1 10 H C C C .: 100	1 1EV 42 H C C C .: 1212 1 '	1	. 1 1 116 11 . 1 1	 Cd II 'c 1

itle 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

Revisions to Operator-Submitted EC Data for Sundry Notice #522023

Operator Submitted

BLM Revised (AFMSS)

Sundry Type:

ABD

NOI

NMSF078064

ABD NOI

Lease:

NMSF078064

Agreement:

Operator:

DJR OPERATING LLC 1 ROAD 3263 AZTEC, NM 87410

Ph: 505-632-3476

DJR OPERATING LLC 1600 BROADWAY SUITE 1960 DENVER, CO 80202 Ph: 303-595-7433

Ph: 505-632-3476

Admin Contact:

SHAW-MARIE FORD REGULATORY SPECIALIST E-Mail: sford@djrllc.com

SHAW-MARIE FORD REGULATORY SPECIALIST E-Mail: sford@djrllc.com

Ph: 505-632-3476

Tech Contact:

SHAW-MARIE FORD REGULATORY SPECIALIST E-Mail: sford@djrllc.com

SHAW-MARIE FORD REGULATORY SPECIALIST E-Mail: sford@djrllc.com

Ph: 505-632-3476

Ph: 505-632-3476

Location:

State: County:

NM SAN JUAN

NM SAN JUAN

Field/Pool:

BASIN FRUITLAND COAL

BASIN FRUITLAND COAL

Well/Facility:

BISTI COAL 12 1 Sec 12 T25N R12W NWNE 790FNL 2510FEL

36.420740 N Lat, 108.062599 W Lon

BISTI COAL 12 1 Sec 12 T25N R12W NWNE 0790FNL 2510FEL

36.420670 N Lat, 108.061890 W Lon

Plug and Abandonment Procedure

for

DJR Operating, LLC

Bisti Coal 12 #1

API # 30-045-27672

NW/NE, Unit B, Sec. 12, T25N, R12W

San Juan County, NM

I.

- 1. Hold pre-job meeting, comply with all NMOCD, BLM and environmental regulations.
- 2. Check and record tubing, casing and bradenhead pressures.
- 3. Remove existing piping from casing valve, RU blow lines from casing valves and blow down casing pressure. Kill well as necessary. Ensure that well is dead or on a vacuum.

Note: The last record from 1997 lists the 2 3/8" tbg was replaced with $1\frac{1}{2}$ " tbg but no record of rods and pump being re-installed.

- 4. ND WH, NU BOP, function test BOP.
- 5. Trip out of hole with 1 ½" tubing. LD tubing to be sent in for storage/salvage.

II.

- 6. PU workstring, TIH with bit and scraper, make sure that the bit and scraper will go below 1100'. TOOH.
- 7. PU and RIH with a 4 ½" cement retainer. Set the CR at +/- 1100'. Pressure test tubing to 1000 psi, sting out of CR, test casing to 600 psi. If casing does not test, contact engineering.

Provided that casing test was good, proceed to step 9.

8. RU cement equipment. Pump water to assure that tubing is clear.

- 9. Plug 1. Mix and attempt to pump 10 sx class G cement through cement retainer and displace with 4.3 bbl water. If zone pressures up, sting back out of retainer and continue with Plug 2.
- 10. Plug 2. Fruitland, Kirtland, Ojo Alamo, and surface casing shoe. From 1100' to surface, mix and pump cement until cement circulation is achieved at surface.
- 11. RD cementing equipment. Cut off wellhead, fill annuli with cement as necessary. Install P&A marker as per regulatory requirements. Record GPS coordinates for P&A marker and the final P&A report. Photograph the P&A marker and attach to the report.
- 12. RD and MO all rig and cement equipment. Assure that location is free of trash and contamination before moving off.
- 13. Send all reports and attachments to DJR Aztec office for regulatory filings.

Note: All cement is to be class G mixed at 15.8 ppg, yield 1.15 cu ft / sx. Cement volumes are based on inside capacities + 50% excess and outside capacities + 100 % excess.


DJR Operating, LLC Current Wellbore Diagram

Bisti Coal 12 #1

API # 30-045-27672

NW/NE, Unit B, Sec 12, T25N, R12W San Juan County, NM

GL 6310' KB N/A Spud Date 3/23/1990

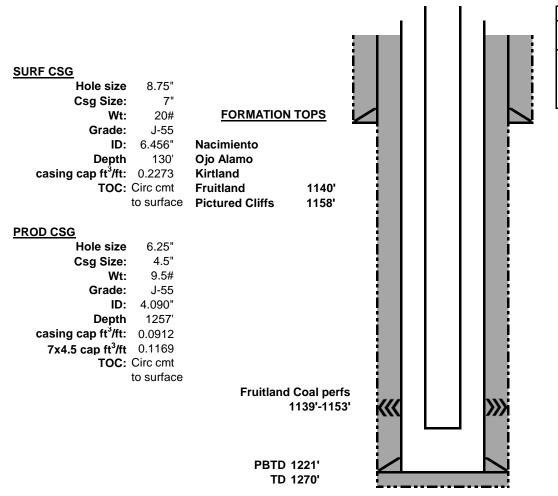

Production Tubing/Rod Detail

Last record: 05/12/1997: 1.5" tbg, @ 1040'.

Last record: 5-12-1997: No records to show if any rods or pump were re-run.


DJR Operating, LLC Proposed Wellbore Diagram

Bisti Coal 12 #1

API # 30-045-27672

NW/NE, Unit B, Sec 12, T25N, R12W San Juan County, NM

GL 6310' KB N/A Spud Date 3/23/1990

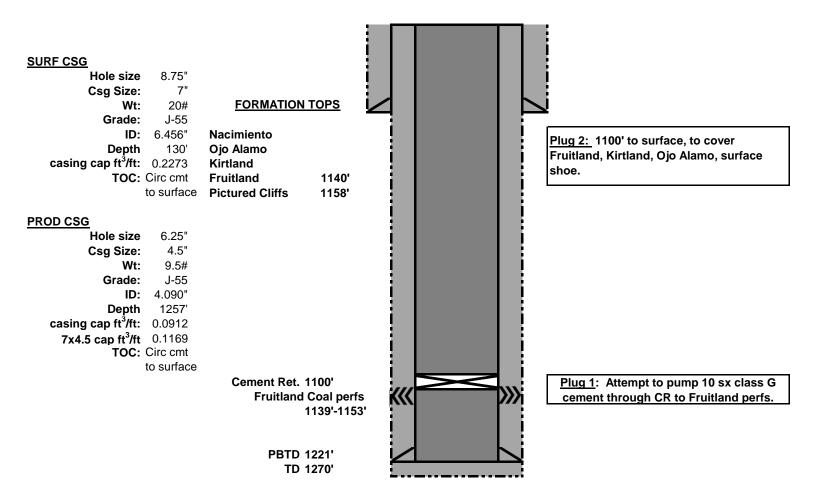

BLM FLUID MINERALS Geologic Report

Date Completed: 10/28/2020

Well No. Bisti Coal 12 #1(API# 30-045-27672)		Location	790	FNL	&	2510	FEL	
Lease No. NMSF-078064		Sec. 12	T25N		R12W			
Operator	perator DJR Operating, LLC		County	San Juan Sta		State	New Mexico	
Total Depth	1270	PBTD 1221	Formation Fruitland Coal (producing), Pictured Cliffs (TD)				(TD)	
Elevation (GL) 6310			Elevation (KB) 6322					

Geologic Formations	Est. Top	Est. Bottom	Log Top	Log Bottom	Remarks
San Jose Fm					Surface/Fresh water sands
Nacimiento Fm			Surface	282	Fresh water sands
Ojo Alamo Ss			282	386	Aquifer (fresh water)
Kirtland Shale			386	820	
Fruitland Fm			820	1158	Coal/Gas/Possible water
Pictured Cliffs Ss			1158	PBTD	Gas
Lewis Shale					
Chacra					
Cliff House Ss					Water/Possible gas
Menefee Fm					Coal/Ss/Water/Possible O&G
Point Lookout Ss					Probable water/Possible O&G
Mancos Shale					
Gallup					O&G/Water
Graneros Shale					
Dakota Ss					O&G/Water

Remarks:

P & A

- BLM geologist's formation top picks vary from operator's, but the proposed P&A plan has cement from the retainer @ 1100' – Surface, so no changes are necessary.

- Log analysis of reference well #2 indicates the Nacimiento and Ojo Alamo sands investigated likely contain fresh water (≤5,000 ppm TDS). The submitted plugging plan has cement from the CR @ 1100' – Surface, which is adequate to protect freshwater sands in this well bore.

Reference Well:

1) Same

Fm. Tops

2) Giant E & P Co. Carson Unit #23 1980' FSL, 1980' FEL Sec. 19, T25N, R11W GL 6438' KB 6447' Water Analysis

Prepared by: Chris Wenman

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

Re: Permanent Abandonment

Attachment to notice of

Intention to Abandon: EC#522023 Well: Bisti Coal 12 1

CONDITIONS OF APPROVAL

1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."

2. Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 564-7750.

GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

- 1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.
 - 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
 - 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)
- 3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.
 - 3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.
- 4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.
 - 4.1 The cement shall be as specified in the approved plugging plan.
 - 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.3 Surface plugs may be no less than 50' in length.
 - 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
 - 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
 - 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

- 5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.
 - 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
 - 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
 - 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
 - 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.
- 6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.
 - 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
 - 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.
- 7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H_2S .
- 8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), five copies, with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show date well was plugged.
- 9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.
- 10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III
1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 12704

CONDITIONS OF APPROVAL

Operator:			OGRID:	Action Number:	Action Type:
DJR OPERATING, LLC	1 Road 3263	Aztec, NM87410	371838	12704	C-103F

OCD Reviewer	Condition
ahvermersch	None