Form 3160-3 FORM APPROVED OMB No. 1004-0137 (June 2015) Expires: January 31, 2018 **UNITED STATES** 5. Lease Serial No. DEPARTMENT OF THE INTERIOR NMNM017224 BUREAU OF LAND MANAGEMENT APPLICATION FOR PERMIT TO DRILL OR REENTER 6. If Indian, Allotee or Tribe Name 7. If Unit or CA Agreement, Name and No. ✓ DRILL REENTER 1a. Type of work: 1b. Type of Well: ✓ Oil Well Gas Well Other 8. Lease Name and Well No. 1c. Type of Completion: Hydraulic Fracturing Single Zone ✓ Multiple Zone OXBOW CC 17-8 FEDERAL COM 42H 9. API Well No. 30 015 48208 2. Name of Operator **OXY USA INCORPORATED** 3a. Address 3b. Phone No. (include area code) 10. Field and Pool, or Exploratory Purple Sage / BONE SPRING 5 Greenway Plaza, Suite 110 Houston TX 77046 (713)366-5716 4. Location of Well (Report location clearly and in accordance with any State requirements.*) 11. Sec., T. R. M. or Blk. and Survey or Area SEC 20 / T24S / R29E / NMP At surface NWNW / 478 FNL / 966 FWL / LAT 32.209032 / LONG -104.0119877 At proposed prod. zone NENW / 20 FNL / 1700 FWL / LAT 32.2394784 / LONG -104.0096905 14. Distance in miles and direction from nearest town or post office* 12. County or Parish 13. State **EDDY** NM 8 miles 15. Distance from proposed* 16. No of acres in lease 17. Spacing Unit dedicated to this well 20 feet location to nearest property or lease line, ft. 640 (Also to nearest drig. unit line, if any) 18. Distance from proposed location* 19. Proposed Depth 20. BLM/BIA Bond No. in file to nearest well, drilling, completed, 35 feet 10950 feet / 21845 feet FED: ESB000226 applied for, on this lease, ft. 21. Elevations (Show whether DF, KDB, RT, GL, etc.) 22. Approximate date work will start* 23. Estimated duration 2966 feet 06/15/2021 20 days 24. Attachments The following, completed in accordance with the requirements of Onshore Oil and Gas Order No. 1, and the Hydraulic Fracturing rule per 43 CFR 3162.3-3 (as applicable) 1. Well plat certified by a registered surveyor. 4. Bond to cover the operations unless covered by an existing bond on file (see 2. A Drilling Plan. Item 20 above) 3. A Surface Use Plan (if the location is on National Forest System Lands, the 5. Operator certification. 6. Such other site specific information and/or plans as may be requested by the SUPO must be filed with the appropriate Forest Service Office). 25. Signature Name (Printed/Typed) Date (Electronic Submission) 06/20/2019 Title Approved by (Signature) Date Name (Printed/Typed) (Electronic Submission) Cody Layton / Ph: (575)234-5959 04/21/2021 Title Office Assistant Field Manager Lands & Minerals **CARLSBAD** Application approval does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the

applicant to conduct operations thereon. Conditions of approval, if any, are attached.

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction



District 1
1625 N. French Dr., Hobbs, NM 88240
Phone: (375) 393-6161 Fax: (575) 393-0720
District II.
811 S. First St., Artesia, NM 88210
Phone: (375) 748-1283 Fax: (575) 748-9720
Phone: (375) 748-1283 Fax: (575) 748-9720 Total (3/3) Pho-3/20 District III
1000 Rio Brazos Road, Aztec, NM 87410
Phone: (505) 334-6178 Fax: (505) 334-6170

State of New Mexico Energy, Minerals & Natural Resources Department OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, NM 87505 1220 S. St. Prancis Dr., Santa Fe, NM 87505 Phane: (505) 476-3460 Fax. (505) 476-3462

Form C-102 Revised August 1, 2011 Submit one copy to appropriate District Office


☐ AMENDED REPORT

Released to Imaging: 4/23/2021 1:54:55 PM

WELL LOCATION AND ACREAGE DEDICATION PLAT

	API	Number		I	Pool Cod	le				Pool Name			
30-01	5-	48208		98	220			þι	uple Su	use li	olfica	mD	
Property Code							Property			Well Number			
32163	33			OXBC)W C	C "17	7_8"	FEDERA	L COM				42H
OGR	No.		-				Operator	Name					Elevation
166	96					OXY	USA	A INC.				2	965.7'
						Surfa	ace Lo	ocation					
UL or lot no.	Section	Township		Rang	ge		Lot Ida	Feet from the	North/South line	Feet from the	East/We	st line	County
D	20	24 SOUTH	29	EAST,	N. M. 1	P. M.		478'	NORTH	966'	WES	T	EDDY
			В	ottom I	Hole 1	Locatio	on If l	Different F	rom Surfac	е			
UL or lot no.	Section	Township	T	Rang	ge		Lot Idn	Feet from the	North/South line	Feet from the	East/We	est line	County
С	8	24 SOUTH	29	EAST,	N. M. I	P. M.		20'	NORTH	1700'	WES	T	EDDY
Dedicated	Acres	Joint or Infill	Conso	lidation Cod	e 0	rder No.	-						
لوس	\supset	1 4	Y										

No allowable will be assigned to this completion until all interests have been consolidated or a non-standard unit has been approved by the division.

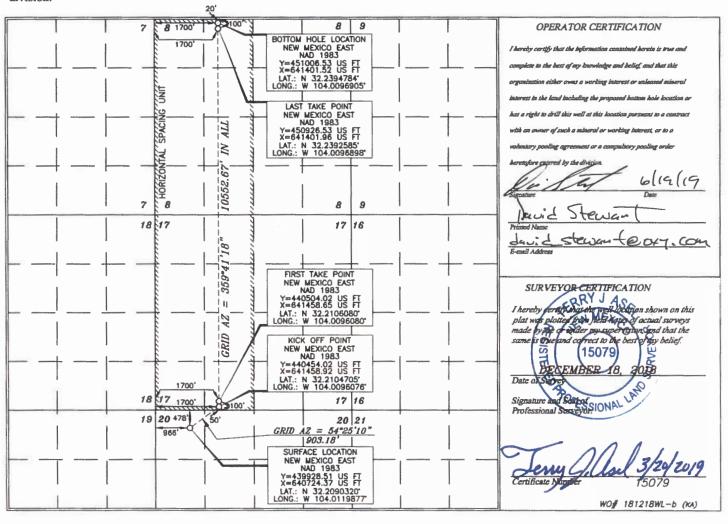

PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

OPERATOR'S NAME: OXY USA INCORPORATED

LEASE NO.: NMNM094651

LOCATION: | T-24S, R-29E, S-20. NMPM

COUNTY: EDDY COUNTY, NEW MEXICO

WELL NAME & NO.: OXBOW CC 17-8 FEDERAL COM 41H

SURFACE HOLE FOOTAGE: 498'/N & 938'/W **BOTTOM HOLE FOOTAGE** 20'/N & 380'/W

WELL NAME & NO.: OXBOW CC 17-8 FEDERAL COM 42H

SURFACE HOLE FOOTAGE: 478'/N & 966'/W **BOTTOM HOLE FOOTAGE** 20'/N & 1700'/W

COA

H2S	O Yes	No No	
Potash	None	Secretary	© R-111-P
Cave/Karst Potential	C Low	• Medium	C High
Cave/Karst Potential	Critical Critical		
Variance	© None	• Flex Hose	Other
Wellhead	Conventional	O Multibowl	O Both
Other	☐ 4 String Area	☐ Capitan Reef	□WIPP
Other	☐ Fluid Filled	✓ Cement Squeeze	☐ Pilot Hole
Special Requirements	☐ Water Disposal	☑ COM	□ Unit

A. HYDROGEN SULFIDE

Hydrogen Sulfide (H2S) monitors shall be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the Hydrogen Sulfide area shall meet Onshore Order 6 requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, provide measured values and formations to the BLM.

B. CASING

Casing Design:

1. The 10-3/4 inch surface casing shall be set at approximately 529 feet (a minimum of 70 feet (Eddy County) into the Rustler Anhydrite and above the salt) and cemented to the surface.

- a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
- b. Wait on cement (WOC) time for a primary cement job will be a minimum of **8** hours or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
- c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
- d. If cement falls back, remedial cementing will be done prior to drilling out that string.
- 2. The **7-5/8** inch intermediate casing shall be set at approximately **7144** feet. The minimum required fill of cement behind the **7-5/8** inch intermediate casing is:

Option 1 (Single Stage):

• Cement to surface. If cement does not circulate see B.1.a, c-d above. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.

Option 2:

Operator has proposed a DV tool, the depth may be adjusted as long as the cement is changed proportionally. The DV tool may be cancelled if cement circulates to surface on the first stage.

- a. First stage to DV tool: Cement to circulate. If cement does not circulate off the DV tool, contact the appropriate BLM office before proceeding with second stage cement job.
- b. Second stage above DV tool:
 - Cement to surface. If cement does not circulate, contact the appropriate BLM office.
 - Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to cave/karst or potash.
- ❖ In Medium Cave/Karst Areas if cement does not circulate to surface on the first two casing strings, the cement on the 3rd casing string must come to surface.

Operator has proposed to pump down 10-3/4" X 7-5/8" annulus. Operator must run a CBL or ECHOMETER from TD of the 7-5/8" casing to surface. Submit results to BLM.

3. The minimum required fill of cement behind the 5-1/2 inch production casing is:

Option 1 (Single Stage):

• Cement should tie-back at least **200 feet** into previous casing string. Operator shall provide method of verification.

Option 2:

Operator has proposed a DV tool, the depth may be adjusted as long as the cement is changed proportionally. The DV tool may be cancelled if cement circulates to surface on the first stage.

- a. First stage to DV tool: Cement to circulate. If cement does not circulate off the DV tool, contact the appropriate BLM office before proceeding with second stage cement job.
- b. Second stage above DV tool:
 - Cement should tie-back at least **200 feet** into previous casing string. Operator shall provide method of verification.

C. PRESSURE CONTROL

1. Variance approved to use flex line from BOP to choke manifold. Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).'

2.

Option 1:

- a. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **5000 (5M)** psi.
- b. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the intermediate casing shoe shall be 10,000 (10M) psi. Variance is approved to use a 5000 (5M) Annular which shall be tested to 5000 (5M) psi.

Option 2:

- 1. Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 10,000 (10M) psi. Variance is approved to use a 5000 (5M) Annular which shall be tested to 5000 (5M) psi.
 - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
 - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
 - c. Manufacturer representative shall install the test plug for the initial BOP test.
 - d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
 - e. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.

D. SPECIAL REQUIREMENT (S)

Communitization Agreement

- The operator will submit a Communitization Agreement to the Santa Fe Office, 301 Dinosaur Trail Santa Fe, New Mexico 87508, at least 90 days before the anticipated date of first production from a well subject to a spacing order issued by the New Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.
- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. When the Communitization Agreement number is known, it shall also be on the sign.

Offline Cementing

• Contact the BLM prior to the commencement of any offline cementing procedure.

BOP Break Testing Variance

• BOP break testing is not permitted on this well pending sundry submission

GENERAL REQUIREMENTS

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)
 - ☑ Eddy CountyCall the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (575) 361-2822
 - Lea County
 Call the Hobbs Field Station, 414 West Taylor, Hobbs NM 88240, (575)
 393-3612
- 1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
 - a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).
 - b. When the operator proposes to set surface casing with Spudder Rig
 - Notify the BLM when moving in and removing the Spudder Rig.
 - Notify the BLM when moving in the 2nd Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
 - BOP/BOPE test to be conducted per Onshore Oil and Gas Order No. 2 as soon as 2nd Rig is rigged up on well.
- 2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.
- 3. The record of the drilling rate along with the GR/N well log run from TD to surface (horizontal well vertical portion of hole) shall be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies. The Rustler top and top and bottom of Salt are to be recorded on the Completion Report.

Page 5 of 9

A. CASING

- 1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.
- 2. Wait on cement (WOC) for Potash Areas: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends, 2) until cement has been in place at least 24 hours. WOC time will be recorded in the driller's log. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 3. Wait on cement (WOC) for Water Basin: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least 8 hours. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 4. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.
- 5. No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.
- 6. On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.
- 7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.
- 8. Whenever a casing string is cemented in the R-111-P potash area, the NMOCD requirements shall be followed.

B. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.
- 3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.
- 4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:
 - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
 - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
 - c. Manufacturer representative shall install the test plug for the initial BOP test.
 - d. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.
 - e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
 - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin

- after cut-off or once cement reaches 500 psi compressive strength (including lead when specified), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
- b. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the plug. However, **no tests** shall commence until the cement has had a minimum of 24 hours setup time, except the casing pressure test can be initiated immediately after bumping the plug (only applies to single stage cement jobs).
- c. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to Onshore Order 2 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for water basin (8 hours) or potash (24 hours) or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
- d. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.
- e. The results of the test shall be reported to the appropriate BLM office.
- f. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- g. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- h. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per Onshore Order No. 2.

C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

NMK01282021



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Drilling Plan Data Report

04/22/2021

APD ID: 10400042976

Submission Date: 06/20/2019

Highlighted data reflects the most recent changes

Well Name: OXBOW CC 17-8 FEDERAL COM

Operator Name: OXY USA INCORPORATED

Well Number: 42H

Show Final Text

Well Type: OIL WELL

Well Work Type: Drill

Section 1 - Geologic Formations

Formation			True Vertical				Producing
ID	Formation Name	Elevation	Depth	Depth	Lithologies	Mineral Resources	Formation
482889	RUSTLER	2966	309	309	ANHYDRITE, DOLOMITE, SHALE	USEABLE WATER	N
482890	SALADO	2341	625	625	ANHYDRITE, DOLOMITE, HALITE, SHALE	OTHER : SALT	N
482887	CASTILE	1700	1266	1266	ANHYDRITE	OTHER : salt	N
482891	LAMAR	148	2818	2818	LIMESTONE, SANDSTONE, SILTSTONE	NATURAL GAS, OIL, OTHER : BRINE	N
482892	BELL CANYON	96	2870	2870	SANDSTONE, SILTSTONE	NATURAL GAS, OIL, OTHER, USEABLE WATER : BRINE	N
482893	CHERRY CANYON	-784	3750	3750	SANDSTONE, SILTSTONE	NATURAL GAS, OIL, OTHER : BRINE	N
482894	BRUSHY CANYON	-2029	4995	4995	LIMESTONE, SANDSTONE, SILTSTONE	NATURAL GAS, OIL, OTHER : BRINE	N
482888	BONE SPRING	-3644	6610	6619	LIMESTONE, SANDSTONE, SILTSTONE	NATURAL GAS, OIL	Y
482881	BONE SPRING 1ST	-4584	7550	7575	LIMESTONE, SANDSTONE, SILTSTONE	NATURAL GAS, OIL	Y
482901	BONE SPRING 2ND	-5410	8376	8412	LIMESTONE, SANDSTONE, SILTSTONE	NATURAL GAS, OIL	Y
482879	BONE SPRING 3RD	-6508	9474	9527	LIMESTONE, SANDSTONE, SILTSTONE	NATURAL GAS, OIL	Y
482880	WOLFCAMP	-6858	9824	9883	SANDSTONE, SILTSTONE	NATURAL GAS, OIL	Y

Section 2 - Blowout Prevention

Pressure Rating (PSI): 10M Rating Depth: 10950

Equipment: 13-5/8" 5/10M Annular, Blind Ram, Double Ram

Requesting Variance? YES

Variance request: Request for the use of a flexible choke line from the BOP to Choke Manifold.

Testing Procedure: OXY will utilize a 5M annular with a 10M BOPE stack. The BOP/BOPE will be tested by an independent service company to 250 psi low and the high pressure indicated above per Onshore Order 2 requirements. The System may be upgraded to a higher pressure but still tested to the working pressure listed in the table above. If the system is upgraded

Well Name: OXBOW CC 17-8 FEDERAL COM Well Number: 42H

all the components installed will be functional and tested. Pipe rams will be operationally checked each 24 hour period. Blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets. Other accessories to the BOP equipment will include a Kelly cock and floor safety valve (inside BOP) and choke lines and choke manifold. A multibowl wellhead or a unionized multibowl wellhead system will be employed. The wellhead and connection to the BOPE will meet all API 6A requirements. The BOP will be tested per Onshore Order #2 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system will be tested. We will test the flange connection of the wellhead with a test port that is directly in the flange. Per BLM's Memorandum No. NM-2017-008: Decision and Rationale for a Variance Allowing the Use of a 5M Annular Preventer with a 10M BOP Stack, OXY requests to employ a 5M annular with a 10M BOPE stack in the pilot and lateral sections of the well and will ensure that two barriers to flow are maintained at all times. Please see attached Well Control Plan. BOP Break Testing Request - As per the agreement reached in the OXY/BLM meeting on Feb 22, 2018, OXY requests permission to allow BOP Break Testing under the following conditions: 1. After a full BOP test is conducted on the first well on the pad. 2. When skidding to drill an intermediate section that the casing point is either shallower than the 3rd Bone Spring or 10000' TVD. 3. Full BOP test will be required prior to drilling any production section.

Choke Diagram Attachment:

OxbowCC17 8FdCom42H ChkManifold 20190619162159.pdf

BOP Diagram Attachment:

OxbowCC17 8FdCom42H BOP 20190619162211.pdf

OxbowCC17_8FdCom42H_FlexHoseCert_20190619162227.pdf

OxbowCC17_8FdCom42H_WellControlPlan_20190619162240.pdf

Section 3 - Casing

Casing ID	String Type	Hole Size	Csg Size	Condition	Standard	Tapered String	Top Set MD	Bottom Set MD	Top Set TVD	Bottom Set TVD	Top Set MSL	Bottom Set MSL	Calculated casing length MD	Grade	Weight	Joint Type	Collapse SF	Burst SF	Joint SF Type	Joint SF	Body SF Type	Body SF
1		14.7 5	10.75	NEW	API	N	0	565	0	565			565	J-55	40.5	BUTT	1.12 5	1.2	BUOY	1.4	BUOY	1.4
	INTERMED IATE	9.87 5	7.625	NEW	API	N	0	10441	0	10378			10441	HCL -80	26.4	BUTT	1.12 5	1.2	BUOY	1.4	BUOY	1.4
	PRODUCTI ON	6.75	5.5	NEW	API	N	0	21845	0	10950			21845	P- 110		L	1.12 5	1.2	BUOY	1.4	BUOY	1.4

Casing Attachments

Operator Name: OXY USA INCORPORATED
Well Name: OXBOW CC 17-8 FEDERAL COM

Well Number: 42H

Casing ID: 1

String Type: SURFACE

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

OxbowCC17_8FdCom42H_CsgCriteria_20190620093711.pdf

Casing ID: 2

String Type: INTERMEDIATE

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

OxbowCC17_8FdCom42H_CsgCriteria_20190620093656.pdf

Casing ID: 3

String Type: PRODUCTION

Inspection Document:

Spec Document:

Tapered String Spec:

Casing Design Assumptions and Worksheet(s):

 $Oxbow CC17_8 Fd Com 42 H_Csg Criteria_20190620093623.pdf$

OxbowCC17_8FdCom42H_5.5_20_P110CY_TMKUPDQWTORQ_20190620093637.pdf

OxbowCC17_8FdCom42H_5.5_20_P110_DQX_20190620093638.pdf

OxbowCC17_8FdCom42H_5.5_20_P110HC_TMKUPSFTORQ_20190620093638.pdf

Well Name: OXBOW CC 17-8 FEDERAL COM Well Number: 42H

0 11 -	. 4	O	
Sectio	n 4 -	Gen	1ent

String Type	Lead/Tail	Stage Tool Depth	Тор МD	Bottom MD	Quantity(sx)	Yield	Density	Cu Ft	Excess%	Cement type	Additives
SURFACE	Lead		0	565	459	1.33	14.8	610	100	CIC	Accelerator

INTERMEDIATE	Lead	2868	0	2868	672	1.67	13.6	1122	100	CI C	Accelerator, Retarder

INTERMEDIATE	Lead	2868	2768	9441	667	2.58	10.2	1721	20	CI C/Pozzolan	Retarder
INTERMEDIATE	Tail		9441	1044 1	167	1.61	13.2	269	20	CIH	Retarder, Dispersant, Salt
PRODUCTION	Lead		9941	2184 5	873	1.38	13.2	1205	20	CIH	Retarder, Dispersant, Salt

Section 5 - Circulating Medium

Mud System Type: Closed

Will an air or gas system be Used? NO

Description of the equipment for the circulating system in accordance with Onshore Order #2:

Diagram of the equipment for the circulating system in accordance with Onshore Order #2:

Describe what will be on location to control well or mitigate other conditions: Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements. The following is a general list of products: Barite, Bentonite, Gypsum, Lime, Soda Ash, Caustic Soda, Nut Plug, Cedar Fiber, Cotton Seed Hulls, Drilling Paper, Salt Water Clay, CaCl2.

Describe the mud monitoring system utilized: PVT/MD Totco/Visual Monitoring

Circulating Medium Table

Well Name: OXBOW CC 17-8 FEDERAL COM Well Number: 42H

Top Depth	Bottom Depth	Mud Type	Min Weight (lbs/gal)	Max Weight (lbs/gal)	Density (lbs/cu ft)	Gel Strength (lbs/100 sqft)	ЬН	Viscosity (CP)	Salinity (ppm)	Filtration (cc)	Additional Characteristics
565	1044	OTHER: Saturated Brine Based Mud and/or Oil-Base Mud	8	10							
1044 1	2184 5	OTHER: Water- Based and/or Oil-Based Mud	9.5	13							
0	565	WATER-BASED MUD	8.6	8.8							

Section 6 - Test, Logging, Coring

List of production tests including testing procedures, equipment and safety measures:

GR from TD to surface (horizontal well – vertical portion of hole). Mud Log from intermediate shoe to TD.

List of open and cased hole logs run in the well:

GR, MUDLOG

Coring operation description for the well:

No coring is planned at this time.

Section 7 - Pressure

Anticipated Bottom Hole Pressure: 7403 Anticipated Surface Pressure: 4994

Anticipated Bottom Hole Temperature(F): 168

Anticipated abnormal pressures, temperatures, or potential geologic hazards? NO

Describe:

Contingency Plans geoharzards description:

Contingency Plans geohazards attachment:

Hydrogen Sulfide drilling operations plan required? YES

Hydrogen sulfide drilling operations plan:

OxbowCC17_8FdCom42H_H2S1_20190619162451.pdf OxbowCC17_8FdCom42H_H2S2_20190619162452.pdf

Well Name: OXBOW CC 17-8 FEDERAL COM Well Number: 42H

OxbowCC17 8FdCom42H EmergencyContactList 20190619162502.pdf

Section 8 - Other Information

Proposed horizontal/directional/multi-lateral plan submission:

OxbowCC17_8FdCom42H_DirectPlan_20190619162533.pdf OxbowCC17_8FdCom42H_DirectPlot_20190619162752.pdf

Other proposed operations facets description:

OXY requests the option to set casing shallower yet still below the salts if losses or hole conditions require this. Cement volumes may be adjusted if casing is set shallower and a DV tool may be run in case hole conditions merit pumping a second stage cement job to comply with permitted top of cement. If cement circulated to surface during first stage we will drop a cancelation cone and not pump the second stage.

OXY respectfully requests a variance to cement the 7-5/8" intermediate casing string offline, see attached for additional information.

OXY requests to pump a two stage Intermediate casing cement job with the first stage being pumped conventionally with the calculated TOC @ the Brushy Canyon and the second stage performed as a bradenhead squeeze with planned cement from the Brushy Canyon to Surface.

Oxy requests the option to run production casing with DQX, SF TORQ and/or DQW TORQ connections to accommodate hole conditions or drilling operations.

Annular Clearance Variance Request - As per the agreement reached in the Oxy/BLM meeting on Feb 22, 2018, Oxy requests permission to allow deviation from the 0.422" annular clearance requirement from Onshore Order #2 under the following conditions:

- 1. Annular clearance to meet or exceed 0.422" between intermediate casing ID and production casing coupling only on the first 500' overlap between both casings.
- 2. Annular clearance less than 0.422" is acceptable for the curve and lateral portions of the production open hole section.

Well will be drilled with a walking/skidding operation. Plan to drill the multiple well pad in batch by section: all surface sections, intermediate sections and production sections. The wellhead will be secured with a night cap whenever the rig is not over the well.

OXY requests the option to contract a Surface Rig to drill, set surface casing, and cement for this well. If the timing between rigs is such that OXY would not be able to preset surface, the Primary Rig will MIRU and drill the well in its entirety per the APD. Please see the attached document for information on the spudder rig.


Other proposed operations facets attachment:

OxbowCC17_8FdCom42H_DrillPlan_20190619162549.pdf
OxbowCC17_8FdCom42H_GasCapPlan_20190619162603.pdf
OxbowCC17_8FdCom42H_SpudRigData_20190619162615.pdf

Other Variance attachment:

OxbowCC17_8FdCom42H_OfflineCmtgDetail_20190619162634.pdf

5/10M BOP Stack

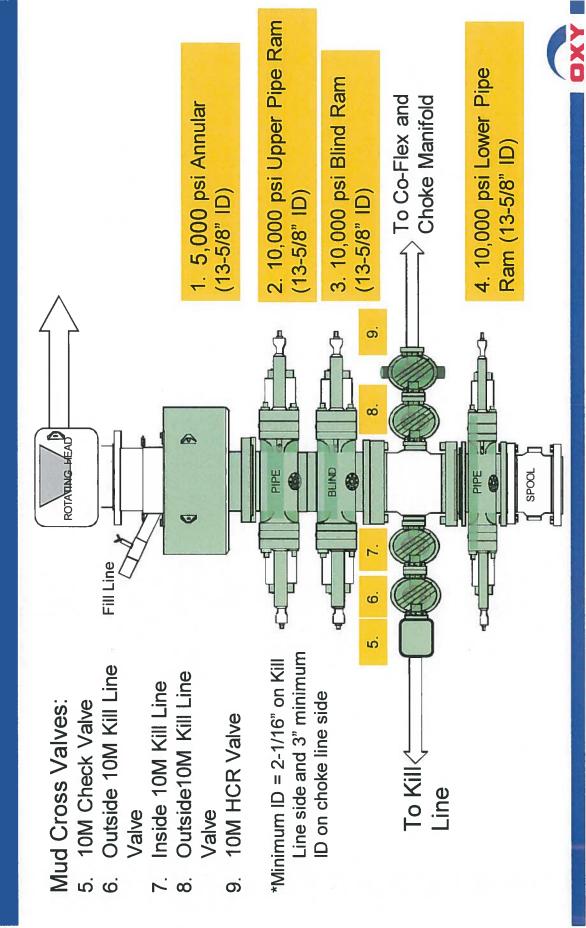




Permian Drilling Hydrogen Sulfide Drilling Operations Plan Oxbow CC 17-8 Federal Com 42H

Open drill site. No homes or buildings are near the proposed location.

1. Escape

Personnel shall escape upwind of wellbore in the event of an emergency gas release. Escape can take place through the lease road on the Southeast side of the location. Personnel need to move to a safe distance and block the entrance to location. If the primary route is not an option due to the wind direction, then a secondary egress route should be taken.

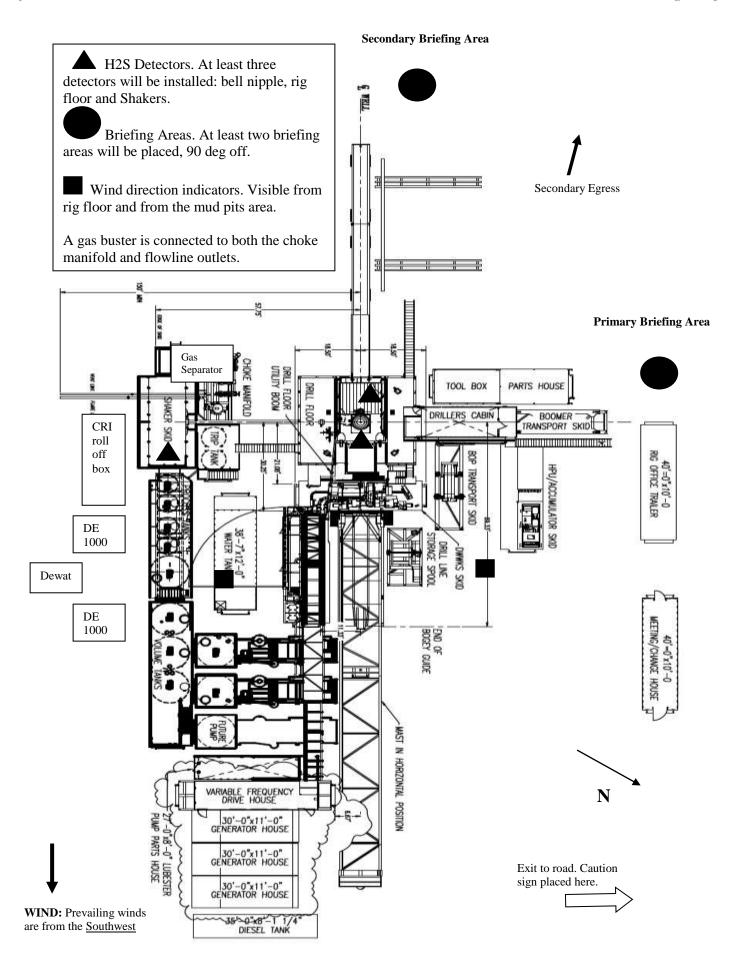



Permian Drilling Hydrogen Sulfide Drilling Operations Plan New Mexico

Scope

This contingency plan establishes guidelines for the public, all company employees, and contract employees who's work activities may involve exposure to hydrogen sulfide (H2S) gas.

While drilling this well, it is possible to encounter H2S bearing formations. At all times, the first barrier to control H2S emissions will be the drilling fluid, which will have a density high enough to control influx.

Objective

- 1. Provide an immediate and predetermined response plan to any condition when H2S is detected. All H2S detections in excess of 10 parts per million (ppm) concentration are considered an Emergency.
- 2. Prevent any and all accidents, and prevent the uncontrolled release of hydrogen sulfide into the atmosphere.
- 3. Provide proper evacuation procedures to cope with emergencies.
- 4. Provide immediate and adequate medical attention should an injury occur.

Discussion

Implementation: This plan with all details is to be fully implemented

before drilling to commence.

Emergency response This section outlines the conditions and denotes steps

Procedure: to be taken in the event of an emergency.

Emergency equipment This section outlines the safety and emergency

Procedure: equipment that will be required for the drilling of this

well.

Training provisions: This section outlines the training provisions that must

be adhered to prior to drilling.

Drilling emergency call lists: Included are the telephone numbers of all persons to

be contacted should an emergency exist.

Briefing: This section deals with the briefing of all people

involved in the drilling operation.

Public safety: Public safety personnel will be made aware of any

potential evacuation and any additional support

needed.

Check lists: Status check lists and procedural check lists have been

included to insure adherence to the plan.

General information: A general information section has been included to

supply support information.

Hydrogen Sulfide Training

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on the well:

- 1. The hazards and characteristics of H2S.
- 2. Proper use and maintenance of personal protective equipment and life support systems.
- 3. H2S detection.
- 4. Proper use of H2S detectors, alarms, warning systems, briefing areas, evacuation procedures and prevailing winds.
- 5. Proper techniques for first aid and rescue procedures.
- 6. Physical effects of hydrogen sulfide on the human body.
- 7. Toxicity of hydrogen sulfide and sulfur dioxide.
- 8. Use of SCBA and supplied air equipment.
- 9. First aid and artificial respiration.
- 10. Emergency rescue.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H2S on metal components. If high tensile strength tubular is to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling a well, blowout prevention and well control procedures.
- 3. The contents and requirements of the H2S Drilling Operations Plan.

H2S training refresher must have been taken within one year prior to drilling the well. Specifics on the well to be drilled will be discussed during the pre-spud meeting. H2S and well control (choke) drills will be performed while drilling the well, at least on a weekly basis. This plan shall be available in the well site. All personnel will be required to carry the documentation proving that the H2S training has been taken.

Service company and visiting personnel

- A. Each service company that will be on this well will be notified if the zone contains H2S.
- B. Each service company must provide for the training and equipment of their employees before they arrive at the well site.
- C. Each service company will be expected to attend a well site briefing

Emergency Equipment Requirements

1. Well control equipment

The well shall have hydraulic BOP equipment for the anticipated pressures. Equipment is to be tested on installation and follow Oxy Well Control standard, as well as BLM Onshore Order #2.

Special control equipment:

- A. Hydraulic BOP equipment with remote control on ground. Remotely operated choke.
- B. Rotating head
- C. Gas buster equipment shall be installed before drilling out of surface pipe.

2. <u>Protective equipment for personnel</u>

- A. Four (4) 30-minute positive pressure air packs (2 at each briefing area) on location.
- B. Adequate fire extinguishers shall be located at strategic locations.
- C. Radio / cell telephone communication will be available at the rig.
 - Rig floor and trailers.
 - Vehicle.

3. Hydrogen sulfide sensors and alarms

- A. H2S sensor with alarms will be located on the rig floor, at the bell nipple, and at the flow line. These monitors will be set to alarm at 10 ppm with strobe light, and audible alarm.
- B. Hand operated detectors with tubes.
- C. H2S monitor tester (to be provided by contract Safety Company.)
- D. There shall be one combustible gas detector on location at all times.

4. <u>Visual Warning Systems</u>

A. One sign located at each location entrance with the following language:

Caution – potential poison gas Hydrogen sulfide No admittance without authorization *Wind sock – wind streamers:*

- A. One 36" (in length) wind sock located at protection center, at height visible from rig floor.
- B. One 36" (in length) wind sock located at height visible from pit areas.

Condition flags

A. One each condition flag to be displayed to denote conditions.

```
green – normal conditions
yellow – potential danger
red – danger, H2S present
```

B. Condition flag shall be posted at each location sign entrance.

5. <u>Mud Program</u>

The mud program is designed to minimize the risk of having H2S and other formation fluids at surface. Proper mud weight and safe drilling practices will be applied. H2S scavengers will be used to minimize the hazards while drilling. Below is a summary of the drilling program.

Mud inspection devices:

Garrett gas train or hatch tester for inspection of sulfide concentration in mud system.

6. <u>Metallurgy</u>

- A. Drill string, casing, tubing, wellhead, blowout preventers, drilling spools or adapters, kill lines, choke manifold, lines and valves shall be suitable for the H2S service.
- B. All the elastomers, packing, seals and ring gaskets shall be suitable for H2S service.

7. <u>Well Testing</u>

No drill stem test will be performed on this well.

8. Evacuation plan

Evacuation routes should be established prior to well spud for each well and discussed with all rig personnel.

9. <u>Designated area</u>

- A. Parking and visitor area: all vehicles are to be parked at a predetermined safe distance from the wellhead.
- B. There will be a designated smoking area.
- C. Two briefing areas on either side of the location at the maximum allowable distance from the well bore so they offset prevailing winds perpendicularly, or at a 45-degree angle if wind direction tends to shift in the area.

Emergency procedures

- A. In the event of any evidence of H2S level above 10 ppm, take the following steps:
 - 1. The Driller will pick up off bottom, shut down the pumps, slow down the pipe rotation.
 - 2. Secure and don escape breathing equipment, report to the upwind designated safe briefing / muster area.
 - 3. All personnel on location will be accounted for and emergency search should begin for any missing, the Buddy System will be implemented.
 - 4. Order non-essential personnel to leave the well site, order all essential personnel out of the danger zone and upwind to the nearest designated safe briefing / muster area.
 - 5. Entrance to the location will be secured to a higher level than our usual "Meet and Greet" requirement, and the proper condition flag will be displayed at the entrance to the location.
 - 6. Take steps to determine if the H2S level can be corrected or suppressed and, if so, proceed as required.

B. If uncontrollable conditions occur:

1. Take steps to protect and/or remove any public in the down-wind area from the rig – partial evacuation and isolation. Notify necessary public safety personnel and appropriate regulatory entities (i.e. BLM) of the situation.

- 2. Remove all personnel to the nearest upwind designated safe briefing / muster area or off location.
- 3. Notify public safety personnel of safe briefing / muster area.
- 4. An assigned crew member will blockade the entrance to the location. No unauthorized personnel will be allowed entry to the location.
- 5. Proceed with best plan (at the time) to regain control of the well. Maintain tight security and safety procedures.

C. Responsibility:

- 1. Designated personnel.
 - a. Shall be responsible for the total implementation of this plan.
 - b. Shall be in complete command during any emergency.
 - c. Shall designate a back-up.

All personnel:

- 1. On alarm, don escape unit and report to the nearest upwind designated safe briefing / muster area upw
- 2. Check status of personnel (buddy system).
- 3. Secure breathing equipment.
- 4. Await orders from supervisor.

Drill site manager:

- 1. Don escape unit if necessary and report to nearest upwind designated safe briefing / muster area.
- 2. Coordinate preparations of individuals to return to point of release with tool pusher and driller (using the buddy system).
- 3. Determine H2S concentrations.
- 4. Assess situation and take control measures.

Tool pusher:

- 1. Don escape unit Report to up nearest upwind designated safe briefing / muster area.
- 2. Coordinate preparation of individuals to return to point of release with tool pusher drill site manager (using the buddy system).
- 3. Determine H2S concentration.
- 4. Assess situation and take control measures.

Driller:

1. Don escape unit, shut down pumps, continue

- rotating DP.
- 2. Check monitor for point of release.
- 3. Report to nearest upwind designated safe briefing / muster area.
- 4. Check status of personnel (in an attempt to rescue, use the buddy system).
- 5. Assigns least essential person to notify Drill Site Manager and tool pusher by quickest means in case of their absence.
- 6. Assumes the responsibilities of the Drill Site Manager and tool pusher until they arrive should they be absent.

Derrick man Floor man #1 Floor man #2 1. Will remain in briefing / muster area until instructed by supervisor.

Mud engineer:

- 1. Report to nearest upwind designated safe briefing / muster area.
- 2. When instructed, begin check of mud for ph and H2S level. (Garett gas train.)

Safety personnel:

1. Mask up and check status of all personnel and secure operations as instructed by drill site manager.

Taking a kick

When taking a kick during an H2S emergency, all personnel will follow standard Well control procedures after reporting to briefing area and masking up.

Open-hole logging

All unnecessary personnel off floor. Drill Site Manager and safety personnel should monitor condition, advise status and determine need for use of air equipment.

Running casing or plugging

Following the same "tripping" procedure as above. Drill Site Manager and safety personnel should determine if all personnel have access to protective equipment.

Ignition procedures

The decision to ignite the well is the responsibility of the operator (Oxy Drilling Management). The decision should be made only as a last resort and in a situation where it is clear that:

- 1. Human life and property are endangered.
- 2. There is no hope controlling the blowout under the prevailing conditions at the well.

<u>Instructions for igniting the well</u>

- 1. Two people are required for the actual igniting operation. They must wear self-contained breathing units and have a safety rope attached. One man (tool pusher or safety engineer) will check the atmosphere for explosive gases with the gas monitor. The other man is responsible for igniting the well.
- 2. Primary method to ignite: 25 mm flare gun with range of approximately 500 feet.
- 3. Ignite upwind and do not approach any closer than is warranted.
- 4. Select the ignition site best for protection, and which offers an easy escape route.
- 5. Before firing, check for presence of combustible gas.
- 6. After lighting, continue emergency action and procedure as before.
- 7. All unassigned personnel will remain in briefing area until instructed by supervisor or directed by the Drill Site Manager.

<u>Remember</u>: After well is ignited, burning hydrogen sulfide will convert to sulfur dioxide, which is also highly toxic. <u>Do not assume the area is safe after the well is ignited.</u>

Status check list

Note: All items on this list must be completed before drilling to production casing point.

- 1. H2S sign at location entrance.
- 2. Two (2) wind socks located as required.
- 3. Four (4) 30-minute positive pressure air packs (2 at each Briefing area) on location for all rig personnel and mud loggers.
- 4. Air packs inspected and ready for use.
- 5. Cascade system and hose line hook-up as needed.
- 6. Cascade system for refilling air bottles as needed.
- 7. Condition flag on location and ready for use.
- 8. H2S detection system hooked up and tested.
- 9. H2S alarm system hooked up and tested.
- 10. Hand operated H2S detector with tubes on location.
- 11. 1 100' length of nylon rope on location.
- 12. All rig crew and supervisors trained as required.
- 13. All outside service contractors advised of potential H2S hazard on well.
- 14. No smoking sign posted and a designated smoking area identified.
- 15. Calibration of all H2S equipment shall be noted on the IADC report.

Checked by	7 .	Date:
Checken by	/ •	Date

Procedural check list during H2S events

Perform each tour:

- 1. Check fire extinguishers to see that they have the proper charge.
- 2. Check breathing equipment to ensure that it in proper working order.
- 3. Make sure all the H2S detection system is operative.

Perform each week:

- 1. Check each piece of breathing equipment to make sure that demand or forced air regulator is working. This requires that the bottle be opened and the mask assembly be put on tight enough so that when you inhale, you receive air or feel air flow.
- 2. BOP skills (well control drills).
- 3. Check supply pressure on BOP accumulator stand by source.
- 4. Check breathing equipment mask assembly to see that straps are loosened and turned back, ready to put on.
- 5. Check pressure on breathing equipment air bottles to make sure they are charged to full volume. (Air quality checked for proper air grade "D" before bringing to location)
- 6. Confirm pressure on all supply air bottles.
- 7. Perform breathing equipment drills with on-site personnel.
- 8. Check the following supplies for availability.
 - A. Emergency telephone list.
 - B. Hand operated H2S detectors and tubes.

General evacuation plan

- 1. When the company approved supervisor (Drill Site Manager, consultant, rig pusher, or driller) determines the H2S gas cannot be limited to the well location and the public will be involved, he will activate the evacuation plan.
- 2. Drill Site Manager or designee will notify local government agency that a hazardous condition exists and evacuation needs to be implemented.
- 3. Company or contractor safety personnel that have been trained in the use of H2S detection equipment and self-contained breathing equipment will monitor H2S concentrations, wind directions, and area of exposure. They will delineate the outer perimeter of the hazardous gas area. Extension to the evacuation area will be determined from information gathered.
- 4. Law enforcement personnel (state police, police dept., fire dept., and sheriff's dept.) Will be called to aid in setting up and maintaining road blocks. Also, they will aid in evacuation of the public if necessary.
- 5. After the discharge of gas has been controlled, company safety personnel will determine when the area is safe for re-entry.

<u>Important:</u> Law enforcement personnel will not be asked to come into a contaminated area. Their assistance will be limited to uncontaminated areas. Constant radio contact will be maintained with them.

Emergency actions

Well blowout – if emergency

- 1. Evacuate all personnel to "Safe Briefing / Muster Areas" or off location if needed.
- 2. If sour gas evacuate rig personnel.
- 3. If sour gas evacuate public within 3000 ft radius of exposure.
- 4. Don SCBA and shut well in if possible using the buddy system.
- 5. Notify Drilling Superintendent and call 911 for emergency help (fire dept and ambulance) if needed.
- 6. Implement the Blowout Contingency Plan, and Drilling Emergency Action Plan.
- 6. Give first aid as needed.

Person down location/facility

- 1. If immediately possible, contact 911. Give location and wait for confirmation.
- 2. Don SCBA and perform rescue operation using buddy system.

Toxic effects of hydrogen sulfide

Hydrogen sulfide is extremely toxic. The acceptable ceiling concentration for eight-hour exposure is 10 ppm, which is .001% by volume. Hydrogen sulfide is heavier than air (specific gravity – 1.192) and colorless. It forms an explosive mixture with air between 4.3 and 46.0 percent by volume. Hydrogen sulfide is almost as toxic as hydrogen cyanide and is between five and six times more toxic than carbon monoxide. Toxicity data for hydrogen sulfide and various other gases are compared in table i. Physical effects at various hydrogen sulfide exposure levels are shown in table ii.

Table i
Toxicity of various gases

Common name	Chemical formula	Specific gravity	Threshold limit	Hazardous limit	Lethal concentration (3)
		(sc=1)	(1)	(2)	
Hydrogen	Hen	0.94	10 ppm	150 ppm/hr	300 ppm
Cyanide Hydrogen	H2S	1.18	10 ppm	250 ppm/hr	600 ppm
Sulfide	1125	1.10	то ррш	250 ppin/in	ооо ррш
Sulfur	So2	2.21	5 ppm	-	1000 ppm
Dioxide Chlorine	C12	2.45	1 ppm	4 ppm/hr	1000 ppm
Cimorinio	CIZ	2.15	т ррш	i ppiii ii	тооо ррш
Carbon	Co	0.97	50 ppm	400 ppm/hr	1000 ppm
Monoxide					
Carbon	Co2	1.52	5000 ppm	5%	10%
Dioxide					
Methane	Ch4	0.55	90,000 ppm	Combustibl	e above 5% in air

- 1) threshold limit concentration at which it is believed that all workers may be repeatedly exposed day after day without adverse effects.
- 2) hazardous limit concentration that will cause death with short-term exposure.
- 3) lethal concentration concentration that will cause death with short-term exposure.

Toxic effects of hydrogen sulfide

Table ii Physical effects of hydrogen sulfide

		Concentration	Physical effects
Percent (%)	<u>Ppm</u>	Grains	
		100 std. Ft3*	
0.001	<10	00.65	Obvious and unpleasant odor.

0.002	10	01.30	Safe for 8 hours of exposure.
0.010	100	06.48	Kill smell in $3 - 15$ minutes. May sting eyes and throat.
0.020	200	12.96	Kills smell shortly; stings eyes and throat.
0.050	500	32.96	Dizziness; breathing ceases in a few minutes; needs prompt artificial respiration.
0.070	700	45.36	Unconscious quickly; death will result if not rescued promptly.
0.100	1000	64.30	Unconscious at once; followed by death within minutes.

^{*}at 15.00 psia and 60'f.

Use of self-contained breathing equipment (SCBA)

- 1. Written procedures shall be prepared covering safe use of SCBA's in dangerous atmosphere, which might be encountered in normal operations or in emergencies. Personnel shall be familiar with these procedures and the available SCBA.
- 2 SCBA's shall be inspected frequently at random to insure that they are properly used, cleaned, and maintained.
- 3. Anyone who may use the SCBA's shall be trained in how to insure proper facepiece to face seal. They shall wear SCBA's in normal air and then wear them in a
 test atmosphere. (note: such items as facial hair {beard or sideburns} and
 eyeglasses will not allow proper seal.) Anyone that may be reasonably expected
 to wear SCBA's should have these items removed before entering a toxic
 atmosphere. A special mask must be obtained for anyone who must wear
 eyeglasses or contact lenses.
- 4. Maintenance and care of SCBA's:
 - a. A program for maintenance and care of SCBA's shall include the following:
 - 1. Inspection for defects, including leak checks.
 - 2. Cleaning and disinfecting.
 - 3. Repair.
 - 4. Storage.
 - b. Inspection, self-contained breathing apparatus for emergency use shall be inspected monthly.
 - 1. Fully charged cylinders.
 - 2. Regulator and warning device operation.
 - 3. Condition of face piece and connections.
 - 4. Rubber parts shall be maintained to keep them pliable and prevent deterioration.
 - c. Routinely used SCBA's shall be collected, cleaned and disinfected as frequently as necessary to insure proper protection is provided.
- 5. Persons assigned tasks that requires use of self-contained breathing equipment shall be certified physically fit (medically cleared) for breathing equipment usage at least annually.
- 6. SCBA's should be worn when:
 - A. Any employee works near the top or on top of any tank unless test reveals less than 10 ppm of H2S.

- B. When breaking out any line where H2S can reasonably be expected.
- C. When sampling air in areas to determine if toxic concentrations of H2S exists.
- D. When working in areas where over 10 ppm H2S has been detected.
- E. At any time there is a doubt as to the H2S level in the area to be entered.

Rescue First aid for H2S poisoning

Do not panic!

Remain calm – think!

- 1. Don SCBA breathing equipment.
- 2. Remove victim(s) utilizing buddy system to fresh air as quickly as possible. (go up-wind from source or at right angle to the wind. Not down wind.)
- 3. Briefly apply chest pressure arm lift method of artificial respiration to clean the victim's lungs and to avoid inhaling any toxic gas directly from the victim's lungs.
- 4. Provide for prompt transportation to the hospital, and continue giving artificial respiration if needed.
- 5. Hospital(s) or medical facilities need to be informed, before-hand, of the possibility of H2S gas poisoning no matter how remote the possibility is.
- 6. Notify emergency room personnel that the victim(s) has been exposed to H2S gas.

Besides basic first aid, everyone on location should have a good working knowledge of artificial respiration.

Revised CM 6/27/2012

OXY

PRD NM DIRECTIONAL PLANS (NAD 1983) OXBOW CC 17-08 FED COM Oxbow CC 17_8 Federal Com 42H

Wellbore #1

Plan: Permitting Plan

Standard Planning Report

23 April, 2019

Database: HOPSPP

Company:

ENGINEERING DESIGNS PRD NM DIRECTIONAL PLANS (NAD 1983)

Project: Site: OXBOW CC 17-08 FED COM Well: Oxbow CC 17 8 Federal Com 42H

Wellbore: Wellbore #1 Design: Permitting Plan Local Co-ordinate Reference:

TVD Reference: MD Reference: North Reference:

Survey Calculation Method:

Well Oxbow CC 17_8 Federal Com 42H

RKB=26.5' @ 2992.20ft

RKB=26.5' @ 2992.20ft Grid

Minimum Curvature

Project PRD NM DIRECTIONAL PLANS (NAD 1983)

Map System: US State Plane 1983 North American Datum 1983 Geo Datum:

Map Zone: New Mexico Eastern Zone System Datum:

Mean Sea Level

Using geodetic scale factor

OXBOW CC 17-08 FED COM Site

Site Position: Northing: 440,994.67 usft 32° 12' 42.973882 N Latitude: From: Мар Easting: 643,785.93 usft Longitude: 104° 0' 7.482139 W 0.18°

Position Uncertainty: 50.00 ft Slot Radius: 13.200 in **Grid Convergence:**

Well Oxbow CC 17_8 Federal Com 42H

Well Position Latitude: 32° 12' 32.515213 N +N/-S -1,066.25 ft Northing: 439,928.51 usft -3,061.81 ft 640,724.37 usft 104° 0' 43.155852 W +E/-W Easting: Longitude:

Position Uncertainty 2.00 ft Wellhead Elevation: 0.00 ft **Ground Level:** 2,965.70 ft

Wellbore #1 Wellbore Declination Dip Angle Field Strength **Model Name** Sample Date Magnetics (nT) (°) (°) **HDGM** 4/23/2019 7.00 59.93 47,910

Design Permitting Plan **Audit Notes:** Version: Phase: **PROTOTYPE** Tie On Depth: 0.00 Depth From (TVD) +E/-W Direction **Vertical Section:** +N/-S (ft) (ft) (ft) (°) 0.00 0.00 0.00 3.50

Plan Sections										
Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)	TFO (°)	Target
0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	
5,670.00	0.00	0.00	5,670.00	0.00	0.00	0.00	0.00	0.00	0.00	
6,170.15	10.00	94.08	6,167.61	-3.10	43.44	2.00	2.00	0.00	94.08	
9,809.53	10.00	94.08	9,751.67	-48.05	673.99	0.00	0.00	0.00	0.00	
10,541.57	10.00	359.69	10,476.54	11.31	737.41	2.00	0.00	-12.89	-136.76	
11,341.57	90.00	359.69	10,950.00	575.56	734.34	10.00	10.00	0.00	0.00	FTP (Oxbow CC
21,845.09	90.00	359.69	10,950.00	11,078.92	677.21	0.00	0.00	0.00	0.00	PBHL (Oxbow CC

Database: Company:

Project:

HOPSPP

ENGINEERING DESIGNS

PRD NM DIRECTIONAL PLANS (NAD 1983)

Site: OXBOW CC 17-08 FED COM Well: Oxbow CC 17_8 Federal Com 42H

Wellbore: Wellbore #1 Design: Permitting Plan Local Co-ordinate Reference:

TVD Reference: MD Reference: North Reference:

Survey Calculation Method:

Well Oxbow CC 17_8 Federal Com 42H

RKB=26.5' @ 2992.20ft RKB=26.5' @ 2992.20ft

Design.	remining Fig	411							
Planned Survey									
Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00
100.00	0.00	0.00	100.00	0.00	0.00	0.00	0.00	0.00	0.00
200.00	0.00	0.00	200.00	0.00	0.00	0.00	0.00	0.00	0.00
300.00	0.00	0.00	300.00	0.00	0.00	0.00	0.00	0.00	0.00
400.00	0.00	0.00	400.00	0.00	0.00	0.00	0.00	0.00	0.00
400.00	0.00	0.00	400.00	0.00	0.00	0.00	0.00	0.00	0.00
500.00	0.00	0.00	500.00	0.00	0.00	0.00	0.00	0.00	0.00
600.00	0.00	0.00	600.00	0.00	0.00	0.00	0.00	0.00	0.00
700.00	0.00	0.00	700.00	0.00	0.00	0.00	0.00	0.00	0.00
800.00	0.00	0.00	800.00	0.00	0.00	0.00	0.00	0.00	0.00
900.00	0.00	0.00	900.00	0.00	0.00	0.00	0.00	0.00	0.00
1,000.00	0.00	0.00	1,000.00	0.00	0.00	0.00	0.00	0.00	0.00
1,100.00	0.00	0.00	1,100.00	0.00	0.00	0.00	0.00	0.00	0.00
1,200.00	0.00	0.00	1,200.00	0.00	0.00	0.00	0.00	0.00	0.00
1,300.00	0.00	0.00	1,300.00	0.00	0.00	0.00	0.00	0.00	0.00
1,400.00	0.00	0.00	1,400.00	0.00	0.00	0.00	0.00	0.00	0.00
1,500.00	0.00	0.00	1,500.00	0.00	0.00	0.00	0.00	0.00	0.00
1,600.00	0.00	0.00	1,600.00	0.00	0.00	0.00	0.00	0.00	0.00
1,700.00	0.00	0.00	1,700.00	0.00	0.00	0.00	0.00	0.00	0.00
1,800.00	0.00	0.00	1,800.00	0.00	0.00	0.00	0.00	0.00	0.00
1,900.00	0.00	0.00	1,900.00	0.00	0.00	0.00	0.00	0.00	0.00
2,000.00	0.00	0.00	2,000.00	0.00	0.00	0.00	0.00	0.00	0.00
2,100.00	0.00	0.00	2,100.00	0.00	0.00	0.00	0.00	0.00	0.00
2,200.00	0.00	0.00	2,200.00	0.00	0.00	0.00	0.00	0.00	0.00
2,300.00	0.00	0.00	2,300.00	0.00	0.00	0.00	0.00	0.00	0.00
2,400.00	0.00	0.00	2,400.00	0.00	0.00	0.00	0.00	0.00	0.00
2 500 00	0.00	0.00	2,500.00	0.00	0.00	0.00	0.00	0.00	0.00
2,500.00	0.00	0.00	,	0.00	0.00	0.00	0.00		
2,600.00	0.00	0.00	2,600.00	0.00	0.00	0.00	0.00	0.00	0.00
2,700.00	0.00	0.00	2,700.00	0.00	0.00	0.00	0.00	0.00	0.00
2,800.00	0.00	0.00	2,800.00	0.00	0.00	0.00	0.00	0.00	0.00
2,900.00	0.00	0.00	2,900.00	0.00	0.00	0.00	0.00	0.00	0.00
3,000.00	0.00	0.00	3,000.00	0.00	0.00	0.00	0.00	0.00	0.00
3,100.00	0.00	0.00	3,100.00	0.00	0.00	0.00	0.00	0.00	0.00
3,200.00	0.00	0.00	3,200.00	0.00	0.00	0.00	0.00	0.00	0.00
3,300.00	0.00	0.00	3,300.00	0.00	0.00	0.00	0.00	0.00	0.00
3,400.00	0.00	0.00	3,400.00	0.00	0.00	0.00	0.00	0.00	0.00
3,400.00		0.00	3,400.00	0.00	0.00	0.00		0.00	0.00
3,500.00	0.00	0.00	3,500.00	0.00	0.00	0.00	0.00	0.00	0.00
3,600.00	0.00	0.00	3,600.00	0.00	0.00	0.00	0.00	0.00	0.00
3,700.00	0.00	0.00	3,700.00	0.00	0.00	0.00	0.00	0.00	0.00
3,800.00	0.00	0.00	3,800.00	0.00	0.00	0.00	0.00	0.00	0.00
3,900.00	0.00	0.00	3,900.00	0.00	0.00	0.00	0.00	0.00	0.00
•									
4,000.00	0.00	0.00	4,000.00	0.00	0.00	0.00	0.00	0.00	0.00
4,100.00	0.00	0.00	4,100.00	0.00	0.00	0.00	0.00	0.00	0.00
4,200.00	0.00	0.00	4,200.00	0.00	0.00	0.00	0.00	0.00	0.00
4,300.00	0.00	0.00	4,300.00	0.00	0.00	0.00	0.00	0.00	0.00
4,400.00	0.00	0.00	4,400.00	0.00	0.00	0.00	0.00	0.00	0.00
4,500.00	0.00	0.00	4,500.00	0.00	0.00	0.00	0.00	0.00	0.00
4,500.00 4,600.00	0.00		4,600.00	0.00	0.00	0.00	0.00	0.00	0.00
		0.00							
4,700.00	0.00	0.00	4,700.00	0.00	0.00	0.00	0.00	0.00	0.00
4,800.00	0.00	0.00	4,800.00	0.00	0.00	0.00	0.00	0.00	0.00
4,900.00	0.00	0.00	4,900.00	0.00	0.00	0.00	0.00	0.00	0.00
5,000.00	0.00	0.00	5,000.00	0.00	0.00	0.00	0.00	0.00	0.00
5,100.00	0.00	0.00	5,100.00	0.00	0.00	0.00	0.00	0.00	0.00
5,200.00	0.00	0.00	5,200.00	0.00	0.00	0.00	0.00	0.00	0.00
5,300.00	0.00	0.00	5,300.00	0.00	0.00	0.00	0.00	0.00	0.00
3,300.00	0.00	0.00	5,550.00	0.00	0.00	0.00	0.00	0.00	0.00

Database: Company:

Project:

HOPSPP

ENGINEERING DESIGNS

PRD NM DIRECTIONAL PLANS (NAD 1983)

 Site:
 OXBOW CC 17-08 FED COM

 Well:
 Oxbow CC 17_8 Federal Com 42H

Wellbore: Wellbore #1

Design: Permitting Plan

Local Co-ordinate Reference:

TVD Reference: MD Reference: North Reference:

Survey Calculation Method:

Well Oxbow CC 17_8 Federal Com 42H

RKB=26.5' @ 2992.20ft

RKB=26.5' @ 2992.20ft

Design:	Permitting Pla	all							
Planned Survey									
Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
5,400.00	0.00	0.00	5,400.00	0.00	0.00	0.00	0.00	0.00	0.00
5,500.00	0.00	0.00	5,500.00	0.00	0.00	0.00	0.00	0.00	0.00
5,600.00	0.00	0.00	5,600.00	0.00	0.00	0.00	0.00	0.00	0.00
5,670.00	0.00	0.00	5,670.00	0.00	0.00	0.00	0.00	0.00	0.00
5,700.00	0.60	94.08	5,700.00	-0.01	0.16	0.00	2.00	2.00	0.00
5,800.00	2.60	94.08	5,799.96	-0.21	2.94	-0.03	2.00	2.00	0.00
5,900.00	4.60	94.08	5,899.75	-0.66	9.20	-0.09	2.00	2.00	0.00
6,000.00	6.60	94.08	5,999.27	-1.35	18.94	-0.19	2.00	2.00	0.00
6,100.00	8.60	94.08	6,098.39	-2.29	32.13	-0.33	2.00	2.00	0.00
6,170.15	10.00	94.08	6,167.61	-3.10	43.44	-0.44	2.00	2.00	0.00
6,200.00	10.00	94.08	6,197.01	-3.47	48.61	-0.49	0.00	0.00	0.00
6,300.00	10.00	94.08	6,295.49	-4.70	65.94	-0.67	0.00	0.00	0.00
6,400.00	10.00	94.08	6,393.97	-5.94	83.26	-0.84	0.00	0.00	0.00
6,500.00	10.00	94.08	6,492.45	-7.17	100.59	-1.02	0.00	0.00	0.00
6,600.00	10.00	94.08	6,590.93	-8.41	117.91	-1.20	0.00	0.00	0.00
6,700.00	10.00	94.08	6,689.41	-9.64	135.24	-1.37	0.00	0.00	0.00
6,800.00	10.00	94.08	6,787.89	-10.88	152.57	-1.55	0.00	0.00	0.00
6,900.00	10.00	94.08	6,886.37	-12.11	169.89	-1.72	0.00	0.00	0.00
7,000.00	10.00	94.08	6,984.85	-13.35	187.22	-1.90	0.00	0.00	0.00
7,100.00	10.00	94.08	7,083.33	-14.58	204.54	-2.08	0.00	0.00	0.00
7,200.00	10.00	94.08	7,181.81	-15.82	221.87	-2.25	0.00	0.00	0.00
7,300.00	10.00	94.08	7,280.29	-17.05	239.19	-2.43	0.00	0.00	0.00
7,400.00	10.00	94.08	7,378.77	-18.29	256.52	-2.60	0.00	0.00	0.00
7,500.00	10.00	94.08	7,477.25	-19.52	273.85	-2.78	0.00	0.00	0.00
7,600.00	10.00	94.08	7,575.73	-20.76	291.17	-2.95	0.00	0.00	0.00
7,700.00	10.00	94.08	7,674.21	-21.99	308.50	-3.13	0.00	0.00	0.00
7,800.00	10.00	94.08	7,772.69	-23.23	325.82	-3.31	0.00	0.00	0.00
7,900.00	10.00	94.08	7,871.17	-24.46	343.15	-3.48	0.00	0.00	0.00
8,000.00	10.00	94.08	7,969.65	-25.70	360.48	-3.66	0.00	0.00	0.00
8,100.00	10.00	94.08	8,068.13	-26.93	377.80	-3.83	0.00	0.00	0.00
8,200.00	10.00	94.08	8,166.61	-28.17	395.13	-4.01	0.00	0.00	0.00
8,300.00	10.00	94.08	8,265.09	-29.40	412.45	-4.19	0.00	0.00	0.00
8,400.00	10.00	94.08	8,363.57	-30.64	429.78	-4.36	0.00	0.00	0.00
8,500.00	10.00	94.08	8,462.05	-31.87	447.11	-4.54	0.00	0.00	0.00
8,600.00	10.00	94.08	8,560.53	-33.11	464.43	-4.71	0.00	0.00	0.00
8,700.00	10.00	94.08	8,659.01	-34.34	481.76	-4.89	0.00	0.00	0.00
8,800.00	10.00	94.08	8,757.49	-35.58	499.08	-5.06	0.00	0.00	0.00
8,900.00	10.00	94.08	8,855.97	-36.81	516.41	-5.24	0.00	0.00	0.00
9,000.00	10.00	94.08	8,954.45	-38.05	533.74	-5.42	0.00	0.00	0.00
9,100.00	10.00	94.08	9,052.93	-39.28	551.06	-5.59	0.00	0.00	0.00
9,200.00	10.00	94.08	9,151.41	-40.52	568.39	-5.77	0.00	0.00	0.00
9,300.00	10.00	94.08	9,249.89	-41.76	585.71	-5.94	0.00	0.00	0.00
9,400.00	10.00	94.08	9,348.37	-42.99	603.04	-6.12	0.00	0.00	0.00
9,500.00	10.00	94.08	9,446.85	-44.23	620.36	-6.30	0.00	0.00	0.00
9,600.00	10.00	94.08	9,545.33	-45.46	637.69	-6.47	0.00	0.00	0.00
9,700.00	10.00	94.08	9,643.81	-46.70	655.02	-6.65	0.00	0.00	0.00
9,800.00	10.00	94.08	9,742.29	-47.93	672.34	-6.82	0.00	0.00	0.00
9,809.53	10.00	94.08	9,751.67	-48.05	673.99	-6.84	0.00	0.00	0.00
9,900.00	8.77	85.92	9,840.93	-48.12	688.71	-6.01	2.00	-1.36	-9.01
10,000.00	7.68	74.17	9,939.91	-45.75	702.75	-2.79	2.00	-1.09	-11.76
10,100.00	7.00	59.39	10,039.10	-40.83	714.42	2.84	2.00	-0.68	-14.78
10,200.00	6.85	42.79	10,138.38	-33.35	723.72	10.87	2.00	-0.15	-16.60
10,300.00	7.27	26.82	10,237.63	-23.32	730.62	21.30	2.00	0.42	-15.97
10,400.00	8.17	13.47	10,336.73	-10.77	735.13	34.10	2.00	0.90	-13.35

Database: Company:

Project:

HOPSPP

ENGINEERING DESIGNS

PRD NM DIRECTIONAL PLANS (NAD 1983)

Site: OXBOW CC 17-08 FED COM
Well: Oxbow CC 17_8 Federal Com 42H

Wellbore: Wellbore #1

Design: Permitting Plan

Local Co-ordinate Reference:

TVD Reference: MD Reference: North Reference:

Survey Calculation Method:

Well Oxbow CC 17_8 Federal Com 42H

RKB=26.5' @ 2992.20ft RKB=26.5' @ 2992.20ft

Grid

Planned Survey									
Measured	clination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
10,500.00 10,541.57	9.41 10.00	3.17 359.69	10,435.56 10,476.54	4.31 11.31	737.24 737.41	49.28 56.28	2.00 2.00	1.24 1.42	-10.29 -8.39
10,600.00	15.84	359.69	10,533.46	24.37	737.34	69.31	10.00	10.00	0.00
10,700.00	25.84	359.69	10,626.80	59.91	737.14	104.77	10.00	10.00	0.00
10,800.00	35.84	359.69	10,712.55	111.11	736.87	155.86	10.00	10.00	0.00
10,900.00	45.84	359.69	10,788.10	176.42	736.51	221.03	10.00	10.00	0.00
11,000.00	55.84	359.69	10,851.17	253.87	736.09	298.30	10.00	10.00	0.00
11,100.00	65.84	359.69	10,899.82	341.08	735.62	385.33	10.00	10.00	0.00
11,200.00	75.84	359.69	10,932.60	435.42	735.10	479.46	10.00	10.00	0.00
11,300.00	85.84	359.69	10,948.49	534.02	734.57	577.84	10.00	10.00	0.00
11,341.57	90.00	359.69	10,950.00	575.56	734.34	619.29	10.00	10.00	0.00
11,400.00	90.00	359.69	10,950.00	633.99	734.02	677.59	0.00	0.00	0.00
11,500.00	90.00	359.69	10,950.00 10,950.00	733.98	733.48	777.37 877.14	0.00	0.00	0.00
11,600.00 11,700.00	90.00 90.00	359.69 359.69	10,950.00	833.98 933.98	732.93 732.39	877.14 976.92	0.00 0.00	0.00 0.00	0.00 0.00
11,800.00	90.00	359.69	10,950.00	1,033.98	731.85	1,076.70	0.00	0.00	0.00
11,900.00	90.00	359.69	10,950.00	1,133.98	731.30	1,176.48	0.00	0.00	0.00
12,000.00	90.00	359.69	10,950.00	1,233.98	730.76	1,276.26	0.00	0.00	0.00
12,100.00	90.00	359.69	10,950.00	1,333.97	730.21	1,376.04	0.00	0.00	0.00
12,200.00	90.00	359.69	10,950.00	1,433.97	729.67	1,475.82	0.00	0.00	0.00
12,300.00	90.00	359.69	10,950.00	1,533.97	729.13	1,575.60	0.00	0.00	0.00
12,400.00	90.00	359.69	10,950.00	1,633.97	728.58	1,675.38	0.00	0.00	0.00
12,500.00	90.00	359.69	10,950.00	1,733.97	728.04	1,775.16	0.00	0.00	0.00
12,600.00	90.00	359.69	10,950.00	1,833.97	727.49	1,874.93	0.00	0.00	0.00
12,700.00	90.00	359.69	10,950.00	1,933.97	726.95	1,974.71	0.00	0.00	0.00
12,800.00 12,900.00	90.00 90.00	359.69 359.69	10,950.00 10,950.00	2,033.96 2,133.96	726.41 725.86	2,074.49 2,174.27	0.00 0.00	0.00 0.00	0.00 0.00
13,000.00	90.00	359.69	10,950.00	2,233.96	725.32	2,274.05	0.00	0.00	0.00
13,100.00	90.00	359.69	10,950.00	2,333.96	724.77	2,373.83	0.00	0.00	0.00
13,200.00	90.00	359.69	10,950.00	2,433.96	724.23	2,473.61	0.00	0.00	0.00
13,300.00	90.00	359.69	10,950.00	2,533.96	723.69	2,573.39	0.00	0.00	0.00
13,400.00	90.00	359.69	10,950.00	2,633.96	723.14	2,673.17	0.00	0.00	0.00
13,500.00	90.00	359.69	10,950.00	2,733.95	722.60	2,772.95	0.00	0.00	0.00
13,600.00 13,700.00	90.00 90.00	359.69 359.69	10,950.00 10,950.00	2,833.95 2,933.95	722.06 721.51	2,872.73 2,972.50	0.00 0.00	0.00 0.00	0.00 0.00
13,800.00	90.00	359.69	10,950.00	3,033.95	721.31	3,072.28	0.00	0.00	0.00
13,900.00	90.00	359.69	10,950.00	3,133.95	720.42	3,172.06	0.00	0.00	0.00
14,000.00	90.00	359.69	10,950.00	3,233.95	719.88	3,271.84	0.00	0.00	0.00
14,100.00	90.00	359.69	10,950.00	3,333.95	719.34	3,371.62	0.00	0.00	0.00
14,200.00	90.00	359.69	10,950.00	3,433.94	718.79	3,471.40	0.00	0.00	0.00
14,300.00	90.00	359.69	10,950.00	3,533.94	718.25	3,571.18	0.00	0.00	0.00
14,400.00	90.00	359.69	10,950.00	3,633.94	717.70	3,670.96	0.00	0.00	0.00
14,500.00	90.00	359.69	10,950.00	3,733.94	717.16	3,770.74	0.00	0.00	0.00
14,600.00	90.00	359.69	10,950.00	3,833.94	716.62	3,870.52	0.00	0.00	0.00
14,700.00	90.00	359.69	10,950.00	3,933.94	716.07	3,970.30	0.00	0.00	0.00
14,800.00 14,900.00	90.00 90.00	359.69 359.69	10,950.00 10,950.00	4,033.93 4,133.93	715.53 714.98	4,070.07 4,169.85	0.00 0.00	0.00 0.00	0.00 0.00
15,000.00	90.00	359.69	10,950.00	4,233.93	714.44	4,269.63	0.00	0.00	0.00
15,000.00	90.00	359.69	10,950.00	4,233.93 4,333.93	714.44	4,269.63	0.00	0.00	0.00
15,200.00	90.00	359.69	10,950.00	4,433.93	713.35	4,469.19	0.00	0.00	0.00
15,300.00	90.00	359.69	10,950.00	4,533.93	712.81	4,568.97	0.00	0.00	0.00
15,400.00	90.00	359.69	10,950.00	4,633.93	712.26	4,668.75	0.00	0.00	0.00
15,500.00	90.00	359.69	10,950.00	4,733.92	711.72	4,768.53	0.00	0.00	0.00
15,600.00	90.00	359.69	10,950.00	4,833.92	711.18	4,868.31	0.00	0.00	0.00

Database: Company:

Project:

HOPSPP

ENGINEERING DESIGNS

PRD NM DIRECTIONAL PLANS (NAD 1983)

Site: OXBOW CC 17-08 FED COM
Well: Oxbow CC 17_8 Federal Com 42H

Wellbore: Wellbore #1

Design: Permitting Plan

Local Co-ordinate Reference:

TVD Reference:
MD Reference:
North Reference:

Survey Calculation Method:

Well Oxbow CC 17_8 Federal Com 42H

RKB=26.5' @ 2992.20ft RKB=26.5' @ 2992.20ft

Grid

Design.	remining Fig	411 							
Planned Survey									
Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
15,700.00	90.00	359.69	10,950.00	4,933.92	710.63	4,968.09	0.00	0.00	0.00
15,800.00	90.00	359.69	10,950.00	5,033.92	710.09	5,067.86	0.00	0.00	0.00
15,900.00	90.00	359.69	10,950.00	5,133.92	709.54	5,167.64	0.00	0.00	0.00
16,000.00	90.00	359.69	10,950.00	5,233.92	709.00	5,267.42	0.00	0.00	0.00
16,100.00	90.00	359.69	10,950.00	5,333.92	708.46	5,367.20	0.00	0.00	0.00
16,200.00	90.00	359.69	10,950.00	5,433.91	707.91	5,466.98	0.00	0.00	0.00
16,300.00	90.00	359.69	10,950.00	5,533.91	707.37	5,566.76	0.00	0.00	0.00
16,400.00	90.00	359.69	10,950.00	5,633.91	706.82	5,666.54	0.00	0.00	0.00
16,500.00	90.00	359.69	10,950.00	5,733.91	706.28	5,766.32	0.00	0.00	0.00
16,600.00	90.00	359.69	10,950.00	5,833.91	705.74	5,866.10	0.00	0.00	0.00
16,700.00	90.00	359.69	10,950.00	5,933.91	705.19	5,965.88	0.00	0.00	0.00
16,800.00	90.00	359.69	10,950.00	6,033.91	704.65	6,065.66	0.00	0.00	0.00
16,900.00	90.00	359.69	10,950.00	6,133.90	704.10	6,165.43	0.00	0.00	0.00
17,000.00	90.00	359.69	10,950.00	6,233.90	703.56	6,265.21	0.00	0.00	0.00
17,100.00	90.00	359.69	10,950.00	6,333.90	703.02	6,364.99	0.00	0.00	0.00
17,200.00	90.00	359.69	10,950.00	6,433.90	702.47	6,464.77	0.00	0.00	0.00
17,300.00	90.00	359.69	10,950.00	6,533.90	701.93	6,564.55	0.00	0.00	0.00
17,400.00	90.00	359.69	10,950.00	6,633.90	701.38	6,664.33	0.00	0.00	0.00
17,500.00	90.00	359.69	10,950.00	6,733.90	700.84	6,764.11	0.00	0.00	0.00
17,600.00	90.00	359.69	10,950.00	6,833.89	700.30	6,863.89	0.00	0.00	0.00
17,700.00	90.00	359.69	10,950.00	6,933.89	699.75	6,963.67	0.00	0.00	0.00
17,800.00	90.00	359.69	10,950.00	7,033.89	699.21	7,063.45	0.00	0.00	0.00
17,900.00	90.00	359.69	10,950.00	7,133.89	698.66	7,163.23	0.00	0.00	0.00
18,000.00	90.00	359.69	10,950.00	7,233.89	698.12	7,263.00	0.00	0.00	0.00
18,100.00	90.00	359.69	10,950.00	7,333.89	697.58	7,362.78	0.00	0.00	0.00
18,200.00	90.00	359.69	10,950.00	7,433.88	697.03	7,462.56	0.00	0.00	0.00
18,300.00	90.00	359.69	10,950.00	7,533.88	696.49	7,562.34	0.00	0.00	0.00
18,400.00	90.00	359.69	10,950.00	7,633.88	695.95	7,662.12	0.00	0.00	0.00
18,500.00	90.00	359.69	10,950.00	7,733.88	695.40	7,761.90	0.00	0.00	0.00
18,600.00	90.00	359.69	10,950.00	7,833.88	694.86	7,861.68	0.00	0.00	0.00
18,700.00	90.00	359.69	10,950.00	7,933.88	694.31	7,961.46	0.00	0.00	0.00
18,800.00	90.00	359.69	10,950.00	8,033.88	693.77	8,061.24	0.00	0.00	0.00
18,900.00	90.00	359.69	10,950.00	8,133.87	693.23	8,161.02	0.00	0.00	0.00
19,000.00	90.00	359.69	10,950.00	8,233.87	692.68	8,260.79	0.00	0.00	0.00
19,100.00	90.00	359.69	10,950.00	8,333.87	692.14	8,360.57	0.00	0.00	0.00
19,200.00	90.00	359.69	10,950.00	8,433.87	691.59	8,460.35	0.00	0.00	0.00
19,300.00	90.00	359.69	10,950.00	8,533.87	691.05	8,560.13	0.00	0.00	0.00
19,400.00	90.00	359.69	10,950.00	8,633.87	690.51	8,659.91	0.00	0.00	0.00
19,500.00	90.00	359.69	10,950.00	8,733.87	689.96	8,759.69	0.00	0.00	0.00
19,600.00	90.00	359.69	10,950.00	8,833.86	689.42	8,859.47	0.00	0.00	0.00
19,700.00	90.00	359.69	10,950.00	8,933.86	688.87	8,959.25	0.00	0.00	0.00
19,800.00	90.00	359.69	10,950.00	9,033.86	688.33	9,059.03	0.00	0.00	0.00
19,900.00	90.00	359.69	10,950.00	9,133.86	687.79	9,158.81	0.00	0.00	0.00
20,000.00	90.00	359.69	10,950.00	9,233.86	687.24	9,258.59	0.00	0.00	0.00
20,100.00	90.00	359.69	10,950.00	9,333.86	686.70	9,358.36	0.00	0.00	0.00
20,200.00	90.00	359.69	10,950.00	9,433.86	686.15	9,458.14	0.00	0.00	0.00
20,300.00	90.00	359.69	10,950.00	9,533.85	685.61	9,557.92	0.00	0.00	0.00
20,400.00	90.00	359.69	10,950.00	9,633.85	685.07	9,657.70	0.00	0.00	0.00
20,500.00	90.00	359.69	10,950.00	9,733.85	684.52	9,757.48	0.00	0.00	0.00
20,600.00	90.00	359.69	10,950.00	9,833.85	683.98	9,857.26	0.00	0.00	0.00
20,700.00	90.00	359.69	10,950.00	9,933.85	683.43	9,957.04	0.00	0.00	0.00
20,800.00	90.00	359.69	10,950.00	10,033.85	682.89	10,056.82	0.00	0.00	0.00
20,900.00	90.00	359.69	10,950.00	10,133.84	682.35	10,156.60	0.00	0.00	0.00
21,000.00	90.00	359.69	10,950.00	10,233.84	681.80	10,256.38	0.00	0.00	0.00

Database: HOPSPP

Company: ENGINEERING DESIGNS

Project: PRD NM DIRECTIONAL PLANS (NAD 1983)

Site: OXBOW CC 17-08 FED COM
Well: Oxbow CC 17_8 Federal Com 42H

Wellbore: Wellbore #1

Design: Permitting Plan

Local Co-ordinate Reference:

TVD Reference: MD Reference: North Reference:

Survey Calculation Method:

Well Oxbow CC 17_8 Federal Com 42H

RKB=26.5' @ 2992.20ft

RKB=26.5' @ 2992.20ft

Planned Survey									
Measured Depth (ft)	Inclination (°)	Azimuth (°)	Vertical Depth (ft)	+N/-S (ft)	+E/-W (ft)	Vertical Section (ft)	Dogleg Rate (°/100ft)	Build Rate (°/100ft)	Turn Rate (°/100ft)
21,100.00	90.00	359.69	10,950.00	10,333.84	681.26	10,356.16	0.00	0.00	0.00
21,200.00	90.00	359.69	10,950.00	10,433.84	680.71	10,455.93	0.00	0.00	0.00
21,300.00	90.00	359.69	10,950.00	10,533.84	680.17	10,555.71	0.00	0.00	0.00
21,400.00	90.00	359.69	10,950.00	10,633.84	679.63	10,655.49	0.00	0.00	0.00
21,500.00	90.00	359.69	10,950.00	10,733.84	679.08	10,755.27	0.00	0.00	0.00
21,600.00	90.00	359.69	10,950.00	10,833.83	678.54	10,855.05	0.00	0.00	0.00
21,700.00	90.00	359.69	10,950.00	10,933.83	677.99	10,954.83	0.00	0.00	0.00
21,800.00	90.00	359.69	10,950.00	11,033.83	677.45	11,054.61	0.00	0.00	0.00
21,845.09	90.00	359.69	10,950.00	11,078.92	677.21	11,099.60	0.00	0.00	0.00

Design Targets									
Target Name - hit/miss target - Shape	Dip Angle (°)	Dip Dir. (°)	TVD (ft)	+N/-S (ft)	+E/-W (ft)	Northing (usft)	Easting (usft)	Latitude	Longitude
FTP (Oxbow CC 17_8 - plan hits target cer - Point	0.00 nter	0.00	10,950.00	575.56	734.34	440,504.02	641,458.65	32° 12' 38.188617 N	104° 0' 34.588915
PBHL (Oxbow CC - plan hits target cer - Point	0.00 nter	0.00	10,950.00	11,078.92	677.21	451,006.53	641,401.52	32° 14' 22.122161 N	104° 0' 34.885672

Plan Annotations					
Meas	ured	Vertical	Local Coor	dinates	
Der (fi		Depth (ft)	+N/-S (ft)	+E/-W (ft)	Comment
5,6	70.00	5,670.00	0.00	0.00	Build 2.00°/100'
6,1	70.15	6,167.61	-3.10	43.44	Hold 10.00° Tangent
9,8	809.53	9,751.67	-48.05	673.99	Turn 2.00°/100'
10,5	41.57	10,476.54	11.31	737.41	KOP, Build 10.00°/100'
11,3	341.57	10,950.00	575.56	734.34	Landing Point
21,8	45.09	10,950.00	11,078.92	677.21	TD at 21845.09' MD



Well: Oxbow CC 17_8 Federal Com 42H Wellbore: Wellbore #1

Design: Permitting Plan


PROJECT DETAILS: NM DIRECTIONAL PLANS (NAD 1983)

Geodetic System: US State Plane 1983 Datum: North American Datum 1983

Ellipsoid: GRS 1980

Zone: New Mexico Eastern Zone

System Datum: Mean Sea Level

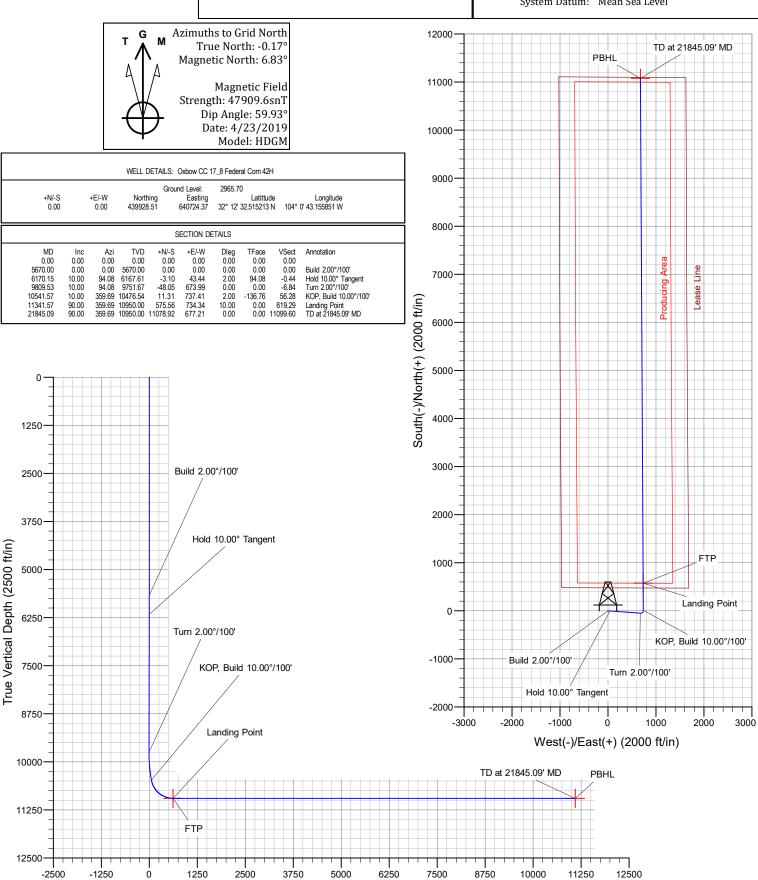

Vertical Section at 3.50° (2500 ft/in)

1. Geologic Formations

TVD of target	10950'	Pilot Hole Depth	N/A
MD at TD:	21845'	Deepest Expected fresh water:	309'

Delaware Basin

Formation	TVD - RKB	Expected Fluids
Rustler	309	
Salado	625	Salt
Castile	1,266	Salt
Lamar/Delaware	2,818	Oil/Gas/Brine
Bell Canyon	2,870	Oil/Gas/Brine
Cherry Canyon	3,750	Oil/Gas/Brine
Brushy Canyon	4,995	Losses
Bone Spring	6,610	Oil/Gas
1st Bone Spring	7,550	Oil/Gas
2nd Bone Spring	8,376	Oil/Gas
3rd Bone Spring	9,474	Oil/Gas
Wolfcamp	9,824	Oil/Gas

^{*}H2S, water flows, loss of circulation, abnormal pressures, etc.

2. Casing Program

Hala Cina (in)	Casing Interval		Csg. Size	Weight	ight Crods	Conn.	SF CE Daniel		Body SF	Joint SF
Hole Size (in)	From (ft)	To (ft)	(in)	(in) (lbs)	Grade	Cullii	Collapse	SF Burst	Tension	Tension
14.75	0	565	10.75	40.5	J-55	BTC	1.125	1.2	1.4	1.4
9.875	0	10441	7.625	26.4	L-80 HC	BTC	1.125	1.2	1.4	1.4
6.75	0	21845	5.5	20	P-110	DQX	1.125	1.2	1.4	1.4
							SF Values will meet or Exceed			

All casing strings will be tested in accordance with Onshore Oil and Gas Order #2 III.B.1.h

*Oxy requests the option to set casing shallower yet still below the salts if losses or hole conditions require this. Cement volumes may be adjusted if casing is set shallower and a DV tool may be run in case hole conditions merit pumping a second stage cement job to comply with permitted top of cement. If cement circulated to surface during first stage, we will drop a cancelation cone and not pump the second stage.

*Oxy requests the option to run production casing with DQX, SF TORQ, and/or DQW TORQ connections to accommodate hole conditions or drilling operations.

Annular Clearance Variance Request

As per the agreement reached in the Oxy/BLM meeting on Feb 22, 2018, Oxy requests permission to allow deviation from the 0.422" annular clearance requirement from Onshore Order #2 under the following conditions:

- 1. Annular clearance to meet or exceed 0.422" between intermediate casing ID and production casing coupling only on the first 500' overlap between both casings.
- 2. Annular clearance less than 0.422" is acceptable for the curve and lateral portions of the production open hole section.

	Y or N
Is casing new? If used, attach certification as required in Onshore Order #1	Y
Does casing meet API specifications? If no, attach casing specification sheet.	Y
Is premium or uncommon casing planned? If yes attach casing specification sheet.	Y
Does the above casing design meet or exceed BLM's minimum standards? If not provide justification (loading assumptions, casing design criteria).	Y
Will the intermediate pipe be kept at a minimum 1/3 fluid filled to avoid approaching the collapse pressure rating of the casing?	Y
Is well located within Capitan Reef?	N
If yes, does production casing cement tie back a minimum of 50' above the Reef?	11
Is well within the designated 4 string boundary.	
Is well located in SOPA but not in R-111-P?	N
If yes, are the first 2 strings cemented to surface and 3 rd string cement tied back 500' into previous casing?	
Is well located in R-111-P and SOPA?	N
If yes, are the first three strings cemented to surface?	
Is 2 nd string set 100' to 600' below the base of salt?	
Is well located in high Cave/Karst?	N
If yes, are there two strings cemented to surface?	
(For 2 string wells) If yes, is there a contingency casing if lost circulation occurs?	
Is well located in critical Cave/Karst?	N
If yes, are there three strings cemented to surface?	

Class H Cement, Retarder, Dispersant, Salt

3:39

OXY USA Inc. - Oxbow CC 17-8 Federal Com 42H – Drill Plan

3. Cementing Program

Production (Tail)

873

13.2

Casing String	# Sks	Wt.	Yld	H20	500# Comp. Strength	Slurry Description	
		(lb/gal)	(ft3/sack)	(gal/sk)	(hours)		
Surface (Lead)	N/A	N/A	N/A	N/A	N/A	N/A	
Surface (Tail)	459	14.8	1.33	6.365	5:26	Class C Cement, Accelerator	
Intermediate 1st Stage (Lead)	667	10.2	2.58	11.568	6:59	Pozzolan Cement, Retarder	
Intermediate 1st Stage (Tail)	167	13.2	1.61	7.804	7:11	Class H Cement, Retarder, Dispersant, Sal	
DV/ECP Tool @ 2868 (We request the option to cancel the second stage if cement is circulated to surface during the first stage of cemen operations)				urface during the first stage of cement			
Intermediate 2nd Stage (Lead)	N/A	N/A	N/A	N/A	N/A	N/A	
Intermediate 2nd Stage (Tail)	672	13.6	1.67	8.765	7:32	Class C Cement, Accelerator, Retarder	
Production (Lead)	N/A	N/A	N/A	N/A	N/A	N/A	

1.38

6.686

Casing String	Top (ft)	Bottom (ft)	% Excess
Surface (Lead)	N/A	N/A	N/A
Surface (Tail)	0	565	100%
Intermediate 1st Stage (Lead)	2768	9441	20%
Intermediate 1st Stage (Tail)	9441	10441	20%
Intermediate 2nd Stage (Lead)	N/A	N/A	N/A
Intermediate 2nd Stage (Tail)	0	2868	100%
Production (Lead)	N/A	N/A	N/A
Production (Tail)	9941	21845	20%

^{*}OXY respectfully requests a variance to cement the 9-5/8" and/or 7-5/8" intermediate casing strings offline, see attached for additional information.

4. Pressure Control Equipment

BOP installed and tested before drilling which hole?	Size?	Min. Required WP	Туре		4	Tested to:						
		5M	Annula	ar	→	70% of working pressure						
9.875" Hole	13-5/8"		Blind R	am	✓							
9.8/3 Hole	13-3/8	13-3/8	5M	Pipe Ra	ım		250 psi / 5000 psi					
		JIVI	Double F	Ram	✓	230 psi / 3000 psi						
			Other*									
		5M	Annula	ar	✓	70% of working pressure						
6.75" Hole 13-5/8"	13-5/8"	13-5/8"		12.5/0"	(ala 12.5/9"	i	I		Blind R	am	✓	
				10M	Pipe Ra	ım		250 psi / 10000 psi				
	TOM	Double F	Ram	✓	250 psi / 10000 psi							
			Other*									

^{*}Specify if additional ram is utilized.

Per BLM's Memorandum No. NM-2017-008: *Decision and Rationale for a Variance Allowing the Use of a 5M Annular Preventer with a 10M BOP Stack*, Oxy requests to employ a 5M annular with a 10M BOPE stack in the pilot and lateral sections of the well and will ensure that two barriers to flow are maintained at all times. Please see attached Well Control Plan.

Oxy will utilize a 5M annular with a 10M BOPE stack. The BOP/BOPE will be tested by an independent service company to 250 psi low and the high pressure indicated above per Onshore Order 2 requirements. The System may be upgraded to a higher pressure but still tested to the working pressure listed in the table above. If the system is upgraded all the components installed will be functional and tested.

Pipe rams will be operationally checked each 24 hour period. Blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets. Other accessories to the BOP equipment will include a Kelly cock and floor safety valve (inside BOP) and choke lines and choke manifold. See attached schematics.

Formation integrity test will be performed per Onshore Order #2.

On Exploratory wells or on that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Will be tested in accordance with Onshore Oil and Gas Order #2 III.B.1.i.

A variance is requested for the use of a flexible choke line from the BOP to Choke Manifold. See attached for specs and hydrostatic test chart.

Y Are anchors required by manufacturer?

A multibowl or a unionized multibowl wellhead system will be employed. The wellhead and connection to the BOPE will meet all API 6A requirements. The BOP will be tested per Onshore Order #2 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system must be tested. We will test the flange connection of the wellhead with a test port that is directly in the flange. We are proposing that we will run the wellhead through the rotary prior to cementing surface casing as discussed with the BLM on October 8, 2015. See attached schematics.

BOP Break Testing Request

As per the agreement reached in the Oxy/BLM meeting on Feb 22, 2018, Oxy requests permission to allow BOP Break Testing under the following conditions:

- After a full BOP test is conducted on the first well on the pad.
- When skidding to drill an intermediate section that the casing point is either shallower than the 3rd Bone Spring or 10000' TVD.
- Full BOP test will be required prior to drilling any production hole.

5. Mud Program

Depth		Tymo	Weight (nng)	V 7: ~ ~ ~ ~ : 4	Water I age
From (ft)	To (ft)	Туре	Weight (ppg)	Viscosity	Water Loss
0	565	Water-Based Mud	8.6-8.8	40-60	N/C
565	10441	Saturated Brine-Based or Oil-Based Mud	8.0-10.0	35-45	N/C
10441	21845	Water-Based or Oil- Based Mud	9.5-13.0	38-50	N/C

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept on location at all times. The following is a general list of products: Barite, Bentonite, Gypsum, Lime, Soda Ash, Caustic Soda, Nut Plug, Cedar Fiber, Cotton Seed Hulls, Drilling Paper, Salt Water Clay, CACL2. Oxy will use a closed mud system.

What will be used to monitor the loss or gain	PVT/MD Totco/Visual Monitoring
of fluid?	

6. Logging and Testing Procedures

Logg	ing, Coring and Testing.
Yes	Will run GR from TD to surface (horizontal well – vertical portion of hole). Stated logs
	run will be in the Completion Report and submitted to the BLM.
No	Logs are planned based on well control or offset log information.
No	Drill stem test? If yes, explain
No	Coring? If yes, explain

Addi	tional logs planned	Interval
No	Resistivity	
No	Density	
No	CBL	
Yes	Mud log	ICP - TD
No	PEX	

7. Drilling Conditions

Condition	Specify what type and where?
BH Pressure at deepest TVD	7403 psi
Abnormal Temperature	No
BH Temperature at deepest TVD	168°F

Pump high viscosity sweeps as needed for hole cleaning. The mud system will be monitored visually/manually as well as with an electronic PVT. The necessary mud products for additional weight and fluid loss control will be on location at all times. Appropriately weighted mud will be used to isolate potential gas, oil, and water zones until such time as casing can be cemented into place for zonal isolation.

Hydrogen Sulfide (H2S) monitors will be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the operator will comply with the provisions of Onshore Oil and Gas Order #6. If Hydrogen Sulfide is encountered, measured values and formations will be provided to the BLM.

N	H2S is present
Y	H2S Plan attached

8. Other facets of operation

	Yes/No
Will the well be drilled with a walking/skidding operation? If yes, describe.	Yes
• We plan to drill the ten well pad in batch by section: all surface sections,	
intermediate sections and production sections. The wellhead will be	
secured with a night cap whenever the rig is not over the well.	
Will more than one drilling rig be used for drilling operations? If yes, describe.	Yes
Oxy requests the option to contract a Surface Rig to drill, set surface	
casing, and cement for this well. If the timing between rigs is such that	
Oxy would not be able to preset surface, the Primary Rig will MIRU and	
drill the well in its entirety per the APD. Please see the attached document	
for information on the spudder rig.	

Total estimated cuttings volume: 1559.7 bbls.

9. Company Personnel

<u>Name</u>	<u>Title</u>	Office Phone	Mobile Phone
Garrett Granier	Drilling Engineer	713-513-6633	832-265-0581
William Turner	Drilling Engineer Supervisor	713-350-4951	661-817-4586
Simon Benavides	Drilling Superintendent	713-522-8652	281-684-6897
Diego Te l lez	Drilling Manager	713-350-4602	713-303-4932

District I 1625 N. French Dr., Hobbs, NM 88240 District II 811 S. First St., Artesia, NM 88210 District III 1000 Rio Brazos Road, Aztec, NM 87410 District IV 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico Energy, Minerals and Natural Resources Department

Submit Original to Appropriate District Office

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

GAS CAPTURE PLAN

Date: <u>6-10-2019</u>	
⊠ Original	Operator & OGRID No.: OXY USA INC 16696
☐ Amended - Reason for Amendment:	

This Gas Capture Plan outlines actions to be taken by the Operator to reduce well/production facility flaring/venting for new completion (new drill, recomplete to new zone, re-frac) activity.

Note: Form C-129 must be submitted and approved prior to exceeding 60 days allowed by Rule (Subsection A of 19.15.18.12 NMAC).

Well(s)/Production Facility – Name of facility

The well(s) that will be located at the production facility are shown in the table below.

Well Name	API	Well Location (ULSTR)	Footages	Expected MCF/D	Flared or Vented	Comments
Oxbow CC 17-8 Fd Com 1H	Pending	D-20-24S-29E	538 FNL 880 FWL	3,100	0	
Oxbow CC 17-8 Fd Com 11H	Pending	D-20-24S-29E	579 FNL 823 FWL	3,900	0	
Oxbow CC 17-8 Fd Com 12H	Pending	D-20-24S-29E	438 FNL 1024 FWL	3,900	0	
Oxbow CC 17-8 Fd Com 41H	Pending	D-20-24S-29E	498 FNL 938 FWL	7,100	0	
Oxbow CC 17-8 Fd Com 42H	Pending	D-20-24S-29E	478 FNL 966 FWL	7,100	0	
Salt Flat CC 20-29 Fd Com 1H	Pending	D-20-24S-29E	558 FNL 851 FWL	3,100	0	
Salt Flat CC 20-29 Fd Com 11H	Pending	D-20-24S-29E	599 FNL 794 FWL	3,900	0	
Salt Flat CC 20-29 Fd Com 12H	Pending	D-20-24S-29E	418 FNL 1052 FWL	3,900	0	
Salt Flat CC 20-29 Fd Com 41H	Pending	D-20-24S-29E	518 FNL 909 FWL	7,100	0	
Salt Flat CC 20-29 Fd Com 42H	Pending	D-20-24S-29E	458 FNL 995 FWL	7,100	0	

Gathering System and Pipeline Notification

Well(s) will be connected to a production facility after flowback operations are complete, where a gas transporter system is in place. The gas produced from production facility is dedicated to Enterprise Field Services, LLC ("Enterprise") and is connected to Enterprise low/high pressure gathering system located in Eddy County, New Mexico. OXY USA INC. ("OXY") provides (periodically) to Enterprise a drilling, completion and estimated first production date for wells that are scheduled to be drilled in the foreseeable future. In addition, OXY and Enterprise have periodic conference calls to discuss changes to drilling and completion schedules. Gas from these wells will be processed at OXY USA WTP LP Processing Plant located in Sec. 23, Twn. 21S, Rng. 23E, Eddy County, New Mexico. The actual flow of the gas will be based on compression operating parameters and gathering system pressures.

Flowback Strategy

After the fracture treatment/completion operations, well(s) will be produced to temporary production tanks and gas will be flared or vented. During flowback, the fluids and sand content will be monitored. When the produced fluids contain minimal sand, the wells will be turned to production facilities. Gas sales should start as soon as the wells start flowing through the production facilities, unless there are operational issues on Enterprise system at that time. Based on current information, it is OXY's belief the system can take this gas upon completion of the well(s).

Safety requirements during cleanout operations from the use of underbalanced air cleanout systems may necessitate that sand and non-pipeline quality gas be vented and/or flared rather than sold on a temporary basis.

Alternatives to Reduce Flaring

Below are alternatives considered from a conceptual standpoint to reduce the amount of gas flared.

- Power Generation On lease
 - Only a portion of gas is consumed operating the generator, remainder of gas will be flared
- Compressed Natural Gas On lease
 - Gas flared would be minimal, but might be uneconomical to operate when gas volume declines
- NGL Removal On lease
- Plants are expensive, residue gas is still flared, and uneconomical to operate when gas volume declines Released to Imaging: 4/23/2021 1:54:55 PM



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT SUPO Data Repoi

APD ID: 10400042976

Submission Date: 06/20/2019

Highlighted data reflects the most

recent changes

Operator Name: OXY USA INCORPORATED

Well Number: 42H

Show Final Text

Well Name: OXBOW CC 17-8 FEDERAL COM

Well Type: OIL WELL Well Work Type: Drill

Section 1 - Existing Roads

Will existing roads be used? YES

Existing Road Map:

OxbowCC17_8FdCom42H_ExistRoads_20190619162816.pdf

Existing Road Purpose: FLUID TRANSPORT Row(s) Exist? NO

ROW ID(s)

ID:

Do the existing roads need to be improved? NO

Existing Road Improvement Description:

Existing Road Improvement Attachment:

Section 2 - New or Reconstructed Access Roads

Will new roads be needed? YES

New Road Map:

OxbowCC17_8FdCom42H_NewRoad_20190619162832.pdf

New road type: LOCAL

Length: 4060.8

Feet

Width (ft.): 25

Max slope (%): 0

Max grade (%): 0

Army Corp of Engineers (ACOE) permit required? NO

ACOE Permit Number(s):

New road travel width: 14

New road access erosion control: Watershed Diversion every 200' if needed.

New road access plan or profile prepared? YES

New road access plan attachment:

OxbowCC17_8FdCom42H_NewRoad_20190619162848.pdf

Access road engineering design? NO

Well Name: OXBOW CC 17-8 FEDERAL COM Well Number: 42H

Access road engineering design attachment:

Turnout? N

Access surfacing type: OTHER

Access topsoil source: ONSITE

Access surfacing type description: Caliche

Access onsite topsoil source depth: 0

Offsite topsoil source description:

Onsite topsoil removal process: If available

Access other construction information: None

Access miscellaneous information: The access road will run from an existing road and will go 887.4' northwest, 549.2' west, 438.8' south, 340.8' southeast, 416.2' south, then 1301.4' west, then 127' south to the northeast corner of the pad.

Number of access turnouts: Access turnout map:

Drainage Control

New road drainage crossing: CULVERT

Drainage Control comments: Watershed Diversion every 200' if needed.

Road Drainage Control Structures (DCS) description: Watershed Diversion every 200' if needed.

Road Drainage Control Structures (DCS) attachment:

Access Additional Attachments

Section 3 - Location of Existing Wells

Existing Wells Map? YES

Attach Well map:

OxbowCC17_8FdCom42H_ExistWells_20190619162909.pdf

Section 4 - Location of Existing and/or Proposed Production Facilities

Submit or defer a Proposed Production Facilities plan? SUBMIT

Production Facilities description: a. In the event the well is found productive, the Salt Flat CC 20 Federal Central Tank Battery would be utilized and the necessary production equipment will be installed at the well site. See proposed facilities layout diagram. b. All flow lines will adhere to API standards. They will consist of 3 – 4" composite production flowlines operating 75% MAWP, surface lines to follow surveyed route. Survey of a strip of land 30' wide and 2222' in length crossing in Section 20 T24S R29E, NMPM, Eddy County, NM and being 15' left and 15' right of the centerline survey, see attached. c. Electric line will follow a route approved by the BLM. Survey of a strip of land 30' wide and 990.2' in length crossing in Section 20 T24S R29E NMPM, Eddy County, NM and being 15' left and 15' right of the centerline survey, see attached. **Production Facilities map:**

Well Name: OXBOW CC 17-8 FEDERAL COM Well Number: 42H

OxbowCC17_8FdCom42H_FacilityPLEL_20190619162923.pdf

Section 5 - Location and Types of Water Supply

Water Source Table

Water source type: GW WELL

Water source use type: SURFACE CASING

INTERMEDIATE/PRODUCTION

CASING

OTHER Describe use type: Drilling

Source latitude: Source longitude:

Source datum:

Water source permit type: WATER WELL

Water source transport method: PIPELINE

TRUCKING

Source land ownership: COMMERCIAL

Source transportation land ownership: COMMERCIAL

Water source volume (barrels): 2000 Source volume (acre-feet): 0.25778618

Source volume (gal): 84000

Water source and transportation map:

OxbowCC17_8FdCom42H_GRRWtrSrc_20190619162940.pdf OxbowCC17_8FdCom42H_MesqWtrSrc_20190619162953.pdf

Water source comments: This well will be drilled using a combination of water mud systems. It will be obtained from commercial water stations (Gregory Rockhouse, Mesquite) in the area and will be hauled to location by transport truck using existing and proposed roads.

New water well? NO

New Water Well Info

Well latitude: Well Longitude: Well datum:

Well target aquifer:

Est. depth to top of aquifer(ft): Est thickness of aquifer:

Aquifer comments:

Aquifer documentation:

Well depth (ft): Well casing type:

Well Name: OXBOW CC 17-8 FEDERAL COM Well Number: 42H

Well casing outside diameter (in.): Well casing inside diameter (in.):

New water well casing?

Used casing source:

Drilling method: Drill material:

Grout material: Grout depth:

Casing length (ft.): Casing top depth (ft.):

Well Production type: Completion Method:

Water well additional information:

State appropriation permit:

Additional information attachment:

Section 6 - Construction Materials

Using any construction materials: YES

Construction Materials description: Primary - All caliche utilized for the drilling pad and proposed access road will be obtained from an existing BLM/State/Fee approved pit or from prevailing deposits found on the location. Will use BLM recommended extra caliche from other locations close by for roads, if available. Secondary - The secondary way of obtaining caliche to build locations and roads will be by "turning over" the location. This means, caliche will be obtained from the actual well site. A caliche permit will be obtained from BLM prior to pushing up any caliche. 2400 cubic yards is max amount of caliche needed for pad and roads. Amount will vary for each pad. The procedure below has been approved by BLM personnel: a. The top 6" of topsoil is pushed off and stockpiled along the side of the location. b. An approximate 120' X 120' area is used within the proposed well site to remove caliche. c. Subsoil is removed and piled alongside the 120' X 120' within the pad site. d. When caliche is found, material will be stockpiled within the pad site to build the location and road. e. Then subsoil is pushed back in the hole and caliche is spread accordingly across entire location and road. f. Once the well is drilled the stockpiled top soil will be used for interim reclamation and spread along areas where caliche is picked up and the location size is reduced. Neither caliche nor subsoil will be stockpiled outside of the well pad. Topsoil will be stockpiled along the edge of the pad. Caliche will be provided from a pit located in Section 6, 20, 22 T24S R29E. Water will be provided from a frac pond located in Sections 15, 21, 22 T24S R29E.

Construction Materials source location attachment:

Section 7 - Methods for Handling Waste

Waste type: DRILLING

Waste content description: Water-Based Cuttings, Water-Based Mud, Oil-Based Cuttings, Oil-Based Mud, Produced Water

Amount of waste: 1559.7 barrels

Waste disposal frequency: Daily

Safe containment description: Haul-Off Bins

Safe containment attachment:

Waste disposal type: HAUL TO COMMERCIAL Disposal location ownership: COMMERCIAL

FACILITY

Disposal type description:

Disposal location description: An approved facility that can process drill cuttings, drill fluids, flowback water, produced water, contaminated soils, and other non-hazardous wastes.

Well Name: OXBOW CC 17-8 FEDERAL COM

Well Number: 42H

Reserve Pit

Reserve Pit being used? NO

Temporary disposal of produced water into reserve pit?

Reserve pit length (ft.)

Reserve pit width (ft.)

Reserve pit depth (ft.)

Reserve pit volume (cu. yd.)

Is at least 50% of the reserve pit in cut?

Reserve pit liner

Reserve pit liner specifications and installation description

Cuttings Area

Cuttings Area being used? NO

Are you storing cuttings on location? YES

Description of cuttings location A closed loop system will be utilized consisting of above ground steel tanks and haul-off bins. Disposal of liquids, drilling fluids and cuttings will be disposed of at an approved facility.

Cuttings area length (ft.)

Cuttings area width (ft.)

Cuttings area depth (ft.)

Cuttings area volume (cu. yd.)

Is at least 50% of the cuttings area in cut?

WCuttings area liner

Cuttings area liner specifications and installation description

Section 8 - Ancillary Facilities

Are you requesting any Ancillary Facilities?: NO

Ancillary Facilities attachment:

Comments:

Section 9 - Well Site Layout

Well Site Layout Diagram:

OxbowCC17_8FdCom42H_WellSiteCL_20190619163035.pdf

Comments: V-Door-Southwest - CL Tanks-Southeast - 280' X 775' - 10 Well Pad

Well Number: 42H Well Name: OXBOW CC 17-8 FEDERAL COM

Section 10 - Plans for Surface Reclamation

Multiple Well Pad Name: SALT FLAT CC 20-29 FEDERAL COM Type of disturbance: New Surface Disturbance

Multiple Well Pad Number: 1H

Recontouring attachment:

Drainage/Erosion control construction: Reclamation to be wind rowed as needed to control erosion

Drainage/Erosion control reclamation: Reclamation to be wind rowed as needed to control erosion

Well pad proposed disturbance

(acres): 4.98

Road proposed disturbance (acres):

Powerline proposed disturbance

(acres): 0.68

Pipeline proposed disturbance

(acres): 1.53

Other proposed disturbance (acres): 0

Total proposed disturbance: 9.99

Well pad interim reclamation (acres): Well pad long term disturbance

(acres): 3.51

Road interim reclamation (acres): 1.49 Road long term disturbance (acres):

Powerline interim reclamation (acres): Powerline long term disturbance

(acres): 0

Pipeline interim reclamation (acres): Pipeline long term disturbance

Other interim reclamation (acres): 0.33 (acres): 0.51 Other long term disturbance (acres): 0

Total interim reclamation: 4.99 Total long term disturbance: 5.33

Disturbance Comments: See Below

Reconstruction method: If the well is deemed commercially productive, caliche from the areas of the pad site not required for operations will be reclaimed. The original topsoil will be returned to the area of the drill pad not necessary to operate the well. These unused areas of the drill pad will be contoured, as close as possible, to match the original topography, and the area will be seeded with an approved BLM mixture to re-establish vegetation. After concluding the drilling and/or completion operations, if the well is found non-commercial, the caliche will be removed from the pad and transported to the original caliche pit or used for other drilling locations. The road will be reclaimed as directed by the BLM. The original topsoil will again be returned to the pad and contoured, as close as possible, to the original topography, and the area will be seeded with an approved BLM mixture to re-establish vegetation.

Topsoil redistribution: The original topsoil will be returned to the area of the drill pad not necessary to operate the well.

Soil treatment: To be determined by the BLM.

Existing Vegetation at the well pad: To be determined by the BLM at Onsite.

Existing Vegetation at the well pad attachment:

Existing Vegetation Community at the road: To be determined by the BLM at Onsite.

Existing Vegetation Community at the road attachment:

Existing Vegetation Community at the pipeline: To be determined by the BLM at Onsite.

Existing Vegetation Community at the pipeline attachment:

Existing Vegetation Community at other disturbances: To be determined by the BLM at Onsite.

Existing Vegetation Community at other disturbances attachment:

Well Name: OXBOW CC 17-8 FEDERAL COM Well Number: 42H

Non native seed used? NO

Non native seed description:

Seedling transplant description:

Will seedlings be transplanted for this project? NO

Seedling transplant description attachment:

Will seed be harvested for use in site reclamation? NO

Seed harvest description:

Seed harvest description attachment:

Seed Management

Seed Table

Seed Summary

Pounds/Acre

Total pounds/Acre:

Seed Type

Seed reclamation attachment:

Operator Contact/Responsible Official Contact Info

First Name: Jim Last Name: Wilson

Phone: (575)631-2442 Email: jim_wilson@oxy.com

Seedbed prep:

Seed BMP:

Seed method:

Existing invasive species? NO

Existing invasive species treatment description:

Existing invasive species treatment attachment:

Weed treatment plan description: To be determined by the BLM.

Weed treatment plan attachment:

Monitoring plan description: To be determined by the BLM.

Monitoring plan attachment:

Success standards: To be determined by the BLM.

Well Name: OXBOW CC 17-8 FEDERAL COM Well Number: 42H

Pit closure description: NA

Pit closure attachment:

	Section 11 - Surface Ownership
Di	sturbance type: PIPELINE
De	escribe:
Sı	urface Owner: BUREAU OF LAND MANAGEMENT,OTHER
O	ther surface owner description: OXY USA Inc.
ВІ	A Local Office:
В	OR Local Office:
C	OE Local Office:
D	OD Local Office:
NI	PS Local Office:
St	ate Local Office:
M	ilitary Local Office:
U	SFWS Local Office:
O	ther Local Office:
U	SFS Region:
U	SFS Forest/Grassland: USFS Ranger District:

Disturbance type: WELL PAD

Describe:

Surface Owner: OTHER

Other surface owner description: OXY USA Inc.

BIA Local Office:

BOR Local Office:

COE Local Office:

DOD Local Office:

NPS Local Office:

State Local Office:

Military Local Office:

Operator Name: OXY USA INCORPORATED		
Well Name: OXBOW CC 17-8 FEDERAL COM	Well Number: 42H	
USFWS Local Office:		
Other Local Office:		
USFS Region:		
USFS Forest/Grassland:	USFS Ranger District:	
Disturbance type: OTHER		
Describe: Electric Line		
Surface Owner: BUREAU OF LAND MANAGEMENT,OT	THER	
Other surface owner description: OXY USA Inc.		
BIA Local Office:		
BOR Local Office:		
COE Local Office:		
DOD Local Office:		
NPS Local Office:		
State Local Office:		
Military Local Office:		
USFWS Local Office:		
Other Local Office:		
USFS Region: USFS Forest/Grassland:	USFS Ranger District:	
ooi o i oicarorassiana.	oor o Ranger District.	
Disturbance type: NEW ACCESS ROAD		
Describe:		
Surface Owner: OTHER		
Other surface owner description: OXY USA Inc.		
BIA Local Office:		

BOR Local Office:
COE Local Office:

DOD Local Office:

Well Name: OXBOW CC 17-8 FEDERAL COM

Well Number: 42H

NPS Local Office:

State Local Office:

Military Local Office:

USFWS Local Office:

Other Local Office:

USFS Region:

USFS Forest/Grassland:

USFS Ranger District:

Section 12 - Other Information

Right of Way needed? NO

Use APD as ROW?

ROW Type(s):


ROW Applications


SUPO Additional Information: Permian Basin MOA - To be submitted after APD acceptance. GIS Shapefiles available for BLM download from shared FTP site after APD submittal. Use a previously conducted onsite? NO

Previous Onsite information:

Other SUPO Attachment

OxbowCC17_8FdCom42H_GasCapPlan_20190619163139.pdf OxbowCC17_8FdCom42H_MiscSvyPlats_20190619163152.pdf OxbowCC17_8FdCom42H_StakeForm_20190619163205.pdf OxbowCC17_8FdCom42H_SUPO_20190619163217.pdf

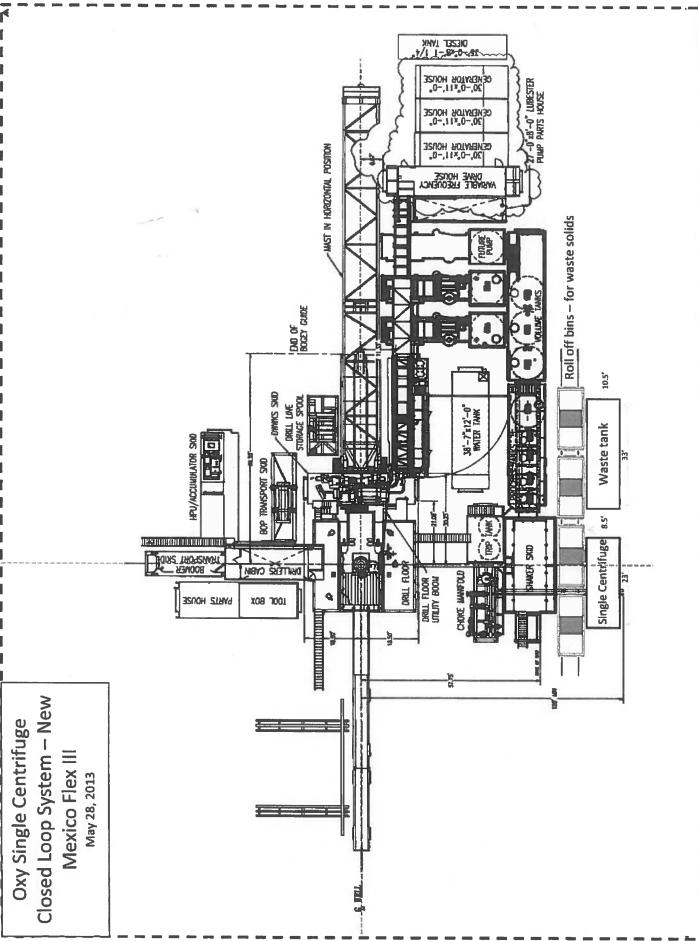

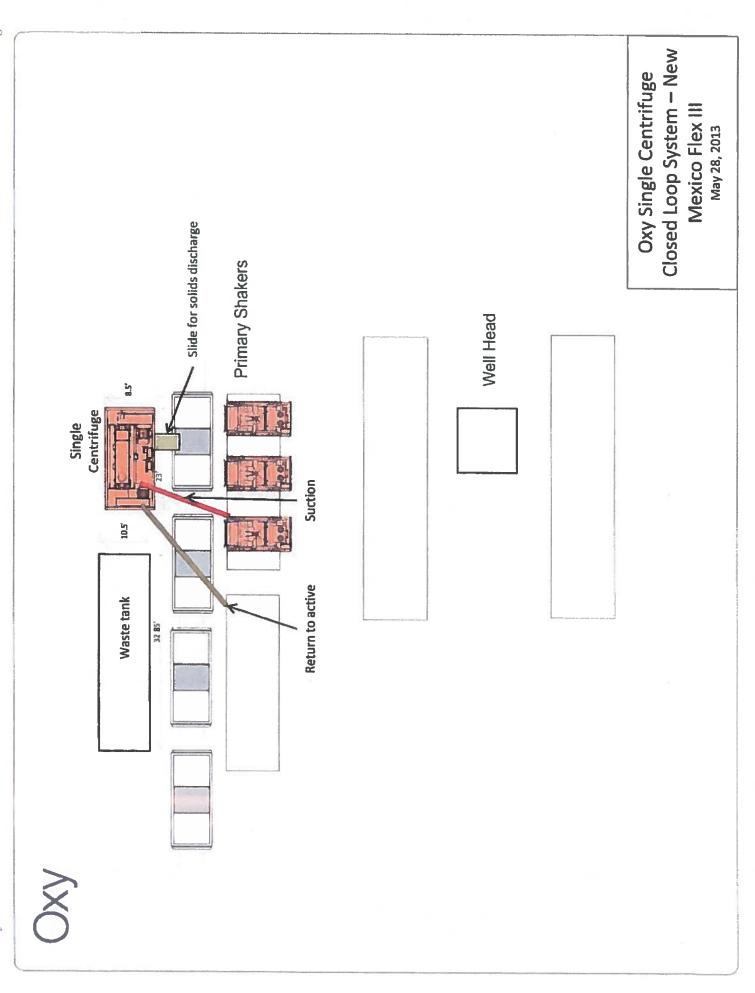



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT PWD Data Report

APD ID: 10400042976 **Submission Date:** 06/20/2019

Operator Name: OXY USA INCORPORATED

Well Name: OXBOW CC 17-8 FEDERAL COM Well Number: 42H

Well Type: OIL WELL Well Work Type: Drill

Section 1 - General

Would you like to address long-term produced water disposal? NO

Section 2 - Lined Pits

Would you like to utilize Lined Pit PWD options? NO

Produced Water Disposal (PWD) Location:

PWD surface owner:

PWD disturbance (acres):

Lined pit PWD on or off channel:

Lined pit PWD discharge volume (bbl/day):

Lined pit specifications:

Pit liner description:

Pit liner manufacturers information:

Precipitated solids disposal:

Decribe precipitated solids disposal:

Precipitated solids disposal permit:

Lined pit precipitated solids disposal schedule:

Lined pit precipitated solids disposal schedule attachment:

Lined pit reclamation description:

Lined pit reclamation attachment:

Leak detection system description:

Leak detection system attachment:

Well Name: OXBOW CC 17-8 FEDERAL COM Well Number: 42H

Lined pit Monitor description:

Lined pit Monitor attachment:

Lined pit: do you have a reclamation bond for the pit?

Is the reclamation bond a rider under the BLM bond?

Lined pit bond number:

Lined pit bond amount:

Additional bond information attachment:

Section 3 - Unlined Pits

Would you like to utilize Unlined Pit PWD options? NO

Produced Water Disposal (PWD) Location:

PWD disturbance (acres): PWD surface owner:

Unlined pit PWD on or off channel:

Unlined pit PWD discharge volume (bbl/day):

Unlined pit specifications:

Precipitated solids disposal:

Decribe precipitated solids disposal:

Precipitated solids disposal permit:

Unlined pit precipitated solids disposal schedule:

Unlined pit precipitated solids disposal schedule attachment:

Unlined pit reclamation description:

Unlined pit reclamation attachment:

Unlined pit Monitor description:

Unlined pit Monitor attachment:

Do you propose to put the produced water to beneficial use?

Beneficial use user confirmation:

Estimated depth of the shallowest aquifer (feet):

Does the produced water have an annual average Total Dissolved Solids (TDS) concentration equal to or less than that of the existing water to be protected?

TDS lab results:

Geologic and hydrologic evidence:

State authorization:

Unlined Produced Water Pit Estimated percolation:

Unlined pit: do you have a reclamation bond for the pit?

Well Name: OXBOW CC 17-8 FEDERAL COM Well Number: 42H

Is the reclamation bond a rider under the BLM bond?

Unlined pit bond number:

Unlined pit bond amount:

Additional bond information attachment:

Section 4 - Injection

Would you like to utilize Injection PWD options? NO

Produced Water Disposal (PWD) Location:

PWD surface owner: PWD disturbance (acres):

Injection PWD discharge volume (bbl/day):

Injection well mineral owner:

Injection well type:

Injection well number: Injection well name:

Assigned injection well API number? Injection well API number:

Injection well new surface disturbance (acres):

Minerals protection information:

Mineral protection attachment:

Underground Injection Control (UIC) Permit?

UIC Permit attachment:

Section 5 - Surface Discharge

Would you like to utilize Surface Discharge PWD options? NO

Produced Water Disposal (PWD) Location:

PWD surface owner: PWD disturbance (acres):

Surface discharge PWD discharge volume (bbl/day):

Surface Discharge NPDES Permit?

Surface Discharge NPDES Permit attachment:

Surface Discharge site facilities information:

Surface discharge site facilities map:

Section 6 - Other

Would you like to utilize Other PWD options? NO

Produced Water Disposal (PWD) Location:

PWD surface owner: PWD disturbance (acres):

Other PWD discharge volume (bbl/day):

Well Name: OXBOW CC 17-8 FEDERAL COM Well Number: 42H

Other PWD type description:

Other PWD type attachment:

Have other regulatory requirements been met?

Other regulatory requirements attachment:



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Bond Info Data Report

04/22/2021

APD ID: 10400042976

Operator Name: OXY USA INCORPORATED

Well Name: OXBOW CC 17-8 FEDERAL COM

Well Type: OIL WELL

Submission Date: 06/20/2019

Highlighted data reflects the most recent changes

Show Final Text

Well Number: 42H

Well Work Type: Drill

Bond Information

Federal/Indian APD: FED

BLM Bond number: ESB000226

BIA Bond number:

Do you have a reclamation bond? NO

Is the reclamation bond a rider under the BLM bond?

Is the reclamation bond BLM or Forest Service?

BLM reclamation bond number:

Forest Service reclamation bond number:

Forest Service reclamation bond attachment:

Reclamation bond number:

Reclamation bond amount:

Reclamation bond rider amount:

Additional reclamation bond information attachment:

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III
1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 25233

COMMENTS

Operator:		OGRID:	Action Number:	Action Type:
OXY USA INC P.O. Box 4294	Houston, TX772104294	16696	25233	FORM 3160-3

Created By	Comment	Comment Date	
kpickford	KP GEO Review 4/22/2021	04/23/2021	

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III
1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 25233

CONDITIONS OF APPROVAL

Operator:			OGRID:	Action Number:	Action Type:
OXY USA INC	P.O. Box 4294	Houston, TX772104294	16696	25233	FORM 3160-3

OCD Reviewer	Condition
kpickford	Will require a administrative order for non-standard location prior to placing the well on production
kpickford	Notify OCD 24 hours prior to casing & cement
kpickford	Will require a File As Drilled C-102 and a Directional Survey with the C-104
kpickford	Once the well is spud, to prevent ground water contamination through whole or partial conduits from the surface, the operator shall drill without interruption through the fresh water zone or zones and shall immediately set in cement the water protection string
kpickford	Cement is required to circulate on both surface and intermediate1 strings of casing
kpickford	Oil base muds are not to be used until fresh water zones are cased and cemented providing isolation from the oil or diesel. This includes synthetic oils. Oil based mud, drilling fluids and solids must be contained in a steel closed loop system