Received by Och: Appropriate District 22:0	State of New Mexico	Form C-103 ¹ of 4		
Office <u>District I</u> – (575) 393-6161 1625 N. French Dr., Hobbs, NM 88240	Energy, Minerals and Natural Resources	Revised July 18, 2013		
<u>District II</u> – (575) 748-1283 811 S. First St., Artesia, NM 88210	OIL CONSERVATION DIVISION	30-015-27188		
<u>District III</u> – (505) 334-6178 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Francis Dr.	5. Indicate Type of Lease STATE FEE FEE		
<u>District IV</u> – (505) 476-3460 1220 S. St. Francis Dr., Santa Fe, NM	Santa Fe, NM 87505	6. State Oil & Gas Lease No.		
87505	ICES AND REPORTS ON WELLS	7. Lease Name or Unit Agreement Name		
(DO NOT USE THIS FORM FOR PROPODIFFERENT RESERVOIR. USE "APPLIP PROPOSALS.)	PINNACLE STATE			
1. Type of Well: Oil Well	8. Well Number 010			
2. Name of Operator	9. OGRID Number 246289			
3. Address of Operator _{3500 ONE W} TULSA, OK 7	10. Pool name or Wildcat HERRADURA BEND; DELAWARE, EAST			
4. Well Location Unit Letter:	1980 feet from the SOUTH line and	990 _{feet from the} EAST _{line}		
Section 36	Township 22S Range 28E	NMPM EDDY County		
	11. Elevation (Show whether DR, RKB, RT, GR 3,140' GL	, etc.)		
12. Check	Appropriate Box to Indicate Nature of Not	tice, Report or Other Data		
NOTICE OF IN		SUBSEQUENT REPORT OF:		
PERFORM REMEDIAL WORK TEMPORARILY ABANDON	PLUG AND ABANDON REMEDIAL \ CHANGE PLANS COMMENCE	NORK ☐ ALTERING CASING ☐ EDRILLING OPNS.☐ P AND A ■		
PULL OR ALTER CASING	MULTIPLE COMPL CASING/CE	MENT JOB		
DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM				
OTHER:	OTHER:			
13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of				
proposed completion or rec	-	MILE, DDEC TECT 5 4/0" OIDD V OOO		
		M.L.F.; PRES. TEST 5-1/2" CIBP X CSG.		
TO 500# -HELD GOOD; PUMP 25 SXS. CMT. @5,650'; WOC X TAG TOC @5,381' (PER OCD); PUMP 160 SXS. CMT. @2,953' (PER OCD); WOC.				
04/45/04: TAC TOC @ 4.47/	DI (OKID DV OCD), MIV V CIDC TO C	LIDE ON CVC CMT @C40LOLDIC OUT V		
04/15/21: TAG TOC @ 1,472' (OK'D BY OCD); MIX X CIRC. TO SURF. 80 SXS. CMT. @610'-3'; DIG OUT X CUT OFF WELLHEAD 4' B.G.L.; WELD ON STEEL PLATE TO CSGS. X INSTALL DRY HOLE MARKER.				
	5.2., 5 2			
Spud Date: 11/12/1	992 Rig Release Date: 1	2/19/1992		
I hereby certify that the information above is true and complete to the best of my knowledge and belief.				
SIGNATURE				
Type or print name Caitlin O'l	Hair E-mail address: caitlin.o'	hair@dvn.com _{PHONE:} 405-552-3330		
For State Use Only				
APPROVED BY:	TITLE Staff 7	Manager DATE 4/23/2021		
Conditions of Approval (if any):	ω	U		

WPX ENERGY PERMIAN/MCDANIEL CO. PXA PROGRAM NEW MEXICO AREA OPERATIONS UPDATE APRIL 16, 2021

DISTRIBUTION:

WPX Energy Permian – Tulsa, OK (decrete-haakinson@wpxenergy.com, Scott.Armstrong@wpxenergy.com, Tommy.Templeton@wpxenergy.com, thiomas.mazal@wpxenergy.com, <a href="caitaling.

The McDaniel Co. – Dallas, Texas


ACTIVE WELL: PINNACLE STATE #10 (EDDY COUNTY, NM)


PREVIOUS DAY: 04/14/21: ARRIVED ON LOC – HELD TAILGATE SAFETY MEETING & JSA ON H2S. OPEN WELL – NO PRESS. CON'T TO RIH W/ CIBP & SET @ 5,650'. GOT OFF & TAGGED PLUG. CIRC HOLE W/ MUD, CLOSED CSG VALVE & TESTED CSG TO 500# - HELD GOOD. RELEASED PRESS & SPOTTED 25 SXS CMT. POOH W/ 30 STANDS & WOC 4 HRS. OPEN WELL, RIH & TAGGED TOC @ 5,381' – GAVE TAG TO GILBERT W/ NMOCD & SCHEDULED NEXT PLUG. POOH W/ 42 STANDS TO DERRICK & SPOTTED A 160 SXS CMT PLUG @ 2,953'. POOH W/ 20 STANDS TBG TO DERRICK & LD BALANCE. CWI. SDFN. WOC OVERNIGHT.

ACTIVE WELL: PINNACLE STATE #10 (EDDY COUNTY, NM)

PREVIOUS DAY: 04/15/21: ARRIVED ON LOC – HELD TAILGATE SAFETY MEETING & JSA ON PUMPING CEMENT. OPEN WELL & CHECKED PRESS – 0# ON WELL. RIH OE & TAGGED TOC @ 1,472'. OK'D BY GILBERT W/ NMOCD. POOH LAYING DOWN TBG. RIH W/ 19 JTS & HOOK UP CMT PUMP. MIX & CIRC 80 SX CMT TO SURF. RD FLOOR & ND BOP. RD UNIT & EQUIP. DIG OUT CELLAR & CUT OF WH 4' BGL. WELD ON PLATE & INSTALL DRY HOLE MARKER. DIG OUT ANCHORS & BACKFILL CELLAR & ANCHOR HOLES. CLEAN UP LOCATION & MOVE OFF. WELL COMPLETE. LOAD WORKSTRING & MOVE TO NEXT LOCATION.

WELLBORE DIAGRAM

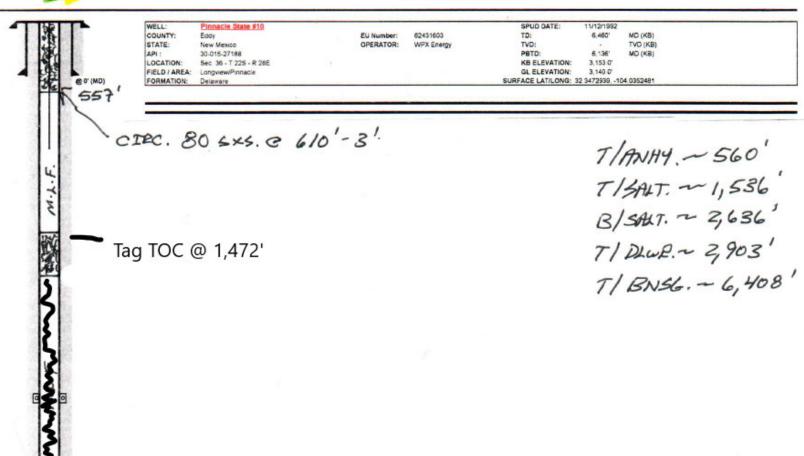

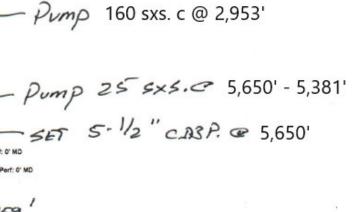

<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III
1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 24787

CONDITIONS OF APPROVAL

Operator:	OGRID:	Action Number:	Action Type:
WPX ENERGY PERMIAN, LLC Devon Energy - Regulatory	246289	24787	C-103P
333West Sheridan Ave. Oklahoma City, OK73102			

OCD Reviewer	Condition
gcordero	None