

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Report

Well Name: TEXAKOMA-FOOTHILLS Well Location: T30N / R12W / SEC 19 / County or Parish/State: SAN

NESW / 36.796066 / -108.142212 JUAN / NM

Well Number: 1 Type of Well: OTHER Allottee or Tribe Name:

Lease Number: NMNM048576 Unit or CA Name: Unit or CA Number:

US Well Number: 3004529027 Well Status: Gas Well Shut In Operator: HILCORP ENERGY

COMPANY

Notice of Intent

Sundry ID: 2655563

Type of Submission: Notice of Intent

Type of Action: Temporary Abandonment

Date Sundry Submitted: 02/03/2022 Time Sundry Submitted: 01:44

Date proposed operation will begin: 02/17/2022

Procedure Description: Hilcorp Energy Company requests permission to Temporary Abandon the subject well for future uphole potential per the attached procedure and current/proposed wellbore schematic. A closed-loop system will be used. The lease is being held by other production.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

 $Texakoma_Foothills_D_1_TA_Procedure_for_NOI_20220203134433.pdf$

Page 1 of 2

Well Location: T30N / R12W / SEC 19 /

D

County or Parish/State: SAN

Allottee or Tribe Name:

NESW / 36.796066 / -108.142212 JUAN / NM

Lease Number: NMNM048576 **Unit or CA Name: Unit or CA Number:**

Type of Well: OTHER

US Well Number: 3004529027 Well Status: Gas Well Shut In Operator: HILCORP ENERGY

COMPANY

Conditions of Approval

Specialist Review

Well Number: 1

Proposed_TA_COAs_KR_01112022_20220203175241.pdf

Operator Certification

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a submission of Form 3160-5 or a Sundry Notice.

Operator Electronic Signature: KANDIS ROLAND Signed on: FEB 03, 2022 01:44 PM

Name: HILCORP ENERGY COMPANY

Title: Operation Regulatory Tech Street Address: 382 Road 3100

State: NM City: Farmington

Phone: (505) 599-3400

Email address: kroland@hilcorp.com

Field Representative

Representative Name:

Street Address:

State: City: Zip:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: KENNETH G RENNICK BLM POC Title: Petroleum Engineer

BLM POC Phone: 5055647742 BLM POC Email Address: krennick@blm.gov

Disposition: Approved **Disposition Date:** 02/03/2022

Signature: Kenneth Rennick

Page 2 of 2



TA Procedure

General Information					
Well Name	Texakoma Foothills D 1	Date:	2/3/2022		
API:	30-045-29027	AFE#			
Field:	San Juan	County	San Juan		
Status:	Well is ACOI				
Subject:	Temporarily Abandon Wellbore				
Ву:	M. Wissing				

Well Data

Surface Casing: 8-5/8 J-55 24# at 179'

Production Casing: 5-1/2" J-55 15.5# at 1,980'

Production Tubing: 2-3/8" J-55 4.7# at 1,935'

Rod String: 7/8" & 3/4" molded & slick guided rods w/ 2"x1.5 x12' RWAC insert pump

Current Perforations: 1,838' - 1,902'

Current PBTD: 1,970' (cement plug)

SICP = 50 psig

Last BH Test: 0 psi

Notes: None

Hold PJSM prior to begin all operations. Properly document all operations via the JSA process. Ensure that all personnel onsite abide by HEC safety protocol, including PPE, housekeeping, and standard guidelines. Verify cathodic protection is off and wellhead instrumentation is properly disconnected from the wellhead. Comply with all NMOCD, BLM, and HEC safety and environmental regulations. Verify there is no H2S present prior to beginning operations. If any H2S is present, take the necessary actions to ensure that the location is safe prior to beginning operations. Observe and record pressures across all strings daily, prior to beginning operations.


Remember to notify NMOCD & BLM 24 hours prior to starting operations on location. This procedure is contingent upon P&A sundry approval by NMOCD & BLM.

TA Procedure

- 1. MIRU workover rig and related equipment. Record pressures on all strings of the wellbore.
- 2. Release rod string and TOOH with rods and insert rod pump
- 3. ND whd and NU BOP. Test BOP. Release tbg hgr and tag for fill. TOOH with the production tubing.
- 4. MU 5-1/2" casing scraper and RIH. Reach +/- 1,800' and POOH.
- 5. MU 5-1/2" CIBP and RIH. Set CIBP at 1,788'.
 - a. Top Fruitland perf at 1,838'
- 6. Load wellbore with inhibited packer fluid and circulate wellbore clean. TOOH with tbg.
- 7. Contact NMOCD & BLM 24 hrs prior to pressure test. Test casing to 560 psi for 30 min on a chart recorder (2 hr chart). Contact engineer if pressure test fails.
- 8. ND BOP and NU whd. RDMO workover rig & equipment.




CURRENT WELLBORE SCHEMATIC

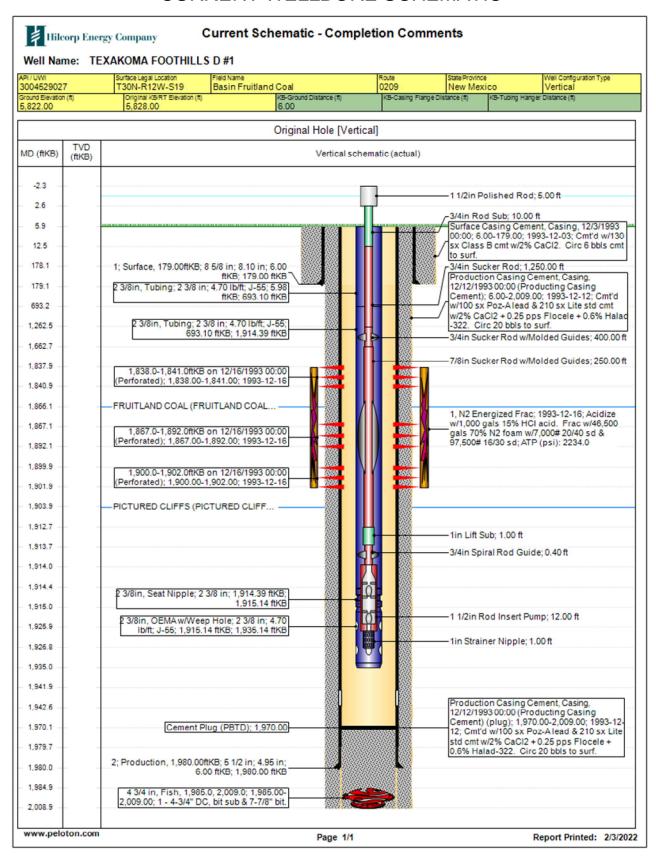



PROPOSED WELLBORE SCHEMATIC

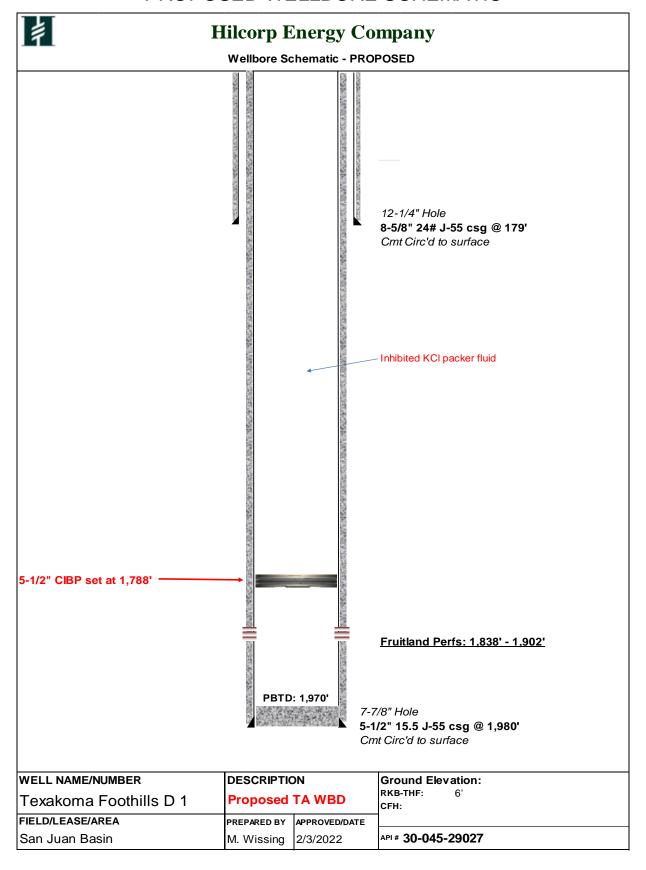



UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

CONDITIONS OF APPROVAL FOR PROPOSED WORK TO TEMPORARY ABANDONED

- 1. Send in a Sundry Notification Notice of Intent (SN-NOI) requesting (or renewing) temporary abandonment status. Note approval is still based on the discretion of this agency. This request must be submitted within 30 days after work is completed.
- 2. Include in the SN-NOI the following:
 - a. Proposed exact expiration date (day, month, year). Can not be greater than 12-months from date of submission. The date can also be when the current TA approval will expire.
 - b. Confirmation of other production on lease, or agreement.
 - c. Plans for the well.
- 3. This agency reserves the right to modify or rescind approval. A plug or produce order may still be issued at the discretion of the authorized officer.

K. Rennick 1/11/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 78448

COMMENTS

Operator:	OGRID:
HILCORP ENERGY COMPANY	372171
1111 Travis Street	Action Number:
Houston, TX 77002	78448
	Action Type:
	[C-103] NOI Temporary Abandonment (C-103I)

COMMENTS

Created B		Comment Date
mkuehli	g perforations appear to be above Fruitland Coal top	3/18/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 78448

CONDITIONS

Operator:	OGRID:
HILCORP ENERGY COMPANY	372171
1111 Travis Street	Action Number:
Houston, TX 77002	78448
	Action Type:
	[C-103] NOI Temporary Abandonment (C-103I)

CONDITIONS

Created By	Condition	Condition Date
mkuehling	Notify NMOCD 24 hours prior to MIT - bradenhead test required prior to MIT - Witness required by NMOCD inspector for all testing - Due to lack of personnel test may be witnessed through facetime.	3/18/2022