Office

87505

PROPOSALS.)

Submit 1 Copy To Appropriate District

1625 N. French Dr., Hobbs, NM 88240

1000 Rio Brazos Rd., Aztec, NM 87410

1220 S. St. Francis Dr., Santa Fe, NM

1. Type of Well: Oil Well

Legacy Reserves Operating LP

Unit Letter

PERFORM REMEDIAL WORK □

TEMPORARILY ABANDON

PULL OR ALTER CASING

DOWNHOLE COMMINGLE CLOSED-LOOP SYSTEM

OTHER:

3.

Section

15 Smith Road, Suite 3000, Midland, TX 79705

11

811 S. First St., Artesia, NM 88210

District I - (575) 393-6161

District II - (575) 748-1283

District III - (505) 334-6178

District IV - (505) 476-3460

2. Name of Operator

3. Address of Operator

4. Well Location

8. Spot 25 sx cmt @ 4010-3625'. WOC & Tag (9. Spot 25 sx cmt @ 2900-2700'. WOC & Tag (10. Spot 25 sx cmt @ 2350-2150'. WOC & Tag (11. Perf & Sqz 90 sx cmt @ 427' to surface. (13 3 12. Cu off well head, verify cmt @ surface, weld	B/Salt) T/Salt) 3/8" Shoe)	CONDITIONS OF APPROVAL
Spud Date:	Rig Release Date:	
I hereby certify that the information above is true and c	complete to the best of my knowledge and beli	lef.
SIGNATURE MILE	TITLE Regulatory Tech	DATE <u>5/5/2022</u>
Type or print name Melanie Reyes For State Use Only	E-mail address: _mreyes@legacyreserves.co	om_ PHONE: <u>(432) 221-6358</u>
APPROVED BY: Yeary Forther Conditions of Approval (if any)	_TITLE Compliance Officer A 575-263-6633	DATE_5/11/22

State of New Mexico

Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION

1220 South St. Francis Dr.

Santa Fe, NM 87505

feet from the

Township 15S

PLUG AND ABANDON

CHANGE PLANS

MULTIPLE COMPL

S

Range

3792' GR

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

11. Elevation (Show whether DR, RKB, RT, GR, etc.)

 \bowtie

SUNDRY NOTICES AND REPORTS ON WELLS

Gas Well Other

(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A

660

NOTICE OF INTENTION TO:

Tag 5 ½" CIBP @ 11,200'. Spot 25 sx cmt @ 11,200-11,000'.

Perf & Sqz 50 sx cmt @ 4840-4640'. WOC & Tag (9 5/8" Shoe)

Spot 25 sx cmt @ 8983-8783'. WOC & Tag (DV Tool)

Spot 25 sx cmt @ 6030-5830'. WOC & Tag (Glorieta)

proposed completion or recompletion.

Spot 25 sx cmt @ 10,405-10,205'. (Atoka)

Spot 25 sx cmt @ 7965-7765'. (Drinkard) Spot 25 sx cmt @ 6695-6495'. (Blinebry)

DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH

Form C-103

line

Revised July 18, 2013

FEE 🖂

WELL API NO.

5. Indicate Type of Lease

STATE

6. State Oil & Gas Lease No.

7. Lease Name or Unit Agreement Name

30-025-05279

J.M. Denton

240974

1980

NMPM

line and

REMEDIAL WORK

OTHER:

CASING/CEMENT JOB

COMMENCE DRILLING OPNS.□

37E

8. Well Number #5

9. OGRID Number

Denton (Devonian)

SUBSEQUENT REPORT OF:

10. Pool name or Wildcat

feet from the

County Lea

ALTERING CASING

4" diameter 4' tall Above Ground Marker


Released to Imaging: 5/12/2022 3:25:32 PM

SEE ATTACHED

P AND A

Received	by OCD: 5/5/2022 9	:50:50 AM	
Legacy Res	sérves		PROPOSED
Author:	Abby BCM		
Well Name	JM Denton	Well No.	#5
Field/Pool	Denton Devonian	API#:	30-025-05279
County	Lea	Location:	Sec 11, T15S, R37E
State	NM	_	1980 FWL & 680 FSL
Spud Date	8/5/1951	GL:	3795
-		_	


Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	Page 2 o
Surface Csg	16		65#	376	20	375	circ'd
Inter Csg	9 5/8		40 & 36#	4,790	12	2,000	1518
Prod Csg	5 1/2	N80	17 & 20#	12,402	8 3/4	1,650	

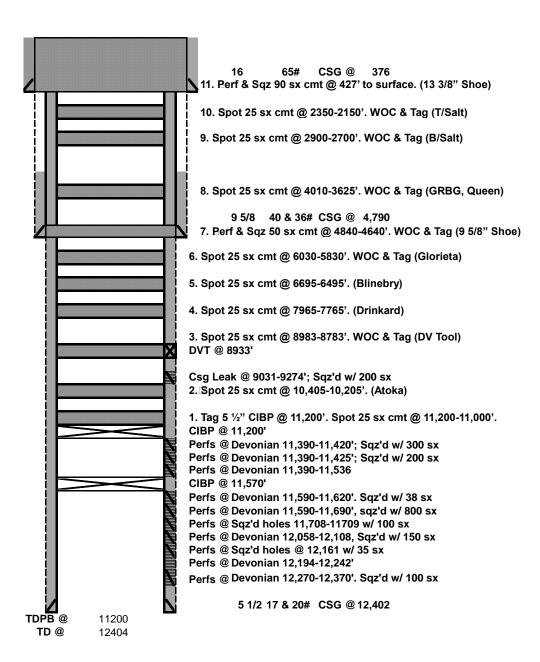

Formation	Тор
Anhy	2080
T/Salt	2300
B/Salts	2900
Yates	3060
7 Rvs	3395
Queen	3675
GRBG	3960
S/A	4585
GL	5980
Blinebry	6645
Tubb	7245
Drinkard	7915
Abo	8995
Wolfcamp	9030
Canyon	9905
Strawn	10240
Atoka	10355
Miss	10487
Woodford	11320
Devonian	11390

Legacy Res	ěrves		CURRENT
Author:	Abby BCM		
Well Name	JM Denton	Well No.	#5
Field/Pool	Denton Devonian	API#:	30-025-05279
County	Lea	Location:	Sec 11, T15S, R37E
State	NM	-	1980 FWL & 680 FSL
Spud Date	8/5/1951	GL:	3795

Description	O.D.	Grade	Weight	Depth	Hole		Page 3 of 9 TOC
Surface Csg	16		65#	376	20	375	circ'd
Inter Csg	9 5/8		40 & 36#	4,790	12	2,000	1518
Prod Csg	5 1/2	N80	17 & 20#	12,402	8 3/4	1,650	

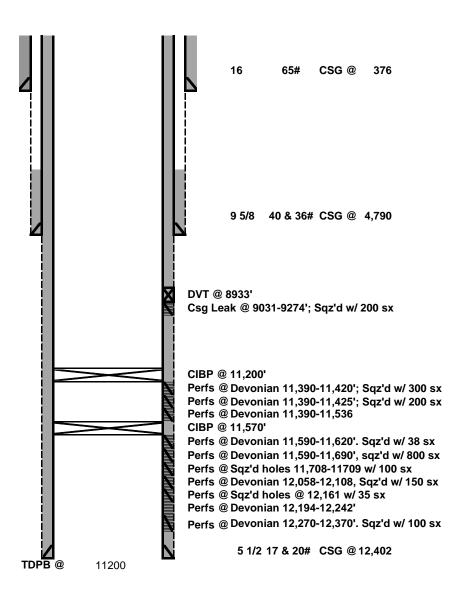

Formation	Тор
Anhy	2080
T/Salt	2300
Yates	3060
7 Rvs	3395
Queen	3675
GRBG	3960
S/A	4585
B/Salt	4620
GL	5980
Blinebry	6645
Tubb	7245
Drinkard	7915
Abo	8995
Wolfcamp	9030
Canyon	9905
Strawn	10240
Atoka	10355
Miss	10487
Woodford	11320
Devonian	11390

CONDITIONS OF APPROVAL FOR PLUGGING AND ABANDONMENT OCD - Southern District

The following is a guide or checklist in preparation of a plugging program, this is not all inclusive and care must be exercised in establishing special plugging programs in unique and unusual cases, Notify NMOCD District Office I (Hobbs) at (575)-263-6633 at least 24 hours before beginning work. After MIRU rig will remain on well until it is plugged to surface. OCD is to be notified before rig down.

Company representative will be on location during plugging procedures.

- **1.** A notice of intent to plug and abandon a wellbore is required to be approved before plugging operations are conducted. A cement evaluation tool is required in order to ensure isolation of producing formations, protection of water and correlative rights. A cement bond log or other accepted cement evaluation tool is to be provided to the division for evaluation if one has not been previously run or if the well did not have cement circulated to surface during the original casing cementing job or subsequent cementing jobs. Insure all bradenheads have been exposed, identified and valves are operational prior to rig up.
- **2.** Closed loop system is to be used for entire plugging operation. Upon completion, contents of steel pits are to be hauled to a permitted disposal location.
- **3.** Trucking companies being used to haul oilfield waste fluids to a disposal commercial or private- shall have an approved NMOCD C-133 permit. A copy of this permit shall be available in each truck used to haul waste products. It is the responsibility of the operator as well as the contractor, to verify that this permit is in place prior to performing work. Drivers shall be able to produce a copy upon request of an NMOCD Field inspector.
- 4. Filing a subsequent C-103 will serve as notification that the well has been plugged.
- **5.** A final C-103 shall be filed (and a site inspection by NMOCD Inspector to determine if the location is satisfactorily cleaned, all equipment, electric poles and trash has been removed to Meet NMOCD standards) before bonding can +be released.
- **6.** If work has not begun within 1 Year of the approval of this procedure, an extension request must be file stating the reason the well has not been plugged.
- 7. Squeeze pressures are not to exceed 500 psi, unless approval is given by NMOCD.
- **8.** Produced water will not be used during any part of the plugging operation.
- 9. Mud laden fluids must be placed between all cement plugs mixed at 25 sacks per 100 bbls of water.
- **10.** All cement plugs will be a minimum of 100' in length or a minimum of 25 sacks of cement, whichever is greater. 50' of calculated cement excess required for inside casing plugs and 100% calculated cement excess required on outside casing plugs.
- 11. Class 'C' cement will be used above 7500 feet.
- 12. Class 'H' cement will be used below 7500 feet.
- **13.** A cement plug is required to be set 50' above and 50' below, casing stubs, DV tools, attempted casing cut offs, cement tops outside casing, salt sections and anywhere the casing is perforated, these plugs require a 4 hour WOC and then will be tagged
- **14.** All Casing Shoes Will Be Perforated 50' below shoe depth and Attempted to be Squeezed, cement needs to be 50' above and 50' Below Casing Shoe inside the Production Casing.
- **16.** When setting the top out cement plug in production, intermediate and surface casing, wellbores should remain full at least 30 minutes after plugs are set
- 17. A CIBP is to be set within 100' of production perforations, capped with 100' of cement, WOC 4 hours and tag.
- **18.** A CIBP with 35' of cement may be used in lieu of the 100' plug if set with a bailer. This plug will be placed within 100' of the top perforation, (WOC 4 hrs and tag).

- 19. No more than 3000' is allowed between cement plugs in cased hole and 2000' in open hole.
- 20. Some of the Formations to be isolated with cement plugs are: These plugs to be set to isolate formation tops
- A) Fusselman
- B) Devonian
- C) Morrow
- D) Wolfcamp
- E) Bone Springs
- F) Delaware
- G) Any salt sections
- H) Abo
- I) Glorieta
- J) Yates.
- K) Potash---(In the R-111-P Area (Potash Mine Area),

A solid cement plug must be set across the salt section. Fluid used to mix the cement shall be saturated with the salts that are common to the section penetrated and in suitable proportions, not more than 3% calcium chloride (by weight of cement) will be considered the desired mixture whenever possible, WOC 4 hours and tag, this plug will be 50' below the bottom and 50' above the top of the Formation.

21. If cement does not exist behind casing strings at recommended formation depths, the casing can be cut and pulled with plugs set at recommended depths. If casing is not pulled, perforations will be shot and cement squeezed behind casing, WOC and tagged. These plugs will be set 50' below formation bottom to 50' above formation top inside the casing.

DRY HOLE MARKER REQ.UIRMENTS

The operator shall mark the exact location of the plugged and abandoned well with a steel marker not less than four inches in diameter, 3' below ground level with a plate of at least ¼" welded to the top of the casing and the dry hole marker welded on the plate with the following information welded on the dry hole marker:

- 1. Operator name
- 2. Lease and Well Number
- 3. API Number
- 4. Unit letter
- 5. Quarter Section (feet from the North, South, East or West)
- 6. Section, Township and Range
- 7. Plugging Date
- 8. County


SPECIAL CASES ----AGRICULTURE OR PRARIE CHICKEN BREEDING AREAS

In these areas, a below ground marker is required with all pertinent information mentioned above on a plate, set 3' below ground level, a picture of the plate will be supplied to NMOCD for record, the exact location of the marker (longitude and latitude by GPS) will be provided to NMOCD (We typically require a current survey to verify the GPS)

SITE REMEDIATION DUE WITHIN ONE YEAR OF WELL PLUGGING COMPLETION

Legacy Res	ěrves		CURRENT
Author:	Abby BCM		
Well Name	JM Denton	Well No.	#5
Field/Pool	Denton Devonian	API#:	30-025-05279
County	Lea	Location:	Sec 11, T15S, R37E
State	NM	-	1980 FWL & 680 FSL
Spud Date	8/5/1951	GL:	3795


Description	O.D.	Grade	Weight	Depth	Hole		Page 6 of 9 TOC
Surface Csg	16		65#	376	20	375	circ'd
Inter Csg	9 5/8		40 & 36#	4,790	12	2,000	1518
Prod Csg	5 1/2	N80	17 & 20#	12,402	8 3/4	1,650	

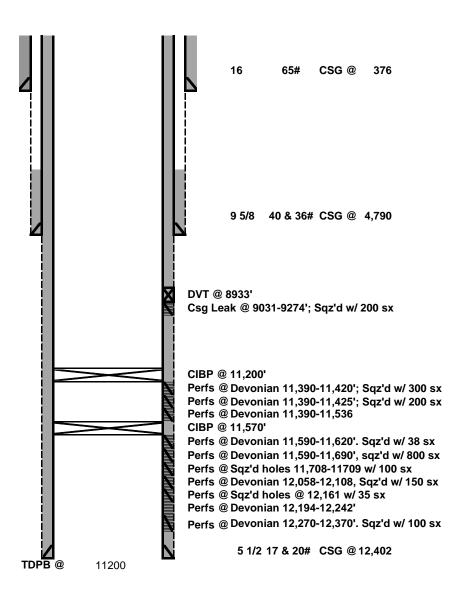

Formation	Тор
Anhy	2080
T/Salt	2300
Yates	3060
7 Rvs	3395
Queen	3675
GRBG	3960
S/A	4585
B/Salt	4620
GL	5980
Blinebry	6645
Tubb	7245
Drinkard	7915
Abo	8995
Wolfcamp	9030
Canyon	9905
Strawn	10240
Atoka	10355
Miss	10487
Woodford	11320
Devonian	11390

Received !	by OCD: 5/5/2022 9:	:50:50 AM	
Legacy Res			PROPOSED
Author:	Abby BCM		
Well Name	JM Denton	Well No.	#5
Field/Pool	Denton Devonian	API#:	30-025-05279
County	Lea	Location:	Sec 11, T15S, R37E
State	NM	-	1980 FWL & 680 FSL
Spud Date	8/5/1951	GL:	3795
_		-	

Description	O.D.	Grade	Weight	Depth	Hole	Cmt Sx	Page 7 o
Surface Csg	16		65#	376	20	375	circ'd
Inter Csg	9 5/8		40 & 36#	4,790	12	2,000	1518
Prod Csg	5 1/2	N80	17 & 20#	12,402	8 3/4	1,650	

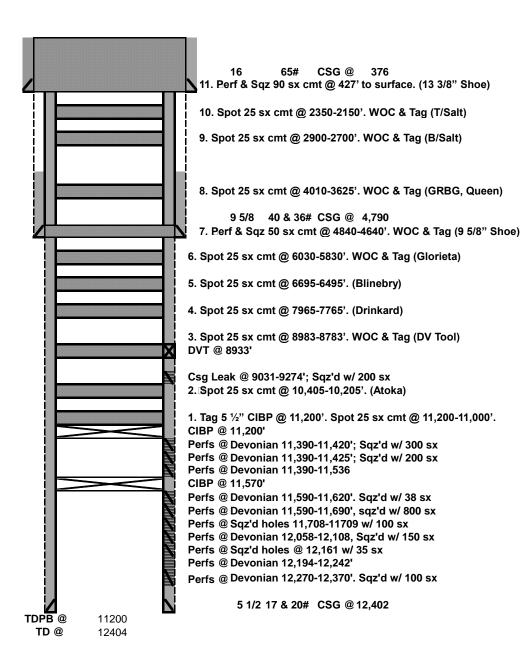

Formation	Тор
Anhy	2080
T/Salt	2300
B/Salts	2900
Yates	3060
7 Rvs	3395
Queen	3675
GRBG	3960
S/A	4585
GL	5980
Blinebry	6645
Tubb	7245
Drinkard	7915
Abo	8995
Wolfcamp	9030
Canyon	9905
Strawn	10240
Atoka	10355
Miss	10487
Woodford	11320
Devonian	11390

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 104415

COMMENTS

Operator:	OGRID:
LEGACY RESERVES OPERATING, LP	240974
15 Smith Road	Action Number:
Midland, TX 79705	104415
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Created By		Comment Date
plmartinez	DATA ENTRY PM	5/12/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 104415

CONDITIONS

Operator:	OGRID:
LEGACY RESERVES OPERATING, LP	240974
15 Smith Road	Action Number:
Midland, TX 79705	104415
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
kfortner	See attached conditions of approval	5/11/2022