

Form 3160-5
(June 2019)UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENTFORM APPROVED
OMB No. 1004-0137
Expires: October 31, 2021**SUNDRY NOTICES AND REPORTS ON WELLS**
Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No. NMLC062052

6. If Indian, Allottee or Tribe Name

SUBMIT IN TRIPLICATE - Other instructions on page 2

1. Type of Well

☒ Oil Well ☐ Gas Well ☐ Other

2. Name of Operator HUDSON OIL COMPANY OF TEXAS

3a. Address 616 TEXAS STREET, FORT WORTH, TX 76102

3b. Phone No. (include area code)
(817) 336-7109

7. If Unit of CA/Agreement, Name and/or No.

8. Well Name and No. SHUGART B/4

9. API Well No. 3001505520

10. Field and Pool or Exploratory Area
YATES/YATES4. Location of Well (Footage, Sec., T., R., M., or Survey Description)
SEC 11/T18S/R31E/NMP11. Country or Parish, State
EDDY/NM

12. CHECK THE APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Hydraulic Fracturing	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input checked="" type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomple horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recomple in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.)

06/06/22 MIRU plugging equipment. Dug out cellar. Bled down well., ND tree, NU BOP. 06/07/22 POH w/ tbg. Set 5 1/2" CIBP @ 3300'.

Pressure tested csg, held 500 PSI. Circ'd hole w/ MLF. Spotted 35 sx class C cmt @ 3300-3059'. Spotted 30 sx class C cmt @ 2470-2150'.

WOC. 06/08/22 Tagged plug @ 2156'. Spotted 25 sx class C cmt @ 2065-1960'. Perf'd @ 950'. Pressured up on perms to 500 PSI. Spotted 30 sx class C cmt @ 1000-711'. WOC. 06/09/22 Tagged plug @ 733'. Perf'd @ 733' per Gilberto Espinoza w/ BLM. Pressured up to 500 PSI. Spotted 80 sx class C cmt @ 733' to surface. Rigged down & moved off. 06/10/22 Rigged down & moved off. Moved in backhoe and welder. Cut off well head & anchors. Gilberto Espinoza w/ BLM verified cmt @ surface via picture text message. Welded on "Above Ground Dry Hole Marker". Backfilled cellar, cut off deadmen, cleaned location, and moved off.

14. I hereby certify that the foregoing is true and correct. Name (Printed/Typed)

EDWARD HUDSON IV / Ph: (817) 336-7109

Land Manager

Title

Signature



Date

06/17/2022

Accepted for record - NMOCD gc 10/13/2022

THE SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

JAMES A AMOS / Ph: (575) 234-5927 / Accepted

Acting Assistant Field Manager

Title

06/21/2022

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office CARLSBAD

Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

GENERAL INSTRUCTIONS

This form is designed for submitting proposals to perform certain well operations and reports of such operations when completed as indicated on Federal and Indian lands pursuant to applicable Federal law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local area or regional procedures and practices, are either shown below, will be issued by or may be obtained from the local Federal office.

SPECIFIC INSTRUCTIONS

Item 4 - Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult the local Federal office for specific instructions.

Item 13: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by the local Federal office. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to the top of any tubing left in the hole; method of closing top of well and date well site conditioned for final inspection looking for approval of the abandonment. If the proposal will involve **hydraulic fracturing operations**, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

NOTICES

The privacy Act of 1974 and the regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 351 et seq., 25 U.S.C. 396; 43 CFR 3160.

PRINCIPAL PURPOSE: The information is used to: (1) Evaluate, when appropriate, approve applications, and report completion of subsequent well operations, on a Federal or Indian lease; and (2) document for administrative use, information for the management, disposal and use of National Resource lands and resources, such as: (a) evaluating the equipment and procedures to be used during a proposed subsequent well operation and reviewing the completed well operations for compliance with the approved plan; (b) requesting and granting approval to perform those actions covered by 43 CFR 3162.3-2, 3162.3-3, and 3162.3-4; (c) reporting the beginning or resumption of production, as required by 43 CFR 3162.4-1(c) and (d) analyzing future applications to drill or modify operations in light of data obtained and methods used.

ROUTINE USES: Information from the record and/or the record will be transferred to appropriate Federal, State, local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecutions in connection with congressional inquiries or to consumer reporting agencies to facilitate collection of debts owed the Government.

EFFECT OF NOT PROVIDING THE INFORMATION: Filing of this notice and report and disclosure of the information is mandatory for those subsequent well operations specified in 43 CFR 3162.3-2, 3162.3-3, 3162.3-4.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM collects this information to evaluate proposed and/or completed subsequent well operations on Federal or Indian oil and gas leases.

Response to this request is mandatory.

The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT: Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Collection Clearance Officer (WO-630), 1849 C St., N.W., Mail Stop 401 LS, Washington, D.C. 20240

Additional Information

Location of Well

0. SHL: NWSW / 1980 FSL / 660 FWL / TWSP: 18S / RANGE: 31E / SECTION: 11 / LAT: 0.0 / LONG: 0.0 (TVD: 0 feet, MD: 0 feet)


BHL: NWSW / 1980 FSL / 660 FWL / TWSP: 18S / SECTION: / LAT: 0.0 / LONG: 0.0 (TVD: 0 feet, MD: 0 feet)

Proposed

Operator: Hudson Oil Company of Texas
 Well Name: Shugart B #4
 Field: Shugart Queen
 County/State: Eddy County, New Mexico
 API Number: 30-015-05520
 Lease Number: LC-062052
 Location: Sec 11 - T18S - R31E
 1980' FSL & 660' FWL

DRILLING DETAILS			
Spud Date:	3-4-91	KB [ft]:	
TD :	4126'	GL [ft]:	3,733'
PBTD	4116'	KB-GL:	
WELLHEAD AND TREE DETAILS			
	Size & Rating		
A Section:			
B Section:			
Tree:			

CASING DETAILS						CMTING DETAILS	
Hole	Size	Wght	Grde	TOL	Depth	Vol	TOC [ft]
11"	8-5/8"	24	J-55		795'	200 sx	Surf
7-7/8"	5-1/2"	15.5	J-55		4,126'	1200 sx	Surf

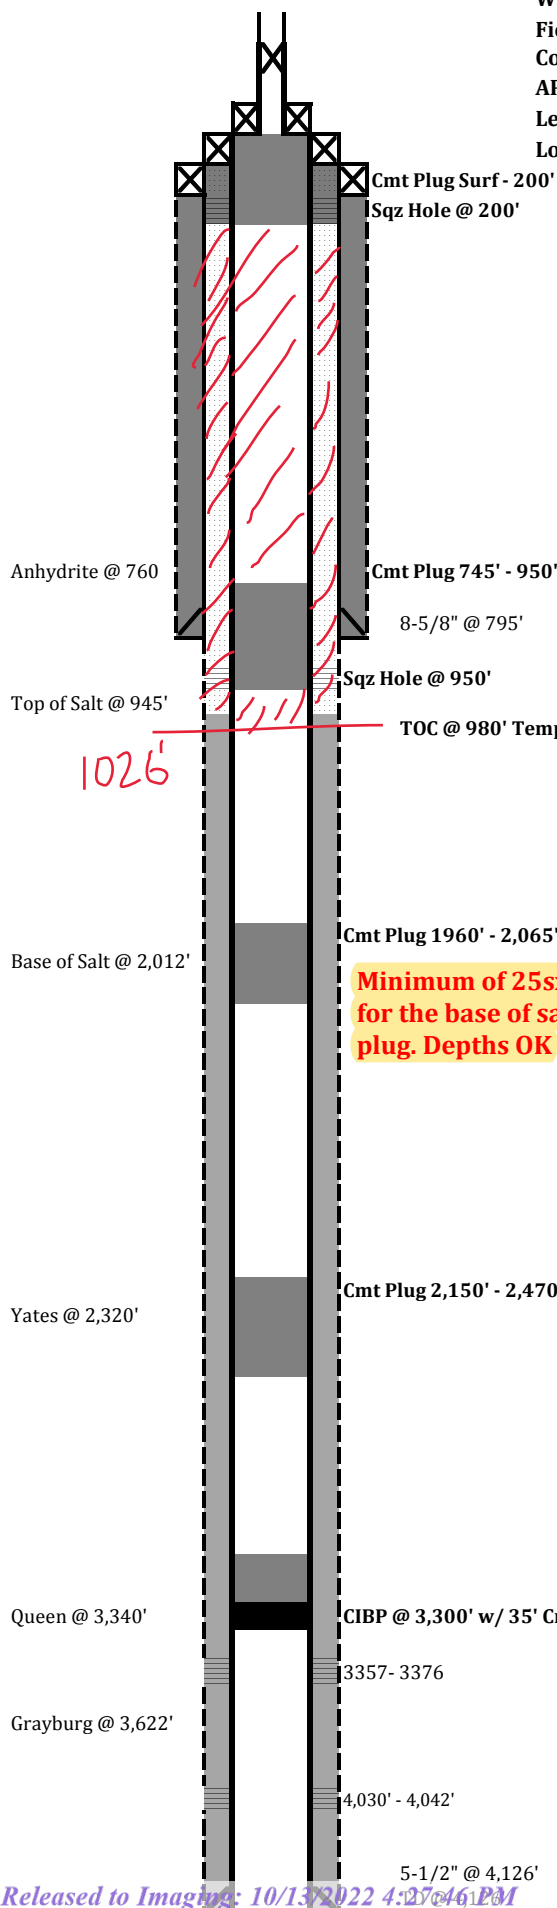

Only one cemented annulus covers the fresh water zone. Perf and squeeze cement to surface with base at 980 in the 5.5"-8.625" annulus and 1026' inside the 5.5" casing. Minimum 130sx in annulus and 110sx in casing. Or cut and remove casing right above TOC. Set plug base at 1026' and bring it to surface with 280sx of cement. Covers all above plugs including surface plug

Downhole Item	Length	Depth
KB Correction		0.00
		0.00
		0.00
		0.00
		0.00

Downhole Item	Length	Depth	Set
			0.00
			0.00
			0.00

Minimum of 25sx for the base of salt plug. Depths OK

Minimum of 25sx for the Yates plug. Depths OK

PERFORATION DETAILS					
Zone	Gross Interval	Net Pay	Shots	IP Date	P&A'd
Grayburg	3357- 3376	3	4	7-11-1957	
San Andres	4030- 4042	3	2	3-8-1991	

Minimum 25sx cement on top of CIBP. Pressure test to 500psi for 30mins.

TREATMENT DETAILS						
Interval	[bbls]	Type	Sd [lbs]	ISIP	ATR	ATP

Date:	12/15/2021
By:	Greg Milner

Current

Operator: Hudson Oil Company of Texas
Well Name: Shugart B #4
Field: Shugart Queen
County/State: Eddy County, New Mexico
API Number: 30-015-05520
Lease Number: LC-062052
Location: Sec 11 - T18S - R31E
 1980' FSL & 660' FWL

DRILLING DETAILS			
Spud Date:	3-4-91	KB [ft]:	
TD :	4126'	GL [ft]:	3,733'
PBTD	4116'	KB-GL:	
WELLHEAD AND TREE DETAILS			
Size & Rating			
A Section:			
B Section:			
Tree:			

CASING DETAILS						CMTING DETAILS	
Hole	Size	Wght	Grde	TOL	Depth	Vol	TOC [ft],
11"	8-5/8"	24	J-55		795'	200 sx	Surf
7-7/8"	5-1/2"	15.5	J-55		4,126'	1200 sx	Surf

Anhydrite @ 760

8-5/8" @ 795'

Top of Salt @ 945'

TOC @ 980' Temp Survey 7-10-57

Base of Salt @ 2,012'

Yates @ 2,320'

Queen @ 3,340'

Grayburg @ 3,622'

3357- 3376

4,030' - 4,042'

5-1/2" @ 4,126'

	Downhole Item	Length	Depth
	KB Correction	7.00	7.00
131	2-7/8" 6.5# J-55 8rd EUE	4,037.00	4,044.00
	SSN	1.10	4,045.10
	Perf Sub	4.00	4,049.10
	MA	27.00	4,076.10

	Downhole Item	Length	Depth Set
	Polish Rod	18.00	18.00
161	3/4" Steel Rods	4,025.00	4,043.00
	2" x 1-1/2" x 12' pump	12.00	4,055.00

PERFORATION DETAILS					
Zone	Gross Interval	Net Pay	Shots	IP Date	P&A'd
Grayburg	3357- 3376	3	4	7-11-1957	
San Andres	4030- 4042	3	2	3-8-1991	

TREATMENT DETAILS						
Interval	[bbls]	Type	Sd [lbs]	ISIP	ATR	ATP

Date:	12/15/2021
By:	Greg Milner

Sundry ID 2663670

Plug Type	Top	Bottom	Length	Tag	Sacks	Notes
Yates @ 2176	2104.24	2226.00	121.76	If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations	25.00	Minimum of 25sx Class C cement.
Surface Plug	0.00		0.00	Tag/Verify	240 or 280	Perf and squeeze cement to surface with base at 980 in the 5.5"-8.625" annulas and 1026' inside the 5.5" casing. Minimum 130sx in annulas and 110sx in casing. Or cut and remove casing right above TOC. Set plug base at 1026' and bring it to surface with 280sx of cement. Covers all above plugs including surface plug

						Perf and squeeze cement to surface with base at 980 in the 5.5"-8.625" annulas and 1026' inside the 5.5" casing. Minimum 130sx in annulas and 110sx in casing. Or cut and remove casing right above TOC. Set plug base at 1026' and bring it to surface with 28
Top of Salt @ 976	916.24	1026.00	109.76	Tag/Verify	240 or 280	
Base of Salt @ 2046	1975.54	2096.00	120.46	Tag/Verify	25.00	Minumum of 25sx of Class C cement
				If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations		Perf and squeeze cement to surface with base at 980 in the 5.5"-8.625" annulas and 1026' inside the 5.5" casing. Minimum 130sx in annulas and 110sx in casing. Or cut and remove casing right above TOC. Set plug base at 1026' and bring it to surface with 280sx of cement. Covers all above plugs including surface plug
Fresh Water @ 820	761.80	870.00	108.20		240 or 280	
						Perf and squeeze cement to surface with base at 980 in the 5.5"-8.625" annulas and 1026' inside the 5.5" casing. Minimum 130sx in annulas and 110sx in casing. Or cut and remove casing right above TOC. Set plug base at 1026' and bring it to surface with 280sx of cement. Covers all above plugs including surface plug
Shoe Plug	737.05	845.00	107.95	Tag/Verify	240 or 280	

CIBP Plug	3265.00	3300.00	35.00	If solid base no need to Tag (CIBP present and/or Mechanical Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforations	25.00	Minimum of 25sx Class C cement. Test to 500psi for 30mins
-----------	---------	---------	-------	--	-------	---

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.

Class H >7500'

Class C <7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Critical, High, Medium, Secretary : Top of salt to surface If no salt take the deepest fresh water.

R111P: 50' from bottom of salt to surface

Class C: 1.32 ft³/sx

Class H: 1.06 ft³/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement Low

Shoe @ 795.00
Shoe @ 4126.00

Perforatons Top @ 3357.00 Perforations Bottom @ 3376.00

Perforatons Top @ 4030.00 Perforations Bottom @ 4042.00

CIBP @ 3300.00

**BUREAU OF LAND MANAGEMENT
Carlsbad Field Office
620 East Greene Street
Carlsbad, New Mexico 88220
575-234-5972**

**Permanent Abandonment of Federal Wells
Conditions of Approval**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **ninety (90)** days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

2. **Notification:** Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.

3. **Blowout Preventers:** A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. **Mud Requirement:** Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. **Cement Requirement:** Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Dry Hole Marker: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). **The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.**

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds).

7. Subsequent Plugging Reporting: Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**

8. Trash: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office
620 E. Greene St.
Carlsbad, New Mexico 88220-6292
www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo “interim” reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo “final” reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its pre-disturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any and all contaminants, scrap/trash, equipment, pipelines and powerlines. Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.

4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.
5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos
Supervisory Petroleum Engineering Tech
575-234-5909, 575-361-2648 (Cell)

Arthur Arias
Environmental Protection Specialist
575-234-6230

Crisha Morgan
Environmental Protection Specialist
575-234-5987

Melissa Horn
Environmental Protection Specialist
575-234-5951

Kelsey Wade
Environmental Protection Specialist
575-234-2220

Trishia Bad Bear, Hobbs Field Station
Natural Resource Specialist
575-393-3612

Well Name: SHUGART B	Well Location: T18S / R31E / SEC 11 / NWSW /	County or Parish/State: EDDY / NM
Well Number: 4	Type of Well: OIL WELL	Allottee or Tribe Name:
Lease Number: NMLC062052	Unit or CA Name:	Unit or CA Number:
US Well Number: 3001505520	Well Status: Abandoned	Operator: HUDSON OIL COMPANY OF TEXAS

Subsequent Report**Sundry ID:** 2677523**Type of Submission:** Subsequent Report**Type of Action:** Plug and Abandonment**Date Sundry Submitted:** 06/17/2022**Time Sundry Submitted:** 09:22**Date Operation Actually Began:** 06/06/2022

Actual Procedure: 06/06/22 MIRU plugging equipment. Dug out cellar. Bled down well., ND tree, NU BOP. 06/07/22 POH w/ tbg. Set 5 1/2" CIBP @ 3300'. Pressure tested csg, held 500 PSI. Circ'd hole w/ MLF. Spotted 35 sx class C cmt @ 3300-3059'. Spotted 30 sx class C cmt @ 2470-2150'. WOC. 06/08/22 Tagged plug @ 2156'. Spotted 25 sx class C cmt @ 2065-1960'. Perf'd @ 950'. Pressured up on perms to 500 PSI. Spotted 30 sx class C cmt @ 1000-711'. WOC. 06/09/22 Tagged plug @ 733'. Perf'd @ 733' per Gilberto Espinoza w/ BLM. Pressured up to 500 PSI. Spotted 80 sx class C cmt @ 733' to surface. Rigged down & moved off. 06/10/22 Rigged down & moved off. Moved in backhoe and welder. Cut off well head & anchors. Gilberto Espinoza w/ BLM verified cmt @ surface via picture text message. Welded on "Above Ground Dry Hole Marker". Backfilled cellar, cut off deadmen, cleaned location, and moved off.

RECLAMATION
DUE 12-10-22

Well Name: SHOGART B

Well Location: T18S / R31E / SEC 11 /
NWSW /County or Parish/State: EDDY /
NM

Well Number: 4

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMLC062052

Unit or CA Name:

Unit or CA Number:

US Well Number: 3001505520

Well Status: Abandoned

Operator: HUDSON OIL
COMPANY OF TEXAS**Operator**

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: EDWARD HUDSON IV

Signed on: JUN 17, 2022 09:16 AM

Name: HUDSON OIL COMPANY OF TEXAS

Title: Land Manager

Street Address: 616 TEXAS STREET

City: FORT WORTH

State: TX

Phone: (817) 336-7109

Email address: EDWARD@HUDSONOIL.COM

Field

Representative Name: Frank Galindo

Street Address: 29 Sand Road

City: Maljamar

State: NM

Zip: 88264

Phone: (575)365-8165

Email address: frankg@hudsonoil.com

BLM Point of Contact

BLM POC Name: JAMES A AMOS

BLM POC Title: Acting Assistant Field Manager

BLM POC Phone: 5752345927

BLM POC Email Address: jamos@blm.gov

Disposition: Accepted

Disposition Date: 06/21/2022

Signature: James A Amos

District I
1625 N. French Dr., Hobbs, NM 88240
Phone:(575) 393-6161 Fax:(575) 393-0720

District II
811 S. First St., Artesia, NM 88210
Phone:(575) 748-1283 Fax:(575) 748-9720

District III
1000 Rio Brazos Rd., Aztec, NM 87410
Phone:(505) 334-6178 Fax:(505) 334-6170

District IV
1220 S. St Francis Dr., Santa Fe, NM 87505
Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 150177

CONDITIONS

Operator: HUDSON OIL COMPANY OF TEXAS 616 Texas Street Fort Worth, TX 76102	OGRID: 25111
	Action Number: 150177
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	10/13/2022