
### OCD: 7/26/2022 8:09:21 AM R


Received by OCD: 7/26/2022 8	:09:21 AM			Page 1 of
				FORM APPROVED OMB No. 1004-0137 Expires: January 31, 2018 5. Lease Serial No.
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.				6. If Indian, Allottee or Tribe Name
SUBMIT IN TRIPLICATE - Other instructions on page 2				7. If Unit of CA/Agreement, Name and/or No.
1. Type of Well Oil Well Gas				8. Well Name and No. CATO SAN ANDRES UNIT #082
2. Name of Operator OXY USA INC.				9. API Well No. 30-005-10525
3a. Address PO BOX 4294 HOUSTON, TX 77210	3b	o. Phone No. <i>(include area cod</i> 172) 404-3722		10. Field and Pool or Exploratory Area CATO; SAN ANDRES
4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description) 330 FNL, 330 FWL, UNIT D, SEC 13, T8S R30E				11. Country or Parish, State CHAVES
12. CH	ECK THE APPROPRIATE BOX	(ES) TO INDICATE NATURI	E OF NOTI	ICE, REPORT OR OTHER DATA
TYPE OF SUBMISSION		TYPE OF ACTION		
Notice of Intent	Acidize	Deepen Hydraulic Fracturing	=	luction (Start/Resume) Water Shut-Off amation Well Integrity
Subsequent Report	Casing Repair Change Plans	New Construction <ul> <li>Plug and Abandon</li> </ul>	=	pomplete Other porarily Abandon
Final Abandonment Notice	Convert to Injection	Plug Back	Wate	er Disposal
the proposal is to deepen direction the Bond under which the work w completion of the involved operat completed. Final Abandonment N is ready for final inspection.)	hally or recomplete horizontally, g ill be perfonned or provide the B ions. If the operation results in a otices must be filed only after all	give subsurface locations and r ond No. on file with BLM/BIA multiple completion or recomp requirements, including reclar	measured an A. Required pletion in a mation, have	late of any proposed work and approximate duration thereof. If nd true vertical depths of all pertinent markers and zones. Attach I subsequent reports must be filed within 30 days following new interval, a Form 3160-4 must be filed once testing has been re been completed and the operator has detennined that the site SD PLUGGING PROCEDURE.

See Conditions of Approval

14. I hereby certify that the foregoing is true and correct. Name ( <i>Printed/Typed</i> ) STEPHEN JANACEK	REGULATORY ENGINEER Title				
Signature Stephen Janacek	Date 07/21/2022				
Accepted for record – NMOCD gc 10/26/2022 HE SPACE FOR FEDERAL OR STATE OFICE USE					
Approved by	Title Petroleum Engineer Date 07/21/2022				
Conditions of approval, if any, are attached. Approval of this notice does not warrant certify that the applicant holds legal or equitable title to those rights in the subject lead which would entitle the applicant to conduct operations thereon.					
Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for an any false, fictitious or fraudulent statements or representations as to any matter within	person knowingly and willfully to make to any department or agency of the United Sta its jurisdiction.				

(Instructions on page 2)

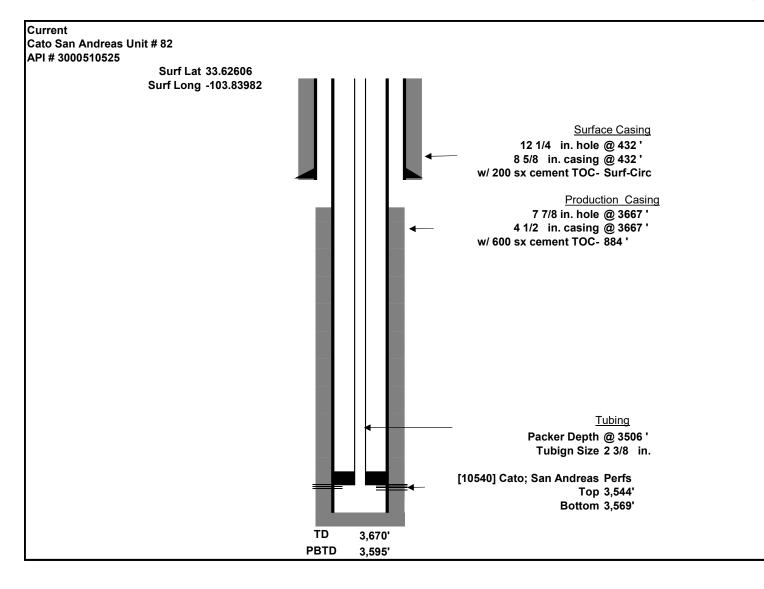

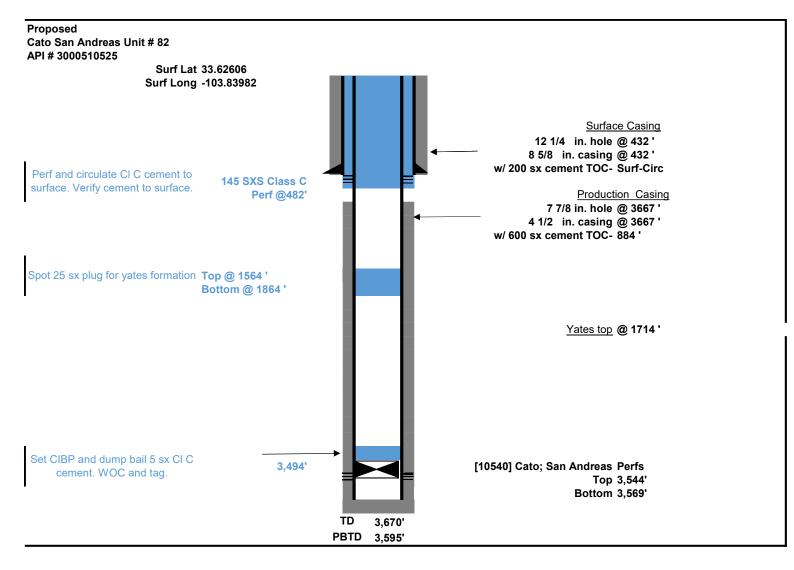

Notice of Intent to PA- Procedure

API # 3000510525

Oxy USA Inc.

10# MLF between plugs. Utilize above ground steel tanks.

1. SET CIBP @ 3494ft. DUMP 5 SX CLASS C CMT. WOC AND TAG

2. Balance Plug @ 1864ft. SPOT 25 SXS IN CSG. WOC AND TAG

3. P&S SURFACE PLUG@ 482ft. SQUEEZE 145 SXS CSG. CONFIRM CMT TO SURFACE

Cato San Andres Unit 82 30-005-10525 Oxy USA Incorporated July 21, 2022 Conditions of Approval

- 1. Operator shall place CIBP at 3,494' (50'-100' above top most perf) and place a minimum of 25 sx of Class C cement on top. <u>WOC and TAG.</u>
- 2. Operator shall place a balanced Class C cement plug from 1,864'-1,564' as proposed to seal the Yates formation. Yates formation top at 1,714' must be isolated.
- 3. Operator shall perf at 482' and squeeze cement to surface to seal the 8-5/8'' casing shoe.
- 4. Dry hole marker must be below ground.
- 5. Surface reclamation will need to be completed once the well bore has been plugged. Please contact <u>rflores@blm.gov</u> for additional information.
- 6. See Attached for general plugging stipulations.

JAM 07212022

### BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 W. Second Street Roswell, New Mexico 88201 575-627-0272

## **General Requirements for Plug Backs**

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from this approval.

If you are unable to plug back the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged back. Failure to do so will result in enforcement action.

# 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plug back operations. Call 575-627-0205.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. **Before pumping cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.** 

Unless otherwise specified in the approved procedure, the cement plug shall consist of either **Neat Class** "C", for up to 7,500 feet of depth or **Neat Class** "H", for deeper than 7,500 feet plugs.

6. <u>Subsequent Plug back Reporting</u>: Within 30 days after plug back work is completed, file one original and three copies of the Subsequent Report, Form 3160-5 to BLM. The report should give in detail the manner in which the plug back work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date work was completed.</u>

7. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

## **State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. Santa Fe, NM 87505

COMMENTS

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	128645
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)
COMMENTS	

#### Created By Comment Comment Date DATA ENTRY PM plmartinez

COMMENTS

Page 7 of 8

Action 128645

10/27/2022

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	128645
Γ	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)
CONDITIONS	

### Created By Condition Condition Date 10/26/2022 None gcordero

Page 8 of 8

.

Action 128645