
Form 3160-5 (June 2015)


UNITED STATES DEPARTMENT OF THE INTERIOR

FORM APPROVED OMB No. 1004-0137 Expires: January 31, 2018

BUREAU OF LAND MANAGEMENT	5. Lease Serial No.
SUNDRY NOTICES AND REPORTS ON V Do not use this form for proposals to drill or to abandoned well. Use Form 3160-3 (APD) for su	o re-enter an
SUBMIT IN TRIPLICATE - Other instructions on pag	7. If Unit of CA/Agreement, Name and/or No.
1. Type of Well ✓ Oil Well Gas Well Other	8. Well Name and No. CATO SAN ANDRES UNIT #133
2. Name of Operator OXY USA INC.	9. API Well No. 30-005-20125
<u> </u>	(include area code) 10. Field and Pool or Exploratory Area
4. Location of Well (Footage, Sec., T.,R.,M., or Survey Description) 1980 FNL, 1980 FWL, UNIT F, SEC 23, T8S R30E	11. Country or Parish, State CHAVES
12. CHECK THE APPROPRIATE BOX(ES) TO IN	DICATE NATURE OF NOTICE, REPORT OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTION
✓ Notice of Intent ☐ Acidize ☐ Dee ☐ Alter Casing ☐ Hyd	pen Production (Start/Resume) Water Shut-Off well Integrity
Subsequent Report S	Construction Recomplete Other and Abandon Temporarily Abandon
Final Abandonment Notice Convert to Injection Plug	Back Water Disposal
is ready for final inspection.) PLEASE SEE ATTACHED CURRENT WELLBORE, PROPOSED WE	Is, including reclamation, have been completed and the operator has detennined that the site LLBORE, AND PROPOSED PLUGGING PROCEDURE. See Conditions of Approval
14. I hereby certify that the foregoing is true and correct. Name (<i>Printed/Typed</i>) STEPHEN JANACEK	REGULATORY ENGINEER Title
Signature Stephen Janacele	Date 10/11/2022
repted for record – NMOCD gc10/26/2022 THE SPACE FOR FED	ERAL OR STATE OFICE USE
Approved by	Petroleum Engineer Date 10/11/2022
Conditions of approval, if any, are attached. Approval of this notice does not warrar certify that the applicant holds legal or equitable title to those rights in the subject lewhich would entitle the applicant to conduct operations thereon.	nt or
Title 18 U.S.C Section 1001 and Title 43 U.S.C Section 1212, make it a crime for a any false, fictitious or fraudulent statements or representations as to any matter with	ny person knowingly and willfully to make to any department or agency of the United States in its jurisdiction.

(Instructions on page 2)

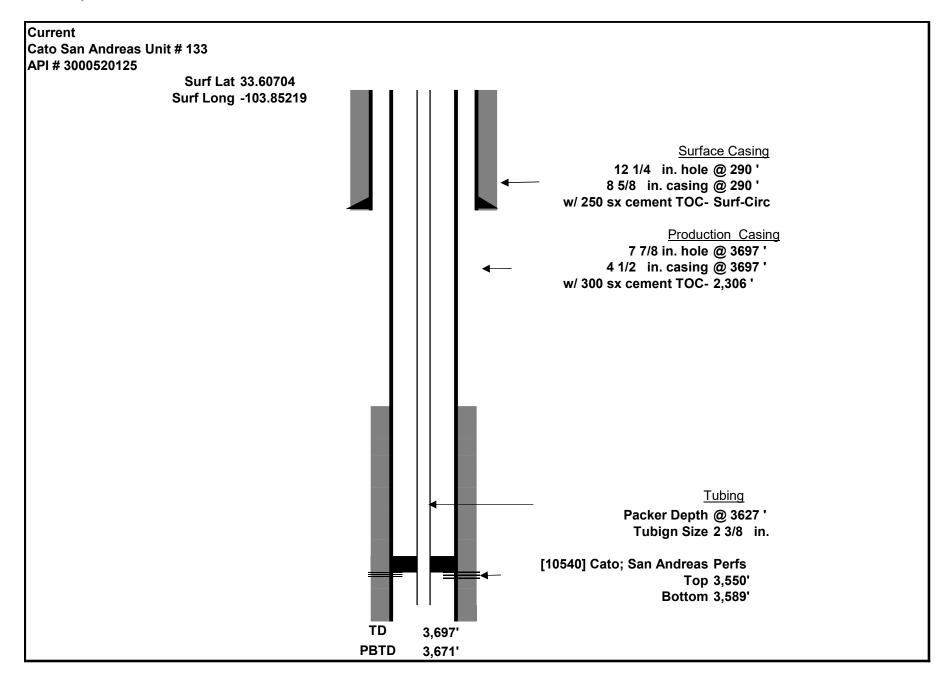

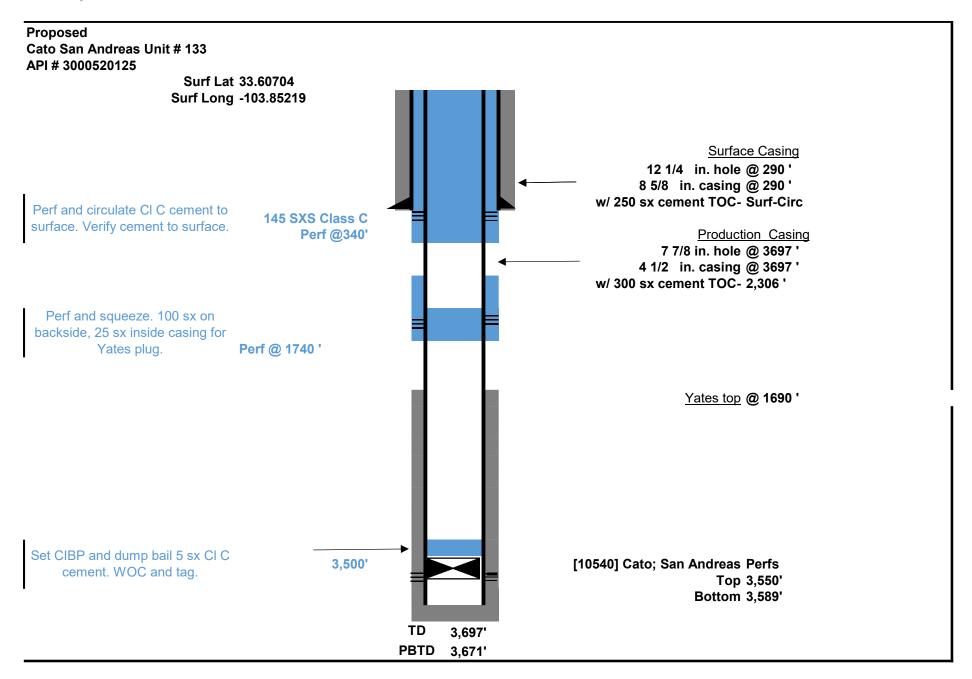

Notice of Intent to PA- Procedure

API # 3000520125

Oxy USA Inc.

10# MLF between plugs. Utilize above ground steel tanks.

- 1. SET CIBP @ 3500ft. DUMP 5 SX CLASS C CMT. WOC AND TAG
- 2. P&S @ 1740ft. SQUEEZE 100 SXS INTO CSG SPOT 25 SXS IN TBG. WOC AND TAG
- 3. P&S SURFACE PLUG@ 340ft. SQUEEZE 145 SXS CSG. CONFIRM CMT TO SURFACE

BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 W. Second Street Roswell, New Mexico 88201 575-627-0272

General Requirements for Plug Backs

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from this approval.

If you are unable to plug back the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged back. Failure to do so will result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plug back operations. Call 575-627-0205.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. **Before pumping cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either **Neat Class** "C", for up to 7,500 feet of depth or **Neat Class** "H", for deeper than 7,500 feet plugs.

- 6. <u>Subsequent Plug back Reporting:</u> Within 30 days after plug back work is completed, file one original and three copies of the Subsequent Report, Form 3160-5 to BLM. The report should give in detail the manner in which the plug back work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date work was completed.**
- 7. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Cato San Andres Unit 133 30-005-20125 Oxy USA Incorporated October 11, 2022 Conditions of Approval

- 1. Operator shall place CIBP at 3,500' (50'-100' above top most perf) and place a minimum of 25 sx of Class C cement on top. WOC and TAG.
- 2. Operator shall perf at 1,740' and squeeze 100sx class C cement as proposed. Must tag a minimum of 1,170' to seal the Yates and Salt Formations. WOC and TAG.
- 3. Operator shall perf at 340' and squeeze class c cement to surface to seal the 8-5/8' casing shoe.
- 4. Dry hole marker must be below ground.
- 5. Surface reclamation will need to be completed once the well bore has been plugged. Please contact reflores@blm.gov for additional information.
- 6. See Attached for general plugging stipulations.

JAM 10112022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 150567

COMMENTS

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	150567
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM	10/27/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 150567

CONDITIONS

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	150567
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
gcordero	None	10/26/2022