Form 3160-5 (June 2015)

UNITED STATES DEPARTMENT OF THE INTERIOR


FORM APPROVED
OMB No. 1004-0137
Expires: January 31, 201


DEFARTMENT OF THE	INTERIOR
BUREAU OF LAND MAN	NAGEMENT

BUR	EAU OF LAND MAN	AGEMENT		5. Lease Serial No.	NMNM-0354427A
Do not use this f	OTICES AND REPO form for proposals t Use Form 3160-3 (A	o drill or to re-	enter an	6. If Indian, Allottee	or Tribe Name
	TRIPLICATE - Other instru	uctions on page 2		7. If Unit of CA/Ag	reement, Name and/or No. NMNM-82050X
1. Type of Well Oil Well Gas W	/ell Other			8. Well Name and N	O. CATO SAN ANDRES UNIT #125
2. Name of Operator OXY USA INC.	<u> </u>			9. API Well No. 30-	005-20146
3a. Address PO BOX 4294 HOUSTON, TX 77210		3b. Phone No. (include) (972) 404-3722	ıde area code		r Exploratory Area
4. Location of Well (Footage, Sec., T.,R 660 FNL, 1980 FWL, UNIT C, SEC				11. Country or Paris CHAVES	h, State
12. CHE	CK THE APPROPRIATE B	OX(ES) TO INDICA	TE NATURE	OF NOTICE, REPORT OR O	THER DATA
TYPE OF SUBMISSION			TYI	PE OF ACTION	
✓ Notice of Intent	Acidize Alter Casing	Deepen Hydraulic	Fracturing	Production (Start/Resume	Water Shut-Off Well Integrity
Subsequent Report	Casing Repair Change Plans	New Cons Plug and A		Recomplete Temporarily Abandon	Other
Final Abandonment Notice	Convert to Injection	= -		Water Disposal	
PLEASE SEE ATTACHED CU SUBJECT TO LIKE APPROVAL BY BLM		X +		ROPOSED PLUGGING PRO	
14. I hereby certify that the foregoing is	true and correct. Name (Pri	inted/Typed)			
STEPHEN JANACEK		Title		ORY ENGINEER	
Signature Stephen	lonacek	Date	2	10/20/	/2022
	THE SPACE	FOR FEDERA	L OR ST	ATE OFICE USE	
Approved by			Pe Title	troleum Engineer	10/24/2022 Date
Conditions of approval, if any, are attack certify that the applicant holds legal or e which would entitle the applicant to con	equitable title to those rights		Office	RFO	
Title 18 U.S.C Section 1001 and Title 43	3 U.S.C Section 1212, make	it a crime for any per	son knowing	ly and willfully to make to any	department or agency of the United States

any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

(Instructions on page 2)

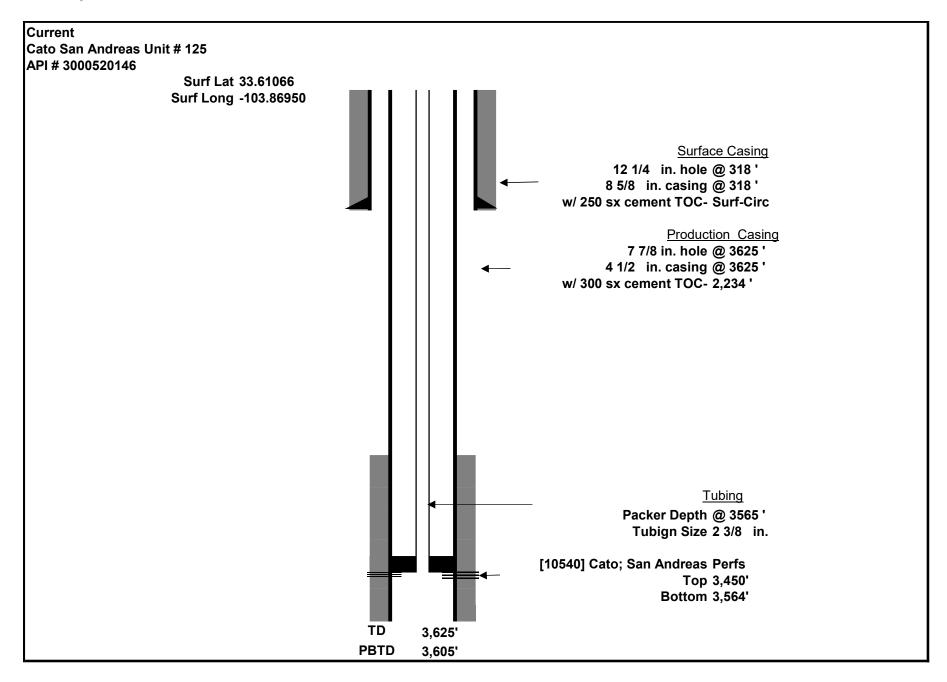

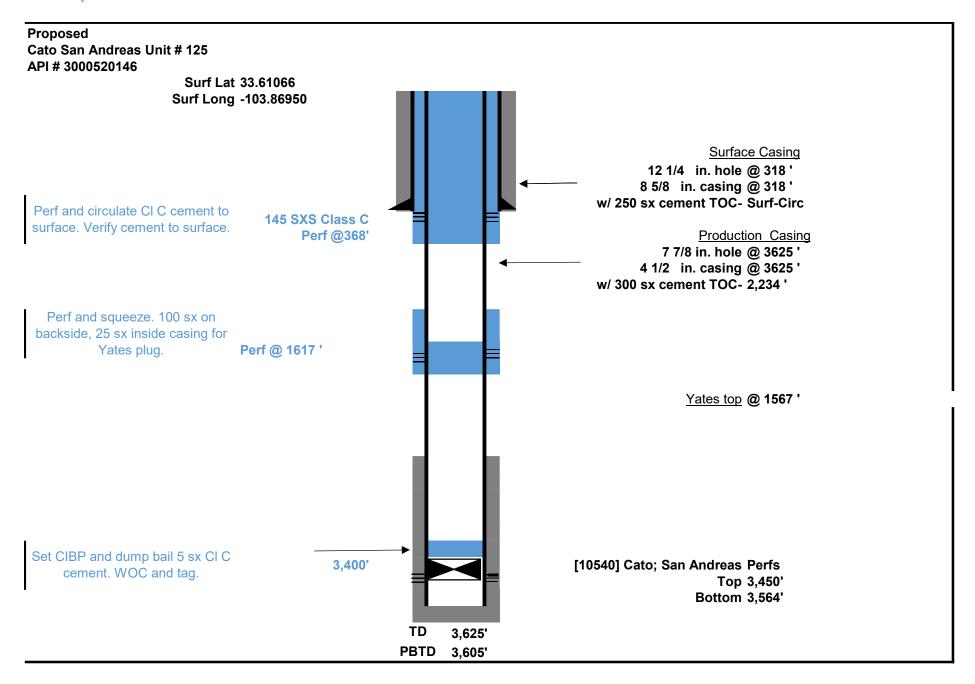

Notice of Intent to PA- Procedure

API # 3000520146

Oxy USA Inc.

10# MLF between plugs. Utilize above ground steel tanks.

- 1. SET CIBP @ 3400ft. DUMP 5 SX CLASS C CMT. WOC AND TAG
- 2. P&S @ 1617ft. SQUEEZE 100 SXS INTO CSG SPOT 25 SXS IN TBG. WOC AND TAG
- 3. P&S SURFACE PLUG@ 368ft. SQUEEZE 145 SXS CSG. CONFIRM CMT TO SURFACE

Cato San Andres Unit 125 30-005-20146 Oxy USA Incorporated October 24, 2022 Conditions of Approval

- 1. Operator shall place CIBP at 3,400' (50'-100' above top most perf) and place a minimum of 25 sx of Class C cement on top. WOC and TAG.
- 2. Operator shall perf at 1,617' and squeeze cement to 1,090'. WOC and TAG.
- 3. Operator shall perf at 368' and squeeze class c cement to surface to seal the 8-5/8'' casing shoe.
- 4. Dry hole marker must be below ground.
- 5. Surface reclamation will need to be completed once the well bore has been plugged. Please contact rflores@blm.gov for additional information.
- 6. See Attached for general plugging stipulations.

JAM 10242022

BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 W. Second Street Roswell, New Mexico 88201 575-627-0272

General Requirements for Plug Backs

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from this approval.

If you are unable to plug back the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged back. Failure to do so will result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plug back operations. Call 575-627-0205.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. **Before pumping cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either **Neat Class** "C", for up to 7,500 feet of depth or **Neat Class** "H", for deeper than 7,500 feet plugs.

- 6. <u>Subsequent Plug back Reporting:</u> Within 30 days after plug back work is completed, file one original and three copies of the Subsequent Report, Form 3160-5 to BLM. The report should give in detail the manner in which the plug back work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date work was completed.**
- 7. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

COMMENTS

Action 153345

COMMENTS

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	153345
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

COMMENTS

Created By	Comment	Comment Date
plmartinez	DATA ENTRY PM	11/28/2022

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 153345

CONDITIONS

Operator:	OGRID:
OXY USA INC	16696
P.O. Box 4294	Action Number:
Houston, TX 772104294	153345
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
kfortne	Like approval from BLM	11/22/2022