Sundry Print Report

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Well Name: POKER LAKE UNIT Well Location: T24S / R30E / SEC 8 / County or Parish/State: EDDY /

LOT M / SWSW / 32.13362 / -103.54343 N

Well Number: 223 Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMLC068431 Unit or CA Name: POKER LAKE Unit or CA Number:

DELAWARE C NMNM71016G

US Well Number: 3001533642 Well Status: Producing Oil Well Operator: XTO PERMIAN

OPERATING LLC

Accepted for record – NMOCD gc2/2/2023

LONG VO Date: 2023.01.28 10:11:46
-06'00'

Notice of Intent

Sundry ID: 2706565

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 12/08/2022 Time Sundry Submitted: 08:13

Date proposed operation will begin: 02/13/2023

Procedure Description: XTO Permian Operating LLC respectfully submits a NOI to PA for the well above. attached is a procedure for your review along with the current and proposed WBD

Surface Disturbance

Is any additional surface disturbance proposed?: No

Approval Subject to

General Requirements and

Special Stipulations

Attached

NOI Attachments

Procedure Description

PLU_223_Proposed_WBD_20221208201242.pdf

 $PLU_223_Procedure_20221208201224.pdf$

PLU_223_DHWP_20221208201201.pdf

eceived by OCD: 2/1/2023 3:56:48 AM
Well Name: POKER LAKE UNIT

Well Location: T24S / R30E / SEC 8 /

LOT M / SWSW / 32.13362 / -103.54343

Well Number: 223 Type of Well: OIL WELL

Allottee or Tribe Name:

County or Parish/State: EDDY? of

Lease Number: NMLC068431 Un

Unit or CA Name: POKER LAKE

DELAWARE C

Unit or CA Number:

NMNM71016G

US Well Number: 3001533642 Well Status: Producing Oil Well Operate

Operator: XTO PERMIAN OPERATING LLC

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: CASSIE EVANS Signed on: DEC 08, 2022 08:12 PM

Name: XTO PERMIAN OPERATING LLC

Title: Regulatory Analyst

Street Address: 6401 Holiday Hill Road, Bldg 5

City: Midland State: TX

Phone: (432) 218-3671

Email address: CASSIE.EVANS@EXXONMOBIL.COM

Field

Representative Name:

Street Address:

Citv:

State:

Zip:

Phone:

Email address:

Page 2 of 2

PLUG AND ABANDON WELLBORE POKER LAKE UNIT 223 EDDY COUNTY, NEW MEXICO Class II

MASIP	MAOP	MAWP	Surface Csg Yield		
1,000 psi	1,000 psi	3,000 psi	3,930 psi		

SUMMARY: Plug and abandon wellbore according to BLM regulations.


- 1) MIRU plugging company. Set open top steel pit for plugging.
- 2) POOH LD rods and pump.
- ND WH and NU 3K manual BOP. Function test BOP.
- 4) Unset TAC at 7307', POOH 2-7/8" tubing.
- 5) MIRU WLU, RIH GR sized for 5-1/2" 15.50# casing to 7335', RIH CIBP and set at 7335'. Propose no pressure test due to upper perforated interval. Notify BLM. Dump bail 35' Class C from 7335' to 7290' (T/Bone Spring Perf).
- 6) RIH second CIBP and set at 6640'. Notify BLM. Pressure test CIBP to 500 PSIG for 30 min. Spot 25 SKS Class C from 6640' to 6400' (T/Perf). WOC, tag and notify BLM.
- 7) MIRU WLU, perforate at 3605'.
- 8) Squeeze 842 SKS Class C from 3605' to surface (T/Delaware, B/Salt, T/Salt, 8-5/8" shoe, fresh water, surface plug). Stage as appropriate. WOC, tag and notify BLM. Verify at surface. (In 365 sxs/Out 316+161 sxs)
- 9) ND BOP and cut off wellhead 5' below surface. RDMO PU and trucks.
- 10) Set P&A marker.
- 11) Pull fluid from steel tank and haul to disposal. Release steel tank.

Received by OCD: 2/1/2023 3:56:48 AM



Downhole Well Profile - with Schematic Well Name: POKER LAKE UNIT 223

SAP Cost Center ID Permit Number State/Province County 3001533642 1137961001 **New Mexico** Eddy Surface Location Spud Date KB-Ground Distance (ft) Original KB Elevation (ft) Ground Elevation (ft) Surface Casing Flange Elevation (ft) T24S-R30E-S08 19.90 3/11/2005 00:15 3,217.90 3,198.00

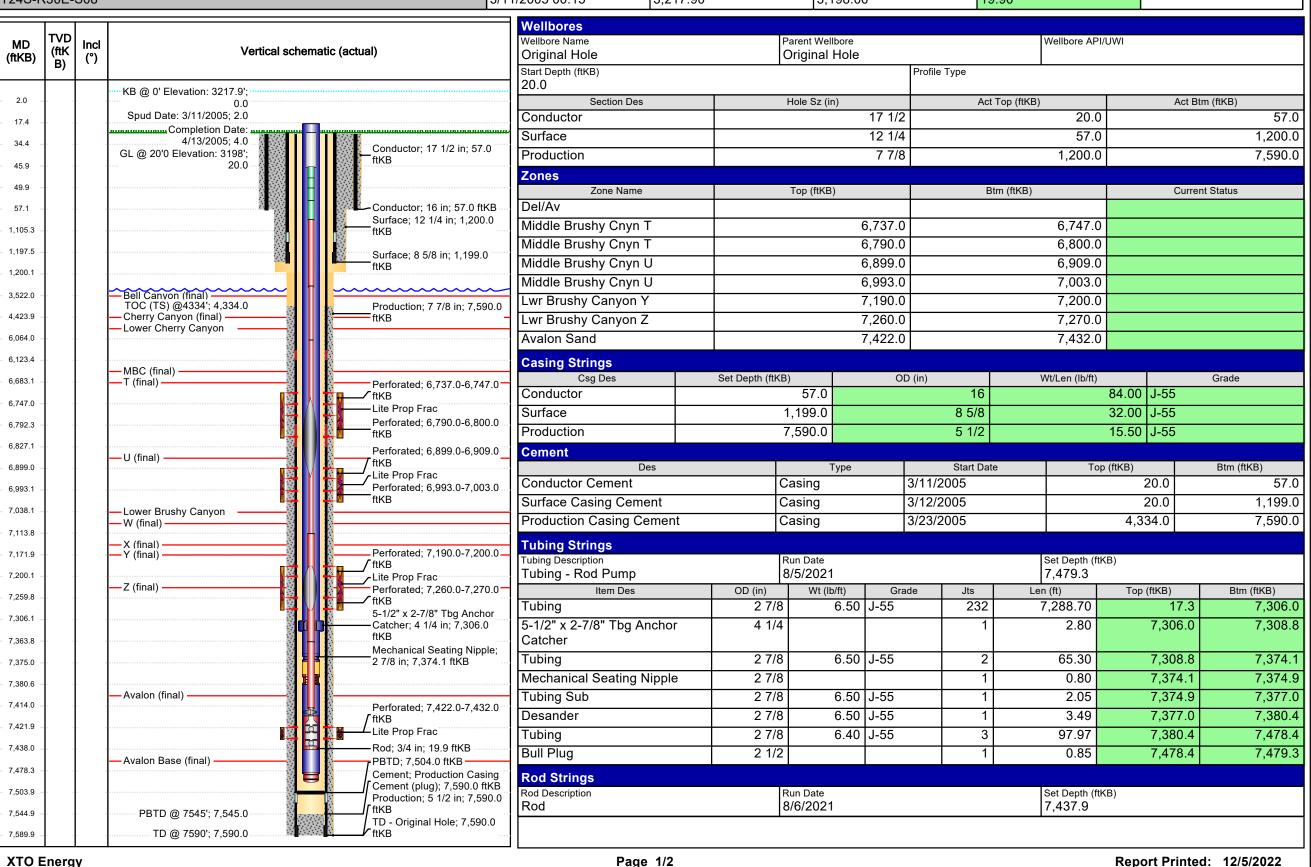


Received by OCD: 2/1/2023 3:56:48 AM



Downhole Well Profile - with Schematic Well Name: POKER LAKE UNIT 223

SAP Cost Center ID Permit Number State/Province County 3001533642 1137961001 Eddy New Mexico Surface Location Spud Date Original KB Elevation (ft) KB-Ground Distance (ft) Ground Elevation (ft) Surface Casing Flange Elevation (ft) 3,217.90 T24S-R30E-S08 3/11/2005 00:15 3,198.00 19.90

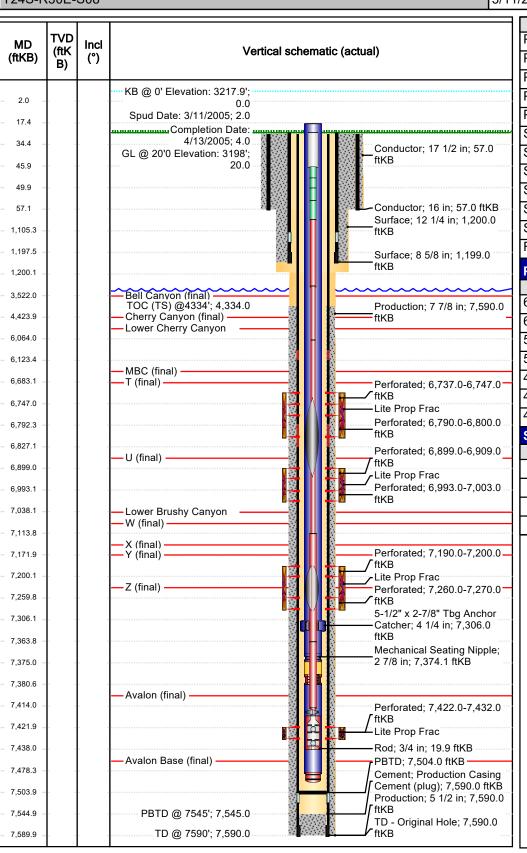

Item Des	OD (in)	Wt (lb/ft)	Grade	Jts	Len (ft)	Top (ftKB)	Btm (ftKB)
Polished Rod	1 1/2		SM	1	26.00	19.9	45.9
Pony Rod	7/8		KD	1	2.00	45.9	47.9
Pony Rod	7/8		KD	1	2.00	47.9	49.9
Pony Rod	7/8		KD	1	6.00	49.9	55.9
Pony Rod	7/8		KD	1	8.00	55.9	63.9
Sucker Rod	7/8		N-97	111	2,775.00	63.9	2,838.9
Sucker Rod	3/4		N-97	129	3,225.00	2,838.9	6,063.9
Sucker Rod w/Snap On Guides	3/4		D	42	1,050.00	6,063.9	7,113.9
Sucker Rod w/Snap On Guides	1		D	10	250.00	7,113.9	7,363.9
Sucker Rod	1		D-90	2	50.00	7,363.9	7,413.9
Sucker Rod w/Molded Guides	3/4		D	1	4.00	7,413.9	7,417.9
Rod Insert Pump	2 1/2			1	20.00	7,417.9	7,437.9

ļ	Perforations			
1	Date	Top (ftKB)	Btm (ftKB)	Linked Zone
1	6/2/2009	6,737.0		Middle Brushy Cnyn T, Original Hole
1	6/2/2009	6,790.0		Middle Brushy Cnyn T, Original Hole
l	5/30/2009	6,899.0		Middle Brushy Cnyn U, Original Hole
l	5/30/2009	6,993.0		Middle Brushy Cnyn U, Original Hole
1	4/4/2005	7,190.0		Lwr Brushy Canyon Y, Original Hole
ļ	4/4/2005	7,260.0		Lwr Brushy Canyon Z, Original Hole
l	4/1/2005	7,422.0	7,432.0	Avalon Sand, Original Hole

Stimulation intervals					
Interval Number	Top (ftKB)	Btm (ftKB)	AIR (bbl/min)	MIR (bbl/min)	Proppant Total (lb)
1	7,422.0	7,432.0			0.0
2	7,190.0	7,270.0			0.0
1	6,899.0	7,003.0			0.0
2	6,737.0	6,800.0			0.0
	_	·	·	_	-

Page 2/2 Report Printed: 12/5/2022

XTO Energy

Sundry ID 2706565

Sundry ID	2706565						
Plug Type	Тор	Bottom	Length	Tag	Sacks	Cement Class	Notes
1.109 1760	1.00			_ · J			
Surface Plug	0.00	100.00		Tag/Verify			
Fresh Water @ 642	585.58			base no			
Shoe Plug	1137.01	1249.00	111.99	Tag/Verify			
Top of Salt @ 1329 Base of Salt @ 3280	1265.71 3197.20			Tag/Verify Tag/Verify	325.00	С	Perf and squeeze cement from 1379' to surface. (In 140 sxs/Out 185 sxs) Verify at surface.
2000 01 0011 @ 0200	0107.20	0000.00	102.00	,			
Delaware @ 3522	3436.78	3605.00	168.22	If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio	96.00	C	Perf and squeeze cement from 3605' to 3197'. WOC and Tag. (In 42 sxs/Out 54 sxs)
Delaware & 0022	0400.70	0000.00	100.22	110	00.00		o i onoj
CIBP Plug	6605.00				25.00	С	Set CIBP at 6640' to 6605'. Leak Test CIBP. Spot 25 sxs on top.
Perforations Plug (If No CIBP)	6687.00			Tag/Verify			
Perforations Plug (If No CIBP)	7140.00			Tag/Verify base no			
Bonesprings @ 7299	7176.01	7349.00	172.99	nase 110			<u> </u>

				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no Open Perforatio			Set CIBP at 7335'. Dump bail 35' on
CIBP Plug	7300.00	7335.00			4.00	С	top. WOC and Tag.
Perforations Plug (If No CIBP)	7307.68	7482.00	174.32	Tag/Verify			
Shoe Plug	7464.10	7640.00	175.90	Tag/Verify			

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.

Class H >7500'

Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater

R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement Shoe @	Secretary 1199.00		Top of Salt to surface
Shoe @	7590.00	тос @	4334.00
Perforatons Top @ Perforatons Top @ Perforatons Top @	7190.00 7422.00 6737.00	Perforations Perforations Perforations	7270.00 7432.00 7003.00
		CIBP @ CIBP @	7335.00 6640.00

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612

Poker Lake Unit 223 - Proposed WBD

8-5/8" shoe 1199'

T/Salt 1329'

B/Salt 3280'

T/Delaware 3494'

5-1/2" TOC 4334'

T/Perf 6737'

T/Bone Spring 7306'


T/Bone Spring Perf 7422'

Approval Subject to

General Requirements and

Special Stipulations

Attached

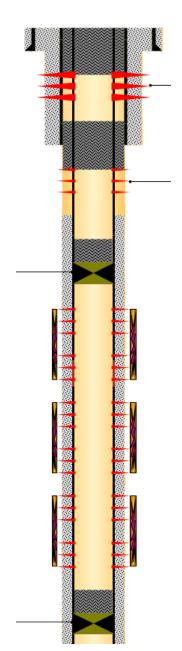

Circulate ~25 SKS Class C: 100' to surface.

Squeeze 775 SKS Class C: 3544' – 1099'. WOC and tag.

Spot 25 SKS Class C atop CIBP: 6640' – 6400'. Pressure test to 500 PSIG for 30 min. WOC and TTOC.

Dump bail 35' Class C atop CIBP: 7325' – 7290'. WOC and tag.


Received by OCD: 2/1/2023 3:56:48 AM

Page 15 of 31



Downhole Well Profile - with Schematic Well Name: POKER LAKE UNIT 223

SAP Cost Center ID Permit Number State/Province County 3001533642 1137961001 **New Mexico** Eddy Surface Location Spud Date KB-Ground Distance (ft) Original KB Elevation (ft) Ground Elevation (ft) Surface Casing Flange Elevation (ft) T24S-R30E-S08 19.90 3/11/2005 00:15 3,217.90 3,198.00

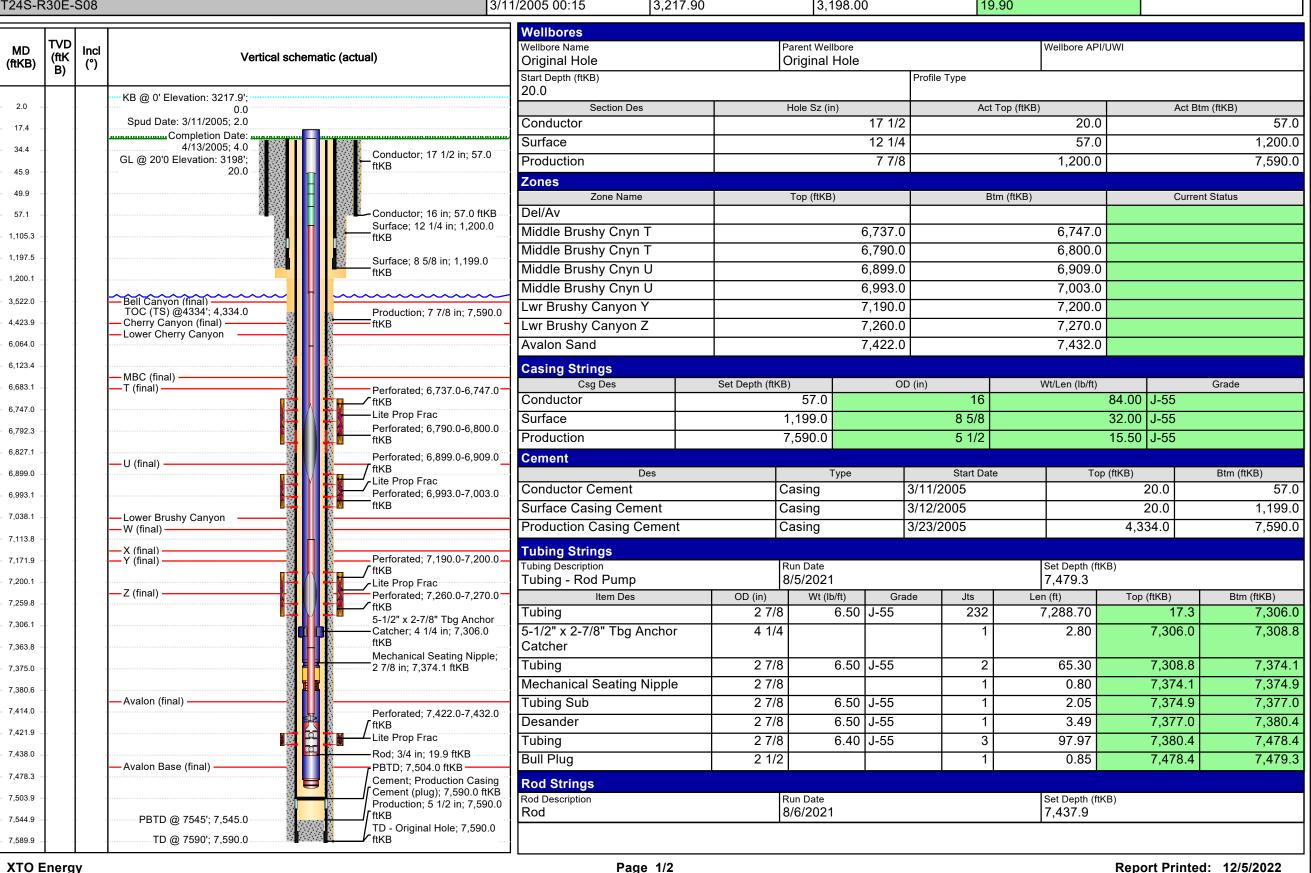


Received by OCD: 2/1/2023 3:56:48 AM

Page 16 of 31



Downhole Well Profile - with Schematic Well Name: POKER LAKE UNIT 223

SAP Cost Center ID Permit Number State/Province County 1137961001 Eddy 3001533642 New Mexico Surface Location Spud Date Original KB Elevation (ft) KB-Ground Distance (ft) Ground Elevation (ft) Surface Casing Flange Elevation (ft) 3,217.90 T24S-R30E-S08 3/11/2005 00:15 3,198.00 19.90

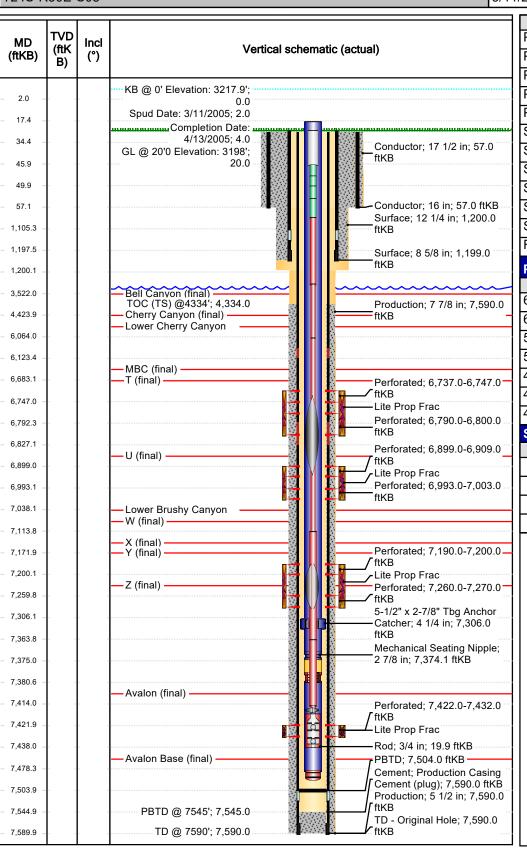

Item Des	OD (in)	Wt (lb/ft)	Grade	Jts	Len (ft)	Top (ftKB)	Btm (ftKB)
Polished Rod	1 1/2		SM	1	26.00	19.9	45.9
Pony Rod	7/8		KD	1	2.00	45.9	47.9
Pony Rod	7/8		KD	1	2.00	47.9	49.9
Pony Rod	7/8		KD	1	6.00	49.9	55.9
Pony Rod	7/8		KD	1	8.00	55.9	63.9
Sucker Rod	7/8		N-97	111	2,775.00	63.9	2,838.9
Sucker Rod	3/4		N-97	129	3,225.00	2,838.9	6,063.9
Sucker Rod w/Snap On Guides	3/4		D	42	1,050.00	6,063.9	7,113.9
Sucker Rod w/Snap On Guides	1		D	10	250.00	7,113.9	7,363.9
Sucker Rod	1		D-90	2	50.00	7,363.9	7,413.9
Sucker Rod w/Molded Guides	3/4		D	1	4.00	7,413.9	7,417.9
Rod Insert Pump	2 1/2			1	20.00	7,417.9	7,437.9

ļ	Perforations			
ł	Date	Top (ftKB)	Btm (ftKB)	Linked Zone
1	6/2/2009	6,737.0	· ·	Middle Brushy Cnyn T, Original Hole
1	6/2/2009	6,790.0		Middle Brushy Cnyn T, Original Hole
l	5/30/2009	6,899.0		Middle Brushy Cnyn U, Original Hole
l	5/30/2009	6,993.0	· ·	Middle Brushy Cnyn U, Original Hole
1	4/4/2005	7,190.0		Lwr Brushy Canyon Y, Original Hole
ļ	4/4/2005	7,260.0	7,270.0	Lwr Brushy Canyon Z, Original Hole
l	4/1/2005	7,422.0	7,432.0	Avalon Sand, Original Hole

Sumulation intervals	tilitulation intervals								
Interval Number	Top (ftKB)	Btm (ftKB)	AIR (bbl/min)	MIR (bbl/min)	Proppant Total (lb)				
1	7,422.0	7,432.0			0.0				
2	7,190.0	7,270.0			0.0				
1	6,899.0	7,003.0			0.0				
2	6,737.0	6,800.0			0.0				

Page 2/2 Report Printed: 12/5/2022

XTO Energy



U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Sundry Print Reports
01/19/2023

Well Name: POKER LAKE UNIT Well Location: T24S / R30E / SEC 8 / County or Parish/State: EDDY /

LOT M / SWSW / 32.13362 / -103.54343 NM

Well Number: 223 Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMLC068431 Unit or CA Name: POKER LAKE Unit or CA Number:

DELAWARE C NMNM71016G

US Well Number: 3001533642 Well Status: Producing Oil Well Operator: XTO PERMIAN

OPERATING LLC

Notice of Intent

Sundry ID: 2706565

Type of Submission: Notice of Intent

Type of Action: Plug and Abandonment

Date Sundry Submitted: 12/08/2022 Time Sundry Submitted: 08:13

Date proposed operation will begin: 02/13/2023

Procedure Description: XTO Permian Operating LLC respectfully submits a NOI to PA for the well above. attached is a procedure for your review along with the current and proposed WBD

Surface Disturbance

Is any additional surface disturbance proposed?: No

Approval Subject to

General Requirements and

Special Stipulations

Attached

NOI Attachments

Procedure Description

PLU_223_Proposed_WBD_20221208201242.pdf

PLU_223_Procedure_20221208201224.pdf

PLU_223_DHWP_20221208201201.pdf

eceived by OCD: 2/1/2023 3:56:48 AM
Well Name: POKER LAKE UNIT

Well Location: T24S / R30E / SEC 8 /

LOT M / SWSW / 32.13362 / -103.54343

County or Parish/State: Page 18 of

Well Number: 223

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMLC068431

Unit or CA Name: POKER LAKE

DELAWARE C

Unit or CA Number:

NMNM71016G

US Well Number: 3001533642

Well Status: Producing Oil Well

Operator: XTO PERMIAN

OPERATING LLC

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Signed on: DEC 08, 2022 08:12 PM **Operator Electronic Signature: CASSIE EVANS**

Name: XTO PERMIAN OPERATING LLC

Title: Regulatory Analyst

Street Address: 6401 Holiday Hill Road, Bldg 5

City: Midland State: TX

Phone: (432) 218-3671

Email address: CASSIE.EVANS@EXXONMOBIL.COM

Field

Representative Name:

Street Address:

City:

State:

Zip:

Phone:

Email address:

Page 2 of 2

PLUG AND ABANDON WELLBORE POKER LAKE UNIT 223 EDDY COUNTY, NEW MEXICO Class II

MASIP	MAOP	MAWP	Surface Csg Yield		
1,000 psi	1,000 psi	3,000 psi	3,930 psi		

SUMMARY: Plug and abandon wellbore according to BLM regulations.

- 1) MIRU plugging company. Set open top steel pit for plugging.
- 2) POOH LD rods and pump.
- 3) ND WH and NU 3K manual BOP. Function test BOP.
- 4) Unset TAC at 7307', POOH 2-7/8" tubing.
- 5) MIRU WLU, RIH GR sized for 5-1/2" 15.50# casing to 7335', RIH CIBP and set at 7335'. Propose no pressure test due to upper perforated interval. Notify BLM. Dump bail 35' Class C from 7335' to 7290' (T/Bone Spring Perf).
- 6) RIH second CIBP and set at 6640'. Notify BLM. Pressure test CIBP to 500 PSIG for 30 min. Spot 25 SKS Class C from 6640' to 6400' (T/Perf). WOC, tag and notify BLM.
- 7) MIRU WLU, perforate at 3605'.
- 8) Squeeze 842 SKS Class C from 3605' to surface (T/Delaware, B/Salt, T/Salt, 8-5/8" shoe, fresh water, surface plug). Stage as appropriate. WOC, tag and notify BLM. Verify at surface. (In 365 sxs/Out 316+161 sxs)
- 9) ND BOP and cut off wellhead 5' below surface. RDMO PU and trucks.
- 10) Set P&A marker.
- 11) Pull fluid from steel tank and haul to disposal. Release steel tank.


Received by OCD: 2/1/2023 3:56:48 AM

Page 20 of 31



Downhole Well Profile - with Schematic Well Name: POKER LAKE UNIT 223

SAP Cost Center ID Permit Number State/Province County 3001533642 1137961001 **New Mexico** Eddy Surface Location Spud Date KB-Ground Distance (ft) Original KB Elevation (ft) Ground Elevation (ft) Surface Casing Flange Elevation (ft) T24S-R30E-S08 19.90 3/11/2005 00:15 3,217.90 3,198.00

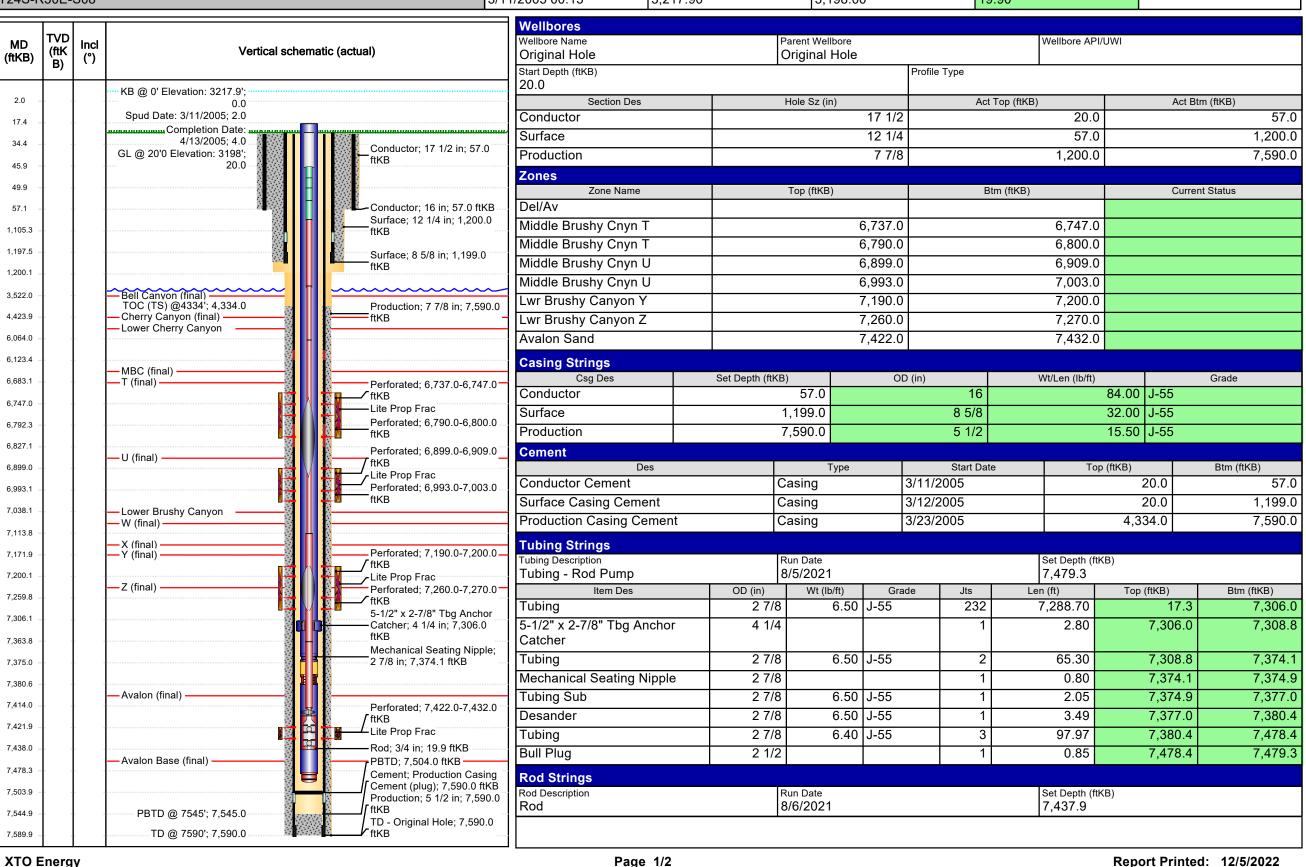


Received by OCD: 2/1/2023 3:56:48 AM

Page 21 of 31



Downhole Well Profile - with Schematic Well Name: POKER LAKE UNIT 223

SAP Cost Center ID Permit Number State/Province County 1137961001 Eddy 3001533642 New Mexico Surface Location Spud Date Original KB Elevation (ft) KB-Ground Distance (ft) Ground Elevation (ft) Surface Casing Flange Elevation (ft) 3,217.90 T24S-R30E-S08 3/11/2005 00:15 3,198.00 19.90

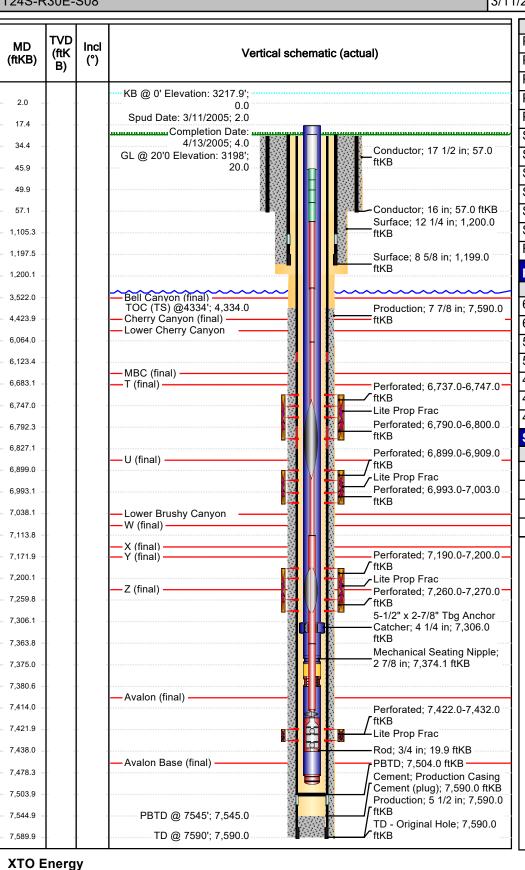

Item Des	OD (in)	Wt (lb/ft)	Grade	Jts	Len (ft)	Top (ftKB)	Btm (ftKB)
Polished Rod	1 1/2		SM	1	26.00	19.9	45.9
Pony Rod	7/8		KD	1	2.00	45.9	47.9
Pony Rod	7/8		KD	1	2.00	47.9	49.9
Pony Rod	7/8		KD	1	6.00	49.9	55.9
Pony Rod	7/8		KD	1	8.00	55.9	63.9
Sucker Rod	7/8		N-97	111	2,775.00	63.9	2,838.9
Sucker Rod	3/4		N-97	129	3,225.00	2,838.9	6,063.9
Sucker Rod w/Snap On Guides	3/4		D	42	1,050.00	6,063.9	7,113.9
Sucker Rod w/Snap On Guides	1		D	10	250.00	7,113.9	7,363.9
Sucker Rod	1		D-90	2	50.00	7,363.9	7,413.9
Sucker Rod w/Molded Guides	3/4		D	1	4.00	7,413.9	7,417.9
Rod Insert Pump	2 1/2			1	20.00	7,417.9	7,437.9

Perforations			
Date	Top (ftKB)	Btm (ftKB)	Linked Zone
6/2/2009	6,737.0		Middle Brushy Cnyn T, Original Hole
6/2/2009	6,790.0		Middle Brushy Cnyn T, Original Hole
5/30/2009	6,899.0		Middle Brushy Cnyn U, Original Hole
5/30/2009	6,993.0		Middle Brushy Cnyn U, Original Hole
4/4/2005	7,190.0		Lwr Brushy Canyon Y, Original Hole
4/4/2005	7,260.0	7,270.0	Lwr Brushy Canyon Z, Original Hole
4/1/2005	7,422.0	7,432.0	Avalon Sand, Original Hole

Sumulation intervals						
Interval Number	Top (ftKB)	Btm (ftKB)	AIR (bbl/min)	MIR (bbl/min)	Proppant Total (lb)	
1	7,422.0	7,432.0			0.0	
2	7,190.0	7,270.0			0.0	
1	6,899.0	7,003.0			0.0	
2	6,737.0	6,800.0			0.0	

Page 2/2 Report Printed: 12/5/2022

Sundry ID 2706565

Sundry ID	2706565			-			
						Cement	
Plug Type	Тор	Bottom	Length	Tag	Sacks	Class	Notes
Surface Plug	0.00			Tag/Verify			
Fresh Water @ 642	585.58			base no			
Shoe Plug	1137.01	1249.00	111.99	Tag/Verify			
							Perf and squeeze
							cement from 1379'
							to surface. (In 140
							sxs/Out 185 sxs)
Top of Salt @ 1329	1265.71			Tag/Verify	325.00	С	Verify at surface.
Base of Salt @ 3280	3197.20	3330.00	132.80	Tag/Verify			
				If solid			
				base no			
				need to			
				Tag			
				(CIBP			
				present			
				and/or			
				Mechanic			
				al Integrity			
				Test), If			
				Perf &			
				Sqz then			
				Tag, Leak			
				Test all			Perf and squeeze
				CIBP if no			cement from 3605'
				Open			to 3197'. WOC and
				Perforatio			Tag. (In 42 sxs/Out
Delaware @ 3522	3436.78	3605.00	168.22	ns	96.00	С	54 sxs)
				If solid			
				base no			
				need to			
				Tag			
				(CIBP			
				present			
				and/or			
				Mechanic			
				al Integrity			
				Test), If			
				Perf &			
				Sqz then			
				Tag, Leak			
				Test all			
				CIBP if no			Set CIBP at 6640' to
				Open			6605'. Leak Test
				Perforatio			CIBP. Spot 25 sxs
CIBP Plug	6605.00	6640.00	35.00		25.00	С	on top.
Perforations Plug (If No CIBP)	6687.00			Tag/Verify			
Perforations Plug (If No CIBP)	7140.00			Tag/Verify			
Bonesprings @ 7299	7176.01			base no			
ge @ . = 00	0.01	. 5 15.50	172.00			l	ı

				If solid base no need to Tag (CIBP present and/or Mechanic al Integrity Test), If Perf & Sqz then Tag, Leak Test all CIBP if no			
							Set CIBP at 7335'.
				Perforatio			Dump bail 35' on
CIBP Plug	7300.00	7335.00	35.00	ns	4.00	С	top. WOC and Tag.
Perforations Plug (If No CIBP)	7307.68	7482.00	174.32	Tag/Verify			
Shoe Plug	7464.10	7640.00	175.90	Tag/Verify			

No more than 2000' is to be allowed between plugs in open hole, and no more than 3000' between plugs in cased hole.

Class H >7500'

Class C<7500'

Fluid used to mix the cement in R111P shall be saturated with the salts common to the section penetrated, and in suitable proportions, but not more than 3% calcium chloride by weight of cement will be considered the desired mixture whenever possible.

Medium, Secretary: Top of salt to surface If no salt take the deepest fresh water or Karst Depth

High, Critical: Bottom of Karst to surface or Deepest fresh water, whichever is greater

R111P: 50 Feet from Base of Salt to surface.

Class C: 1.32 ft^3/sx Class H: 1.06 ft^3/sx

Onshore Order 2.III.G Drilling Abandonment Requirements: "All formations bearing usable-quality water, oil, gas, or geothermal resources, and/or a prospectively valuable deposit of minerals shall be protected.

Cave Karst/Potash Cement Shoe @	Secretary 1199.00		Top of Salt to surface
Shoe @	7590.00	тос @	4334.00
Perforatons Top @ Perforatons Top @ Perforatons Top @	7190.00 7422.00 6737.00	Perforations Perforations Perforations	7270.00 7432.00 7003.00
		CIBP @ CIBP @	7335.00 6640.00

BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Permanent Abandonment of Federal Wells Conditions of Approval

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-689-5981.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. **Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.**

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Dry Hole Marker</u>: All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10th day, the BLM is to be contacted with justification to receive an extension for completing the cut off.

The well bore shall then be capped with a 4-inch pipe, 10-feet in length, 4 feet above ground and embedded in cement, unless otherwise noted in COA (requirements will be attached). The following information shall be permanently inscribed on the dry hole marker: well name and number, name of the operator, lease serial number, surveyed location (quarter-quarter section, section, township and range or other authorized survey designation acceptable to the authorized officer such as metes and bounds). A weep hole shall be left if a metal plate is welded in place.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash:</u> All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.



United States Department of the Interior

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 E. Greene St. Carlsbad, New Mexico 88220-6292 www.blm.gov/nm



In Reply Refer To: 1310

Reclamation Objectives and Procedures

Reclamation Objective: Oil and gas development is one of many uses of the public lands and resources. While development may have a short- or long-term effect on the land, successful reclamation can ensure the effect is not permanent. During the life of the development, all disturbed areas not needed for active support of production operations should undergo "interim" reclamation in order to minimize the environmental impacts of development on other resources and uses. At final abandonment, well locations, production facilities, and access roads must undergo "final" reclamation so that the character and productivity of the land and water are restored.

The long-term objective of final reclamation is to set the course for eventual ecosystem restoration, including the restoration of the natural vegetation community, hydrology, and wildlife habitats. In most cases this means returning the land to a condition approximating or equal to that which existed prior to the disturbance. The final goal of reclamation is to restore the character of the land and water to its predisturbance condition. The operator is generally not responsible for achieving full ecological restoration of the site. Instead, the operator must achieve the short-term stability, visual, hydrological, and productivity objectives of the surface management agency and take steps necessary to ensure that long-term objectives will be reached through natural processes.

To achieve these objectives, remove any/all contaminants, scrap/trash, equipment, pipelines and powerlines (Contact service companies, allowing plenty of time to have the risers and power lines and poles removed prior to reclamation, don't wait till the last day and try to get them to remove infrastructure). Strip and remove caliche, contour the location to blend with the surrounding landscape, re-distribute the native soils, provide erosion control as needed, rip (across the slope and seed as specified in the original APD COA. This will apply to well pads, facilities, and access roads. Barricade access road at the starting point. If reserve pits have not reclaimed due to salts or other contaminants, submit a plan for approval, as to how you propose to provide adequate restoration of the pit area.

- 1. The Application for Permit to Drill or Reenter (APD, Form 3160-3), Surface Use Plan of Operations must include adequate measures for stabilization and reclamation of disturbed lands. Oil and Gas operators must plan for reclamation, both interim and final, up front in the APD process as per Onshore Oil and Gas Order No. 1.
- 2. For wells and/or access roads not having an approved plan, or an inadequate plan for surface reclamation (either interim or final reclamation), the operator must submit a proposal describing the procedures for reclamation. For interim reclamation, the appropriate time for submittal would be when filing the Well Completion or Recompletion Report and Log (Form 3160-4). For final reclamation, the appropriate time for submittal would be when filing the Notice of Intent, or the Subsequent Report of Abandonment, Sundry Notices and Reports on Wells (Form 3160-5). Interim reclamation is to be completed within 6 months of well completion, and final reclamation is to be completed within 6 months of well abandonment.
- 3. The operator must file a Subsequent Report Plug and Abandonment (Form 3160-5) following the plugging of a well.
- 4. Previous instruction had you waiting for a BLM specialist to inspect the location and provide you with reclamation requirements. If you have an approved Surface Use Plan of Operation and/or an approved Sundry Notice, you are free to proceed with reclamation as per approved APD. If you

have issues or concerns, contact a BLM specialist to assist you. It would be in your interest to have a BLM specialist look at the location and access road prior to the removal of reclamation equipment to ensure that it meets BLM objectives. Upon conclusion submit a Form 3160-5, Subsequent Report of Reclamation. This will prompt a specialist to inspect the location to verify work was completed as per approved plans.

- 5. The approved Subsequent Report of Reclamation will be your notice that the native soils, contour and seedbed have been reestablished. If the BLM objectives have not been met the operator will be notified and corrective actions may be required.
- 6. It is the responsibility of the operator to monitor these locations and/or access roads until such time as the operator feels that the BLM objective has been met. If after two growing seasons the location and/or access roads are not showing the potential for successful revegetation, additional actions may be needed. When you feel the BLM objectives have been met submit a Final Abandonment Notice (FAN), Form 3160-5, stating that all reclamation requirements have been achieved and the location and/or access road is ready for a final abandonment inspection.
- 7. At this time the BLM specialist will inspect the location and/or access road. If the native soils and contour have been restored, and the revegetation is successful, the FAN will be approved, releasing the operator of any further liability of the location and/or access road. If the location and/or access road have not achieved the objective, you will be notified as to additional work needed or additional time being needed to achieve the objective.

If there are any questions, please feel free to contact any of the following specialists:

Jim Amos Supervisory Petroleum Engineering Tech/Environmental Protection Specialist 575-234-5909 (Office), 575-361-2648 (Cell)

Arthur Arias Environmental Protection Specialist 575-234-6230

Crisha Morgan Environmental Protection Specialist 575-234-5987

Jose Martinez-Colon Environmental Protection Specialist 575-234-5951

Mark Mattozzi Environmental Protection Specialist 575-234-5713

Robert Duenas Environmental Protection Specialist 575-234-2229

Trishia Bad Bear, Hobbs Field Station Natural Resource Specialist 575-393-3612

Poker Lake Unit 223 - Proposed WBD

8-5/8" shoe 1199'

T/Salt 1329'

B/Salt 3280'

T/Delaware 3494'

5-1/2" TOC 4334'

T/Perf 6737'

T/Bone Spring 7306'


T/Bone Spring Perf 7422'

Approval Subject to

General Requirements and

Special Stipulations

Attached

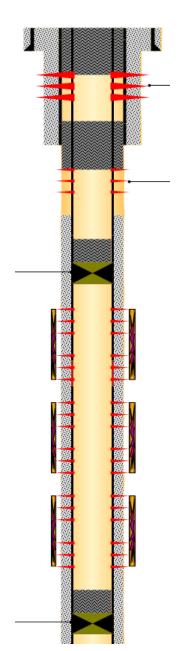

Circulate ~25 SKS Class C: 100' to surface.

Squeeze 775 SKS Class C: 3544′ – 1099′. WOC and tag.

Spot 25 SKS Class C atop CIBP: 6640' – 6400'. Pressure test to 500 PSIG for 30 min. WOC and TTOC.

Dump bail 35' Class C atop CIBP: 7325' – 7290'. WOC and tag.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 181478

CONDITIONS

Operator:	OGRID:
XTO PERMIAN OPERATING LLC.	373075
6401 HOLIDAY HILL ROAD	Action Number:
MIDLAND, TX 79707	181478
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By		Condition Date
gcordero	None	2/2/2023