Form 3160-3 FORM APPROVED OMB No. 1004-0137 (June 2015) Expires: January 31, 2018 **UNITED STATES** DEPARTMENT OF THE INTERIOR 5. Lease Serial No. BUREAU OF LAND MANAGEMENT APPLICATION FOR PERMIT TO DRILL OR REENTER 6. If Indian, Allotee or Tribe Name 7. If Unit or CA Agreement, Name and No. DRILL REENTER 1a. Type of work: 1b. Type of Well: Oil Well Gas Well Other 8. Lease Name and Well No. 1c. Type of Completion: Hydraulic Fracturing Single Zone Multiple Zone 2. Name of Operator 9. API Well No. 3a. Address 3b. Phone No. (include area code) 10. Field and Pool, or Exploratory 4. Location of Well (Report location clearly and in accordance with any State requirements.\*) 11. Sec., T. R. M. or Blk. and Survey or Area At surface At proposed prod. zone 14. Distance in miles and direction from nearest town or post office\* 12. County or Parish 13. State 15. Distance from proposed\* 16. No of acres in lease 17. Spacing Unit dedicated to this well location to nearest property or lease line, ft. (Also to nearest drig. unit line, if any) 18. Distance from proposed location\* 19. Proposed Depth 20. BLM/BIA Bond No. in file to nearest well, drilling, completed, applied for, on this lease, ft. 21. Elevations (Show whether DF, KDB, RT, GL, etc.) 22. Approximate date work will start\* 23. Estimated duration 24. Attachments The following, completed in accordance with the requirements of Onshore Oil and Gas Order No. 1, and the Hydraulic Fracturing rule per 43 CFR 3162.3-3 (as applicable) 1. Well plat certified by a registered surveyor. 4. Bond to cover the operations unless covered by an existing bond on file (see 2. A Drilling Plan. Item 20 above). 3. A Surface Use Plan (if the location is on National Forest System Lands, the 5. Operator certification. SUPO must be filed with the appropriate Forest Service Office). 6. Such other site specific information and/or plans as may be requested by the 25. Signature Name (Printed/Typed) Date Title Approved by (Signature) Name (Printed/Typed) Date Title Office Application approval does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Conditions of approval, if any, are attached. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction



(Continued on page 2)

\*(Instructions on page 2)

DISTRICT I 1625 N. FRENCH DR., HOBBS, NM 88240 Phone: (575) 393-6161 Fax: (575) 393-0720 DISTRICT II 811 S. FIRST ST., ARTESIA, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

State of New Mexico Energy, Minerals & Natural Resources Department CONSERVATION DIVISION

1220 SOUTH ST. FRANCIS DR. Santa Fe, New Mexico 87505

Form C-102 Revised August 1, 2011 Submit one copy to appropriate District Office

DISTRICT III 1000 RIO BRAZOS RD., AZTEC, NM 87410 Phone: (505) 334-6178 Fax: (505) 334-6170

DISTRICT IV 1220 S. ST. FRANCIS DR., SANTA FE, NM 87505 Phone: (505) 476-3460 Fax: (505) 476-3462

□ AMENDED REPORT

WELL	LOCATION	AND	ACREAGE	DEDICATION	PLAT

API Number	Pool Code	Pool Code Pool Name		
	96672	WC-025 G-08 S263412K;BC	ONE SPRING	
Property Code	I	Well Number		
	NORTH BLON	4H		
OGRID No.	(	Operator Name	Elevation	
6137	DEVON ENERGY PI	RODUCTION COMPANY, L.P.	3311.1'	


#### Surface Location

UL or lot No.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
0	34	25-S	34-E		230	SOUTH	2490	EAST	LEA

#### Bottom Hole Location If Different From Surface

UL or lot No.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
Н	15	26-S	34-E		2050	NORTH	1320	EAST	LEA
Dedicated Acres   Joint or Infill   Consolidation Code				Code Or	der No.				
800									

#### NO ALLOWABLE WILL BE ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION

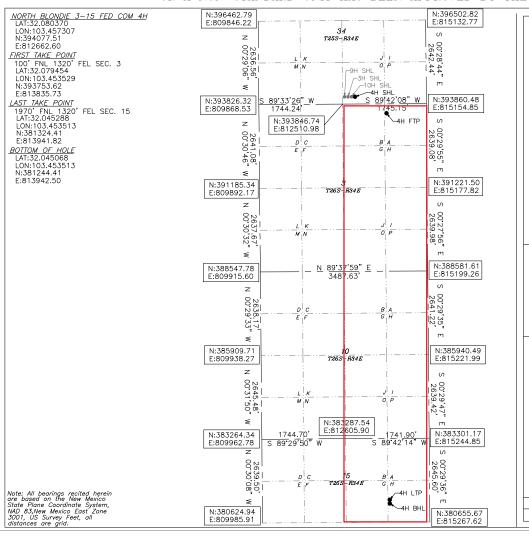

#### OPERATOR CERTIFICATION

I hereby certify that the information herein is true and complete to the best of my knowledge and belief, and that this organization either owns a working interest or unleased mineral interest in the land including the proposed bottom hole location or has a right to drill this well at this location pursuant to a contract with an owner of such mineral or working interest, or to a voluntary pooling agreement or a compulsory pooling order heretofore entered by the division.

6/1/22

Date

Signature Chelsey Green

helsey

Printed Name

chelsey.green@dvn.com

#### E-mail Address SURVEYOR CERTIFICATION

I hereby certify that the well location shown on this plat was plotted from field notes of actual surveys made by me or under my supervision, and that the same is true and correct to the best of my belief.

04/05/2022

Date of Survey Signature & Seal of Professional Surveyor LAMAN MEXICO 04/20/22

Certificate No. 22404 B.L. LAMAN DRAWN BY: CM

Inten	t	As Dril	led											
API#	ŀ													
Ope	rator Nai	me:				Proper	rty Na	ame:						Well Number
Kick (	Off Point	(KOP)												
UL	Section	Township	Range	Lot	Feet	Feet From N/S Feet From E/W County					County			
Latitu	ude				Longitu	ıde							NAD	
First <sup>-</sup>	Take Poir	nt (FTP)												
UL	Section	Township	Range	Lot	Feet	Feet From N/S Feet From E/W County				County				
Latitu	Latitude					Longitude					NAD			
Lact T	Take Poin	+ /I TD\												
UL	Section	Township	Range	Lot	Feet	From N	N/S	Feet		From E/	/w	Count	·V	
Latitu			, and the second		Longitu					•		NAD		
Latite	auc				Longitt	auc .						NAD		
										7				
Is this	s well the	defining v	vell for th	ne Hori	zontal S <sub>ا</sub>	pacing U	Jnit?							
ن مله در	مم المسم	infill well?			7									
is triis	s well all	ınını wenr			_									
If infi	ll is ves p	lease provi	ide API if	availal	ble. Ope	rator Na	me a	ınd w	ell ni	umber 1	for E	Definir	ng well f	or Horizontal
	ng Unit.	icase provi		avana	o.c, opc.				C 11.				.g wen n	or 110112011tu
API#	ł													
Ope	rator Na	me:				Proper	rty Na	ame:						Well Number
														1

KZ 06/29/2018

#### State of New Mexico Energy, Minerals and Natural Resources Department

Submit Electronically Via E-permitting

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

#### NATURAL GAS MANAGEMENT PLAN

This Natural Gas Management Plan must be submitted with each Application for Permit to Drill (APD) for a new or recompleted well.

#### Section 1 – Plan Description Effective May 25, 2021

I. Operator: DEVON	ENERGY PRODUC	CTION COMPANY, LP	OGRID:	6137	Date:	05 /31 / 2022			
II. Type: ☒ Original	☐ Amendment	due to □ 19.15.27.	9.D(6)(a) NMA	C □ 19.15.27.9.D(	6)(b) NMAC 🗆 (	Other.			
If Other, please descri	be:								
<b>III. Well(s):</b> Provide to be recompleted from a					wells proposed to	be drilled or proposed to			
Well Name	API	ULSTR	Footages	Anticipated Oil BBL/D	Anticipated Gas MCF/D	Anticipated Produced Water BBL/D			
See attachment									
V. Anticipated Sched	V. Central Delivery Point Name:  See attachment  [See 19.15.27.9(D)(1) NM.  V. Anticipated Schedule: Provide the following information for each new or recompleted well or set of wells proposed to be drilled proposed to be recompleted from a single well pad or connected to a central delivery point.  Well Name  API  Spud Date  TD Reached  Completion  Date  Tommencement Date  Back Date  Date								
See attachment									
VI. Separation Equipment:   Attach a complete description of how Operator will size separation equipment to optimize gas capture.  VII. Operational Practices:   Attach a complete description of the actions Operator will take to comply with the requirements of Subsection A through F of 19.15.27.8 NMAC.  VIII. Best Management Practices:   Attach a complete description of Operator's best management practices to minimize venting during active and planned maintenance.									

## NATURAL GAS MANAGEMENT PLAN Section 1 - Plan Description

III. Well(s): Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

							Anticipated		
					Anticipated Oil	Anticipated Gas	Produced Water	Central Delivery Point	
Well Name	API	ULSTR	FOC	OTAGES	BBL/D	MCF/D	BBL/D	Name:	
North Blondie 3-15 Fed Com 1H		34-25S-34E	205 FSL	970 FWL	(+/-)1420bopd	(+/-)5520mcfd	(+/-)3540bwpd	Stranger 34 CTB 2	
North Blondie 3-15 Fed Com 2H		34-25S-34E	205 FSL	1000 FWL	(+/-)2080bopd	(+/-)5210mcfd	(+/-)4690bwpd	Stranger 34 CTB 2	
North Blondie 3-15 Fed Com 3H		34-25S-34E	230 FSL	2550 FEL	(+/-)2080bopd	(+/-)5210mcfd	(+/-)4690bwpd	Stranger 34 CTB 2	
North Blondie 3-15 Fed Com 4H		34-25S-34E	230 FSL	2490 FEL	(+/-)1420bopd	(+/-)5520mcfd	(+/-)3540bwpd	Stranger 34 CTB 2	
North Blondie 3-15 Fed Com 5H		34-25S-34E	230 FSL	340 FEL	(+/-)2080bopd	(+/-)5210mcfd	(+/-)4690bwpd	Stranger 34 CTB 2	
North Blondie 3-15 Fed Com 6H		34-25S-34E	205 FSL	940 FWL	(+/-)2080bopd	(+/-)7280mcfd	(+/-)2500bwpd	Stranger 34 CTB 2	
North Blondie 3-15 Fed Com 7H		34-25S-34E	480 FSL	970 FWL	(+/-)2080bopd	(+/-)7280mcfd	(+/-)2500bwpd	Stranger 34 CTB 2	
North Blondie 3-15 Fed Com 8H		34-25S-34E	480 FSL	1000 FWL	(+/-)2080bopd	(+/-)7280mcfd	(+/-)2500bwpd	Stranger 34 CTB 2	
North Blondie 3-15 Fed Com 9H		34-25S-34E	230 FSL	2580 FEL	(+/-)2080bopd	(+/-)7280mcfd	(+/-)2500bwpd	Stranger 34 CTB 2	
North Blondie 3-15 Fed Com 10H		34-25S-34E	230 FSL	2520 FEL	(+/-)2080bopd	(+/-)7280mcfd	(+/-)2500bwpd	Stranger 34 CTB 2	
North Blondie 3-15 Fed Com 11H		34-25S-34E	230 FSL	370 FEL	(+/-)2080bopd	(+/-)7280mcfd	(+/-)2500bwpd	Stranger 34 CTB 2	
North Blondie 3-15 Fed Com 12H		34-25S-34E	230 FSL	310 FEL	(+/-)2080bopd	(+/-)7280mcfd	(+/-)2500bwpd	Stranger 34 CTB 2	
North Blondie 3-15 Fed Com 13H		34-25S-34E	230 FSL	280 FEL	(+/-)2080bopd	(+/-)7280mcfd	(+/-)2500bwpd	Stranger 34 CTB 2	
North Blondie 3-15 Fed Com 22H		34-25S-34E	205 FSL	910 FWL	(+/-)2080bopd	(+/-)7280mcfd	(+/-)2500bwpd	Stranger 34 CTB 2	

V. Anticipated Schedule: Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

			Completion			First
			TD Reached Commencem Initial Flow		Initial Flow	Production
Well Name	API	Spud Date	Date	ent Date	back Date	Date
North Blondie 3-15 Fed Com 1H	n/a	8/8/2023	9/7/2023	1/5/2024	1/5/2024	1/5/2024
North Blondie 3-15 Fed Com 2H	n/a	8/29/2023	9/28/2023	1/26/2024	1/26/2024	1/26/2024
North Blondie 3-15 Fed Com 3H	n/a	9/16/2022	10/16/2022	2/13/2023	2/13/2023	2/13/2023
North Blondie 3-15 Fed Com 4H	n/a	8/1/2023	8/31/2023	12/29/2023	12/29/2023	12/29/2023
North Blondie 3-15 Fed Com 5H	n/a	8/17/2023	9/16/2023	1/14/2024	1/14/2024	1/14/2024
North Blondie 3-15 Fed Com 6H	n/a	9/9/2023	10/9/2023	2/6/2024	2/6/2024	2/6/2024
North Blondie 3-15 Fed Com 7H	n/a	8/2/2023	9/1/2023	12/30/2023	12/30/2023	12/30/2023
North Blondie 3-15 Fed Com 8H	n/a	8/18/2023	9/17/2023	1/15/2024	1/15/2024	1/15/2024
North Blondie 3-15 Fed Com 9H	n/a	9/11/2023	10/11/2023	2/8/2024	2/8/2024	2/8/2024
North Blondie 3-15 Fed Com 10H	n/a	8/14/2023	9/13/2023	1/11/2024	1/11/2024	1/11/2024
North Blondie 3-15 Fed Com 11H	n/a	8/6/2023	9/5/2023	1/3/2024	1/3/2024	1/3/2024
North Blondie 3-15 Fed Com 12H	n/a	8/17/2023	9/16/2023	1/14/2024	1/14/2024	1/14/2024
North Blondie 3-15 Fed Com 13H	n/a	8/27/2023	9/26/2023	1/24/2024	1/24/2024	1/24/2024
North Blondie 3-15 Fed Com 22H	n/a	9/5/2023	10/5/2023	2/2/2024	2/2/2024	2/2/2024

<sup>\*</sup> Dates subject to change

#### Section 2 – Enhanced Plan EFFECTIVE APRIL 1, 2022

Beginning April 1, 2022, an operator that is not in compliance with its statewide natural gas capture requirement for the applicable reporting area must complete this section.

🗵 Operator certifies that it is not required to complete this section because Operator is in compliance with its statewide natural gas capture requirement for the applicable reporting area.

#### IX. Anticipated Natural Gas Production:

Well	API	Anticipated Average Natural Gas Rate MCF/D	Anticipated Volume of Natural Gas for the First Year MCF		

#### X. Natural Gas Gathering System (NGGS):

Operator	System	ULSTR of Tie-in	Anticipated Gathering Start Date	Available Maximum Daily Capacity of System Segment Tie-in

XI. Map. $\square$ Attach an accurate and legible map depicting the location of the well(s), the anticipated pipeline route(s) connecting the
production operations to the existing or planned interconnect of the natural gas gathering system(s), and the maximum daily capacity of
the segment or portion of the natural gas gathering system(s) to which the well(s) will be connected.

XII. Line Capacity. The natural	gas gathering system	□ will □ will r	not have capacity to	o gather 10	00% of the antic	ipated nat	tural gas
production volume from the well	prior to the date of firs	t production.					

XIII. Line Pressure. Operator $\square$ does $\square$ does not anticipate that its existing well(s) connected to the same segment, or portion, of the same segment is a connected to the same segment.	he
natural gas gathering system(s) described above will continue to meet anticipated increases in line pressure caused by the new well(s)	).

l Attach (	Onerator's nla	an to manag	nroduction i	n response to	the increased	l line pressure

XIV. Confidentiality:   Operator asserts confidentiality pursuant to Section 71-2-8 NMSA 1978 for the information provides the information provide	ded in
Section 2 as provided in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and attaches a full description of the specific inform	nation
for which confidentiality is asserted and the basis for such assertion.	

# Section 3 - Certifications Effective May 25, 2021

Operator certifies that, after reasonable inquiry and based on the available information at the time of submittal:

- 🖾 Operator will be able to connect the well(s) to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system; or
- D Operator will not be able to connect to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system. If Operator checks this box, Operator will select one of the following:

Well Shut-In. ☐ Operator will shut-in and not produce the well until it submits the certification required by Paragraph (4) of Subsection D of 19.15.27.9 NMAC; or

Venting and Flaring Plan. □ Operator has attached a venting and flaring plan that evaluates and selects one or more of the potential alternative beneficial uses for the natural gas until a natural gas gathering system is available, including:

- (a) power generation on lease;
- **(b)** power generation for grid;
- (c) compression on lease;
- (d) liquids removal on lease;
- (e) reinjection for underground storage;
- (t) reinjection for temporary storage;
- (g) reinjection for enhanced oil recovery;
- (h) fuel cell production; and
- (i) other alternative beneficial uses approved by the division.

## Section 4 - Notices

- 1. If, at any time after Operator submits this Natural Gas Management Plan and before the well is spud:
- (a) Operator becomes aware that the natural gas gathering system it planned to connect the well(s) to has become unavailable or will not have capacity to transport one hundred percent of the production from the well(s), no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised venting and flaring plan containing the information specified in Paragraph (5) of Subsection D of 19.15.27.9 NMAC; or
- (b) Operator becomes aware that it has, cumulatively for the year, become out of compliance with its baseline natural gas capture rate or natural gas capture requirement, no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised Natural Gas Management Plan for each well it plans to spud during the next 90 days containing the information specified in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and shall file an update for each Natural Gas Management Plan until Operator is back in compliance with its baseline natural gas capture rate or natural gas capture requirement.
- 2. OCD may deny or conditionally approve an APD if Operator does not make a certification, fails to submit an adequate venting and flaring plan which includes alternative beneficial uses for the anticipated volume of natural gas produced, or if OCD determines that Operator will not have adequate natural gas takeaway capacity at the time a well will be spud.

I certify that, after reasonable inquiry, the statements in and attached to this Natural Gas Management Plan are true and correct to the best of my knowledge and acknowledge that a false statement may be subject to civil and criminal penalties under the Oil and Gas Act.

Signature:
Printed Name: Jeffrey Walla  Title: Surface Land & Regulatory Manager  E-mail Address:
Title: Surface Land & Regulators Manager
E-mail Address: jeff.walla@dvn.com
Date: 06/14/2022
Phone: (405) 552-8154
OIL CONSERVATION DIVISION
(Only applicable when submitted as a standalone form)
Approved By:
Title:
Approval Date:
Conditions of Approval:



#### VI. Separation Equipment

Devon Energy Production Company, L.P. utilizes a "stage separation" process in which oil and gas separation is carried out through a series of separators operating at successively reduced pressures. Hydrocarbon liquids are produced into a high-pressure inlet separator, then carried through one or more lower pressure separation vessels before entering the storage tanks. The purpose of this separation process is to attain maximum recovery of liquid hydrocarbons from the fluids and allow maximum capture of produced gas into the sales pipeline. Devon utilizes a series of Low-Pressure Compression units to capture gas off the staged separation and send it to the sales pipeline. This process minimizes the amount of flash gas that enters the end-stage storage tanks that is subsequently vented or flared.



#### VII. Operational Practices

Devon Energy Production Company, L. P. will employ best management practices and control technologies to maximize the recovery and minimize waste of natural gas through venting and flaring.

- During drilling operations, Devon will utilize flares and/or combustors to capture and control
  natural gas, where technically feasible. If flaring is deemed technically in-feasible, Devon will
  employ best management practices to minimize or reduce venting to the extent possible.
- During completions operations, Devon will utilize Green Completion methods to capture gas
  produced during well completions that is otherwise vented or flared. If capture is technically
  in-feasible, flares and/or combustors will be used to capture and control flow back fluids
  entering into frac tanks during initial flowback. Upon indication of first measurable hydrocarbon
  volumes, Devon will turn operations to onsite separation vessels and flow to the gathering
  pipeline.
- During production operations, Devon will take every practical effort to minimize waste of natural gas through venting and flaring by:
  - Designing and constructing facilities in a manner consistent to achieve maximum capture and control of hydrocarbon liquids & produced gas
  - Utilizing a closed-loop capture system to collect and route produced gas to sales line via low pressure compression, or to a flare/combustor
  - o Flaring in lieu of venting, where technically feasible
  - Utilizing auto-ignitors or continuous pilots, with thermocouples connected to Scada, to quickly detect and resolve issues related to malfunctioning flares/combustors
  - Employ the use of automatic tank gauging to minimize storage tank venting during loading events
  - Installing air-driven or electric-driven pneumatics & combustion engines, where technically feasible to minimize venting to the atmosphere
  - Confirm equipment is properly maintained and repaired through a preventative maintenance and repair program to ensure equipment meets all manufacturer specifications
  - Conduct and document AVO inspections on the frequency set forth in Part 27 to detect and repair any onsite leaks as quickly and efficiently as is feasible



VIII. Best Management Practices during Maintenance

Devon Energy Production Company, L.P. will utilize best management practices to minimize venting during active and planned maintenance activities. Devon is operating under guidance that production facilities permitted under NOI permits have no provisions to allow high pressure flaring and high pressure flaring is only allowed in disruption scenarios so long as the duration is less than eight hours. When technically feasible, flaring during maintenance activities will be utilized in lieu of venting to the atmosphere. Devon will work with third-party operators during scheduled maintenance of downstream pipeline or processing plants to address those events ahead of time to minimize venting. Actions considered include identifying alternative capture approaches or planning to temporarily reduce production or shut in the well to address these circumstances.

# Devon Energy APD VARIANCE DATA

**OPERATOR NAME:** Devon Energy

#### 1. SUMMARY OF Variance:

Devon Energy respectfully requests approval for the following additions to the drilling plan:

1. Potential utilization of a spudder rig to pre-set surface casing.

#### 2. Description of Operations

- 1. A spudder rig contractor may move in their rig to drill the surface hole section and pre-set surface casing on this well.
  - **a.** After drilling the surface hole section, the rig will run casing and cement following all of the applicable rules and regulations (OnShore Order 2, all COAs and NMOCD regulations).
  - **b.** Rig will utilize fresh water based mud to drill surface hole to TD.
- 2. The wellhead will be installed and tested once the surface casing is cut off and the WOC time has been reached.
- **3.** A blind flange with the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with needle valves installed on two wingvalves.
  - **a.** A means for intervention will be maintained while the drilling rig is not over the well.
- **4.** The BLM will be contacted and notified 24 hours prior to commencing spudder rig operations.
- **5.** Drilling operation will be performed with the big rig. At that time an approved BOP stack will be nippled up and tested on the wellhead before drilling operations commences on each well.
  - **a.** The BLM will be contacted / notified 24 hours before the big rig moves back on to the pad with the pre-set surface casing.
- **6.** Devon Energy will have supervision on the rig to ensure compliance with all BLM and NMOCD regulations and to oversee operations.
- 7. Once the rig is removed, Devon Energy will secure the wellhead area by placing a guard rail around the cellar area.

#### **Devon Energy Annular Preventer Summary**

#### 1. Component and Preventer Compatibility Table

The table below, which covers the drilling and casing of the 10M MASP portion of the well, outlines the tubulars and the compatible preventers in use. This table, combined with the mud program, documents that two barriers to flow can be maintained at all times, independent of the rating of the annular preventer.

Component	OD	Preventer	RWP
Drillpipe	4.5"	Fixed lower 4.5"	10M
		Upper 4.5-7" VBR	
HWDP	4.5"	Fixed lower 4.5"	10M
		Upper 4.5-7" VBR	
Drill collars and MWD tools	4.75"	Upper 4.5-7" VBR	10M
Mud Motor	4.75"	Upper 4.5-7" VBR	10M
Production casing	5.5"	Upper 4.5-7" VBR	10M
ALL	0-13-5/8"	Annular	5M
Open-hole	-	Blind Rams	10M

6-3/4" Production hole section, 10M requirement

VBR = Variable Bore Ram. Compatible range listed in chart.

#### 2. Well Control Procedures

Well control procedures are specific to the rig equipment and the operation at the time the kick occurs. Below are the minimal high-level tasks prescribed to assure a proper shut-in while drilling, tripping, running casing, pipe out of the hole (open hole), and moving the BHA through the BOPs. The pressure at which control is swapped from the annular to another compatible ram is variable, but the operator will document in the submission their operating pressure limit. The operator may chose an operating pressure less than or equal to RWP, but in no case will it exceed the RWP of the annular preventer.

#### General Procedure While Drilling

- 1. Sound alarm (alert crew)
- 2. Space out drill string
- 3. Shut down pumps (stop pumps and rotary)
- 4. Shut-in Well (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
  - a. SIDPP and SICP
  - b. Pit gain
  - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to the upper pipe ram.

#### **Devon Energy Annular Preventer Summary**

#### **General Procedure While Tripping**

- 1. Sound alarm (alert crew)
- 2. Stab full opening safety valve and close
- 3. Space out drill string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
  - a. SIDPP and SICP
  - b. Pit gain
  - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to the upper pipe ram.

#### General Procedure While Running Casing

- 1. Sound alarm (alert crew)
- 2. Stab crossover and full opening safety valve and close
- 3. Space out string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
  - a. SIDPP and SICP
  - b. Pit gain
  - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach the RWP of the annular preventer, confirm spacing and swap to compatible pipe ram.

#### General Procedure With No Pipe In Hole (Open Hole)

- 1. Sound alarm (alert crew)
- 2. Shut-in with blind rams or BSR. (HCR and choke will already be in the closed position.)
- 3. Confirm shut-in
- 4. Notify toolpusher/company representative
- 5. Read and record the following:
  - a. SICP
  - b. Pit gain
  - c. Time
- 6. Regroup and identify forward plan

#### **Devon Energy Annular Preventer Summary**

#### General Procedures While Pulling BHA thru Stack

- 1. PRIOR to pulling last joint of drillpipe thru the stack.
  - a. Perform flowcheck, if flowing:
  - b. Sound alarm (alert crew)
  - c. Stab full opening safety valve and close
  - d. Space out drill string with tool joint just beneath the upper pipe ram.
  - e. Shut-in using upper pipe ram. (HCR and choke will already be in the closed position.)
  - f. Confirm shut-in
  - g. Notify toolpusher/company representative
  - h. Read and record the following:
    - i. SIDPP and SICP
    - ii. Pit gain
    - iii. Time
  - i. Regroup and identify forward plan
- 2. With BHA in the stack and compatible ram preventer and pipe combo immediately available.
  - a. Sound alarm (alert crew)
  - b. Stab crossover and full opening safety valve and close
  - c. Space out drill string with upset just beneath the compatible pipe ram.
  - d. Shut-in using compatible pipe ram. (HCR and choke will already be in the closed position.)
  - e. Confirm shut-in
  - f. Notify toolpusher/company representative
  - g. Read and record the following:
    - i. SIDPP and SICP
    - ii. Pit gain
    - iii. Time
  - h. Regroup and identify forward plan
- 3. With BHA in the stack and NO compatible ram preventer and pipe combo immediately available.
  - a. Sound alarm (alert crew)
  - b. If possible to pick up high enough, pull string clear of the stack and follow "Open Hole" scenario.
  - c. If impossible to pick up high enough to pull the string clear of the stack:
  - d. Stab crossover, make up one joint/stand of drillpipe, and full opening safety valve and close
  - e. Space out drill string with tooljoint just beneath the upper pipe ram.
  - f. Shut-in using upper pipe ram. (HCR and choke will already be in the closed position.)
  - g. Confirm shut-in
  - h. Notify toolpusher/company representative
  - i. Read and record the following:
    - i. SIDPP and SICP
    - ii. Pit gain
    - iii. Time
  - i. Regroup and identify forward plan

#### North Blondie 3-15 Fed Com 4H

#### 1. Geologic Formations

TVD of target	10340	Pilot hole depth	N/A
MD at TD:	22288	Deepest expected fresh water	

#### **Basin**

Dasiii		TT : 73.51	
	Depth	Water/Mineral	
Formation	(TVD)	Bearing/Target	Hazards*
	from KB	Zone?	
Rustler	860		
Salt	1300		
Base of Salt	5050		
Delaware	5320		
Cherry Canyon	6320		
Brushy Canyon	7950		
1st Bone Spring Lime	9420		
Leonard	9470		
	•		

<sup>\*</sup>H2S, water flows, loss of circulation, abnormal pressures, etc.

2. Casing Program

		Wt			Casing	Casing Interval		Casing Interval	
Hole Size	Csg. Size	(PPF)	(-crade		From (MD)	To (MD)	From (TVD)	To (TVD)	
17 1/2	13 3/8	48	H40	ВТС	0	885	0	885	
12 1/4	9 5/8	40	J-55	ВТС	0	5150	0	5150	
8 3/4	5 1/2	17	P110	ВТС	0	22288	0	10340	

<sup>•</sup> All casing strings will be tested in accordance with Onshore Oil and Gas Order #2 IILB.1.h Must have table for contingency casing.

3. Cementing Program (3-String Primary Design)

Casing	# Sks	TOC	Wt. (lb/gal)	Yld (ft3/sack)	Slurry Description
Surface	679	Surf	13.2	1.4	Lead: Class C Cement + additives
I., 1	571	Surf	9.0	3.3	Lead: Class C Cement + additives
Int 1	154	500' above shoe	13.2	1.4	Tail: Class H / C + additives
Int 1	As Needed	Surf	9.0	3.3	Squeeze Lead: Class C Cement + additives
Intermediate	571	Surf	9.0	3.3	Lead: Class C Cement + additives
Squeeze	154	500' above shoe	13.2	1.4	Tail: Class H / C + additives
D 1 6	394	500' tieback	9.0	3.3	Lead: Class H /C + additives
Production	2511	KOP	13.2	1.4	Tail: Class H / C + additives

If a DV tool is ran the depth(s) will be adjusted based on hole conditions and cement volumes will be adjusted proportionally. Slurry weights will be adjusted based on estimated fracture gradient of the formation. DV tool will be set a minimum of 50 feet below previous casing and a minimum of 200 feet above current shoe. If cement is not returned to surface during the primary cement job on the surface casing string, a planned top job will be conducted immediately after completion of the primary job.

Casing String	% Excess
Surface	50%
Intermediate	30%
Production	10%

**4. Pressure Control Equipment (Three String Design)** 

BOP installed and tested before drilling which hole?	Size?	Min. Required WP	Туре		<b>✓</b>	Tested to:
		Annular X	50% of rated working pressure			
Int 1	13-5/8"	5M	Blind	d Ram	X	
IIIC I	13-3/0	3101	•	Ram		5M
			Doub	le Ram	X	JIVI
			Other*			
			Anı	nular	X	50% of rated working pressure
Production	13-5/8"	5M	Blind Ram X Pipe Ram	X		
Troduction	13-3/0	3101			5M	
			Doub	Double Ram X	JIVI	
			Other*			
			Annul	ar (5M)		
			Blind Ram			
			Pipe Ram			]
			Double Ram			
			Other*			

5. Mud Program (Three String Design)

Section	Туре	Weight (ppg)
Surface	FW Gel	8.5-9
Intermediate	Brine	10-10.5
Production	WBM	8.5-9

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept on location at all times.

What will be used to monitor the loss or gain of fluid?	PVT/Pason/Visual Monitoring

6. Logging and Testing Procedures

Logging, Coring and Testing							
	Will run GR/CNL from TD to surface (horizontal well - vertical portion of hole). Stated logs run will be in the						
X	Completion Report and sbumitted to the BLM.						
	No logs are planned based on well control or offset log information.						
	Drill stem test? If yes, explain.						
	Coring? If yes, explain.						

Additional	logs planned	Interval
	Resistivity	
	Density	
X	CBL	Production casing
X	Mud log	KOP to TD
	PEX	

7. Drilling Conditions

Condition	Specfiy what type and where?
BH pressure at deepest TVD	4839
Abnormal temperature	No

Mitigation measure for abnormal conditions. Describe. Lost circulation material/sweeps/mud scavengers.

Hydrogren Sulfide (H2S) monitors will be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the operator will comply with the provisions of Onshore Oil and Gas Order #6. If Hydrogen Sulfide is encountered measured values and formations will be provided to the BLM.

L	encountered measured values and formations will be provided to the BEW.						
	N	H2S is present					
	Y	H2S plan attached.					

#### 8. Other facets of operation

Is this a walking operation? Potentially

- 1 If operator elects, drilling rig will batch drill the surface holes and run/cement surface casing; walking the rig to next wells on the pad.
- 2 The drilling rig will then batch drill the intermediate sections and run/cement intermediate casing; the wellbore will be isolated with a blind flange and pressure gauge installed for monitoring the well before walking to the next well.
- 3 The drilling rig will then batch drill the production hole sections on the wells with OBM, run/cement production casing, and install TA caps or tubing heads for completions.

NOTE: During batch operations the drilling rig will be moved from well to well however, it will not be removed from the pad until all wells have production casing run/cemented.

#### Will be pre-setting casing? Potentially

- 1 Spudder rig will move in and batch drill surface hole.
  - a. Rig will utilize fresh water based mud to drill surface hole to TD. Solids control will be handled entirely on a closed loop basis.
- 2 After drilling the surface hole section, the spudder rig will run casing and cement following all of the applicable rules and regulations (OnShore Order 2, all COAs and NMOCD regulations).
- $^{3}$  The wellhead will be installed and tested once the surface casing is cut off and the WOC time has been reached.
- 4 A blind flange with the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with a pressure gauge installed on the wellhead.
- 5 Spudder rig operations is expected to take 4-5 days per well on a multi-well pad.
- 6 The NMOCD will be contacted and notified 24 hours prior to commencing spudder rig operations.
- 7 Drilling operations will be performed with drilling rig. At that time an approved BOP stack will be nippled up and tested on the wellhead before drilling operations commences on each well.
  - a. The NMOCD will be contacted / notified 24 hours before the drilling rig moves back on to the pad with the pre-set surface casing.

Attachments	1
X	Directional Plan
	Other, describe



**APD ID:** 10400086611

# U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

# Drilling Plan Data Report 08/01/2023

Submission Date: 07/08/2022

Operator Name: DEVON ENERGY PRODUCTION COMPANY LP

Well Name: NORTH BLONDIE 3-15 FED COM Well Number: 4H

Well Type: OIL WELL Well Work Type: Drill

Highlighted data reflects the most recent changes

**Show Final Text** 

### **Section 1 - Geologic Formations**

Formation			True Vertical Elevation		Lithologies	Mineral Resources	Producing Formatio
			_	Depth			
8862781	UNKNOWN	3308	0	0	OTHER : SURFACE	NONE	N
8862782	RUSTLER	2448	860	860	SANDSTONE	NONE	N
8862783	TOP SALT	2008	1300	1300	SALT	NONE	N
8862784	BASE OF SALT	-1742	5050	5050	ANHYDRITE	NONE	N
8862785	BELL CANYON	-2012	5320	5320	SANDSTONE	NATURAL GAS, OIL	N
8862786	CHERRY CANYON	-3012	6320	6320	SANDSTONE	NATURAL GAS, OIL	N
8862787	BRUSHY CANYON	-4642	7950	7950	SANDSTONE	NATURAL GAS, OIL	N
8862788	BONE SPRING LIME	-6112	9420	9420	LIMESTONE	NATURAL GAS, OIL	N
8862791	AVALON SAND	-6162	9470	9470	SANDSTONE	NATURAL GAS, OIL	Y
8862789	BONE SPRING 1ST	-7192	10500	10500	SANDSTONE	NATURAL GAS, OIL	N
8862790	BONE SPRING 2ND	-7892	11200	11200	SANDSTONE	NATURAL GAS, OIL	N
8862792	BONE SPRING LIME	-8242	11550	11550	LIMESTONE	NATURAL GAS, OIL	N
8862793	BONE SPRING 3RD	-8842	12150	12150	SANDSTONE, SHALE	NATURAL GAS, OIL	N
8862794	WOLFCAMP	-9282	12590	12590	SHALE	NATURAL GAS, OIL	N
8862795	STRAWN	-11092	14400	14400	LIMESTONE	NATURAL GAS, OIL	N

#### **Section 2 - Blowout Prevention**



### Commitment Runs Deep



Design Plan
Operation and Maintenance Plan
Closure Plan

SENM - Closed Loop Systems June 2010

#### I. Design Plan

Devon uses MI SWACO closed loop system (CLS). The MI SWACO CLS is designed to maintain drill solids at or below 5%. The equipment is arranged to progressively remove solids from the largest to the smallest size. Drilling fluids can thus be reused and savings is realized on mud and disposal costs. Dewatering may be required with the centrifuges to insure removal of ultra fine solids.

The drilling location is constructed to allow storm water to flow to a central sump normally the cellar. This insures no contamination leaves the drilling pad in the event of a spill. Storm water is reused in the mud system or stored in a reserve fluid tank farm until it can be reused. All lubricants, oils, or chemicals are removed immediately from the ground to prevent the contamination of storm water. An oil trap is normally installed on the sump if an oil spill occurs during a storm.

A tank farm is utilized to store drilling fluids including fresh water and brine fluids. The tank farm is constructed on a 20 ml plastic lined, bermed pad to prevent the contamination of the drilling site during a spill. Fluids from other sites may be stored in these tanks for processing by the solids control equipment and reused in the mud system. At the end of the well the fluids are transported from the tank farm to an adjoining well or to the next well for the rig.


Prior to installing a closed-loop system on site, the topsoil, if present, will be stripped and stockpiled for use as the final cover or fill at the time of closure.

Signs will be posted on the fence surrounding the closed-loop system unless the closed-loop system is located on a site where there is an existing well, that is operated by Devon.

#### II. Operations and Maintenance Plan

*Primary Shakers:* The primary shakers make the first removal of drill solids from the drilling mud as it leaves the well bore. The shakers are sized to handle maximum drilling rate at optimal screen size. The shakers normally remove solids down to 74 microns.

Mud Cleaner: The Mud Cleaner cleans the fluid after it leaves the shakers. A set of hydrocyclones are sized to handle 1.25 to 1.5 times the maximum circulating rate. This ensures all the fluid is being processed to an average cut point of 25 microns. The wet discharged is dewatered on a shaker equipped with ultra fine mesh screens and generally cut at 40 microns.

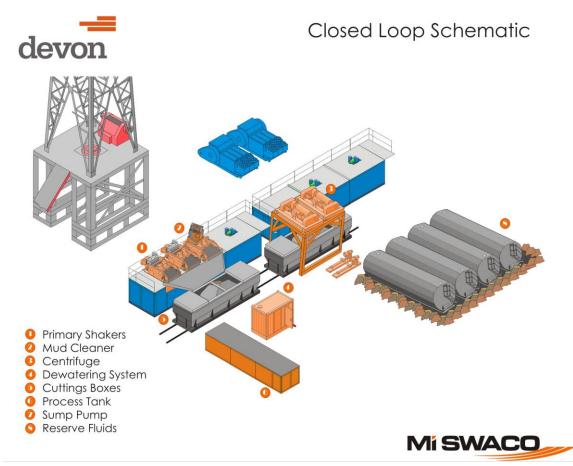

Centrifuges: The centrifuges can be one or two in number depending on the well geometry or depth of well. The centrifuges are sized to maintain low gravity solids at 5% or below. They may or may not need a dewatering system to enhance the removal rates. The centrifuges can make a cut point of 8-10 microns depending on bowl speed, feed rate, solids loading and other factors.

The centrifuge system is designed to work on the active system and be flexible to process incoming fluids from other locations. This set-up is also dependant on well factors.

Dewatering System: The dewatering system is a chemical mixing and dosing system designed to enhance the solids removal of the centrifuge. Not commonly used in shallow wells. It may contain pH adjustment, coagulant mixing and dosing, and polymer mixing and dosing. Chemical flocculation binds ultra fine solids into a mass that is within the centrifuge operating design. The

dewatering system improves the centrifuge cut point to infinity or allows for the return of clear water or brine fluid. This ability allows for the ultimate control of low gravity solids.

Cuttings Boxes: Cuttings boxes are utilized to capture drill solids that are discarded from the solids control equipment. These boxes are set upon a rail system that allows for the removal and replacement of a full box of cuttings with an empty one. They are equipped with a cover that insures no product is spilled into the environment during the transportation phase.

*Process Tank*: (Optional) The process tank allows for the holding and process of fluids that are being transferred into the mud system. Additionally, during times of lost circulation the process tank may hold active fluids that are removed for additional treatment. It can further be used as a mixing tank during well control conditions.

Sump and Sump Pump: The sump is used to collect storm water and the pump is used to transfer this fluid to the active system or to the tank for to hold in reserve. It can also be used to collect fluids that may escape during spills. The location contains drainage ditches that allow the location fluids to drain to the sump.

Reserve Fluids (Tank Farm): A series of frac tanks are used to replace the reserve pit. These are steel tanks that are equipped with a manifold system and a transfer pump. These tanks can contain any number of fluids used during the drilling process. These can include fresh water, cut brine, and saturated salt fluid. The fluid can be from the active well or reclaimed fluid from other locations. A 20 ml liner and berm system is employed to ensure the fluids do not migrate to the environment during a spill.

If a leak develops, the appropriate division district office will be notified within 48 hours of the discovery and the leak will be addressed. Spill prevention is accomplished by maintaining pump packing, hoses, and pipe fittings to insure no leaks are occurring. During an upset condition the source of the spill is isolated and repaired as soon as it is discovered. Free liquid is removed by a diaphragm pump and returned to the mud system. Loose topsoil may be used to stabilize the spill and the contaminated soil is excavated and placed in the cuttings boxes. After the well is finished and the rig has moved, the entire location is scrapped and testing will be performed to determine if a release has occurred.

All trash is kept in a wire mesh enclosure and removed to an approved landfill when full. All spent motor oils are kept in separate containers and they are removed and sent to an approved recycling center. Any spilled lubricants, pipe


dope, or regulated chemicals are removed from soil and sent to landfills approved for these products.

These operations are monitored by Mi Swaco service technicians. Daily logs are maintained to ensure optimal equipment operation and maintenance. Screen and chemical use is logged to maintain inventory control. Fluid properties are monitored and recorded and drilling mud volumes are accounted for in the mud storage farm. This data is kept for end of well review to insure performance goals are met. Lessons learned are logged and used to help with continuous improvement.

A MI SWACO field supervisor manages from 3-5 wells. They are responsible for training personnel, supervising installations, and inspecting sites for compliance of MI SWACO safety and operational policy.

#### III. Closure Plan

A maximum 340' X 340' caliche pad is built per well. All of the trucks and steel tanks fit on this pad. All fluid cuttings go to the steel tanks to be hauled by various trucking companies to an agency approved disposal.

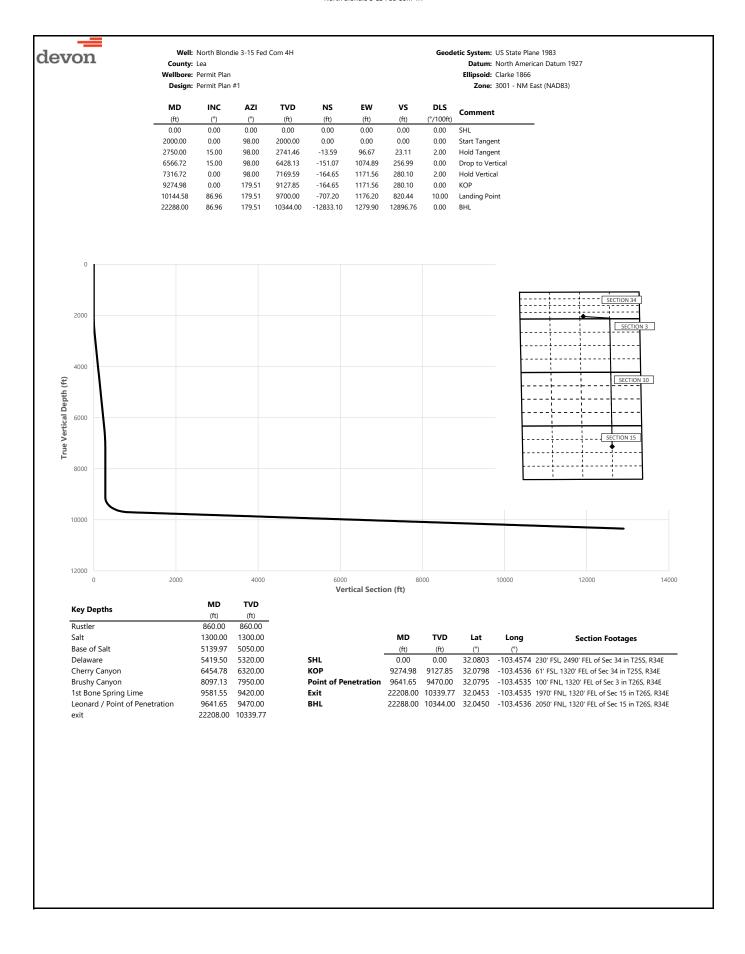



Well: North Blondie 3-15 Fed Com 4H Geodetic System: US State Plane 1983
County: Lea Datum: North American Datum 1927

Wellbore: Permit Plan
Design: Permit Plan #1

Ellipsoid: Clarke 1866

Zone: 3001 - NM Fast (NAD83)

		Permit Plan						Zone: 3001 - NM East (NAD83)
	Design.	. Citilit ridi						Zone. 3001 (NN Last (NNO03)
MD	INC	AZI	TVD	NS	EW	VS	DLS	Comment
(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)	(°/100ft)	
0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	SHL
100.00	0.00	98.00	100.00	0.00	0.00	0.00	0.00	
200.00	0.00	98.00	200.00	0.00	0.00	0.00	0.00	
300.00 400.00	0.00	98.00 98.00	300.00 400.00	0.00	0.00	0.00	0.00	
500.00	0.00	98.00	500.00	0.00	0.00	0.00	0.00	
600.00	0.00	98.00	600.00	0.00	0.00	0.00	0.00	
700.00	0.00	98.00	700.00	0.00	0.00	0.00	0.00	
800.00	0.00	98.00	800.00	0.00	0.00	0.00	0.00	
860.00	0.00	98.00	860.00	0.00	0.00	0.00	0.00	Rustler
900.00	0.00	98.00	900.00	0.00	0.00	0.00	0.00	
1000.00	0.00	98.00	1000.00	0.00	0.00	0.00	0.00	
1100.00	0.00	98.00	1100.00	0.00	0.00	0.00	0.00	
1200.00 1300.00	0.00	98.00 98.00	1200.00 1300.00	0.00	0.00	0.00	0.00	Salt,
1400.00	0.00	98.00	1400.00	0.00	0.00	0.00	0.00	Sait,
1500.00	0.00	98.00	1500.00	0.00	0.00	0.00	0.00	
1600.00	0.00	98.00	1600.00	0.00	0.00	0.00	0.00	
1700.00	0.00	98.00	1700.00	0.00	0.00	0.00	0.00	
1800.00	0.00	98.00	1800.00	0.00	0.00	0.00	0.00	
1900.00	0.00	98.00	1900.00	0.00	0.00	0.00	0.00	
2000.00	0.00	98.00	2000.00	0.00	0.00	0.00	0.00	Start Tangent
2100.00	2.00	98.00	2099.98	-0.24	1.73	0.41	2.00	
2200.00 2300.00	4.00	98.00	2199.84	-0.97	6.91	1.65	2.00	
2400.00	6.00 8.00	98.00 98.00	2299.45 2398.70	-2.18 -3.88	15.54 27.61	3.72 6.60	2.00 2.00	
2500.00	10.00	98.00	2497.47	-6.06	43.10	10.30	2.00	
2600.00	12.00	98.00	2595.62	-8.71	61.99	14.82	2.00	
2700.00	14.00	98.00	2693.06	-11.84	84.27	20.15	2.00	
2750.00	15.00	98.00	2741.46	-13.59	96.67	23.11	2.00	Hold Tangent
2800.00	15.00	98.00	2789.76	-15.39	109.48	26.18	0.00	
2900.00	15.00	98.00	2886.35	-18.99	135.11	32.30	0.00	
3000.00	15.00	98.00	2982.94	-22.59	160.74	38.43	0.00	
3100.00 3200.00	15.00 15.00	98.00	3079.54	-26.19 -29.79	186.37	44.56	0.00	
3300.00	15.00	98.00 98.00	3176.13 3272.72	-33.40	212.00 237.63	50.69 56.81	0.00	
3400.00	15.00	98.00	3369.31	-37.00	263.26	62.94	0.00	
3500.00	15.00	98.00	3465.91	-40.60	288.89	69.07	0.00	
3600.00	15.00	98.00	3562.50	-44.20	314.52	75.20	0.00	
3700.00	15.00	98.00	3659.09	-47.80	340.15	81.33	0.00	
3800.00	15.00	98.00	3755.68	-51.41	365.78	87.45	0.00	
3900.00	15.00	98.00	3852.28	-55.01	391.41	93.58	0.00	
4000.00	15.00	98.00	3948.87	-58.61	417.04	99.71	0.00	
4100.00	15.00	98.00	4045.46	-62.21	442.67	105.84	0.00	
4200.00 4300.00	15.00 15.00	98.00 98.00	4142.05 4238.65	-65.81 -69.42	468.30 493.93	111.97 118.09	0.00	
4400.00	15.00	98.00	4335.24	-73.02	519.56	124.22	0.00	
4500.00	15.00	98.00	4431.83	-76.62	545.19	130.35	0.00	
4600.00	15.00	98.00	4528.42	-80.22	570.82	136.48	0.00	
4700.00	15.00	98.00	4625.02	-83.82	596.45	142.60	0.00	
4800.00	15.00	98.00	4721.61	-87.43	622.08	148.73	0.00	
4900.00	15.00	98.00	4818.20	-91.03	647.71	154.86	0.00	
5000.00	15.00	98.00	4914.80	-94.63	673.34	160.99	0.00	
5100.00 5139.97	15.00	98.00	5011.39	-98.23	698.97	167.12	0.00	Base of Salt
5139.97	15.00 15.00	98.00 98.00	5050.00 5107.98	-99.67 -101.84	709.22 724.60	169.57 173.24	0.00	Dase of Salt
5300.00	15.00	98.00	5204.57	-101.04	750.23	179.37	0.00	
5400.00	15.00	98.00	5301.17	-109.04	775.86	185.50	0.00	
5419.50	15.00	98.00	5320.00	-109.74	780.86	186.69	0.00	Delaware
5500.00	15.00	98.00	5397.76	-112.64	801.49	191.63	0.00	
5600.00	15.00	98.00	5494.35	-116.24	827.12	197.76	0.00	
5700.00	15.00	98.00	5590.94	-119.85	852.75	203.88	0.00	
5800.00	15.00	98.00	5687.54	-123.45	878.38	210.01	0.00	
5900.00	15.00	98.00	5784.13	-127.05	904.01	216.14	0.00	
6000.00	15.00	98.00	5880.72 5077.21	-130.65	929.64	222.27	0.00	
6100.00 6200.00	15.00 15.00	98.00 98.00	5977.31 6073.91	-134.25 -137.86	955.27 980.90	228.39 234.52	0.00	
6300.00	15.00	98.00	6170.50	-137.00	1006.53	240.65	0.00	
6400.00	15.00	98.00	6267.09	-145.06	1032.16	246.78	0.00	
6454.78	15.00	98.00	6320.00	-147.03	1046.20	250.13	0.00	Cherry Canyon



Well: North Blondie 3-15 Fed Com 4H

County: Lea Wellbore: Permit Plan Design: Permit Plan #1 Geodetic System: US State Plane 1983

Datum: North American Datum 1927

Ellipsoid: Clarke 1866
Zone: 3001 - NM East (NAD83)

MD vs INC AZI TVD NS EW DLS Comment (°/100ft) (ft) (°) (°) (ft) (ft) (ft) (ft) 6500.00 15.00 98.00 6363.68 -148.661057.79 252.91 0.00 6566.72 15.00 98.00 6428.13 -151.07 1074.89 256.99 0.00 Drop to Vertical 6600.00 14.33 98.00 6460.33 -152.24 1083.24 258.99 2.00 6700.00 12.33 98.00 6557.62 2.00 -155.45 1106.07 264.45 6800.00 10.33 98.00 6655.67 -158.18 1125.53 269.10 2.00 6900.00 8.33 98.00 6754.34 -160.44 1141.60 272.94 2.00 7000.00 6.33 98.00 6853.52 -162.22 1154.24 275.97 2.00 7100.00 4.33 98.00 6953.08 -163.51 1163.44 278.17 2.00 7200.00 2.33 98.00 7052.90 -164.32 1169.20 279.54 2.00 7300.00 0.33 98.00 7152.87 -164.64 1171.51 280.10 2.00 7316.72 98.00 7169.59 -164.65 1171.56 280.10 0.00 2.00 Hold Vertical 7400.00 0.00 179.51 7252.87 -164.65 1171.56 280.11 0.00 7500.00 0.00 179.51 7352.87 -164.65 1171.56 280.11 0.00 7600.00 0.00 179.51 7452.87 -164.65 1171.56 280.11 0.00 7700.00 0.00 179.51 7552.87 -164.65 1171.56 280.11 0.00 7800.00 0.00 179.51 7652.87 -164.65 1171.56 280.11 0.00 7900.00 179.51 7752.87 -164.65 1171.56 280.11 0.00 0.00 8000.00 7852.87 1171.56 280.11 0.00 179.51 -164.65 0.00 8097.13 0.00 179.51 7950.00 -164.65 1171.56 280.11 0.00 Brushy Canyon 8100.00 0.00 179.51 7952.87 -164.65 1171.56 280.11 0.00 8200.00 0.00 179.51 8052.87 -164.65 1171.56 280.11 0.00 8300.00 0.00 179.51 8152.87 -164.65 1171.56 280.11 0.00 8400.00 0.00 179 51 825287 -164 65 1171 56 280 11 0.00 8500.00 0.00 179.51 8352.87 -164.65 1171.56 280.11 0.00 8600.00 0.00 179.51 8452.87 -164.65 1171.56 280.11 0.00 8700.00 0.00 179.51 8552.87 -164.65 1171.56 280.11 0.00 8800.00 0.00 179.51 8652.87 -164 65 1171.56 280.11 0.00 8900.00 179.51 8752.87 -164.65 1171.56 280.11 0.00 0.00 9000.00 0.00 179.51 8852.87 -164.65 1171.56 280.11 0.00 9100.00 0.00 179.51 8952.87 -164.65 1171.56 280.11 0.00 9200.00 0.00 179.51 9052.87 -164.65 1171.56 280.11 0.00 9274.98 1171.56 280.10 0.00 0.00 179.51 9127.85 -164.65 KOP 9300.00 9152.86 -165.20 1171.56 280.65 2.50 179.51 10.00 9400.00 12.50 179.51 9251.88 -178.241171.67 293.64 10.00 9500.00 22 50 179.51 9347.13 -208 27 1171.93 323.55 10.00 9581.55 30.66 179.51 9420.00 -244.73 1172.24 359.86 10.00 1st Bone Spring Lime 9600.00 32.50 179.51 9435.72 -254.39 1172.32 369.48 10.00 9641.65 36.67 179.51 9470.00 -278.03 1172.53 393.02 10.00 Leonard / Point of Penetration 9700.00 42.50 179.51 9514.95 -315.19 1172.84 430.03 10.00 9800.00 9582.42 -388.83 1173.47 503.37 10.00 52.50 179.51 9900.00 62.50 179.51 9636.08 -473.061174.19 587.25 10.00 10000.00 72 50 179.51 9674.30 -565.33 1174.98 679.14 10.00 10100.00 82.50 179.51 9695.91 -662.83 1175.82 776.25 10.00 10144.58 9700.00 86.96 179.51 -707.20 1176.20 820.44 10.00 Landing Point 10200.00 86.96 179.51 9702.94 -762.55 1176.67 875.56 0.00 10300.00 86.96 179.51 9708.24 -862.40 1177.52 975.01 0.00 10400.00 86.96 179.51 9713.55 -962.26 1178.38 1074.45 0.00 -1062.11 0.00 10500.00 86.96 179.51 9718.85 1179.23 1173.90 10600.00 86.96 179.51 9724.15 -1161.97 1180.09 1273.35 0.00 10700.00 86.96 179.51 9729.46 -1261.83 1180.94 1372.80 0.00 10800.00 86.96 179.51 9734.76 -1361.68 1181.80 1472.24 0.00 10900.00 179.51 9740.06 -1461.54 1182.65 1571.69 86.96 0.00 11000.00 86.96 179.51 9745.37 -1561.39 1183.50 1671.14 0.00 11100.00 1184.36 1770.59 86.96 179.51 9750.67 -1661.25 0.00 9755.97 11200.00 86.96 179.51 -1761.10 1185.21 1870.03 0.00 11300.00 86 96 179 51 9761 28 -1860 96 1186 07 1969 48 0.00 11400.00 86.96 179.51 9766.58 -1960.82 1186.92 2068.93 0.00 11500.00 86.96 179.51 9771.88 -2060.67 1187.77 2168.38 86.96 2267.82 11600.00 179.51 9777.19 -2160.53 1188.63 0.00 11700.00 86.96 179.51 9782.49 -2260.38 1189.48 2367.27 0.00 11800.00 2466.72 86.96 179.51 9787.79 -2360.24 1190.34 11900.00 86.96 179.51 9793.10 -2460.09 1191.19 2566.17 0.00 12000 00 86 96 179 51 9798 40 -2559 95 1192 05 2665 61 0.00 12100.00 86.96 179.51 9803.70 -2659.80 1192.90 2765.06 0.00 12200.00 86.96 179.51 9809.01 -2759.66 1193.75 2864.51 0.00 12300.00 86.96 179.51 9814.31 -2859.52 1194.61 2963.96 0.00 12400.00 86 96 179 51 981961 -2959 37 1195 46 3063.40 0.00 12500.00 86.96 179.51 9824.92 -3059.23 1196.32 3162.85 0.00 12600.00 86.96 179.51 9830.22 -3159.08 1197.17 3262.30 0.00 12700.00 86.96 179.51 9835.52 -3258.94 1198.03 3361.75 0.00



Well: North Blondie 3-15 Fed Com 4H

County: Lea Wellbore: Permit Plan

Design: Permit Plan #1 Geodetic System: US State Plane 1983

Datum: North American Datum 1927

Ellipsoid: Clarke 1866

	Design: Permit Plan #1							<b>Zone:</b> 3001 - NM East (NAD83)		
MD (ft)	INC (°)	AZI (°)	TVD (ft)	NS (ft)	<b>EW</b> (ft)	VS (ft)	<b>DLS</b> (°/100ft)	Comment		
12800.00	86.96	179.51	9840.83	-3358.79	1198.88	3461.19	0.00			
12900.00	86.96	179.51	9846.13	-3458.65	1199.73	3560.64	0.00			
13000.00	86.96	179.51	9851.44	-3558.51	1200.59	3660.09	0.00			
13100.00	86.96	179.51	9856.74	-3658.36	1201.44	3759.54	0.00			
13200.00	86.96	179.51	9862.04	-3758.22	1202.30	3858.98	0.00			
13300.00	86.96	179.51	9867.35	-3858.07	1203.15	3958.43	0.00			
13400.00 13500.00	86.96 86.96	179.51 179.51	9872.65 9877.95	-3957.93 -4057.78	1204.01 1204.86	4057.88 4157.32	0.00			
13600.00	86.96	179.51	9883.26	-4157.64	1205.71	4256.77	0.00			
13700.00	86.96	179.51	9888.56	-4257.49	1206.57	4356.22	0.00			
13800.00	86.96	179.51	9893.86	-4357.35	1207.42	4455.67	0.00			
13900.00	86.96	179.51	9899.17	-4457.21	1208.28	4555.11	0.00			
14000.00	86.96	179.51	9904.47	-4557.06	1209.13	4654.56	0.00			
14100.00	86.96	179.51	9909.77	-4656.92	1209.99	4754.01	0.00			
14200.00	86.96	179.51	9915.08	-4756.77	1210.84	4853.46	0.00			
14300.00	86.96	179.51	9920.38	-4856.63	1211.69	4952.90	0.00			
14400.00 14500.00	86.96 86.96	179.51 179.51	9925.68 9930.99	-4956.48 -5056.34	1212.55 1213.40	5052.35 5151.80	0.00			
14600.00	86.96	179.51	9936.29	-5156.19	1214.26	5251.25	0.00			
14700.00	86.96	179.51	9941.59	-5256.05	1215.11	5350.69	0.00			
14800.00	86.96	179.51	9946.90	-5355.91	1215.97	5450.14	0.00			
14900.00	86.96	179.51	9952.20	-5455.76	1216.82	5549.59	0.00			
15000.00	86.96	179.51	9957.50	-5555.62	1217.67	5649.04	0.00			
15100.00	86.96	179.51	9962.81	-5655.47	1218.53	5748.48	0.00			
15200.00	86.96	179.51	9968.11	-5755.33	1219.38	5847.93	0.00			
15300.00	86.96	179.51	9973.41	-5855.18	1220.24	5947.38	0.00			
15400.00 15500.00	86.96 86.96	179.51 179.51	9978.72 9984.02	-5955.04 -6054.90	1221.09 1221.95	6046.83 6146.27	0.00			
15600.00	86.96	179.51	9989.32	-6154.75	1222.80	6245.72	0.00			
15700.00	86.96	179.51	9994.63	-6254.61	1223.65	6345.17	0.00			
15800.00	86.96	179.51	9999.93	-6354.46	1224.51	6444.62	0.00			
15900.00	86.96	179.51	10005.23	-6454.32	1225.36	6544.06	0.00			
16000.00	86.96	179.51	10010.54	-6554.17	1226.22	6643.51	0.00			
16100.00	86.96	179.51	10015.84	-6654.03	1227.07	6742.96	0.00			
16200.00	86.96	179.51	10021.14	-6753.88	1227.93	6842.41	0.00			
16300.00	86.96	179.51	10026.45	-6853.74	1228.78	6941.85	0.00			
16400.00	86.96	179.51	10031.75	-6953.60	1229.63	7041.30	0.00			
16500.00 16600.00	86.96 86.96	179.51 179.51	10037.05 10042.36	-7053.45 -7153.31	1230.49 1231.34	7140.75 7240.20	0.00			
16700.00	86.96	179.51	10042.56	-7253.16	1232.20	7339.64	0.00			
16800.00	86.96	179.51	10052.96	-7353.02	1233.05	7439.09	0.00			
16900.00	86.96	179.51	10058.27	-7452.87	1233.91	7538.54	0.00			
17000.00	86.96	179.51	10063.57	-7552.73	1234.76	7637.98	0.00			
17100.00	86.96	179.51		-7652.59	1235.61	7737.43	0.00			
17200.00	86.96	179.51	10074.18	-7752.44	1236.47	7836.88	0.00			
17300.00	86.96	179.51	10079.48	-7852.30	1237.32	7936.33	0.00			
17400.00	86.96 86.96	179.51	10084.79	-7952.15	1238.18	8035.77	0.00			
17500.00 17600.00	86.96 86.96	179.51 179.51	10090.09 10095.39	-8052.01 -8151.86	1239.03 1239.88	8135.22 8234.67	0.00			
17700.00	86.96	179.51	101093.39	-8251.72	1239.66	8334.12	0.00			
17800.00	86.96	179.51	10106.70	-8351.57	1241.59	8433.56	0.00			
17900.00	86.96	179.51	10111.30	-8451.43	1242.45	8533.01	0.00			
18000.00	86.96	179.51	10116.61	-8551.29	1243.30	8632.46	0.00			
18100.00	86.96	179.51	10121.91	-8651.14	1244.16	8731.91	0.00			
18200.00	86.96	179.51	10127.21	-8751.00	1245.01	8831.35	0.00			
18300.00	86.96	179.51	10132.52	-8850.85	1245.86	8930.80	0.00			
18400.00	86.96	179.51	10137.82	-8950.71	1246.72	9030.25	0.00			
18500.00 18600.00	86.96 86.96	179.51 179.51	10143.12 10148.43	-9050.56 -9150.42	1247.57 1248.43	9129.70 9229.14	0.00			
18700.00	86.96	179.51	10148.43	-9150.42 -9250.28	1246.43	9328.59	0.00			
18800.00	86.96	179.51	10155.73	-9350.28	1250.14	9428.04	0.00			
18900.00	86.96	179.51	10164.34	-9449.99	1250.99	9527.49	0.00			
19000.00	86.96	179.51	10169.64	-9549.84	1251.84	9626.93	0.00			
19100.00	86.96	179.51	10174.94	-9649.70	1252.70	9726.38	0.00			
19200.00	86.96	179.51	10180.25	-9749.55	1253.55	9825.83	0.00			
19300.00	86.96	179.51	10185.55	-9849.41	1254.41	9925.28	0.00			
19400.00	86.96	179.51	10190.85	-9949.26	1255.26	10024.72	0.00			
19500.00 19600.00	86.96 86.96	179.51 179.51		-10049.12 -10148.98	1256.12	10124.17	0.00			
19600.00	86.96 86.96	179.51		-10148.98	1256.97 1257.82	10223.62 10323.07	0.00			

21800.00

21900.00

22000.00

22100.00

22200.00

22208.00

22288.00

86.96

86.96

86 96

86.96

86.96

86.96

86.96

179.51

179.51

179 51

179.51

179.51

179.51

179.51

10318.14 -12345.80

10323.44 -12445.65

10328 74 -12545 51

10334.05 -12645.37

10339.35 -12745.22

10339.77 -12753.21

10344.00 -12833.10 1279.90



Well: North Blondie 3-15 Fed Com 4H

County: Lea
Wellbore: Permit Plan
Design: Permit Plan #1

Geodetic System: US State Plane 1983

Datum: North American Datum 1927

Ellipsoid: Clarke 1866 Zone: 3001 - NM East (NAD83)

MD INC ΑZI TVD NS EW vs DLS Comment (°/100ft) (ft) (ft) (ft) (ft) (ft) (°) (°) 19800.00 86.96 179.51 10212.07 -10348.69 1258.68 10422.51 0.00 19900.00 86.96 179.51 10217.37 -10448.54 1259.53 10521.96 0.00 20000.00 86.96 179.51 10222.67 -10548.40 1260.39 10621.41 0.00 20100.00 86.96 -10648.25 10720.86 179.51 10227.98 1261.24 0.00 20200.00 86.96 179.51 10233.28 -10748.11 1262.10 10820.30 0.00 20300.00 86.96 179.51 10238.58 -10847.96 1262.95 10919.75 0.00 20400.00 86.96 179.51 10243.89 -10947.82 1263.80 11019.20 0.00 20500.00 10249.19 -11047.68 86.96 179.51 1264.66 11118.64 0.00 20600.00 86.96 179.51 10254.49 -11147.53 1265.51 11218.09 0.00 20700.00 86.96 179.51 10259.80 -11247.39 1266.37 11317.54 0.00 20800.00 86.96 179.51 10265.10 -11347.24 11416.99 0.00 1267.22 20900.00 86.96 179.51 10270.40 -11447.10 1268.08 11516.43 0.00 21000.00 86.96 179.51 10275.71 -11546.95 1268.93 11615.88 0.00 21100.00 86.96 179.51 10281.01 -11646.81 1269.78 11715.33 21200.00 86.96 179.51 10286.31 -11746.67 1270.64 11814.78 0.00 21300.00 86.96 179.51 10291.62 -11846.52 1271.49 11914.22 0.00 21400.00 86.96 179.51 10296.92 -11946.38 1272.35 12013.67 21500.00 86.96 179.51 10302.22 -12046.23 1273.20 12113.12 0.00 21600.00 86.96 179.51 10307.53 -12146.09 1274.06 12212.57 0.00 21700.00 86.96 179.51 10312.83 -12245.94 1274.91 12312.01 0.00

1275.76

1276.62

1277.47

1278.33

1279.18

1279.25

12411.46

12510.91

12610.36

12709.80

12809.25

12817.21

12896.76

0.00

0.00

0.00

0.00

0.00

0.00 exit

0.00 BHL

INC

(°)

AZI

(°)

MD

(ft)

TVD

(ft)

NS

(ft)

EW

(ft)

Well: North Blondie 3-15 Fed Com 4HGeodetic System: US State Plane 1983County: LeaDatum: North American Datum 1927Wellbore: Permit PlanEllipsoid: Clarke 1866Design: Permit Plan #1Zone: 3001 - NM East (NAD83)


٧S

(ft)

DLS

(°/100ft)

Comment

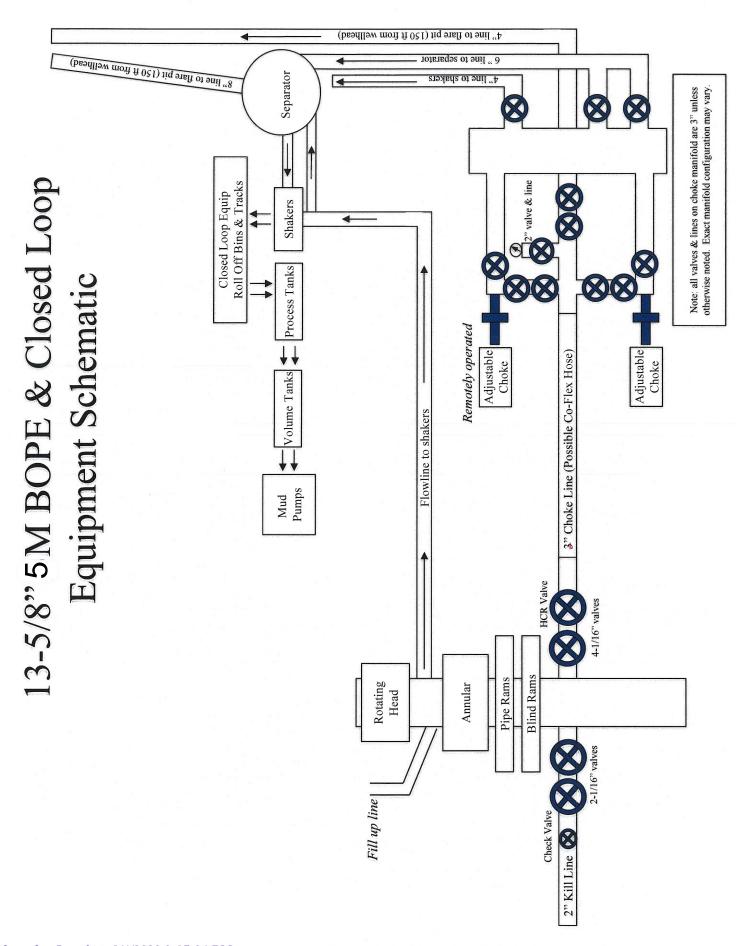

A multibowl wellhead may be used. The BOP will be tested per Onshore Order #2 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system must be tested.

Devon proposes using a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi.


- Wellhead will be installed by wellhead representatives.
- If the welding is performed by a third party, the wellhead representative will monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- Wellhead representative will install the test plug for the initial BOP test.
- Wellhead company will install a solid steel body pack-off to completely isolate the lower head after cementing intermediate casing. After installation of the pack-off, the pack-off and the lower flange will be tested to 5M, as shown on the attached schematic.
   Everything above the pack-off will not have been altered whatsoever from the initial nipple up. Therefore the BOP components will not be retested at that time.
- If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head will be cut and top out operations will be conducted.
- Devon will pressure test all seals above and below the mandrel (but still above the casing) to full working pressure rating.
- Devon will test the casing to 0.22 psi/ft or 1500 psi, whichever is greater, as per Onshore Order #2.

After running the surface casing, a 13-5/8" BOP/BOPE system with a minimum rating of 5M will be installed on the wellhead system and will undergo a 250 psi low pressure test followed by a 5,000 psi high pressure test. The 5,000 psi high and 250 psi low test will cover testing requirements a maximum of 30 days, as per Onshore Order #2. If the well is not complete within 30 days of this BOP test, another full BOP test will be conducted, as per Onshore Order #2.

After running the intermediate casing with a mandrel hanger, the 13-5/8" BOP/BOPE system with a minimum rating of 5M will already be installed on the wellhead.

The pipe rams will be operated and checked each 24 hour period and each time the drill pipe is out of the hole. These tests will be logged in the daily driller's log. A 2" kill line and 3" choke line will be incorporated into the drilling spool below the ram BOP. In addition to the rams and annular preventer, additional BOP accessories include a kelly cock, floor safety valve, choke lines, and choke manifold rated at 5,000 psi WP.

Devon's proposed wellhead manufactures will be FMC Technologies, Cactus Wellhead, or Cameron.

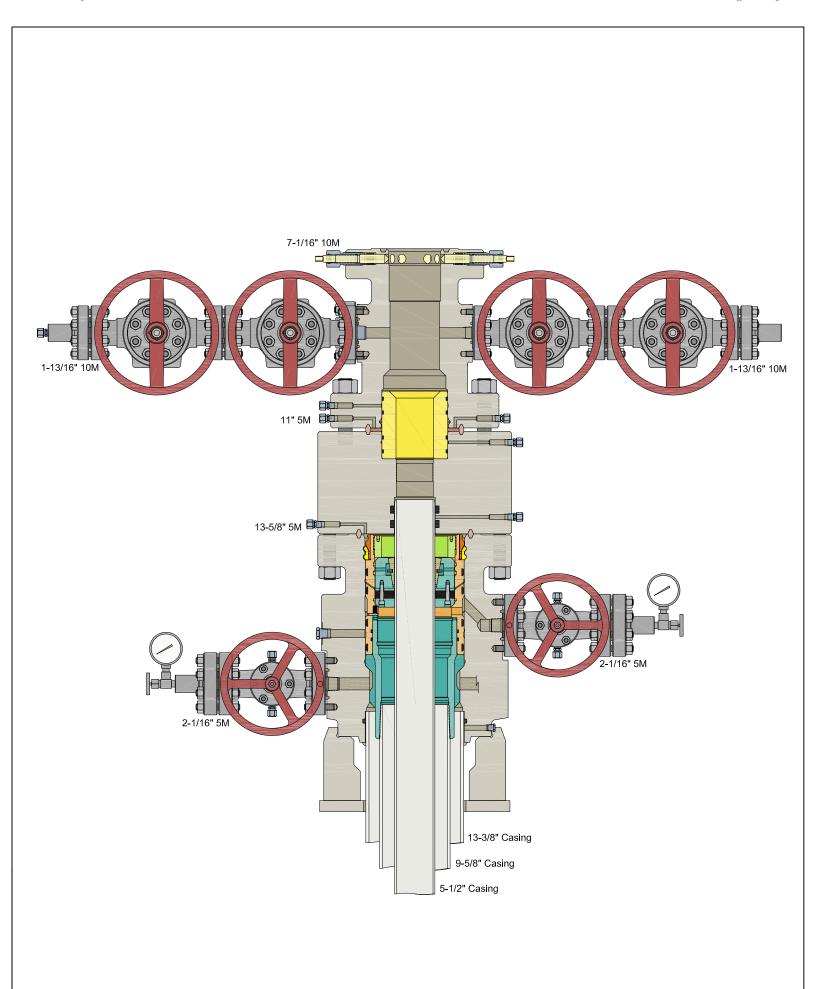

Released to Imaging: 8/4/2023 3:07:34 PM

#### **Section 2 - Blowout Preventer Testing Procedure**

Variance Request

Devon Energy requests to only test BOP connection breaks after drilling out of surface casing and while skidding between wells which conforms to API Standard 53 and industry standards. This test will include the Top Pipe Rams, HCR, Kill Line Check Valve, QDC (quick disconnect to wellhead) and Shell of the 10M BOPE to 5M for 10 minutes. If a break to the flex hose that runs to the choke manifold is required due to repositioning from a skid, the HCR will remain open during the shell test to include that additional break. The variance only pertains to intermediate hole-sections and no deeper than the Bone Springs Formation where 5M BOP tests are required. The initial BOP test will follow OOGO2.III.A.2.i, and subsequent tests following a skid will only test connections that are broken. The annular preventer will be tested to 100% working pressure. This variance will meet or exceed OOGO2.III.A.2.i per the following: Devon Energy will perform a full BOP test per OOGO2.III.A.2.i before drilling out of the intermediate casing string(s) and starting the production hole, before starting any hole section that requires a 10M test, before the expiration of the allotted 14-days for 5M intermediate batch drilling or when the drilling rig is fully mobilized to a new well pad, whichever is sooner. We will utilize a 200' TVD tolerance between intermediate shoes as the cutoff for a full BOP test. The BLM will be contacted 4hrs prior to a BOPE test. The BLM will be notified if and when a well control event is encountered. Break test will be a 14 day interval and not a 30 day full BOPE test interval. If in the event break testing is not utilized, then a full BOPE test would be conducted.

- 1. Well Control Response:
- 1. Primary barrier remains fluid
- 2. In the event of an influx due to being underbalanced and after a realized gain or flow, the order of closing BOPE is as follows:
  - a) Annular first
  - b) If annular were to not hold, Upper pipe rams second (which were tested on the skid BOP test)
  - c) If the Upper Pipe Rams were to not hold, Lower Pipe Rams would be third

Casing Assumptions and Load Cases

Surface

All casing design assumptions were ran in Stress Check to determine safety factor which meet or exceed both Devon Energy and BLM minimum requirements. All casing strings will be filled while running in hole in order to not exceed collapse rating of the pipe.

Surface Casing Burst Design					
Load Case External Pressure Internal Pressure					
Pressure Test	Formation Pore Pressure	Max mud weight of next hole- section plus Test psi			
Drill Ahead	Formation Pore Pressure	Max mud weight of next hole section			
Displace to Gas	Formation Pore Pressure	Dry gas from next casing point			

Surface Casing Collapse Design					
Load Case External Pressure Internal Pressure					
Full Evacuation	Water gradient in cement, mud above TOC	None			
Cementing Wet cement weight Water (8.33ppg)					

Surface Casing Tension Design				
Load Case Assumptions				
Overpull	100kips			
Runing in hole 3 ft/s				
Service Loads N/A				

Casing Assumptions and Load Cases

Intermediate

All casing design assumptions were ran in Stress Check to determine safety factor which meet or exceed both Devon Energy and BLM minimum requirements. All casing strings will be filled while running in hole in order to not exceed collapse rating of the pipe.

Intermediate Casing Burst Design					
Load Case External Pressure Internal Pressure					
Pressure Test	Formation Pore Pressure	Max mud weight of next hole- section plus Test psi			
Drill Ahead	Formation Pore Pressure	Max mud weight of next hole section			
Fracture @ Shoe	Formation Pore Pressure	Dry gas			

Intermediate Casing Collapse Design					
Load Case External Pressure Internal Pressure					
Full Evacuation Water gradient in cement, mud		None			
above TOC					
Cementing Wet cement weight Water (8.33ppg)					

Intermediate Casing Tension Design			
Load Case Assumptions			
Overpull	100kips		
Runing in hole 2 ft/s			
Service Loads N/A			

Casing Assumptions and Load Cases

Production

All casing design assumptions were ran in Stress Check to determine safety factor which meet or exceed both Devon Energy and BLM minimum requirements. All casing strings will be filled while running in hole in order to not exceed collapse rating of the pipe.

Production Casing Burst Design					
Load Case External Pressure Internal Pressure					
Pressure Test	Formation Pore Pressure Fluid in hole (water or pro-				
		water) + test psi			
Tubing Leak	Formation Pore Pressure	Packer @ KOP, leak below			
		surface 8.6 ppg packer fluid			
Stimulation	Formation Pore Pressure	Max frac pressure with heaviest			
		frac fluid			

Production Casing Collapse Design					
Load Case External Pressure Internal Pressure					
Full Evacuation	Water gradient in cement, mud above TOC.	None			
Cementing Wet cement weight Water (8.33ppg)					

Production Casing Tension Design			
Load Case Assumptions			
Overpull 100kips			
Runing in hole 2 ft/s			
Service Loads N/A			

# PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

**OPERATOR'S NAME:** Devon Energy Production Company LP

LEASE NO.: NMNM092200

**LOCATION:** Section 34, T.25 S., R.34 E., NMPM

**COUNTY:** Lea County, New Mexico

WELL NAME & NO.: North Blondie 3-15 Fed Com 3H

**SURFACE HOLE FOOTAGE:** 230'/S & 2550'/E **BOTTOM HOLE FOOTAGE** 2050'/N & 2200'/E

ATS/API ID: ATS-22-1584 APD ID: 10400086610

Sundry ID: N/a

WELL NAME & NO.: North Blondie 3-15 Fed Com 4H

**SURFACE HOLE FOOTAGE:** 230'/S & 2490'/E **BOTTOM HOLE FOOTAGE** 2050'/N & 1320'/E

ATS/API ID: ATS-22-1585 APD ID: 10400086611

Sundry ID: N/a

COA

H2S	Yes		
Potash	None		
Cave/Karst Potential	Low		
Cave/Karst Potential	□ Critical		
Variance	None	© Flex Hose	Other
Wellhead	Conventional and Multibow	/	
Other	□ 4 String	Capitan Reef	□WIPP
		None	
Other	Pilot Hole	Open Annulus	
	None 🔻		
Cementing	Contingency Squeeze	Echo-Meter	Primary Cement
	Int 1 ▼	None ▼	Squeeze
			None ▼
Special	☐ Water	<b>☑</b> COM	□ Unit
Requirements	Disposal/Injection		
Special	☐ Batch Sundry		
Requirements			
Special	✓ Break Testing	☐ Offline	☐ Casing
Requirements		Cementing	Clearance
Variance			

#### A. HYDROGEN SULFIDE

A Hydrogen Sulfide (H2S) Drilling Plan shall be activated 500 feet prior to drilling into the **Delaware** formation. As a result, the Hydrogen Sulfide area must meet Onshore Order 6 requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, please provide measured values and formations to the BLM.

#### **B. CASING**

- 1. The 13-3/8 inch surface casing shall be set at approximately 950 feet (a minimum of 25 feet (Lea County) into the Rustler Anhydrite, above the salt, and below usable fresh water) and cemented to the surface. The surface hole shall be 17 1/2 inch in diameter.
  - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of

- six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
- b. Wait on cement (WOC) time for a primary cement job will be a minimum of **8** hours or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
- c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
- d. If cement falls back, remedial cementing will be done prior to drilling out that string.

## Intermediate casing must be kept fluid filled to meet BLM minimum collapse requirement.

2. The minimum required fill of cement behind the 9-5/8 inch intermediate casing is:

#### **Option 1 (Single Stage):**

• Cement to surface. If cement does not circulate see B.1.a, c-d above.

### Option 2:

Operator has proposed a DV tool, the depth may be adjusted as long as the cement is changed proportionally. The DV tool may be cancelled if cement circulates to surface on the first stage.

- a. First stage to DV tool: Cement to circulate. If cement does not circulate off the DV tool, contact the appropriate BLM office before proceeding with second stage cement job.
- b. Second stage above DV tool:
  - Cement to surface. If cement does not circulate, contact the appropriate BLM office.

Operator has proposed to pump down 13-3/8" X 9-5/8" annulus after primary cementing stage. Operator must run a CBL from TD of the 9-5/8" casing to surface. Submit results to the BLM.

# If cement does not tie-back into the previous casing shoe, a third stage remediation BH may be performed. The appropriate BLM office shall be notified.

- 3. The minimum required fill of cement behind the 5-1/2 inch production casing is:
  - Cement should tie-back at least **200 feet** into previous casing string. Operator shall provide method of verification.

Page 3 of 10

Cement excess is less than 25%, more cement is required if washout occurs. Adjust cement volume and excess based on a fluid caliper or similar method that reflects the as-drilled size of the wellbore.

## C. PRESSURE CONTROL

1. Variance approved to use flex line from BOP to choke manifold. Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).'

2.

#### **Option 1:**

- a. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 3000 (3M) psi. Annular which shall be tested to 2100 (70% Working Pressure) psi.
- b. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the 9-5/8 inch intermediate casing shoe shall be 5000 (5M) psi.

## **Option 2:**

Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the 13-3/8 inch surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi.

- a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
- b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- c. Manufacturer representative shall install the test plug for the initial BOP test.
- d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- e. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.

### D. SPECIAL REQUIREMENT (S)

## **Communitization Agreement**

- The operator will submit a Communitization Agreement to the Santa Fe Office, 301 Dinosaur Trail Santa Fe, New Mexico 87508, at least 90 days before the anticipated date of first production from a well subject to a spacing order issued by the New Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.
- The operator will submit an as-drilled survey well plat of the well completion, but are not limited to, those specified in Onshore Order 1 and 2.
- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. When the Communitization Agreement number is known, it shall also be on the sign.

## **BOPE Break Testing Variance**

- BOPE Break Testing is ONLY permitted for 5M BOPE or less. (Annular preventer must be tested to a minimum of 70% of BOPE working pressure and shall be higher than the MASP)
- BOPE Break Testing is NOT permitted to drilling the production hole section.
- Variance only pertains to the intermediate hole-sections and no deeper than the Bone Springs formation.
- While in transfer between wells, the BOPE shall be secured by the hydraulic carrier or cradle.
- Any well control event while drilling require notification to the BLM Petroleum Engineer (575-706-2779) prior to the commencement of any BOPE Break Testing operations.
- A full BOPE test is required prior to drilling the first deep intermediate hole section. If any subsequent hole interval is deeper than the first, a full BOPE test will be required. (200' TVD tolerance between intermediate shoes is allowable).
- The BLM is to be contacted (575-689-5981 Lea County) 4 hours prior to BOPE tests.
- As a minimum, a full BOPE test shall be performed at 14-day intervals.
- In the event any repairs or replacement of the BOPE is required, the BOPE shall test as per Onshore Oil and Gas Order No. 2.
- If in the event break testing is not utilized, then a full BOPE test would be conducted.

## **GENERAL REQUIREMENTS**

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)
  - ☑ Eddy CountyCall the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220, (575) 361-2822
  - ✓ Lea CountyCall the Hobbs Field Station, 414 West Taylor, Hobbs NM 88240, (575)689-5981
- 1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
  - a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).
  - b. When the operator proposes to set surface casing with Spudder Rig
    - Notify the BLM when moving in and removing the Spudder Rig.
    - Notify the BLM when moving in the 2<sup>nd</sup> Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
    - BOP/BOPE test to be conducted per Onshore Oil and Gas Order No. 2 as soon as 2nd Rig is rigged up on well.
- 2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.
- 3. The record of the drilling rate along with the GR/N well log run from TD to surface (horizontal well vertical portion of hole) shall be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies. The Rustler top and top and bottom of Salt are to be recorded on the Completion Report.

#### A. CASING

- 1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.
- 2. Wait on cement (WOC) for Potash Areas: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends, 2) until cement has been in place at least 24 hours. WOC time will be recorded in the driller's log. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 3. Wait on cement (WOC) for Water Basin: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least 8 hours. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 4. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.
- 5. No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.
- 6. On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.
- 7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.
- 8. Whenever a casing string is cemented in the R-111-P potash area, the NMOCD requirements shall be followed.

#### B. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.
- 3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.
- 4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:
  - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
  - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
  - c. Manufacturer representative shall install the test plug for the initial BOP test.
  - d. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.
  - e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
  - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin

- after cut-off or once cement reaches 500 psi compressive strength (including lead cement), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
- b. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the cement plug. The BOPE test can be initiated after bumping the cement plug with the casing valve open. (only applies to single stage cement jobs, prior to the cement setting up.)
- c. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer and can be initiated immediately with the casing valve open. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to Onshore Order 2 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for water basin (8 hours) or potash (24 hours) or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
- d. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.
- e. The results of the test shall be reported to the appropriate BLM office.
- f. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- g. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- h. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per Onshore Order No. 2.
- C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

### D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

LVO 6/7/2023



Devon Energy Center 333 West Sheridan Avenue Oklahoma City, Oklahoma 73102-5015

# Hydrogen Sulfide (H<sub>2</sub>S) Contingency Plan

For


North Blondie 3-15 Fed Com 4H


Sec-34 T-25S R-34E 230' FSL & 2490' FEL LAT. = 32.080370 N (NAD83) LONG = 103.457307 W

**Lea County NM** 

## North Blondie 3-15 Fed Com 4H

This is an open drilling site.  $H_2S$  monitoring equipment and emergency response equipment will be used within 500' of zones known to contain  $H_2S$ , including warning signs, wind indicators and  $H_2S$  monitor.



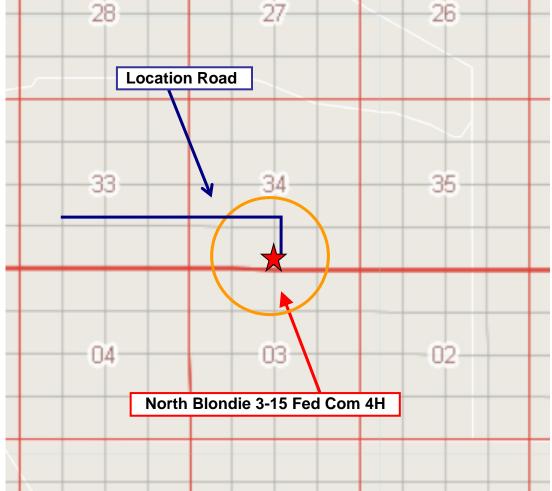

Assumed 100 ppm ROE = 3000' (Radius of Exposure)
100 ppm H2S concentration shall trigger activation of this plan.

## **Escape**

Crews shall escape upwind of escaping gas in the event of an emergency release of gas. Escape can be facilitated from the location entrance road. Crews should then block the entrance to the location from the lease road so as not to allow anyone traversing into a hazardous area. The blockade should be at a safe distance outside of the ROE. There are no homes or buildings in or near the ROE.

## **Assumed 100 ppm ROE = 3000'**

100 ppm H<sub>2</sub>S concentration shall trigger activation of this plan.

### **Emergency Procedures**

In the event of a release of gas containing H<sub>2</sub>S, the first responder(s) must

- Isolate the area and prevent entry by other persons into the 100 ppm ROE.
- Evacuate any public places encompassed by the 100 ppm ROE.
- Be equipped with H<sub>2</sub>S monitors and air packs in order to control the release.
- Use the "buddy system" to ensure no injuries occur during the response
- Take precautions to avoid personal injury during this operation.
- Contact operator and/or local officials to aid in operation. See list of phone numbers attached.
- Have received training in the
  - Detection of H₂S, and
  - Measures for protection against the gas,
  - Equipment used for protection and emergency response.

## **Ignition of Gas Source**

Should control of the well be considered lost and ignition considered, take care to protect against exposure to Sulfur Dioxide (SO<sub>2</sub>). Intentional ignition must be coordinated with the NMOCD and local officials. Additionally the NM State Police may become involved. NM State Police shall be the Incident Command on scene of any major release. Take care to protect downwind whenever there is an ignition of the gas

#### Characteristics of H<sub>2</sub>S and SO<sub>2</sub>

Common Name	Chemical Formula	Specific Gravity	Threshold Limit	Hazardous Limit	Lethal Concentration
Hydrogen Sulfide	H <sub>2</sub> S	1.189 Air = 1	10 ppm	100 ppm/hr	600 ppm
Sulfur Dioxide	SO <sub>2</sub>	2.21 Air = 1	2 ppm	N/A	1000 ppm

## **Contacting Authorities**

Devon Energy Corp. personnel must liaison with local and state agencies to ensure a proper response to a major release. Additionally, the OCD must be notified of the release as soon as possible but no later than 4 hours. Agencies will ask for information such as type and volume of release, wind direction, location of release, etc. Be prepared with all information available. The following call list of essential and potential responders has been prepared for use during a release. Devon Energy Corp. Company response must be in coordination with

the State of New Mexico's 'Hazardous Materials Emergency Response Plan' (HMER)

## **Hydrogen Sulfide Drilling Operation Plan**

## I. HYDROGEN SULFIDE (H<sub>2</sub>S) TRAINING

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on this well:

- 1. The hazards and characteristics of hydrogen sulfide (H<sub>2</sub>S)
- 2. The proper use and maintenance of personal protective equipment and life support systems.
- 3. The proper use of H<sub>2</sub>S detectors, alarms, warning systems, briefing areas, evacuation procedures, and prevailing winds.
- 4. The proper techniques for first aid and rescue procedures.

In addition, supervisory personnel will be trained in the following areas:

- 1. The effects of H<sub>2</sub>S metal components. If high tensile tubulars are to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling or reworking a well and blowout prevention and well control procedures.
- 3. The contents and requirements of the H<sub>2</sub>S Drilling Operations Plan.

There will be weekly H<sub>2</sub>S and well control drills for all personnel in each crew.

#### II. HYDROGEN SULFIDE TRAINING

Note: All  $H_2S$  safety equipment and systems will be installed, tested, and operational when drilling reaches a depth of 500 feet above, or three days prior to penetrating the first zone containing or reasonably expected to contain  $H_2S$ .

## 1. Well Control Equipment

- A. Flare line
- B. Choke manifold Remotely Operated
- C. Blind rams and pipe rams to accommodate all pipe sizes with properly sized closing unit
- D. Auxiliary equipment may include if applicable: annular preventer and rotating head.
- E. Mud/Gas Separator

## 2. Protective equipment for essential personnel:

30-minute SCBA units located at briefing areas, as indicated on well site diagram, with escape units available in the top doghouse. As it may be difficult to communicate audibly while wearing these units, hand signals shall be utilized.

Fire extinguishers are located at various locations around the rig. First Aid supplies are located in the top doghouse and the rig manger's office.

### 3. H<sub>2</sub>S detection and monitoring equipment:

Portable H<sub>2</sub>S monitors positioned on location for best coverage and response. These units have warning lights which activate when H<sub>2</sub>S levels reach 10 ppm and audible sirens which activate at 15 ppm. Sensor locations:

- Bell nipple
- Possum Belly/Shale shaker
- Rig floor
- Choke manifold
- Cellar

## 4. Visual warning systems:

- A. Wind direction indicators as shown on well site diagram
- B. Caution/Danger signs shall be posted on roads providing direct access to locations. Signs will be painted a high visibility yellow with black lettering of sufficient size to be reasonable distance from the immediate location. Bilingual signs will be used when appropriate.

## 5. Mud program:

The mud program has been designed to minimize the volume of H<sub>2</sub>S circulated to surface. Proper mud weight, safe drilling practices and the use of H<sub>2</sub>S scavengers will minimize hazards when penetrating H<sub>2</sub>S bearing zones.

## 6. Metallurgy:

All drill strings, casings, tubing, wellhead, blowout preventer, drilling spool, kill lines, choke manifold lines, and valves shall be H<sub>2</sub>S trim.

All elastomers used for packing and seals shall be H<sub>2</sub>S trim.

#### 7. Communication:

- a. Company personnel have/use cellular telephones in the field.
- **b.** Land line (telephone) communications at Office


#### 8. Well testing:

- a. Drill stem testing will be performed with a minimum number of personnel in the immediate vicinity, which are necessary to safety and adequately conduct the test. The drill stem testing will be conducted during daylight hours and formation fluids will not be flowed to the surface. All drill-stem-testing operations conducted in an H<sub>2</sub>S environment will use the closed chamber method of testing.
- **b.** There will be no drill stem testing.

Devon Energy Corp. Company Call List					
Employe	ee/Company Contact	Position	Phone	After Hours	
Representative			Number	Number	
	Fisher (North) Drilling Manager 832-967-7912				
	lebrand (South)	Drilling Manager	405-552-6514		
Rich Dowr	•	Drilling VP	405-228-2415		
Josh Harv	•	EHS Manger	405-228-2440	918-500-5536	
Laura Wrig		EHS Supervisor	405-552-5334	832-969-8145	
Robert Glo		EHS Professional	575-703-5712	575-703-5712	
Lane Fran		Lead EHS	580-579-7052	580-579-7052	
Rickey Po		Lead EHS	903-720-8315	903-720-8315	
Brock Vise	9	Lead EHS	918-413-3291	918-413-3291	
Agency	Call List				
Les	Habba				
<u>Lea</u> County	Hobbs Lea County Communic	ation Authority		397-9265	
(575)	State Police	allon Authority		885-3138	
10.07	City Police			397-9265	
	Sheriff's Office			396-3611	
	Ambulance			911	
	Fire Department			397-9308	
	LEPC (Local Emergence	ry Planning Committe	۱۵۱	393-2870	
	NMOCD	by I laining Committee	<del>,c</del> )	393-6161	
	US Bureau of Land Ma	fice Closed)	393-0002		
	OS Buleau OI Land Ma	nagement (Hobbs Of	ilice Closed)	393-0002	
Eddy	Carlsbad				
County	State Police			885-3137	
<u>(575)</u>	City Police			885-2111	
	Sheriff's Office			887-7551	
	Ambulance			911	
	Fire Department			885-3125	
	LEPC (Local Emergence	cy Planning Committe	ee)	887-3798	
	US Bureau of Land Ma	anagement (Carlsba	ıd)	(575)-706-1920	
				(575)-234-5909	
	BLM – CFO			(575) 234-5972	
	BLM – PET Petroleum Engineering Tech. ON CALL – (575) 689-5981				
	Cement Notifications or Emergency issues.  NM Emergency Response Commission (Santa Fe) (505) 476-960				
	24 HR			(505) 827-9126	
	National Emergency Response Center			(800) 424-8802	
	National Pollution Control Center: Direct			(703) 872-6000	
	For Oil Spills			(800) 280-7118	
	Emergency Services				
	Wild Well Control			(281) 784-4700	
	Cudd Pressure Control	(915	5) 699-0139	(915) 563-3356	
	Halliburton	(310)	<i>,,</i> 000 0100	(575) 746-2757	
	B. J. Services			(575) 746-3569	
	D. J. DEIVICES			(313) 140-3309	

Give	Native Air – Emergency Helicopter – Hobbs	(575) 347-9836
GPS	For Air Ambulance - Eddy County Dispatch	(575)-616-7155
position:	For Air Ambulance - Lea County (LCCA)	(575)-397-9265
	Poison Control (24/7)	(800) 222-1222
	Oil & Gas Pipeline 24 Hour Service	(800) 364-4366
	NOAA – Website - www.nhc.noaa.gov	
	National Pollution Control Center	202-795-6958
	NPCC – Oil Spills	800-280-7118
	BNSF Railroad Resource Operations	800-832-5452
	NM OSHA – Santa Fe	505-222-9595
	NM OSHA (Reporting)	877-610-6742
		505-476-8700

Prepared in conjunction with Dave Small

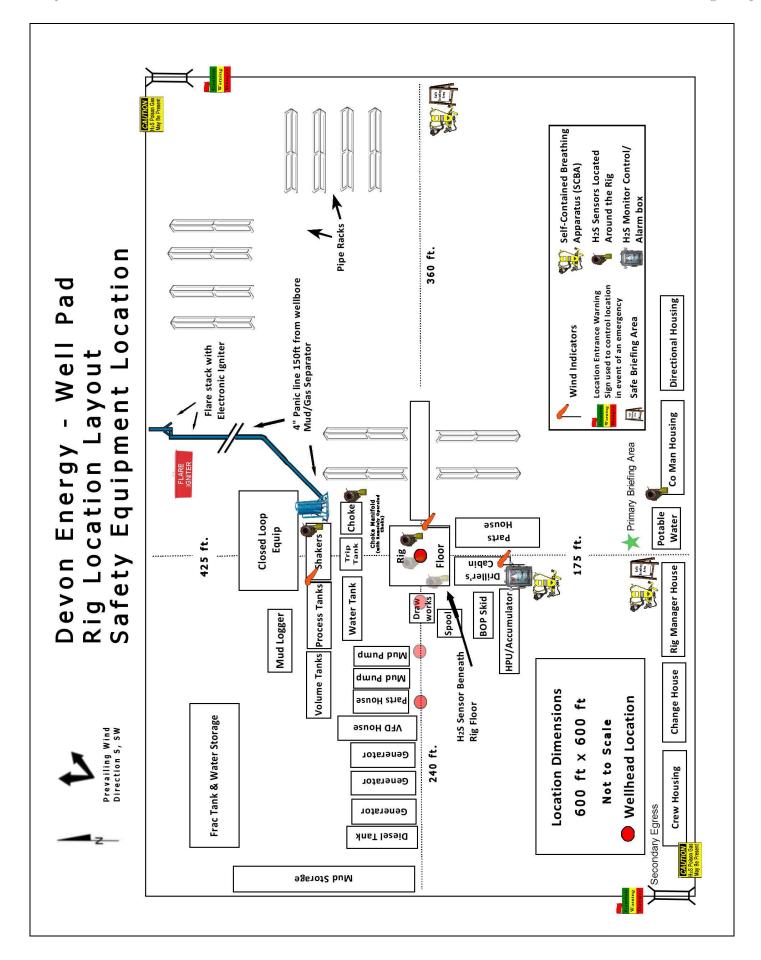

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

## **State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 247625

#### **CONDITIONS**

Operator:	OGRID:
DEVON ENERGY PRODUCTION COMPANY, LP	6137
333 West Sheridan Ave.	Action Number:
Oklahoma City, OK 73102	247625
	Action Type:
	[C-101] BLM - Federal/Indian Land Lease (Form 3160-3)

#### CONDITIONS

Created By	Condition	Condition Date
pkautz	Will require a File As Drilled C-102 and a Directional Survey with the C-104	8/4/2023
pkautz	Once the well is spud, to prevent ground water contamination through whole or partial conduits from the surface, the operator shall drill without interruption through the fresh water zone or zones and shall immediately set in cement the water protection string	8/4/2023
pkautz	Oil base muds are not to be used until fresh water zones are cased and cemented providing isolation from the oil or diesel. This includes synthetic oils. Oil based mud, drilling fluids and solids must be contained in a steel closed loop system	8/4/2023
pkautz	Cement is required to circulate on both surface and intermediate1 strings of casing	8/4/2023