Received by WCD-Sy8/2024 3:46:13 PM U.S. Department of the Interior BUREAU OF LAND MANAGEMENT		Sundry Print Report 08/08/2024
Well Name: JUNIPER COM 17	Well Location: T24N / R10W / SEC 17 / NENE / 36.318131 / -107.913751	County or Parish/State: SAN JUAN / NM
Well Number: 41	Type of Well: OTHER	Allottee or Tribe Name:
Lease Number: NMNM104606	Unit or CA Name:	Unit or CA Number: NMNM108207
US Well Number: 300453063500S1	Operator: DUGAN PRODUCTION CORPORATION	

Notice of Intent

Sundry ID: 2805892 Type of Submission: Notice of Intent Date Sundry Submitted: 08/08/2024 Date proposed operation will begin: 09/04/2024

Type of Action: Plug and Abandonment Time Sundry Submitted: 09:49

Procedure Description: Dugan Production plans to plug and abandon the well per the attached procedure.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

Juniper_Com_17_41_Reclamation_Plan_20240808094647.pdf Juniper_Com_17_41_planned_PA_formation_tops_20240808094640.pdf Juniper_Com_17_41_planned_PA_planned_wellbore_schematic_20240808094632.pdf Juniper_Com_17_41_planned_PA_current_wellbore_schematic_20240808094618.pdf Juniper_Com_17_41_planned_PA_work_20240808094609.pdf

 Received by OCD: 8/8/2024 3:46:13.PM
 Well Location: T24N / R10W / SEC 17 / NENE / 36.318131 / -107.913751
 County or Parish/State: SAN JUAN / NM

 Well Number: 41
 Type of Well: OTHER
 Allottee or Tribe Name:

 Lease Number: NMNM104606
 Unit or CA Name:
 Unit or CA Number: NMNM108207

 US Well Number: 300453063500S1
 Operator: DUGAN PRODUCTION

CORPORATION

Conditions of Approval

Additional

General_Requirement_PxA_20240808132642.pdf

Juniper_Com_17_41_Geo_KR_20240808132623.pdf

2805892_NOIA_17_41_3004530635_KR_08082024_20240808132623.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: TYRA FEIL

Name: DUGAN PRODUCTION CORPORATION

Title: Authorized Representative

Street Address: PO Box 420

City: Farmington

State: NM

Phone: (505) 325-1821

Email address: tyrafeil@duganproduction.com

Field

Representative Name: Aliph ReenaStreet Address: PO Box 420City: FarmingtonState: NMPhone: (505)360-9192Email address: Aliph.Reena@duganproduction.com

Zip: 87499-0420

Signed on: AUG 08, 2024 09:47 AM

BLM Point of Contact

BLM POC Name: KENNETH G RENNICK

BLM POC Phone: 5055647742

Disposition: Approved

Signature: Kenneth Rennick

BLM POC Title: Petroleum Engineer

BLM POC Email Address: krennick@blm.gov


Disposition Date: 08/08/2024

Dugan Production plans to plug and abandon the well per the following procedure:

- Run 5¹/₂" casing scraper to 1339' and tag CIBP set for TA of well in 07/25/2019. Fruitland Coal perforations @ 1385'-1403'. Load and circulate hole.
- Attempt to pressure test casing to 600 psi for 30 mins.
- Run CBL from 1339' to surface.
- Spot Inside Plug I above CIBP @ 1339' w/34 sks (39.1 cu ft) Class G neat cement to 1052' to cover the Fruitland top (5 gal/sk, 15.8 #/gal, 1.15 cu.ft/sk Plug I, inside 5½" casing, 1052'-1339', Fruitland, 34 sks, 39.1 cu ft.
- Spot inside Plug II from 715' w/84 sks Class G neat cement (96.6 cu ft) to cover the Kirtland-Ojo Alamo tops and the surface casing shoe to surface. Plug II, inside 5½" casing, 0-715', Kirtland-Ojo Alamo-Surface, 84 sks, 96.6 cu ft.
- Cut wellhead off. Fill casing w/cement in case needed. Install dry hole marker.
- Clean location. Rig down and move.

Current Wellbore Schematic (TA'd)

Juniper Com 17 #41 30-045-30635 Basin Fruitland Coal 900' FNL & 1140' FEL S17 T24N R10W San Juan County, NM Lat: 36.318005, Long: -107.913640

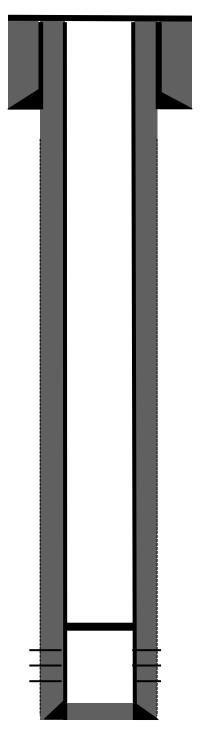

8-5/8" 24# casing @ 138'. Cemented with 165 sks, Class B cement. Hole size: 12-1/4". Circulate 7 bbls cement to surface.

CIBP @ 1339' set during TA of the well in 2019.

5 1/2" 15.5# casing @ 1550'. Hole size: 7-7/8"


Cement production casing w/ 280 sks Cement total. Circulated 20 bbls cement to surface.

Fruitland Coal Perforated @ 1385' - 1403'

PBTD @ 1505', TD 1550'

Planned P & A Wellbore Schematic

Juniper Com 17 #41 30-045-30635 Basin Fruitland Coal 900' FNL & 1140' FEL S17 T24N R10W San Juan County, NM Lat: 36.318005, Long: -107.913640

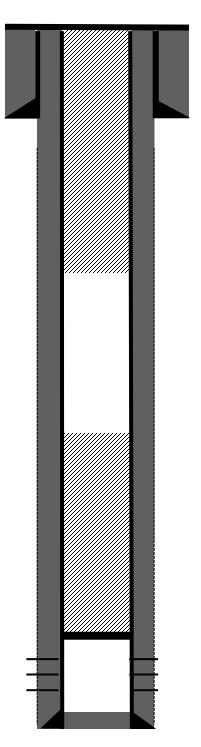

8-5/8" 24# casing @ 138'. Cemented with 165 sks, Class B cement. Hole size: 12-1/4". Circulate 7 bbls cement to surface.

Plug II, inside 5 $^{1}\!\!/_{2}$ '' casing, 0-715', Kirtland-Ojo Alamo-Surface, 84 sks, 96.6 Cu.ft.

Tag 5 $\frac{1}{2}$ " CIBP @ 1339' set during TA of the well in 2019. Plug I, Inside 5 $\frac{1}{2}$ " casing, 1052'-1339', Fruitland, 34 sks, 39.1 Cu.ft.

5 1/2" 15.5# casing @ 1550'. Hole size: 7-7/8"

Cement production casing w/ 280 sks Cement total. Circulated 20 bbls cement to surface.

Fruitland Coal Perforated @ 1385' - 1403'

PBTD @ 1505', TD 1550'

Juniper Com 17 #41 30-045-30635 Basin Fruitland Coal 900' FNL & 1140' FEL S17 T24N R10W San Juan County, NM Lat: 36.318005, Long: -107.913640

Formation Tops

- Nacimiento Surface
- Surface Casing 138'
- Ojo Alamo 586'
- Kirtland 665'
- Fruitland 1152'
- Perforations : 1385'-1403'

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

6251 COLLEGE BLVD. FARMINGTON, NEW MEXICO 87402

AFMSS 2 Sundry ID 2805892

Attachment to notice of Intention to Abandon

Well: Juniper Com 17 41

CONDITIONS OF APPROVAL

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Lease."
- 2. Farmington Office is to be notified at least 24 hours before the plugging operations commence at (505) 564-7750.

You are also required to place cement excesses per 4.2 and 4.4 of the attached General Requirements.

Office Hours: 7:45 a.m. to 4:30 p.m.

K. Rennick 08/08/2024

GENERAL REQUIREMENTS FOR PERMANENT ABANDONMENT OF WELLS ON FEDERAL AND INDIAN LEASES FARMINGTON FIELD OFFICE

1.0 The approved plugging plans may contain variances from the following <u>minimum general</u> requirements.

- 1.1 Modification of the approved plugging procedure is allowed only with the prior approval of the Authorized Officer, Farmington Field Office.
- 1.2 Requirements may be added to address specific well conditions.
- 2.0 Materials used must be accurately measured. (densometer/scales)

3.0 A tank or lined pit must be used for containment of any fluids from the wellbore during plugging operations and all pits are to be fenced with woven wire. These pits will be fenced on three sides and once the rig leaves location, the fourth side will be fenced.

3.1 Pits are not to be used for disposal of any hydrocarbons. If hydrocarbons are present in the pit, the fluids must be removed prior to filling in.

4.0 All cement plugs are to be placed through a work string. Cement may be bull-headed down the casing with prior approval. Cement caps on top of bridge plugs or cement retainers may be placed by dump bailer.

- 4.1 The cement shall be as specified in the approved plugging plan.
- 4.2 All cement plugs placed inside casing shall have sufficient volume to fill a minimum of 100' of the casing, or annular void(s) between casings, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
- 4.3 Surface plugs may be no less than 50' in length.
- 4.4 All cement plugs placed to fill annular void(s) between casing and the formation shall be of sufficient volume to fill a minimum of 100' of the annular space plus 100% excess, calculated using the bit size, or 100' of annular capacity, determined from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug.
- 4.5 All cement plugs placed to fill an open hole shall be of sufficient volume to fill a minimum of 100' of hole, as calculated from a caliper log, plus an excess volume sufficient to provide for 50 linear feet of fill above the plug. In the absence of a caliper log, an excess of 100% shall be required.
- 4.6 A cement bond log or other accepted cement evaluation tool is required to be run if one had not been previously ran or cement did not circulate to surface during the original casing cementing job or subsequent cementing jobs.

2

5.0 All cement plugs spotted across, or above, any exposed zone(s), when; the wellbore is not full of fluid or the fluid level will not remain static, and in the case of lost circulation or partial returns during cement placement, shall be tested by tagging with the work string.

- 5.1 The top of any cement plug verified by tagging must be at or above the depth specified in the approved plan, without regard to any excess.
- 5.2 Testing will not be required for any cement plug that is mechanically contained by use of a bridge plug and/or cement retainer, if casing integrity has been established.
- 5.3 Any cement plug which is the only isolating medium, for a fresh water interval or a zone containing a prospectively valuable deposit of minerals, shall be tested by tagging.
- 5.4 If perforations are required below the surface casing shoe, a 30 minute minimum wait time will be required to determine if gas and/or water flows are present. If flow is present, the well will be shut-in for a minimum of one hour and the pressure recorded. Short or long term venting may be necessary to evacuate trapped gas. If only a water flow occurs with no associated gas, shut well in and record the pressures. Contact the Engineer as it may be necessary to change the cement weight and additives.

6.0 Before setting any cement plugs the hole needs to be rolled. All wells are to be controlled by means of a fluid that is to be of a weight and consistency necessary to stabilize the wellbore. This fluid shall be left in place as filler between all plugs.

- 6.1 Drilling mud may be used as the wellbore fluid in open hole plugging operations.
- 6.2 The wellbore fluid used in cased holes shall be of sufficient weight to balance known pore pressures in all exposed formations.

7.0 A blowout preventer and related equipment (BOPE) shall be installed and tested prior to working in a wellbore with any exposed zone(s); (1) that are over pressured, (2) where the pressures are unknown, or (3) known to contain H_2S .

8.0 Within 30 days after plugging work is completed, file a Sundry Notice, Subsequent Report of Abandonment (Form 3160-5), through the Automated Fluid Minerals Support System (AFMSS) with the Field Manager, Bureau of Land Management, 6251 College Blvd., Suite A, Farmington, NM 87402. The report should show the manner in which the plugging work was carried out, the extent, by depth(s), of cement plugs placed, and the size and location, by depth(s), of casing left in the well. Show <u>date</u> well was plugged.

9.0 All permanently abandoned wells are to be marked with a permanent monument as specified in 43 CFR 3162.6(d). Unless otherwise approved.

10.0 If this well is located in a Specially Designated Area (SDA), compliance with the appropriate seasonal closure requirements will be necessary.

All of the above are minimum requirements. Failure to comply with the above conditions of approval may result in an assessment for noncompliance and/or a Shut-in Order being issued pursuant to 43 CFR 3163.1. You are further advised that any instructions, orders or decisions issued by the Bureau of Land Management are subject to administrative review pursuant to 43 CFR 3165.3 and appeal pursuant to 43 CFR 3165.4 and 43 CFR 4.700.

.

BLM - FFO - Geologic Report

						Date Complete	d 8/08/2024
Well No.	Juniper C	om 17 41		Surf. Loc.	900 FNL	1140 FEL	
US Well No.	30-045-30	0635			Sec. 17	T. 24N R. 10	W
Lease No.	NMNM10	4606					
Agrmt #	NMNM10	8207		County	San Juan	State	New Mexico
Operator	Dugan Pr	oduction Corpora	ation	Formation	Basin Fruitla	and Coal	
TVD	1550	PBTD	1550	Elevation KB	NA		
Elevation GL	6766						
Geologic Form	nations		Est. to	ps		Remarks	
Ojo Alamo Ss				86		Aquifer (possik	ble freshwater)
Kirtland Fm Fruitland Fm			-	65 52		Coal/gas/poss	ible water
Fruitland Perfor	ations			85		Coal/gas/poss	וטוכ שמוכו
	auona		15	00			

Remarks:

Reference Well:

the operator. No changes to the plugging procedure.	Juniper 9 14 JS Well No. 30-045-30636 Sec. 9 T. 24N R. 10W San Juan County, New Mexico
---	---

Prepared by: Kenneth Rennick

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:
DUGAN PRODUCTION CORP	6515
PO Box 420	Action Number:
Farmington, NM 87499	372100
	Action Type:
	[C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
mkuehling	Notify NMOCD 24 hours prior to moving on - monitor string pressure daily report on subsequent - submit all logs prior to subsequent	8/8/2024

Page 11 of 11

Action 372100