Form 3160-3 (June 2015)	~				APPROV o. 1004-0 inuary 31	137
UNITED STATES DEPARTMENT OF THE I BUREAU OF LAND MANA	5. Lease Serial No. NMNM108502					
APPLICATION FOR PERMIT TO D	6. If Indian, Allotee	or Tribe	Name			
la. Type of work:	EENTER			7. If Unit or CA Ag	reement, l	Name and No.
1b. Type of Well: ✓ Oil Well Gas Well O	ther			8. Lease Name and	Well No.	
1c. Type of Completion: Hydraulic Fracturing Si	ngle Zone	✔ Multiple Zone		LACEY SWISS 1	FED CO	М
				303H		
2. Name of Operator EOG RESOURCES INCORPORATED				9. API Well No. 30)-025-	53429
3a. Address		No. <i>(include area cod</i>	e)	10. Field and Pool,	1	2
1111 BAGBY SKY LOBBY 2, HOUSTON, TX 77002	(713) 651-			RED HILLS/LOWE	-	
4. Location of Well <i>(Report location clearly and in accordance v</i>	-	1		11. Sec., T. R. M. or SEC 1/T25S/R33E		Survey or Area
At surface TR 2 / 1070 FNL / 1542 FEL / LAT 32.1638				3EC 1/1233/K33E		
At proposed prod. zone TR O / 100 FSL / 2178 FEL / LA		46 / LONG -103.524	45451			
14. Distance in miles and direction from nearest town or post off	ice*			12. County or Parisl LEA	h	13. State NM
15. Distance from proposed* location to nearest property or lease line, ft. (Also to nearest drig. unit line, if any)	16. No of a	No of acres in lease 17. Spacing Unit dedicated to this well 640.0				
 18. Distance from proposed location* to nearest well, drilling, completed, applied for, on this lease, ft. 33 feet 	19. Propose 10330 feet	ed Depth / 20656 feet	20. BLM/ FED:	LM/BIA Bond No. in file		
21. Elevations (Show whether DF, KDB, RT, GL, etc.) 3459 feet	22. Approx 04/14/2023	Approximate date work will start* 23. Estimated duration 4/2023 25 days				
	24. Attac	chments		1		
The following, completed in accordance with the requirements of (as applicable)	f Onshore Oil	and Gas Order No.	I, and the H	lydraulic Fracturing r	ule per 4	3 CFR 3162.3-3
 Well plat certified by a registered surveyor. A Drilling Plan. 		4. Bond to cover the Item 20 above).	e operation	s unless covered by a	n existing	bond on file (see
3. A Surface Use Plan (if the location is on National Forest System SUPO must be filed with the appropriate Forest Service Office		 5. Operator certific 6. Such other site sp BLM. 		mation and/or plans as	may be r	equested by the
25. Signature (Electronic Submission)		Name (Printed/Typed) CRAIG RICHARDSON / Ph: (713) 651-70		651-7000	Date 06/16/2	2023
Title Regulatory Specialist						
Approved by (Signature) (Electronic Submission)		e (Printed/Typed) Y LAYTON / Ph: (5	75) 234-59	959	Date 04/11/2	2024
Title Assistant Field Manager Lands & Minerals	Office Carls	e bad Field Office				
Application approval does not warrant or certify that the applicar applicant to conduct operations thereon. Conditions of approval, if any, are attached.	nt holds legal	or equitable title to the	nose rights	in the subject lease w	hich wou	ld entitle the
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, n of the United States any false, fictitious or fraudulent statements					any depar	tment or agency



(Continued on page 2)

.

INSTRUCTIONS

GENERAL: This form is designed for submitting proposals to perform certain well operations, as indicated on Federal and Indian lands and leases for action by appropriate Federal agencies, pursuant to applicable Federal laws and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from local Federal offices.

ITEM I: If the proposal is to redrill to the same reservoir at a different subsurface location or to a new reservoir, use this form with appropriate notations. Consult applicable Federal regulations concerning subsequent work proposals or reports on the well.

ITEM 4: Locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local Federal offices for specific instructions.

ITEM 14: Needed only when location of well cannot readily be found by road from the land or lease description. A plat, or plats, separate or on the reverse side, showing the roads to, and the surveyed location of, the wen, and any other required information, should be furnished when required by Federal agency offices.

ITEMS 15 AND 18: If well is to be, or has been directionany drilled, give distances for subsurface location of hole in any present or objective productive zone.

ITEM 22: Consult applicable Federal regulations, or appropriate officials, concerning approval of the proposal before operations are started.

ITEM 24: If the proposal will involve hydraulic fracturing operations, you must comply with 43 CFR 3162.3-3, including providing information about the protection of usable water. Operators should provide the best available information about all formations containing water and their depths. This information could include data and interpretation of resistivity logs run on nearby wells. Information may also be obtained from state or tribal regulatory agencies and from local BLM offices.

NOTICES

The Privacy Act of 1974 and regulation in 43 CFR 2.48(d) provide that you be furnished the following information in connection with information required by this application.

AUTHORITY: 30 U.S.C. 181 et seq., 25 U.S.C. 396; 43 CFR 3160

PRINCIPAL PURPOSES: The information will be used to: (1) process and evaluate your application for a permit to drill a new oil, gas, or service wen or to reenter a plugged and abandoned well; and (2) document, for administrative use, information for the management, disposal and use of National Resource Lands and resources including (a) analyzing your proposal to discover and extract the Federal or Indian resources encountered; (b) reviewing procedures and equipment and the projected impact on the land involved; and (c) evaluating the effects of the proposed operation on the surface and subsurface water and other environmental impacts.

ROUTINE USE: Information from the record and/or the record win be transferred to appropriate Federal, State, and local or foreign agencies, when relevant to civil, criminal or regulatory investigations or prosecution, in connection with congressional inquiries and for regulatory responsibilities.

EFFECT OF NOT PROVIDING INFORMATION: Filing of this application and disclosure of the information is mandatory only if you elect to initiate a drilling or reentry operation on an oil and gas lease.

The Paperwork Reduction Act of 1995 requires us to inform you that:

The BLM conects this information to anow evaluation of the technical, safety, and environmental factors involved with drilling for oil and/or gas on Federal and Indian oil and gas leases. This information will be used to analyze and approve applications. Response to this request is mandatory only if the operator elects to initiate drilling or reentry operations on an oil and gas lease. The BLM would like you to know that you do not have to respond to this or any other Federal agency-sponsored information collection unless it displays a currently valid OMB control number.

BURDEN HOURS STATEMENT: Public reporting burden for this form is estimated to average 8 hours per response, including the time for reviewing instructions, gathering and maintaining data, and completing and reviewing the form. Direct comments regarding the burden estimate or any other aspect of this form to U.S. Department of the Interior, Bureau of Land Management (1004-0137), Bureau Information Conection Clearance Officer (WO-630), 1849 C Street, N.W., Mail Stop 401 LS, Washington, D.C. 20240.

Received by OCD: 8/23/2024 8:52:58 AM

DISTRICT I 1625 N. French Dr., Hobbs, NM 88240 Phone: (575) 393-6161 Fax: (575) 393-0720 DISTRICT II 811 S. First St., Artesia Phone (\$75) 748 128 811 S. Firs Phone: (57 rtesia, NM 88210 -1283 Fax: (575) 748-9720 DISTRICT III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone: (505) 334-6178 Fax: (505) 334-6170 DISTRICT IV 1220 S. St. Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3460 Fax: (505) 476-3462

State of New Mexico Energy, Minerals & Natural Resources Department OIL CONSERVATION DIVISION 1220 South St. Francis Dr. Santa Fe, New Mexico 87505

□ AMENDED REPORT

EN MEX

450

5/24/2023 2:14:58 PM

SURV

T-25-S, R-33-E T-25-S, R-34-E THUR DAY IN THE

	I Number			Pool Co 5102			RF		S		Name R BOI		 -
<u>30-025-5</u> Property Coo 33082	de		Property Name LACEY SWISS 1 FED COM									Well N	lumber
OGRID No			Operator Name							303H Elevation			
7377					EOG RES		-	NC.				3	3459'
UL or lot no.	Section	Township	Range	Lot	Surfac	rom the		orth/South line		Feet fro	m the	East/West line	County
2	1	25-S	33-E	_		70'		NORTH		154		EAST	LEA
1			Bo	ottom H	ole Location	n If Di	ifferent 1	From Su	rfac	i ce			
UL or lot no.	Section	Township	Range	Lot		rom the		orth/South line		Feet fro		East/West line	County
O Dedicated Acres	12 Joint or	25-S	Consolidated	- Code	Order No.)0'		SOUTH		217	'8'	EAST	LEA
639.91	Joint of		Consolidated	Code	Older No.	PE		COM A	GR		т		
No allowable wil	ll be assign	ned to this	completion	n until al	l ll interests hav	ve beei	n consoli	dated or a	no	n-standard	unit has	s been approved	by the
division.	6		1									11	5
NAE X=79224 LAT.: N 3 LONG.: W NAE	XICO EAS ⁻ D 1983 6 Y=424293 32.1638625	т 3 60	35	36		$AZ = 179.57^{\circ}$ 50.0° -100°		2178'	T-24-S, R-33-E	ч 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2 2		ED PERF. POINT NEW MEXICO E NAD 1983 X=791641 Y=420 LAT.: N 32.1522 ONG.: W 103.524 NAD 1927 X=750455 Y=420	AST 0082 998 45439 0024
LONG.: W 1070' FNI	LAT.: N 32.1637381 LONG.: W 103.5220129 1070' FNL 1542' FEL KICK OFF POINT (KOP)		2	1 	X=791137. Y=425356.	52 52 - TOT		LOT 1		AZ = <u>327.6</u> 1202.9'	LOW BOTTO	LAT.: N 32.1521 ONG.: W 103.524 ±0' FSL 2178' F VER MOST PER M HOLE LOCA	40715 'EL F. (LMP) TION (BHL)
NAE X=79160: LAT.: N 3 LONG.: W NAE X=75041 LAT.: N 3 LONG.: W) 1983 2 Y=425309 32.1666682 103.52454) 1927 7 Y=42525 32.1665439	9 2 27 1			 +	HZ SPACING UNIT		USA NMNM 108502		X=793799.36 Y=422732.59) L(NEW MEXICO E NAD 1983 X=791679 Y=414 LAT.: N 32.1380 ONG.: W 103.52 NAD 1927 X=750494 Y=414 LAT.: N 32.1379 ONG.: W 103.52 100' FSL 2178' F	4904 646 45451 4846 1401 40736
	5T PERF. (I XICO EAS ⁻ D 1983	'	2	1	- X=791171 Y=420079		 	2178'		X=793819.23 Y=420093.85 6			
X=79160 LAT.: N LONG.: W NAI X=75041 LAT.: N LONG.: W	2 Y=42525 32.1665308 103.52454 0 1927 7 Y=42520 32.1664065 103.52406 . 2178' FEL	3 27 1 5 94	11	12			 	USA NMNM 030400	330 22	7 7 X=793839.06 Y=417454.72		EYORS CERT	
I hereby certify that the is true and complete to a belief, and that this orga working interest or unlead land including the propos has a right to drill this pursuant to a contract u	the best of my nization either used mineral int sed bottom hole well at this loc with an owner o	knowledge and owns a terest in the location or ation f such a	11	12	: : 		LMP/	: 2178' ////////////////////////////////		<u>7_100'</u> _	plat was p made by n same is tr 04/14/2 Date of Surve	plotted from field notes ne or under my superv rue and correct to the b 2023 cy	of actual surveys ision, and that the pest of my belief.
mineral or working inter- agreement or a compulso: entered by the division.			14	13	X=79121 Y=41480		100'		-	18 X=793858.14 Y=414812.09		d Seal of Professional Surve	MNGUK 111



Released to Imaging: 9/2/2024 10:10:13 AM

Received by	OCD:	8/23/2024	8:52:58 AM
-------------	------	-----------	------------

State of New Mexico	
Energy, Minerals and Natural Resources Department	

Submit Electronically Via E-permitting

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

NATURAL GAS MANAGEMENT PLAN

This Natural Gas Management Plan must be submitted with each Application for Permit to Drill (APD) for a new or recompleted well.

Section 1 – Plan Description Effective May 25, 2021

I. Operator: ____EOG Resources, Inc._____OGRID: ____7377_____ Date: 08/21/2024

П. **Type:** \square Original \square Amendment due to \square 19.15.27.9.D(6)(a) NMAC \square 19.15.27.9.D(6)(b) NMAC \square Other.

If Other, please describe:

III. Well(s): Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

Well Name	API	ULSTR	Footages	Anticipated Oil BBL/D	Anticipated Gas MCF/D	Anticipated Produced Water BBL/D
LACEY SWISS 1 FED COM 303H		B-1-25S-33E	1070' FNL & 1542' FEL	+/- 1000	+/- 3500	+/- 3000

IV. Central Delivery Point Name: LACEY SWISS 1 FED COM CTB [See 19.15.27.9(D)(1) NMAC]

V. Anticipated Schedule: Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

Well Name	API	Spud Date	TD Reached Date	Completion Commencement Date	Initial Flow Back Date	First Production Date
LACEY SWISS 1 FED COM 303H		09/01/24	09/26/24	12/1/24	01/1/25	01/15/25

VI. Separation Equipment: Attach a complete description of how Operator will size separation equipment to optimize gas capture.

VII. Operational Practices: 🛛 Attach a complete description of the actions Operator will take to comply with the requirements of Subsection A through F of 19.15.27.8 NMAC.

VIII. Best Management Practices: Attach a complete description of Operator's best management practices to minimize venting during active and planned maintenance.

Section 2 – Enhanced Plan EFFECTIVE APRIL 1, 2022

Beginning April 1, 2022, an operator that is not in compliance with its statewide natural gas capture requirement for the applicable reporting area must complete this section.

I Operator certifies that it is not required to complete this section because Operator is in compliance with its statewide natural gas capture requirement for the applicable reporting area.

IX. Anticipated Natural Gas Production:

Well	API	Anticipated Average Natural Gas Rate MCF/D	Anticipated Volume of Natural Gas for the First Year MCF

X. Natural Gas Gathering System (NGGS):

Operator	System	ULSTR of Tie-in	Anticipated Gathering Start Date	Available Maximum Daily Capacity of System Segment Tie-in

XI. Map. \Box Attach an accurate and legible map depicting the location of the well(s), the anticipated pipeline route(s) connecting the production operations to the existing or planned interconnect of the natural gas gathering system(s), and the maximum daily capacity of the segment or portion of the natural gas gathering system(s) to which the well(s) will be connected.

XII. Line Capacity. The natural gas gathering system \Box will \Box will not have capacity to gather 100% of the anticipated natural gas production volume from the well prior to the date of first production.

XIII. Line Pressure. Operator \Box does \Box does not anticipate that its existing well(s) connected to the same segment, or portion, of the natural gas gathering system(s) described above will continue to meet anticipated increases in line pressure caused by the new well(s).

□ Attach Operator's plan to manage production in response to the increased line pressure.

XIV. Confidentiality: \Box Operator asserts confidentiality pursuant to Section 71-2-8 NMSA 1978 for the information provided in Section 2 as provided in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and attaches a full description of the specific information for which confidentiality is asserted and the basis for such assertion.

<u>Section 3 - Certifications</u> <u>Effective May 25, 2021</u>

Operator certifies that, after reasonable inquiry and based on the available information at the time of submittal:

 \boxtimes Operator will be able to connect the well(s) to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system; or

 \Box Operator will not be able to connect to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system. *If Operator checks this box, Operator will select one of the following:*

Well Shut-In. \Box Operator will shut-in and not produce the well until it submits the certification required by Paragraph (4) of Subsection D of 19.15.27.9 NMAC; or

Venting and Flaring Plan. \Box Operator has attached a venting and flaring plan that evaluates and selects one or more of the potential alternative beneficial uses for the natural gas until a natural gas gathering system is available, including:

- (a) power generation on lease;
- (b) power generation for grid;
- (c) compression on lease;
- (d) liquids removal on lease;
- (e) reinjection for underground storage;
- (f) reinjection for temporary storage;
- (g) reinjection for enhanced oil recovery;
- (**h**) fuel cell production; and
- (i) other alternative beneficial uses approved by the division.

Section 4 - Notices

1. If, at any time after Operator submits this Natural Gas Management Plan and before the well is spud:

(a) Operator becomes aware that the natural gas gathering system it planned to connect the well(s) to has become unavailable or will not have capacity to transport one hundred percent of the production from the well(s), no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised venting and flaring plan containing the information specified in Paragraph (5) of Subsection D of 19.15.27.9 NMAC; or

(b) Operator becomes aware that it has, cumulatively for the year, become out of compliance with its baseline natural gas capture rate or natural gas capture requirement, no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised Natural Gas Management Plan for each well it plans to spud during the next 90 days containing the information specified in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and shall file an update for each Natural Gas Management Plan until Operator is back in compliance with its baseline natural gas capture rate or natural gas capture requirement.

2. OCD may deny or conditionally approve an APD if Operator does not make a certification, fails to submit an adequate venting and flaring plan which includes alternative beneficial uses for the anticipated volume of natural gas produced, or if OCD determines that Operator will not have adequate natural gas takeaway capacity at the time a well will be spud.

I certify that, after reasonable inquiry, the statements in and attached to this Natural Gas Management Plan are true and correct to the best of my knowledge and acknowledge that a false statement may be subject to civil and criminal penalties under the Oil and Gas Act.

Signature: Kayla McConnell Printed Name: KAYLA MCCONNELL Title: Regulatory Specialist E-mail Address: KAYLA_MCCONNELL@EOGRESOURCES.COM Date: 08/21/2024 Phone: (432) 265-6804 **OIL CONSERVATION DIVISION** (Only applicable when submitted as a standalone form) Approved By: Title: Approval Date: Conditions of Approval:

Natural Gas Management Plan Items VI-VIII

VI. Separation Equipment: Attach a complete description of how Operator will size separation equipment to optimize gas capture.

- Separation equipment will be sized to provide adequate separation for anticipated rates.
- Adequate separation relates to retention time for Liquid Liquid separation and velocity for Gas-Liquid separation.
- Collection systems are appropriately sized to handle facility production rates on all (3) phases.
- Ancillary equipment and metering is selected to be serviced without flow interruptions or the need to release gas from the well.

VII. Operational Practices: Attach a complete description of the actions Operator will take to comply with the requirements of Subsection A through F 19.15.27.8 NMAC.

Drilling Operations

- All flare stacks will be properly sized. The flare stacks will be located at a minimum 100' from the nearest surface hole location on the pad.
- All natural gas produced during drilling operations will be flared, unless there is an equipment malfunction and/or to avoid risk of an immediate and substantial adverse impact on safety and the environment, at which point the gas will be vented.

Completions/Recompletions Operations

- New wells will not be flowed back until they are connected to a properly sized gathering system.
- The facility will be built/sized for maximum anticipated flowrates and pressures to minimize waste.
- For flowback operations, multiple stages of separation will be used as well as excess VRU and blowers to make sure waste is minimized off the storage tanks and facility.
- During initial flowback, the well stream will be routed to separation equipment.
- At an existing facility, when necessary, post separation natural gas will be flared until it meets pipeline specifications, at which point it will be turned into a collection system.
- At a new facility, post separation natural gas will be vented until storage tanks can safely function, at which point it will be flared until it meets pipeline spec.

Production Operations

- Weekly AVOs will be performed on all facilities.
- All flares will be equipped with auto-ignition systems and continuous pilot operations.
- After a well is stabilized from liquid unloading, the well will be turned back into the collection system.
- All plunger lift systems will be optimized to limit the amount of waste.
- All tanks will have automatic gauging equipment installed.
- Leaking thief hatches found during AVOs will be cleaned and properly re-sealed.

Performance Standards

- Production equipment will be designed to handle maximum anticipated rates and pressure.
- All flared gas will be combusted in a flare stack that is properly sized and designed to ensure proper combustion.
- Weekly AVOs will be performed on all wells and facilities that produce more than 60 Mcfd.

Measurement & Estimation

- All volume that is flared and vented that is not measured will be estimated.
- All measurement equipment for flared volumes will conform to API 14.10.
- No meter bypasses with be installed.

• When metering is not practical due to low pressure/low rate, the vented or flared volume will be estimated.

VIII. Best Management Practices: Attach a complete description of Operator's best management practices to minimize venting during active and planned maintenance.

- During downhole well maintenance, EOG will use best management practices to vent as minimally as possible.
- Prior to the commencement of any maintenance, the tank or vessel will be isolated from the rest of the facilities.
 All valves upstream of the equipment will be closed and isolated.
- After equipment has been isolated, the equipment will be blown down to as low a pressure as possible into the collection system.
- If the equipment being maintained cannot be relieved into the collection system, it shall be released to a tank where the vapor can either be captured or combusted if possible.
- After downhole well maintenance, natural gas will be flared until it reaches pipeline specification.

Seog resources

Lacey Swiss 1 Fed Com 303H

1. GEOLOGIC NAME OF SURFACE FORMATION:

Permian

2. ESTIMATED TOPS OF IMPORTANT GEOLOGICAL MARKERS:

Rustler	1,090'
Tamarisk Anhydrite	1,277'
Top of Salt	1,653'
Base of Salt	4,943'
Lamar	5,199'
Bell Canyon	5,211'
Cherry Canyon	6,287'
Brushy Canyon	7,768'
Bone Spring Lime	9,273'
Leonard (Avalon) Shale	9,333'
1st Bone Spring Sand	10,270'
2nd Bone Spring Shale	10,545'
2nd Bone Spring Sand	10,854'
3rd Bone Spring Carb	11,366'
3rd Bone Spring Sand	11,890'
Wolfcamp	12,321'
TD	10,330'

3. ESTIMATED DEPTHS OF ANTICIPATED FRESH WATER, OIL OR GAS:

Upper Permian Sands	0-400'	Fresh Water
Bell Canyon	5,211'	Oil
Cherry Canyon	6,287'	Oil
Brushy Canyon	7,768'	Oil
Leonard (Avalon) Shale	9,333'	Oil
1st Bone Spring Sand	10,270'	Oil
2nd Bone Spring Shale	10,545'	Oil
2nd Bone Spring Sand	10,854'	Oil

No other Formations are expected to give up oil, gas or fresh water in measurable quantities. Surface fresh water sands will be protected by setting 13-3/8" casing at 1,300' and circulating cement back to surface.

Hole	Interval MD		Interval TVD		Csg			
Size	From (ft)	To (ft)	From (ft)	To (ft)	OD	Weight	Grade	Conn
16"	0	1,300	0	1,300	13-3/8"	54.5#	J-55	STC
11"	0	4,132	0	4,000	9-5/8"	40#	J-55	LTC
11"	4,132	5,172	4,000	5,040	9-5/8"	40#	HCK-55	LTC
6-3/4"	0	20,656	0	10,330	5-1/2"	17#	HCP-110	LTC

4. CASING PROGRAM

Variance is requested to waive the centralizer requirements for the 9-5/8" casing in the 11" hole size. An expansion additive will be utilized, in the cement slurry, for the entire length of the 11" hole interval to maximize cement bond and zonal isolation. Variance is also requested to waive any centralizer requirements for the 5-1/2" casing in the 6-3/4" hole size. An expansion additive will be utilized, in the cement slurry, for the entire length of the 6-3/4" hole interval to maximize cement bond and zonal isolation.

EOG requests permission to allow deviation from the 0.422" annulus clearance requirement for the intermediate (salt) section from Onshore Order #2 under the following conditions:

- The variance is not applicable within the Potash Boundaries or Capitan Reef areas.
- Operator takes responsibility to get casing to set point in the event that the clearance causes stuck pipe issues.

		Wt.	Yld	Slurry Description
Depth	No. Sacks	ppg	Ft3/sk	
1,300' 13-3/8''	390	13.5	1.73	Lead: Class C + 4.0% Bentonite Gel + 0.5% CaCl2 + 0.25 lb/sk Cello- Flake (TOC @ Surface)
	100	14.8	1.34	Tail: Class C + 0.6% FL-62 + 0.25 lb/sk Cello-Flake + 0.2% Sodium Metasilicate (TOC @ 1100')
5,040' _{9-5/8''}	490	12.7	2.22	Lead: Class C + 10% NaCl + 6% Bentonite Gel + 3% MagOx (TOC @ Surface)
	170	14.8	1.32	Tail: Class C + 10% NaCL + 3% MagOx (TOC @ 4032')
20,656' _{5-1/2''}	350	10.5	3.21	Lead: Class H + 0.4% Halad-344 + 0.35% HR-601 + 3% Microbond (TOC @ 4540')
	750	13.2	1.52	Tail: Class H + 5% NEX-020 + 0.2% NAC-102 + 0.15% NAS-725 + 0.5% NFL-549 + 0.2% NFP-703 + 1% NBE-737 + 0.3% NRT-241 (TOC @ 9980')

<u>Cementing Program</u>:

Additive	Purpose
Bentonite Gel	Lightweight/Lost circulation prevention
Calcium Chloride	Accelerator
Cello-flake	Lost circulation prevention
Sodium Metasilicate	Accelerator
MagOx	Expansive agent
Pre-Mag-M	Expansive agent
Sodium Chloride	Accelerator
FL-62	Fluid loss control
Halad-344	Fluid loss control
Halad-9	Fluid loss control
HR-601	Retarder
Microbond	Expansive Agent

Cement integrity tests will be performed immediately following plug bump.

Note: Cement volumes based on bit size plus at least 25% excess in the open hole plus 10% excess in the cased-hole overlap section.

5. MINIMUM SPECIFICATIONS FOR PRESSURE CONTROL:

Variance is requested to use a co-flex line between the BOP and choke manifold (instead of using a 4" OD steel line).

The minimum blowout preventer equipment (BOPE) shown in Exhibit #1 will consist of a single ram, mud cross and double ram-type (10,000 psi WP) preventer and an annular preventer (5,000-psi WP). Both units will be hydraulically operated and the ram-type will be equipped with blind rams on bottom and drill pipe rams on top. All BOPE will be tested in accordance with Onshore Oil & Gas order No. 2.

EOG will utilize wing unions on BOPE connections that can be isolated from wellbore pressure through means of a choke. All wing unions will be rated to a pressure that meets or exceeds the pressure rating of the BOPE system.

Variance is requested to use a 5,000 psi annular BOP with the 10,000 psi BOP stack.

Before drilling out of the surface casing, the ram-type BOP and accessory equipment will be tested to 10,000/250 psig and the annular preventer to 5,000/250 psig.

Pipe rams and blind rams will be operationally checked on each trip out of the hole. These checks will be noted on the daily tour sheets.

A hydraulically operated choke will be installed prior to drilling out of the intermediate casing shoe.



6. TYPES AND CHARACTERISTICS OF THE PROPOSED MUD SYSTEM:

During this procedure we plan to use a Closed-Loop System and haul contents to the required disposal.

The applicable depths and properties of the drilling fluid systems are as follows:

Depth	Туре	Weight (ppg)	Viscosity	Water Loss
0 – 1,300'	Fresh - Gel	8.6-8.8	28-34	N/c
1,300' - 5,050'	Brine	8.6-8.8	28-34	N/c
4,840' – 20,656' Lateral	Oil Base	8.8-9.5	58-68	N/c - 6

An electronic pit volume totalizer (PVT) will be utilized on the circulating system, to monitor pit volume, flow rate, pump pressure and stroke rate.

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept at the wellsite at all times.

7. AUXILIARY WELL CONTROL AND MONITORING EQUIPMENT:

- (A) A kelly cock will be kept in the drill string at all times.
- (B) A full opening drill pipe-stabbing valve (inside BOP) with proper drill pipe connections will be on the rig floor at all times.
- (C) H2S monitoring and detection equipment will be utilized from surface casing point to TD.

8. LOGGING, TESTING AND CORING PROGRAM:

- (A) Open-hole logs are not planned for this well.
- (B) GR-CCL will be run in cased hole during completions phase of operations.

9. ABNORMAL CONDITIONS, PRESSURES, TEMPERATURES AND POTENTIAL HAZARDS:

The estimated bottom-hole temperature (BHT) at TD is 173 degrees F with an estimated maximum bottom-hole pressure (BHP) at TD of 4,834 psig and a maximum anticipated surface pressure of 2,562 psig (based on 9.0 ppg MW). No hydrogen sulfide or other hazardous gases or fluids have been encountered, reported or are known to exist at this depth in this area. Severe loss circulation is expected from 7,768' to intermediate casing point.



10. ANTICIPATED STARTING DATE AND DURATION OF OPERATIONS:

The drilling operation should be finished in approximately one month. If the well is productive, an additional 60-90 days will be required for completion and testing before a decision is made to install permanent facilities.

EOG Resources requests the option to contract a Surface Rig to drill, set surface casing, and Cement on the subject well. After WOC 8 hours or 500 psi compressive strength (whichever is greater), the Surface Rig will move off so the wellhead can be installed. A welder will cut the casing to the proper height and weld on the wellhead (both "A" and "B" sections). The weld will be tested to 1,500 psi. All valves will be closed and a wellhead cap will be installed (diagram attached). If the timing between rigs is such that EOG Resources would not be able to preset the surface, the Primary Rig will MIRU and drill the well in its entirety per the APD.

11. WELLHEAD & Offline Cementing:

A multi-bowl wellhead system will be utilized.

After running the 13-3/8" surface casing, a 13-3/8" BOP/BOPE system with a minimum working pressure of 10,000 psi will be installed on the wellhead system and will be pressure tested to 250 psi low followed by a 10,000 psi pressure test. This pressure test will be repeated at least every 30 days, as per Onshore Order No. 2.

The minimum working pressure of the BOP and related BOPE required for drilling below the surface casing shoe shall be 10,000 psi.

The multi-bowl wellhead will be installed by vendor's representative(s). A copy of the installation instructions for the Cactus Multi-Bowl WH system has been sent to the NM BLM office in Carlsbad, NM.

The wellhead will be installed by a third party welder while being monitored by WH vendor's representative.

All BOP equipment will be tested utilizing a conventional test plug. Not a cup or Jpacker type. EOG Resources reserves the option to conduct BOPE testing during wait on cement periods provided a test plug is utilized.

A solid steel body pack-off will be utilized after running and cementing the intermediate casing. After installation the pack-off and lower flange will be pressure tested to 5000 psi.

Casing strings will be tested as per Onshore Order No. 2 to at least 0.22 psi/ft or 1,500 psi, whichever is greater.



EOG Resources Inc. (EOG) respectfully requests a variance from the minimum standards for well control equipment testing of Onshore Order No. 2 (item III.A.2.a.i) to allow a testing schedule of the blow out preventer (BOP) and blow out prevention equipment (BOPE) along with Batch Drilling & Offline cement operations to include the following:

- Full BOPE test at first installation on the pad.
- Full BOPE test every 20 days per Onshore Order No. 2.
- Function test BOP elements per Onshore Order No. 2.
- Break testing BOP and BOPE coupled with batch drilling operations and option to offline cement and/or remediate (if needed) any surface or intermediate sections, according to attached offline cementing support documentation.
- After the well section is secured, the BOP will be disconnected from the wellhead and walked with the rig to another well on the pad.
- TA cap will also be installed per Wellhead vendor procedure and pressure inside the casing will be monitored via the valve on the TA cap as per standard batch drilling ops.
- See attached "EOG BLM Variance 3a -Offline Cement Intermediate Operational Procedure"



12. TUBING REQUIREMENTS


EOG respectively requests an exception to the following NMOCD rule:

19.15.16.10 Casing AND TUBING RQUIREMENTS:
 J (3): "The operator shall set tubing as near the bottom as practical and tubing perforations shall not be more than 250 feet above top of pay zone."

With horizontal flowing and gas lifted wells an end of tubing depth placed at or slightly above KOP is a conservative way to ensure the tubing stays clean from debris, plugging, and allows for fewer well interventions post offset completion. The deeper the tubulars are run into the curve, the higher the probability is that the tubing will become stuck in sand and or well debris as the well produces over time. An additional consideration for EOT placement during artificial lift installations is avoiding the high dog leg severity and inclinations found in the curve section of the wellbore to help improve reliability and performance. Dog leg severity and inclinations tend not to hamper gas lifted or flowing wells, but they do effect other forms of artificial lift like rod pump or ESP (electric submersible pump). Keeping the EOT above KOP is an industry best practice for those respective forms of artificial lift.

&eog resources

Lacey Swiss 1 Fed Com 303H

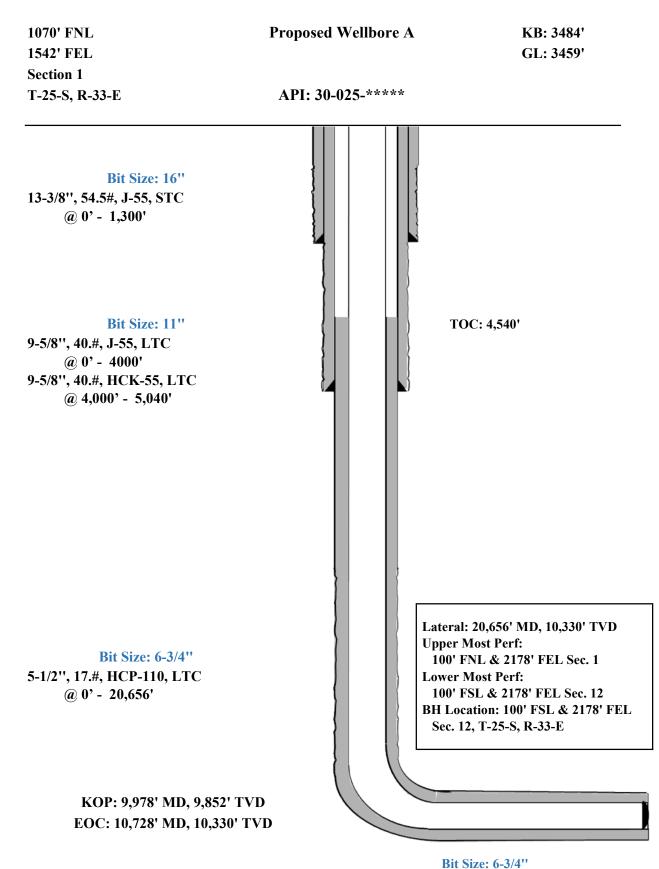

Seog resources

Well Name: Lacey Swiss 1 Fed Com 303H

Location: SHL: 1070' FNL & 1542' FEL, Section 1, T-25-S, R-33-E, Lea Co., N.M. BHL: 100' FSL & 2178' FEL, Section 12, T-25-S, R-33-E, Lea Co., N.M.

Casing Program B:

Hole	Interv	al MD	Interva	Interval TVD				
Size	From (ft)	To (ft)	From (ft) To (ft)		OD	Weight	Grade	Conn
13-1/2"	0	1,300	0	1,300	10-3/4"	40.5#	J-55	STC
9-7/8"	0	4,132	0	4,000	8-5/8"	32#	J-55	BTC-SC
9-7/8"	4,132	5,172	4,000	5,040	8-5/8"	32#	P110-EC	BTC-SC
6-3/4"	0	20,656	0	10,330	5-1/2"	17#	HCP-110	LTC

Cementing Program:

	No.	Wt.	Yld	Shume Description
Depth	Sacks	ppg	Ft3/sk	Slurry Description
1,300'	420	13.5	1.73	Lead: Class C + 4.0% Bentonite Gel + 0.5% CaCl2 + 0.25 lb/sk
10-3/4''				Cello-Flake (TOC @ Surface)
	110	14.8	1.34	Tail: Class C + 0.6% FL-62 + 0.25 lb/sk Cello-Flake + 0.2% Sodium
				Metasilicate (TOC @ 1,100')
5,040'	340	12.7	2.22	Lead: Class C + 10% NaCl + 6% Bentonite Gel + 3% MagOx (TOC
8-5/8''				@ Surface)
	160	14.8	1.32	Tail: Class C + 10% NaCL + 3% MagOx (TOC @ 4,030')
20,656'	560	10.5	3.21	Lead: Class H + 0.4% Halad-344 + 0.35% HR-601 + 3% Microbond
5-1/2''				(TOC @ 4,540')
	770	13.2	1.52	Tail: Class H + 5% NEX-020 + 0.2% NAC-102 + 0.15% NAS-725 +
				0.5% NFL-549 + 0.2% NFP-703 + 1% NBE-737 + 0.3% NRT-241
				(TOC @ 9980')



Variance is requested to waive the centralizer requirements for the 8-5/8" casing in the 9-7/8" hole size. An expansion additive will be utilized, in the cement slurry, for the entire length of the 9-7/8" hole interval to maximize cement bond and zonal isolation.

Variance is also requested to waive any centralizer requirements for the 5-1/2" casing in the 6-3/4" hole size. An expansion additive will be utilized, in the cement slurry, for the entire length of the 6-3/4" hole interval to maximize cement bond and zonal isolation.

EOG requests permission to allow deviation from the 0.422" annulus clearance requirement for the intermediate (salt) section from Onshore Order #2 under the following conditions:

- The variance is not applicable within the Potash Boundaries or Capitan Reef areas.
- Operator takes responsibility to get casing to set point in the event that the clearance causes stuck pipe issues.

Wellhead & Offline Cementing:

EOG Resources Inc. (EOG) respectfully requests a variance from the minimum standards for well control equipment testing of Onshore Order No. 2 (item III.A.2.a.i) to allow a testing schedule of the blow out preventer (BOP) and blow out prevention equipment (BOPE) along with Batch Drilling & Offline cement operations to include the following:

- Full BOPE test at first installation on the pad.
- Full BOPE test every 30 days per Onshore Order No. 2.
- Function test BOP elements per Onshore Order No. 2.
- Break testing BOP and BOPE coupled with batch drilling operations and option to offline cement and/or remediate (if needed) any surface or intermediate sections, according to attached offline cementing support documentation.
- After the well section is secured, the BOP will be disconnected from the wellhead and walked with the rig to another well on the pad.
- TA cap will also be installed per Wellhead vendor procedure and pressure inside the casing will be monitored via the valve on the TA cap as per standard batch drilling ops.
- See attached "EOG BLM Variance 3a -Offline Cement Intermediate Operational Procedure"



1070' **Proposed Wellbore B:** KB: 3484' 1542' GL: 3459' Section 1 T-25-S, R-33-E API: 30-025-***** Bit Size: 13-1/2" 10-3/4", 40.5#, J-55, STC (a) 0' - 1,300' Bit Size: 9-7/8" 8-5/8", 32.#, J-55, BTC-SC (a) 0' - 4000' 8-5/8", 32.#, P110-EC, BTC-SC TOC: 4,540' (a) 4,000' - 5,040' Lateral: 20,656' MD, 10,330' TVD Bit Size: 6-3/4" **Upper Most Perf:** 100' FNL & 2178' FEL Sec. 1 5-1/2", 17.#, HCP-110, LTC Lower Most Perf: (a) 0' - 20,656' 100' FSL & 2178' FEL Sec. 12 BH Location: 100' FSL & 2178' FEL Sec. 12 T-25-S R-33-E KOP: 9,978' MD, 9,852' TVD EOC: 10,728' MD, 10,330' TVD

. eog resources

Lacey Swiss 1 Fed Com #303H

Hydrogen Sulfide Plan Summary

- A. All personnel shall receive proper H2S training in accordance with Onshore Order III.C.3.a.
- **B.** Briefing Area: two perpendicular areas will be designated by signs and readily accessible.
- C. Required Emergency Equipment:

Well control equipment

- a. Flare line 150' from wellhead to be ignited by flare gun.
- b. Choke manifold with a remotely operated choke.
- c. Mud/gas separator

Protective equipment for essential personnel:

- a. Breathing Apparatus:
 - i. Rescue Packs (SCBA) 1 unit shall be placed at each breathing area, 2 shall be stored in the safety trailer.
 - ii. Work/Escape packs —4 packs shall be stored on the rig floor with sufficient air hose not to restrict work activity.
 - iii. Emergency Escape Packs —4 packs shall be stored in the doghouse for emergency evacuation.
- b. Auxiliary Rescue Equipment:
 - i. Stretcher
 - ii. Two OSHA full body harness
 - iii. 100 ft 5/8 inch OSHA approved rope
 - iv. 1-20# class ABC fire extinguisher

H2S Detection and Monitoring Equipment:

The stationary detector with three sensors will be placed in the upper dog house if equipped, set to visually alarm @ 10 ppm and audible @ 14 ppm. Calibrate a minimum of every 30 days or as needed. The sensors will be placed in the following places: Rig floor / Bell nipple / End of flow line or where well bore fluid is being discharged. (Gas sample tubes will be stored in the safety trailer)

Visual Warning System:

- a. One color code condition sign will be placed at the entrance to the site reflecting the possible conditions at the site.
- b. A colored condition flag will be on display, reflecting the current condition at the site at the time.
- c. Two wind socks will be placed in strategic locations, visible from all angles.



Mud Program:

The mud program has been designed to minimize the volume of H2S circulated to surface. The operator will have the necessary mud products to minimize hazards while drilling in H2S bearing zones.

Metallurgy:

All drill strings, casings, tubing, wellhead, blowout preventer, drilling spool, kill lines, choke manifold and lines, and valves shall be suitable for H2S service.

Communication:

Communication will be via cell phones and land lines where available.

Emergency Assistance Telephone List

Corey Helton Fire Department Carlsbad (575) 885-312 Artesia (575) 746-505 Hospitals (575) 748-533 Carlsbad (575) 748-533 Artesia (575) 748-533 Hobbs (575) 392-197 Dept. of Public Safety/Carlsbad (575) 748-533 U.S. Department of Labor (575) 885-312 U.S. Department of Labor (575) 885-312 Bureau of Land Management - Hobbs (Lea Co) (575) 393-361 PET On Call - Hobbs (Ea Co) PET On Call - Carlsbad (Eddy Co) (575) 706-277 Bureau of Land Management - Carlsbad (Eddy Co) (575) 706-277 PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 748-128 Inspection Group South - Gilbert Gordero (575) 626-083 EOG Mesiourees, Inc. (EO Resources, Inc. EOG Midland (432) 206-364 Cord Back Burney (Hat Day) Drilling Engineers (Zill Day) 235-978 Matt Day <th>PUBLIC SAFETY:</th> <th>911 or</th>	PUBLIC SAFETY:	911 or
Fire Department Carlsbad (575) 885-312 Artesia (575) 746-505 Hospitals Carlsbad (575) 748-533 Hobbs (575) 748-333 Hobbs (575) 748-333 Hobbs (575) 748-971 Bighway Department (575) 885-328 U.S. Department of Labor (575) 887-117 Bureau of Land Management - Hobbs (Lea Co) (575) 887-117 Bureau of Land Management - Carlsbad (Eddy Co) (575) 234-597 PET On Call - Hobbs (575) 706-277 Bureau of Land Management - Carlsbad (Eddy Co) (575) 234-597 PET On Call - Carlsbad (575) 706-277 Bureau of Loneservation Division - Artesia (575) 706-277 New Mexice Oil Conservation Division - Artesia (575) 706-277 New Mexice Oil Conservation Division - Artesia (575) 706-277 Bureau of Land Management - Gaibert Gordero (575) 626-083 EOG Resources, Inc. EOG Midland (432) 208-6360 Company Drilling Consultants: EIT Ducit (432) 230-484 Blake Burney Drilling Engineers Stephen Davis (432) 235-978 Matt Day (210) 294-372 Drilling Managers EDG Infing Managers EIT On Call - Engineers EIT Appendix (432) 215-815 Ryan Reynolds (432) 215-815 Ryan Reynolds (432) 215-815 Ryan Reynolds (432) 215-815 Ryan Reynolds (432) 256-373 Nabors Drilling (432) 563-573 Nabors Drilling Patterson UTI Patterson UTI Patterson UTI (432) 561-938 EOG Safety	Lea County Sheriff's Department	(575) 396-3611
Carlsbad (575) 885-312 Artesia (575) 746-505 Hospitals (575) 746-505 Carlsbad (575) 748-303 Hobbs (575) 748-333 Hobbs (575) 748-333 Hobbs (575) 748-333 Hobbs (575) 748-971 Highway Department (575) 885-322 U.S. Department of Labor (575) 885-322 U.S. Department of Labor (575) 885-322 PET On Call - Hobbs (Lea Co) (575) 393-361 PET On Call - Carlsbad (Eddy Co) (575) 234-597 PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 748-128 Inspection Group South - Gilbert Gordero (575) 626-083 EOG Resources, Inc. EOG Midland (432) 230-484 Blake Burney Dilling Consultants: EO Drilling Engineers EO EO Branden Kcener (210) 294-372 Drilling Managers <td>Corey Helton</td> <td></td>	Corey Helton	
Artesia (575) 746-505 Hospitals (575) 887-412 Artesia (575) 748-333 Hobbs (575) 392-197 Dept. of Public Safety/Carlsbad (575) 748-333 Highway Department (575) 887-112 US. Department of Labor (575) 887-112 Bureau of Land Management - Hobbs (Lea Co) (575) 898-328 V.S. Department of Labor (575) 748-971 Bureau of Land Management - Carlsbad (Eddy Co) (575) 393-361 PET On Call - Hobbs (575) 706-277 Bureau of Land Management - Carlsbad (Eddy Co) (575) 748-971 Bureau of Land Management - Carlsbad (Eddy Co) (575) 748-971 Bureau of Land Management - Carlsbad (Eddy Co) (575) 748-971 New Mexico Oil Conservation Division - Artesia (575) 748-972 Inspection Group South - Gilbert Gordero (575) 626-083 EOG Midland (432) 686-360 Company Drilling Consultants:	Fire Department	
Hospitals Carlsbad Carlsbad (575) 887-412 Artesia (575) 748-333 Hobbs (575) 748-333 Hobbs (575) 748-971 Highway Department (575) 885-328 U.S. Department of Labor (575) 885-328 U.S. Department of Labor (575) 885-328 U.S. Department of Labor (575) 887-117 Bureau of Land Management - Hobbs (Lea Co) (575) 393-361 PET On Call - Hobbs (575) 706-277 PET On Call - Carlsbad (Eddy Co) (575) 234-597 PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (432) 230-484 Blake Burney Drilling Eonserve Drilling Somerintendents Lance Hardy (432) 235-978 Natur Day (210) 294-432 Drilling Superintendents Lance Hardy (432) 215-815 Nabors Drilling H&P Drilling (432) 563-575 Nabors Drilling Nabors Drilling (432) 563-575 Nabors Drilling Nabors Drilling (432) 303-818 Patterson UTI Patterson UTI (432) 561-938 EOG Safety	Carlsbad	(575) 885-3125
Carlsbad (575) 887-412 Artesia (575) 748-333 Hobbs (575) 748-333 Hobbs (575) 748-333 Hobbs (575) 748-971 Highway Department (575) 748-971 Bureau of Land Management - Hobbs (Lea Co) (575) 885-328 U.S. Department of Labor (575) 706-277 Bureau of Land Management - Carlsbad (Eddy Co) (575) 706-277 PET On Call - Carlsbad (575) 706-277 PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 748-128 Inspection Group South - Gilbert Gordero (575) 626-083 EOG Midland (432) 206-630 Company Drilling Consultants:	Artesia	(575) 746-5050
Carlsbad (575) 887-412 Artesia (575) 748-333 Hobbs (575) 748-333 Hobbs (575) 748-333 Hobbs (575) 748-971 Highway Department (575) 748-971 Bureau of Land Management - Hobbs (Lea Co) (575) 885-328 U.S. Department of Labor (575) 706-277 Bureau of Land Management - Carlsbad (Eddy Co) (575) 706-277 PET On Call - Carlsbad (575) 706-277 PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 748-128 Inspection Group South - Gilbert Gordero (575) 626-083 EOG Midland (432) 206-630 Company Drilling Consultants:	Hospitals	
Hobbs (575) 392-197 Dept. of Public Safety/Carlsbad (575) 748-971 Highway Department (575) 885-328 U.S. Department of Labor (575) 885-328 U.S. Department of Labor (575) 885-328 Bureau of Land Management - Hobbs (Lea Co) (575) 393-361 PET On Call - Hobbs (575) 706-277 Bureau of Land Management - Carlsbad (Eddy Co) (575) 706-277 PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Consultants: (432) 205-083 EOG Midland (432) 686-360 Company Drilling Consultants: (432) 230-484 Blake Burney Drilling Engineers Stephen Davis (432) 235-978 Matt Day (210) 294-372 Drilling Managers (210) 294-372 Branden Keener (210) 294-372 Drilling Superintendents (432) 215-597 Lance Hardy (432) 215-597 Nabors Drilling (432) 563-575 Nabors Drilling <td></td> <td>(575) 887-4121</td>		(575) 887-4121
Dept. of Public Safety/Carlsbad (575) 748-971 Highway Department (575) 885-328 U.S. Department of Labor (575) 887-117 Bureau of Land Management - Hobbs (Lea Co) (575) 393-361 PET On Call - Hobbs (575) 706-277 Bureau of Land Management - Carlsbad (Eddy Co) (575) 706-277 PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 762-670 Inspection Group South - Gilbert Gordero (575) 626-083 EOG Midland (432) 686-360 Company Drilling Consultants: (432) 230-484 Blake Burney Drilling Engineers Stephen Davis (432) 235-978 Matt Day (210) 296-445 Drilling Managers (210) 294-372 Drilling Superintendents (432) 215-815 Lance Hardy (432) 215-815 Ryan Reynolds (432) 215-597 Steve Kelly (210) 446-789 H&P Drilling (432) 263-818 Harder Maragers (210) 294-372 Drilling Superintendents (432) 215-597 Lance Hardy (432)	Artesia	(575) 748-3333
Highway Department (575) 885-328 U.S. Department of Labor (575) 887-117 Bureau of Land Management - Hobbs (Lea Co) (575) 393-361 PET On Call - Hobbs (575) 706-277 Bureau of Land Management - Carlsbad (Eddy Co) (575) 706-277 PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 Inspection Group South - Gilbert Gordero (575) 748-128 Inspection Group South - Gilbert Gordero (575) 626-083 EOG Resources, Inc. (432) 686-360 Company Drilling Consultants: (432) 230-484 Blake Burney (432) 230-484 Blake Burney (432) 235-978 Drilling Managers (432) 235-978 Branden Keener (210) 296-445 Drilling Managers (210) 296-445 Drilling Superintendents (432) 215-815 Lance Hardy (432) 215-815 Ryan Reynolds (432) 215-817 Keener (210) 416-789 H&P Drilling (432) 563-575 Nabors Drilling (432) 363-818 Patterson UTI (432) 563-575 Nabors Drilling (Hobbs	(575) 392-1979
Highway Department (575) 885-328 U.S. Department of Labor (575) 887-117 Bureau of Land Management - Hobbs (Lea Co) (575) 393-361 PET On Call - Hobbs (575) 706-277 Bureau of Land Management - Carlsbad (Eddy Co) (575) 706-277 PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 Inspection Group South - Gilbert Gordero (575) 626-083 EOG Resources, Inc. EOG EOG Midland (432) 686-360 Company Drilling Consultants: Inspection Group South - Gilbert Gordero Jett Dueitt (432) 230-484 Blake Burney Inspecteres Drilling Engineers (432) 235-978 Matt Day (210) 296-445 Drilling Managers Inspection Group South - Gilbert Gordero Drilling Superintendents (432) 215-815 Lance Hardy (432) 215-815 Nayan Reynolds (432) 215-817 Kep Drilling (432) 2563-757 Nabors Drilling (432) 363-818 H&P Drilling (432) 363-818 H&P Drilling (432) 363-818 Patterson UTI	Dept. of Public Safety/Carlsbad	(575) 748-9718
U.S. Department of Labor (575) 887-117 Bureau of Land Management - Hobbs (Lea Co) (575) 393-361 PET On Call - Hobbs (575) 706-277 Bureau of Land Management - Carlsbad (Eddy Co) (575) 234-597 PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 Defidinad (432) 686-360 Company Drilling Consultants: (432) 230-484 Blake Burney (432) 230-484 Blake Burney (432) 235-978 Drilling Managers (210) 296-445 Drilling Managers (210) 296-445 Drilling Superintendents (210) 296-452 Lance Hardy (432) 215-815 Ryan Reynolds		(575) 885-3281
Bureau of Land Management - Hobbs (Lea Co) (575) 393-361 PET On Call - Hobbs (575) 706-277 Bureau of Land Management - Carlsbad (Eddy Co) (575) 234-597 PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 706-277 Bale Bources, Inc. (575) 626-083 EOG Resources, Inc. (432) 2686-360 Company Drilling Consultants: (432) 230-484 Blake Burney (432) 230-484 Blake Burney (432) 230-484 Blake Burney (432) 235-978 Matt Day (210) 296-445 Drilling Managers (210) 296-445 Drilling Superintendents (210) 294-372 Lance Hardy (432) 215-815 Ryan Reynolds (432) 215-978 H&P Drilling (432) 563-575 Nabors Drilling (432) 563-575 </td <td></td> <td>(575) 887-1174</td>		(575) 887-1174
PET On Call - Hobbs (575) 706-277 Bureau of Land Management - Carlsbad (Eddy Co) (575) 234-597 PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 708-278 Inspection Group South - Gilbert Gordero (575) 748-128 EOG Resources, Inc. (432) 686-360 EOG Midland (432) 686-360 Company Drilling Consultants: (432) 230-484 Blake Burney Drilling Engineers Stephen Davis (432) 235-978 Matt Day (210) 296-445 Drilling Managers (210) 296-445 Drilling Superintendents (432) 215-815 Lance Hardy (432) 215-815 Kyan Reynolds (432) 215-815 Steve Kelly (210) 416-789 H&P Drilling (432) 563-575 Nabors Drilling (432) 563-575 Nabors Drilling (432) 363-818 Patterson UTI (432) 561-938 EOG Safety (432) 561-938	*	(575) 393-3612
Bureau of Land Management - Carlsbad (Eddy Co) (575) 234-597 PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 748-128 Inspection Group South - Gilbert Gordero (575) 626-083 EOG Resources, Inc. EOG Midland Company Drilling Consultants: (432) 686-360 Jett Dueitt (432) 230-484 Blake Burney (432) 230-484 Dake Burney (432) 235-978 Matt Day (210) 296-445 Drilling Managers (210) 294-372 Branden Keener (210) 294-372 Drilling Superintendents (432) 215-815 Lance Hardy (432) 215-815 Ryan Reynolds (432) 2563-575 Steve Kelly (210) 416-789 H&P Drilling (432) 563-575 Nabors Drilling (432) 363-818 Patterson UTI (432) 561-938 EOG Safety (432) 561-938	č	(575) 706-2779
PET On Call - Carlsbad (575) 706-277 New Mexico Oil Conservation Division - Artesia (575) 748-128 Inspection Group South - Gilbert Gordero (575) 626-083 EOG Resources, Inc. EOG Midland EOG Midland (432) 686-360 Company Drilling Consultants: (432) 230-484 Blake Burney Dilling Engineers Drilling Engineers (432) 235-978 Matt Day (210) 296-445 Drilling Managers (210) 296-445 Drilling Managers (210) 296-445 Drilling Superintendents (432) 215-815 Lance Hardy (432) 215-815 Ryan Reynolds (432) 215-815 Steve Kelly (210) 416-789 H&P Drilling (432) 563-575 Nabors Drilling (432) 363-818 Patterson UTI (432) 363-818 Patterson UTI (432) 561-938 EOG Safety (432) 561-938	Bureau of Land Management - Carlsbad (Eddy Co)	(575) 234-5972
New Mexico Oil Conservation Division - Artesia (575) 748-128 Inspection Group South - Gilbert Gordero (575) 626-083 EOG Resources, Inc. EOG Midland EOG Midland (432) 686-360 Company Drilling Consultants: (432) 230-484 Blake Burney (432) 230-484 Blake Burney (432) 235-978 Drilling Engineers (432) 235-978 Matt Day (210) 296-445 Drilling Managers (210) 296-445 Drilling Superintendents (432) 215-815 Lance Hardy (432) 215-815 Ryan Reynolds (432) 215-597 Steve Kelly (210) 416-789 H&P Drilling (432) 215-597 Nabors Drilling (432) 563-575 Nabors Drilling (432) 563-575 Nabors Drilling (432) 363-818 Patterson UTI (432) 561-938 EOG Safety (432) 561-938		(575) 706-2779
Inspection Group South - Gilbert Gordero (575) 626-083 EOG Resources, Inc. EOG Midland (432) 686-360 Company Drilling Consultants: Jett Dueitt (432) 230-484 Blake Burney Drilling Engineers Stephen Davis (432) 235-978 Matt Day (210) 296-445 Drilling Managers Branden Keener (210) 294-372 Drilling Superintendents Lance Hardy (432) 215-815 Ryan Reynolds (432) 215-597 Steve Kelly (210) 416-789 H&P Drilling H&P Drilling (432) 563-575 Nabors Drilling (432) 563-575 Nabors Drilling (432) 363-818 Patterson UTI Patterson UTI (432) 561-938 EOG Safety	New Mexico Oil Conservation Division - Artesia	(575) 748-1283
EOG Resources, Inc.(432) 686-360EOG Midland(432) 686-360Company Drilling Consultants:(432) 230-484Blake Burney(432) 230-484Drilling Engineers(432) 235-978Matt Day(210) 296-445Drilling Managers(210) 296-445Branden Keener(210) 294-372Drilling Superintendents(432) 215-815Lance Hardy(432) 215-815Ryan Reynolds(432) 215-597Steve Kelly(210) 416-789H&P Drilling(432) 563-575Nabors Drilling(432) 363-818Patterson UTI(432) 561-938EOG Safety(432) 561-938	Inspection Group South - Gilbert Gordero	(575) 626-0830
EOG Midland (432) 686-360 Company Drilling Consultants: (432) 230-484 Blake Burney (432) 230-484 Blake Burney (432) 230-484 Drilling Engineers (432) 235-978 Matt Day (210) 296-445 Drilling Managers (210) 296-445 Drilling Managers (210) 294-372 Drilling Superintendents (432) 215-815 Ryan Reynolds (432) 215-597 Steve Kelly (210) 416-789 H&P Drilling (432) 563-575 Nabors Drilling (432) 363-818 Patterson UTI (432) 561-938 EOG Safety (432) 561-938		
Jett Dueitt (432) 230-484 Blake Burney Drilling Engineers Stephen Davis (432) 235-978 Matt Day (210) 296-445 Drilling Managers Branden Keener (210) 294-372 Drilling Superintendents Lance Hardy (432) 215-815 Ryan Reynolds (432) 215-815 Steve Kelly (210) 416-789 H&P Drilling (432) 563-575 Nabors Drilling (432) 563-575 Nabors Drilling (432) 563-575 Nabors Drilling (432) 363-818 Patterson UTI (432) 561-938 EOG Safety	EOG Midland	(432) 686-3600
Blake Burney Drilling Engineers Stephen Davis Matt Day (210) 296-445 Drilling Managers Branden Keener (210) 294-372 Drilling Superintendents Lance Hardy (432) 215-815 Ryan Reynolds (432) 215-597 Steve Kelly H&P Drilling H&P Drilling Mabors Drilling (432) 563-575 Nabors Drilling (432) 363-818 Patterson UTI Patterson UTI (432) 561-938	Company Drilling Consultants:	
Drilling EngineersStephen Davis(432) 235-978Matt Day(210) 296-445Drilling Managers(210) 294-372Branden Keener(210) 294-372Drilling Superintendents(432) 215-815Lance Hardy(432) 215-815Ryan Reynolds(432) 215-597Steve Kelly(210) 416-789H&P Drilling(432) 563-575Nabors Drilling(432) 363-818Patterson UTI(432) 363-818Patterson UTI(432) 561-938EOG Safety(432) 561-938	Jett Dueitt	(432) 230-4840
Stephen Davis (432) 235-978 Matt Day (210) 296-445 Drilling Managers (210) 294-372 Branden Keener (210) 294-372 Drilling Superintendents (432) 215-815 Lance Hardy (432) 215-815 Ryan Reynolds (432) 215-597 Steve Kelly (210) 416-789 H&P Drilling (432) 563-575 Nabors Drilling (432) 363-818 Patterson UTI (432) 561-938 EOG Safety (432) 561-938	Blake Burney	
Matt Day(210) 296-445Drilling Managers(210) 294-372Branden Keener(210) 294-372Drilling Superintendents(432) 215-815Lance Hardy(432) 215-815Ryan Reynolds(432) 215-597Steve Kelly(210) 416-789H&P Drilling(432) 563-575Nabors Drilling(432) 363-818Patterson UTI(432) 561-938EOG Safety(432) 561-938	Drilling Engineers	
Drilling ManagersBranden Keener(210) 294-372Drilling SuperintendentsLance Hardy(432) 215-815Ryan Reynolds(432) 215-597Steve Kelly(210) 416-789H&P Drilling(432) 563-575Nabors Drilling(432) 563-575Nabors Drilling(432) 363-818Patterson UTI(432) 561-938EOG Safety(432) 561-938	Stephen Davis	(432) 235-9789
Branden Keener(210) 294-372Drilling Superintendents(432) 215-815Lance Hardy(432) 215-815Ryan Reynolds(432) 215-597Steve Kelly(210) 416-789H&P Drilling(432) 563-575Nabors Drilling(432) 563-575Nabors Drilling(432) 363-818Patterson UTI(432) 561-938EOG Safety(432) 561-938	Matt Day	(210) 296-4456
Branden Keener(210) 294-372Drilling Superintendents(432) 215-815Lance Hardy(432) 215-815Ryan Reynolds(432) 215-597Steve Kelly(210) 416-789H&P Drilling(432) 563-575Nabors Drilling(432) 563-575Nabors Drilling(432) 363-818Patterson UTI(432) 561-938EOG Safety(432) 561-938	Drilling Managers	
Lance Hardy (432) 215-815 Ryan Reynolds (432) 215-597 Steve Kelly (210) 416-789 H&P Drilling (432) 563-575 Nabors Drilling (432) 363-818 Patterson UTI (432) 561-938 EOG Safety (432) 561-938	Branden Keener	(210) 294-3729
Ryan Reynolds (432) 215-597 Steve Kelly (210) 416-789 H&P Drilling (432) 563-575 Nabors Drilling (432) 363-575 Nabors Drilling (432) 363-818 Patterson UTI (432) 561-938 EOG Safety (432) 561-938	Drilling Superintendents	
Steve Kelly (210) 416-789 H&P Drilling (432) 563-575 H&P Drilling (432) 563-575 Nabors Drilling (432) 363-818 Patterson UTI (432) 561-938 EOG Safety (432) 561-938	Lance Hardy	(432) 215-8152
H&P Drilling (432) 563-575 Mabors Drilling (432) 363-818 Nabors Drilling (432) 363-818 Patterson UTI (432) 561-938 EOG Safety (432) 561-938	Ryan Reynolds	(432) 215-5978
H&P Drilling(432) 563-575Nabors Drilling(432) 363-818Patterson UTI(432) 363-818Patterson UTI(432) 561-938EOG Safety(432) 561-938	Steve Kelly	(210) 416-7894
H&P Drilling(432) 563-575Nabors Drilling(432) 363-818Patterson UTI(432) 363-818Patterson UTI(432) 561-938EOG Safety(432) 561-938	H&P Drilling	
Nabors Drilling(432) 363-818Nabors Drilling(432) 363-818Patterson UTI(432) 561-938EOG Safety(432) 561-938	H&P Drilling	(432) 563-5757
Patterson UTI (432) 561-938 EOG Safety (432) 561-938	Nabors Drilling	
Patterson UTI (432) 561-938 EOG Safety	Nabors Drilling	(432) 363-8180
EOG Safety	Patterson UTI	
EOG Safety	Patterson UTI	(432) 561-9382
•	EOG Safety	
(01//20/020	Brian Chandler (HSE Manager)	(817) 239-0251

leog resources

vived by OCD: 8/23/2024 8:52:58 AM

350-

700-

1050-

1400-

5950-

6300-

6650-

7000-

7350-

7700-

8050-

8400-

8750-

9100-

9450-

.


Lea County, NM (NAD 83 NME)

Lacey Swiss 1 Fed Com

Plan #0.1 RT


Geodetic System: US State Plane 1983 Datum: North American Datum 1983 Ellipsoid: GRS 1980 Zone: New Mexico Eastern Zone System Datum: Mean Sea Level

-350 -1750 ----#303H 1050---+--700 350 - - - - --350 PROJECT DETAILS: Lea County, NM (NAD 83 NME)

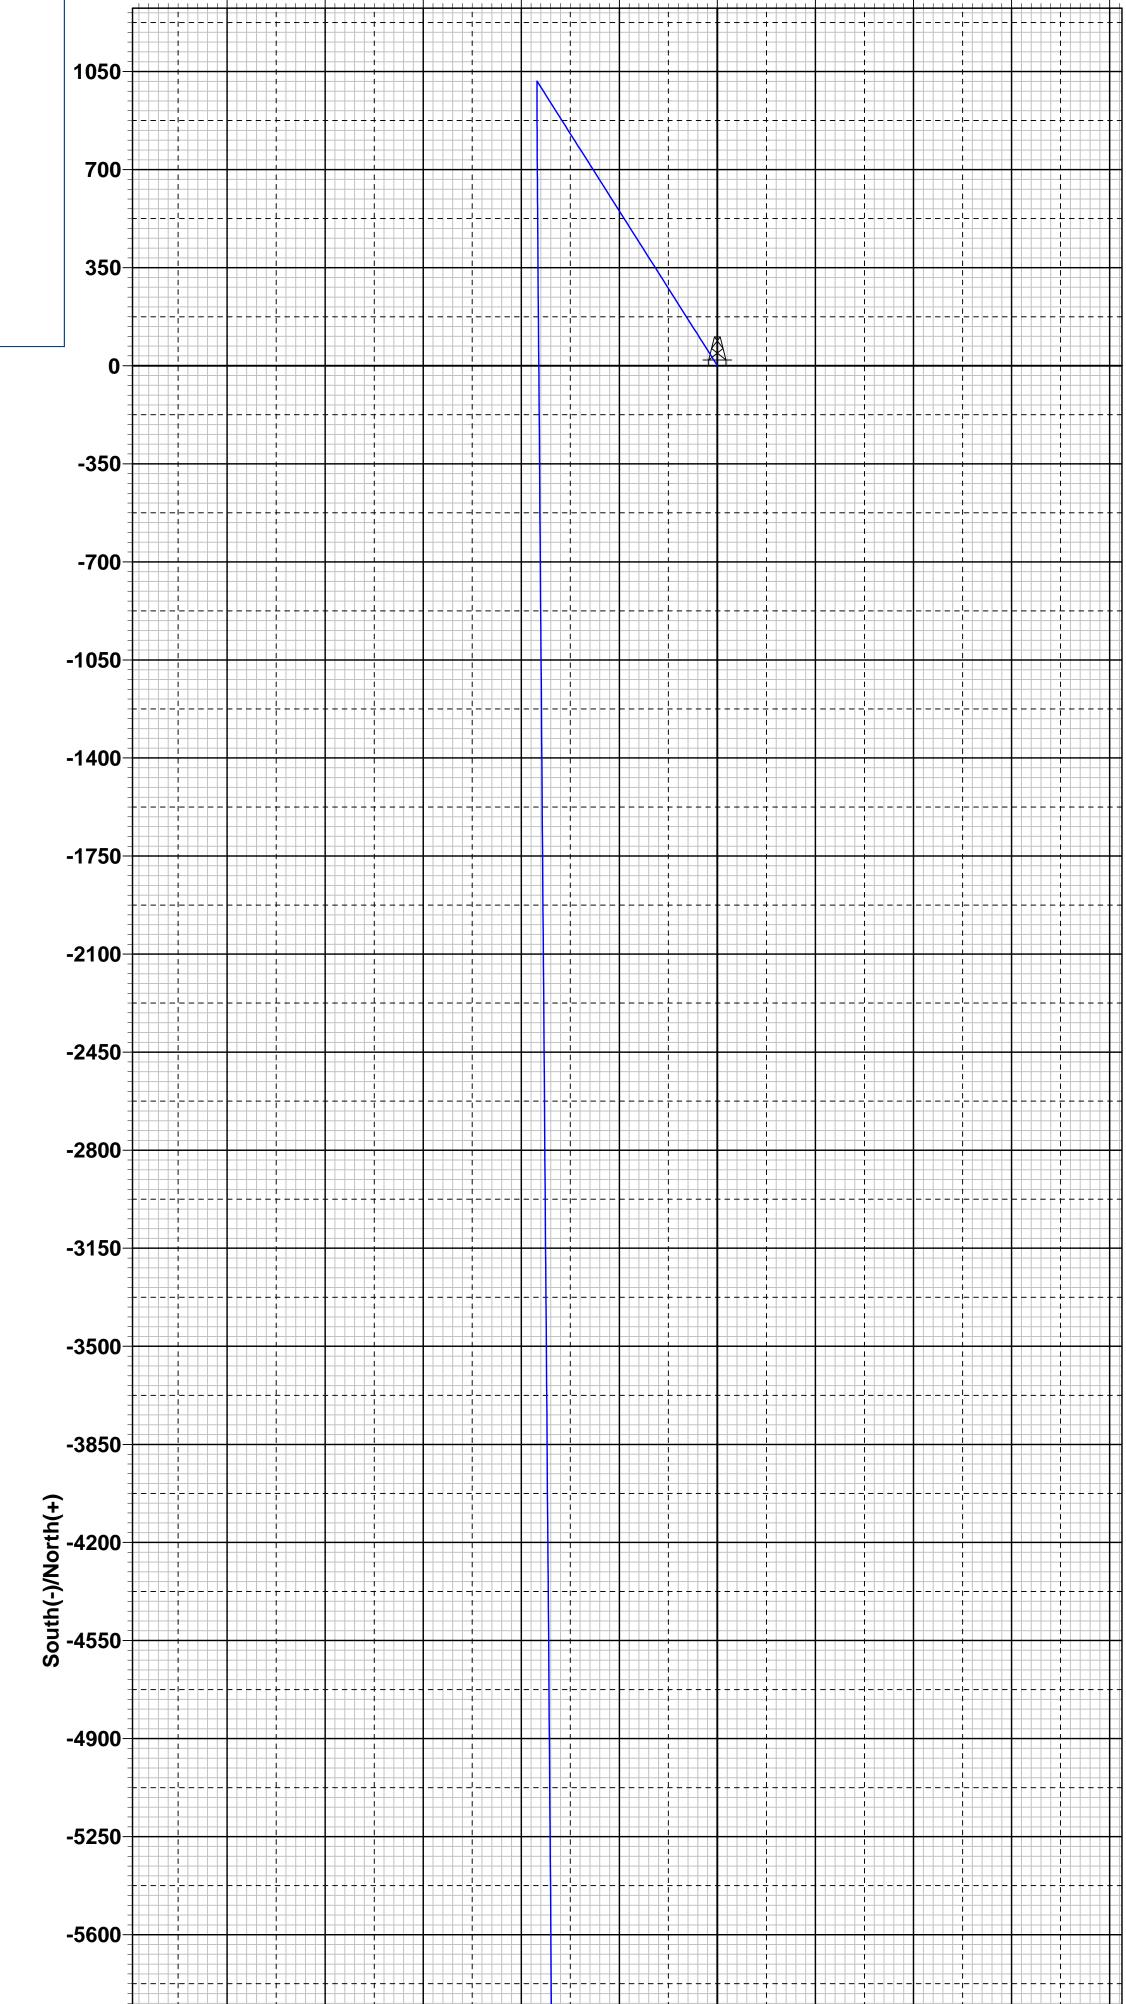


West(-)/East(+)

350

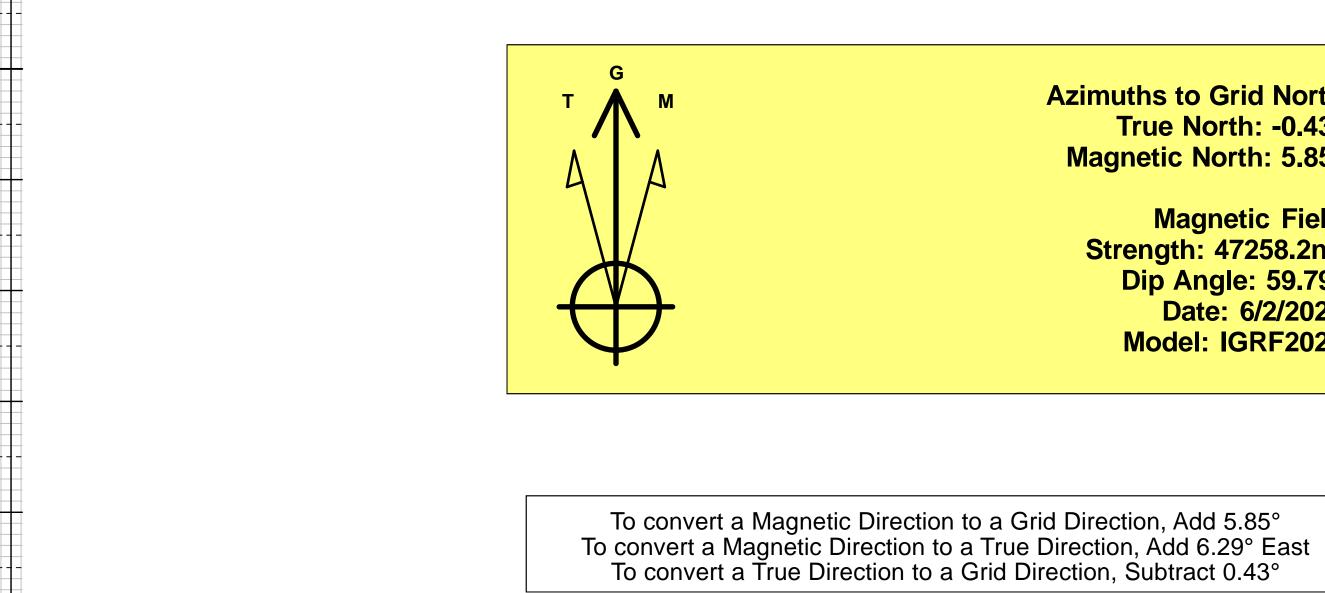

1400

1050

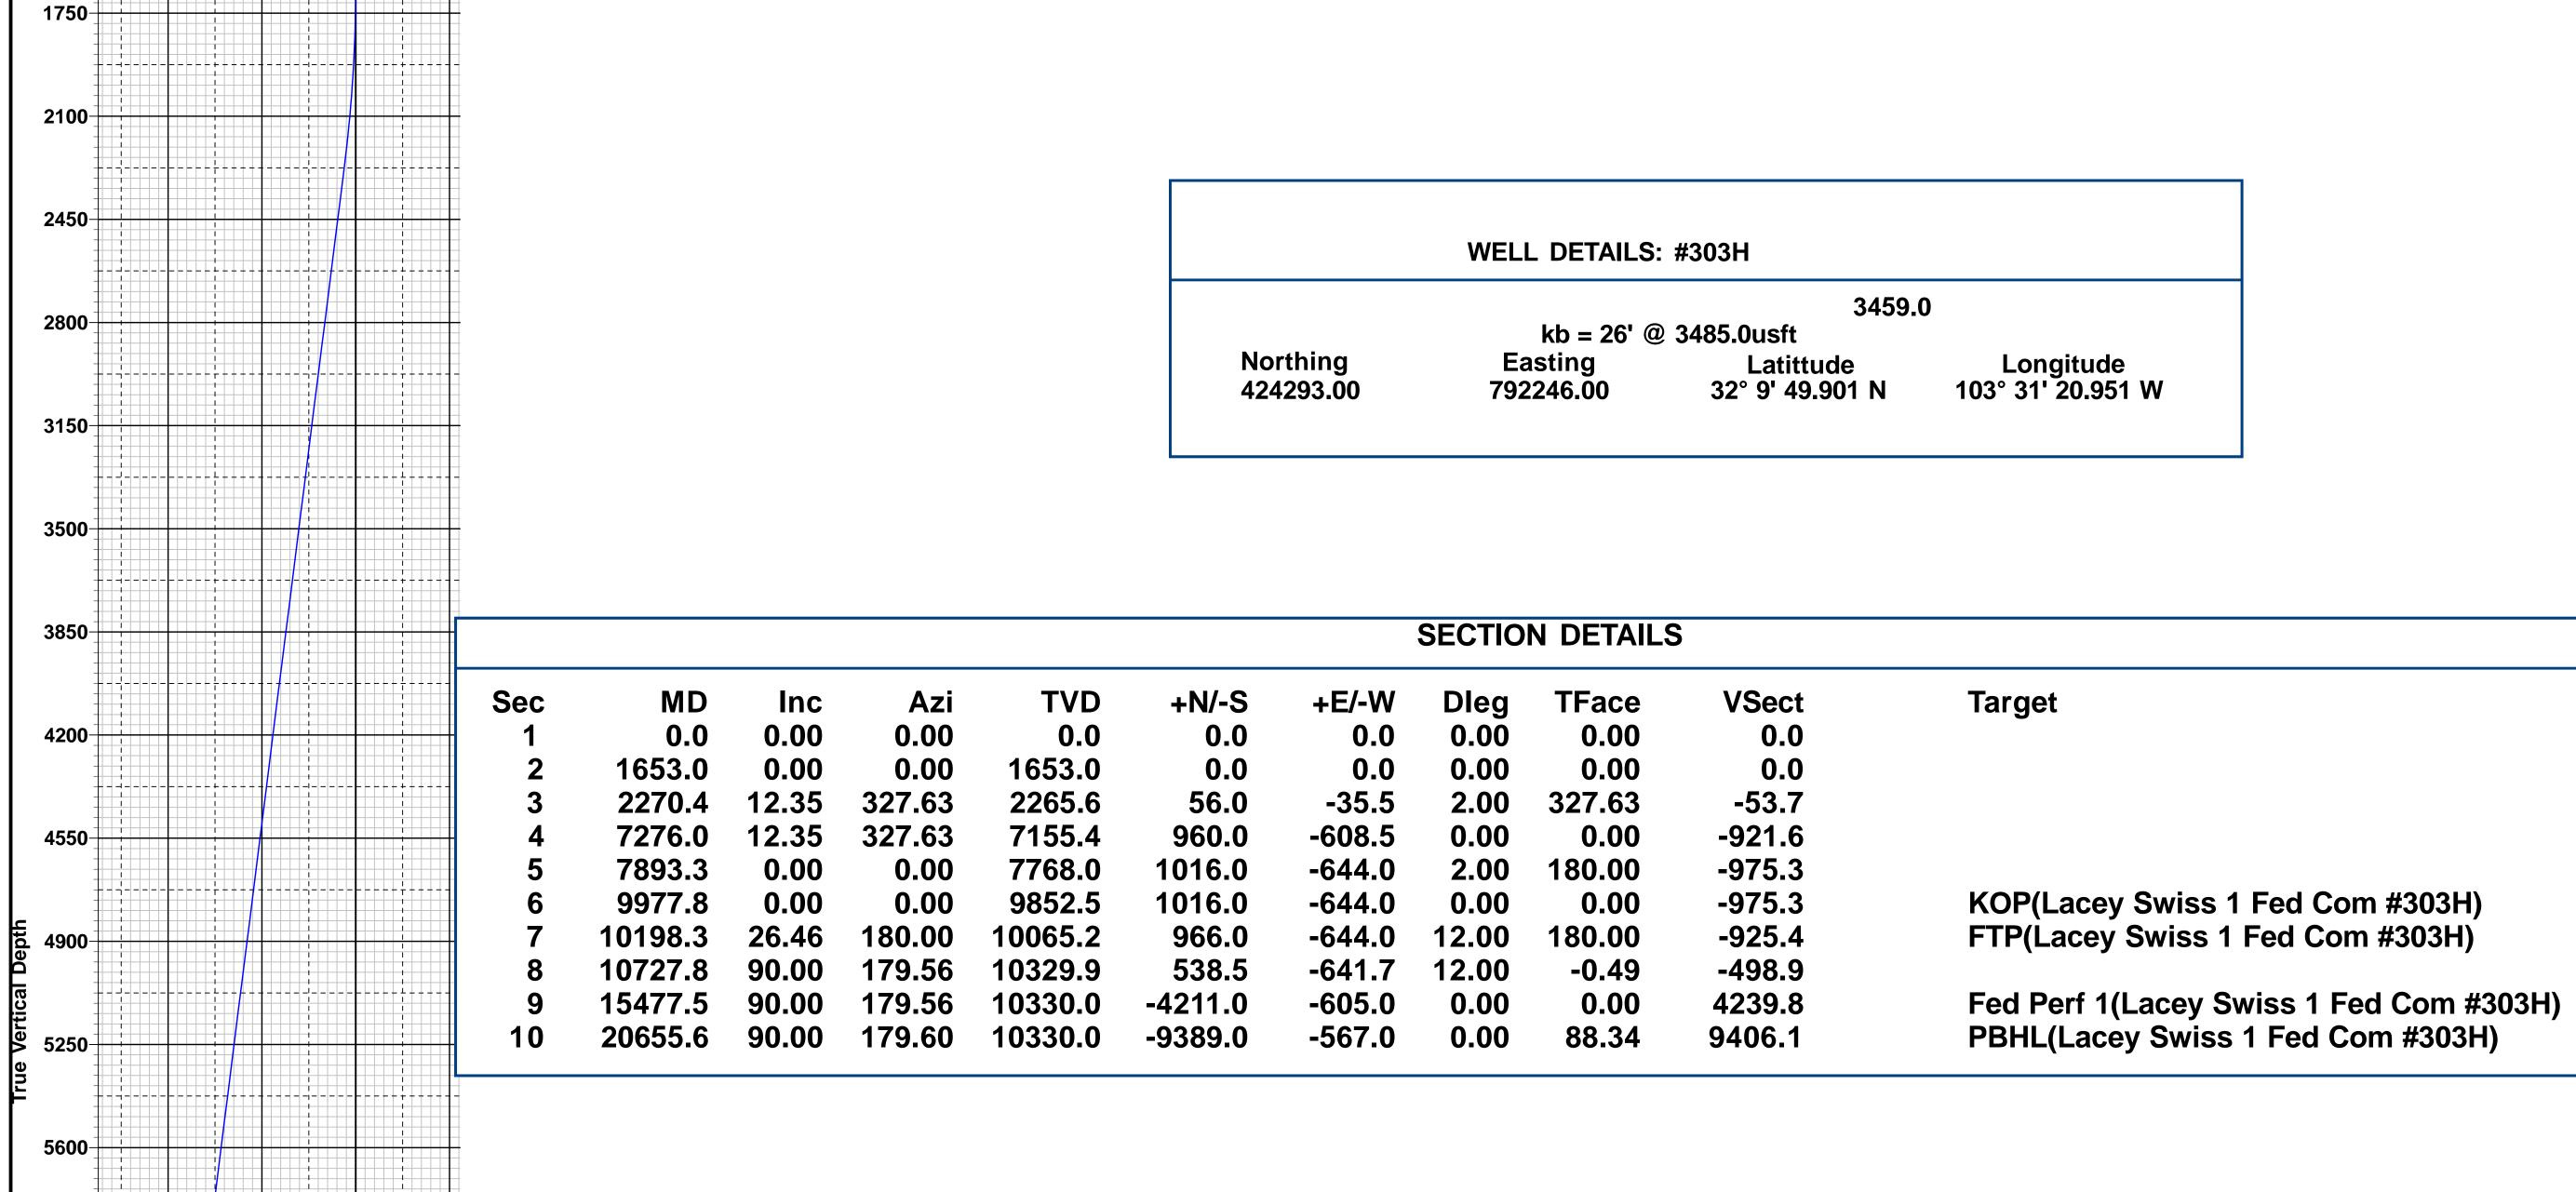

Azimuths to Grid North

Magnetic North: 5.85°

Strength: 47258.2nT


Dip Angle: 59.79°


Model: IGRF2020

True North: -0.43°

Magnetic Field

Date: 6/2/2023

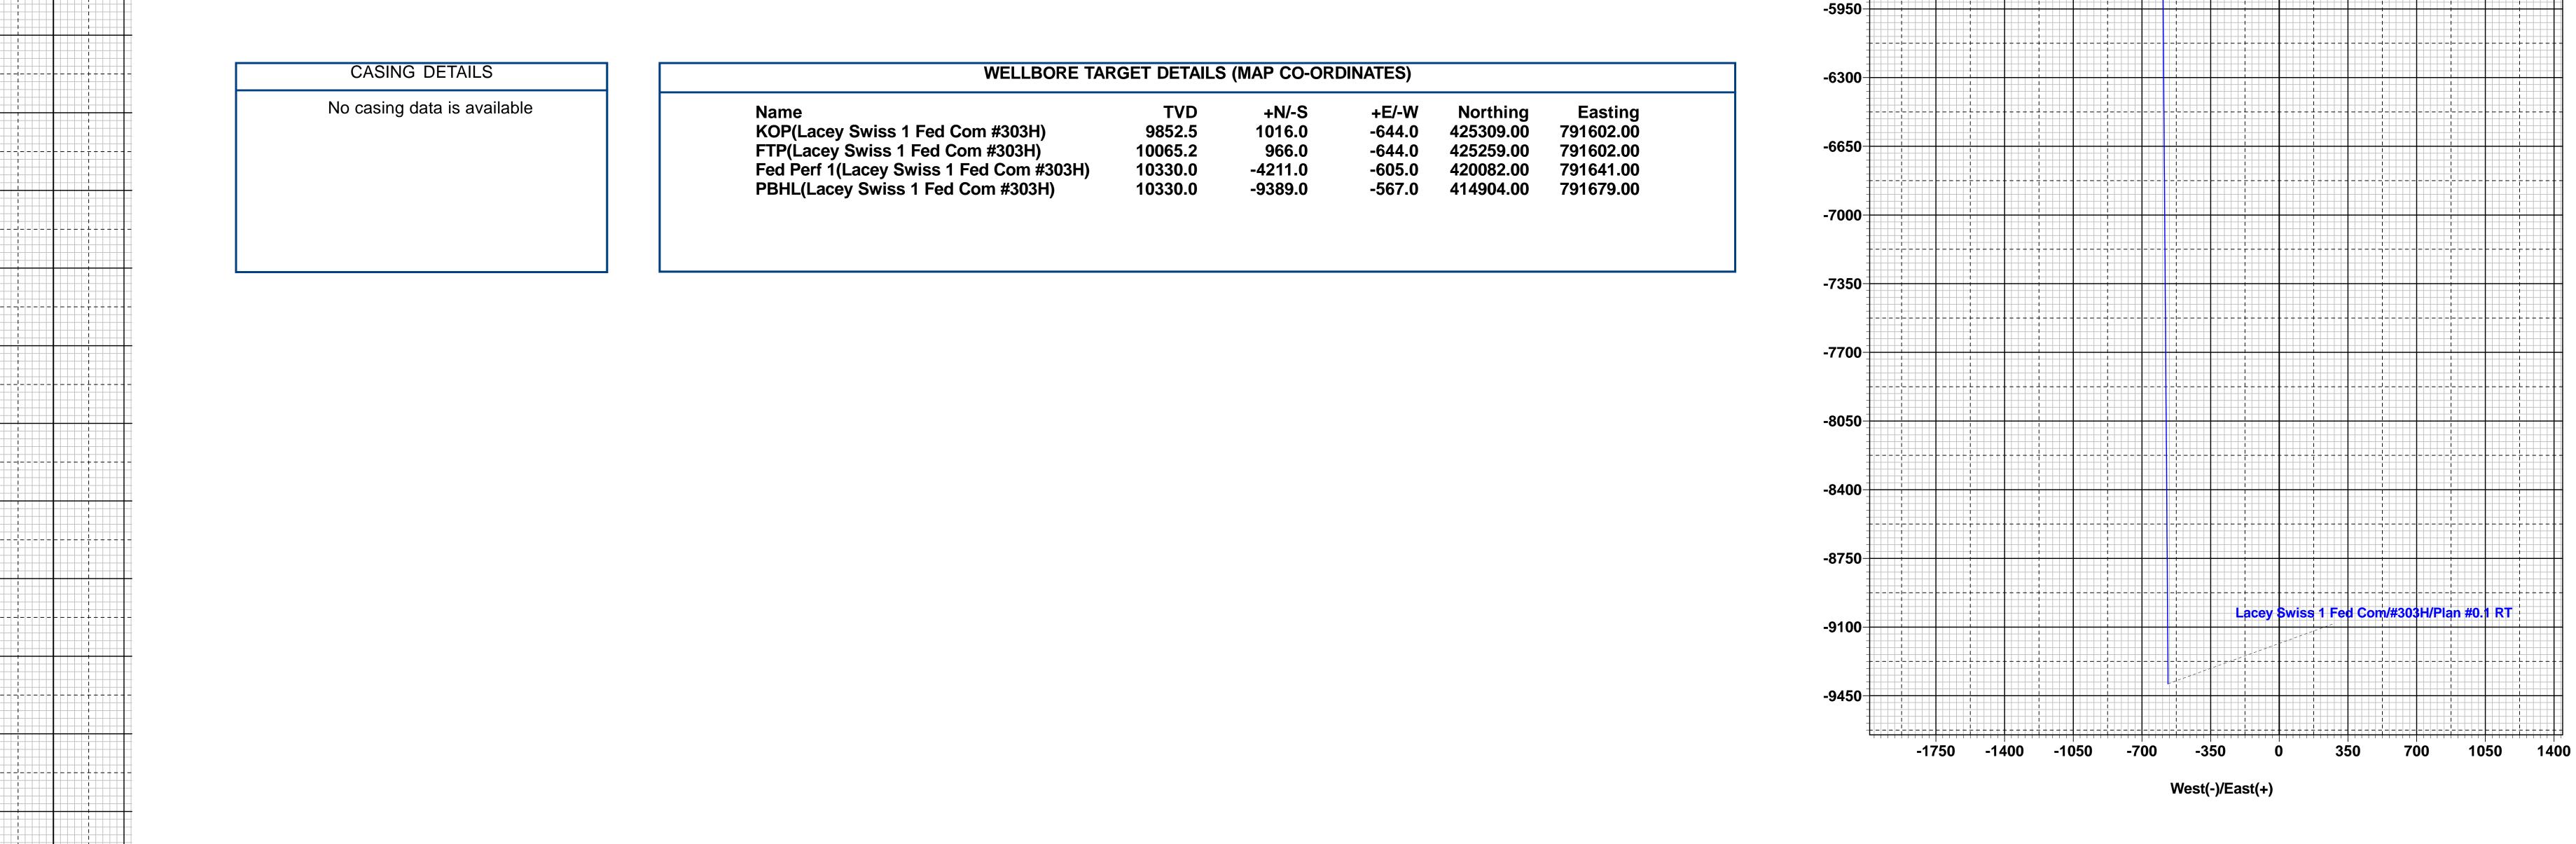

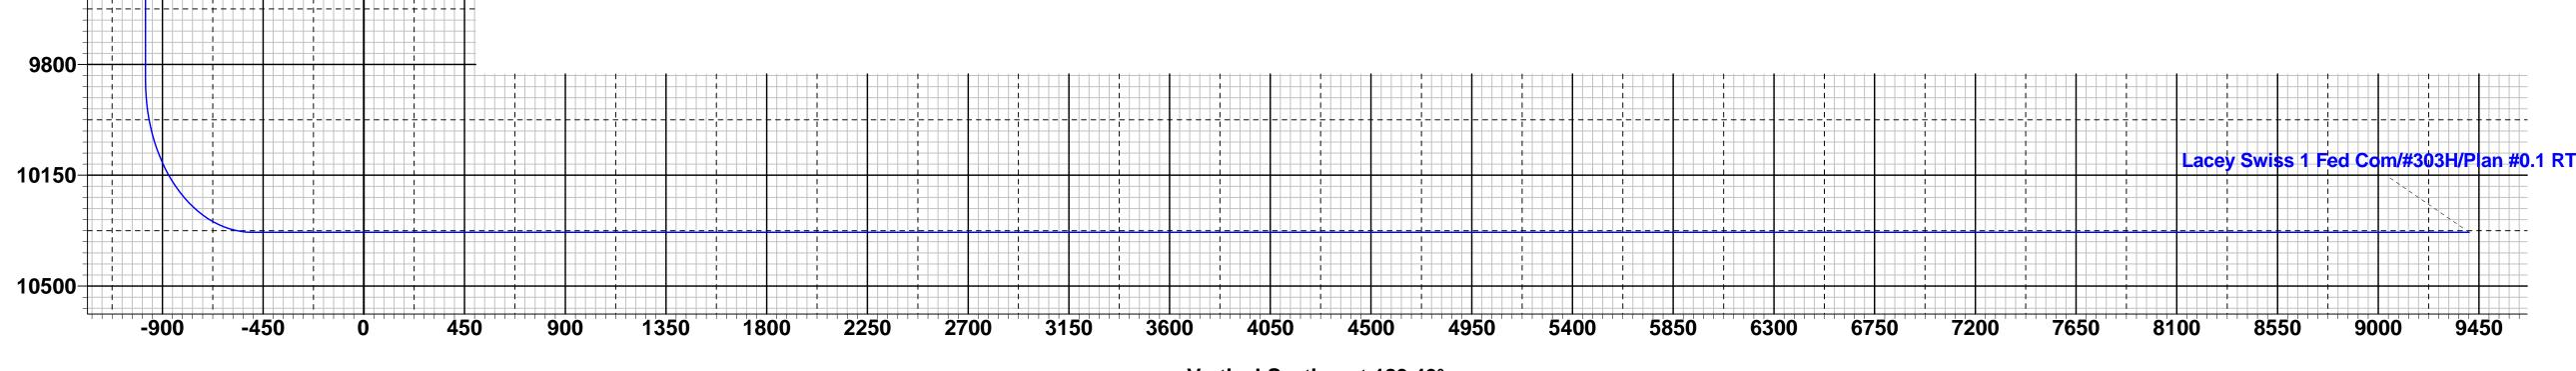

Vertical Section at 183.46°



Lea County, NM (NAD 83 NME) Lacey Swiss 1 Fed Com #303H ОН Plan #0.1 RT 10:25, June 05 2023



Midland

Lea County, NM (NAD 83 NME) Lacey Swiss 1 Fed Com #303H

OH

Plan: Plan #0.1 RT

Standard Planning Report

05 June, 2023



eugre	Jun	663								
Database: Company: Project: Site: Well: Wellbore: Design:		y, NM (NAD 83 ss 1 Fed Com RT	NME)		TVD Refer MD Refere North Ref	ence:		Well #303H kb = 26' @ 3485 kb = 26' @ 3485 Grid Minimum Curvat	.0usft	
Project	Lea County	, NM (NAD 83 N	IME)							
Map System: Geo Datum: Map Zone:		ne 1983 an Datum 1983 Eastern Zone			System Da	tum:	M	ean Sea Level		
Site	Lacey Swiss	s 1 Fed Com								
Site Position: From: Position Uncertainty:	Мар	0.0 usft	Northing: Easting: Slot Radius	:	793,	128.00 usft 117.00 usft 3-3/16 "	Latitude: Longitude:			32° 9' 58.098 N 103° 31' 10.745 W
Well	#303H									
Well Position	+N/-S +E/-W	0.0 ust 0.0 ust	•			424,293.00 792,246.00		itude: ngitude:		32° 9' 49.901 N 103° 31' 20.951 W
Position Uncertainty Grid Convergence:		0.0 ust 0.43 °	t Wellhea	d Elevatio	on:		usft Gro	ound Level:		3,459.0 usft
Wellbore	ОН									
Magnetics	Model I	Name	Sample Date	•	Declina (°)	ition	-	Angle °)	Field St (n	-
	I	GRF2020	6/2/2	2023		6.29		59.79	47,25	8.19421532
Design	Plan #0.1 R	.Т								
Audit Notes:										
Version:			Phase:	PL	AN	Tie	On Depth:		0.0	
Vertical Section:			From (TVD) (usft)		+N/-S (usft)	(u	:/-W sft)		ection (°)	
			0.0		0.0	0	0.0	18	3.46	
Plan Survey Tool Pro Depth From	ogram Depth To	Date 6/2/	2023							
(usft)	(usft)	Survey (Well	bore)		Tool Name		Remarks			
1 0.0	0.0) Plan #0.1 RT	(ОН)							
Plan Sections										
-		imuth De	tical pth +N sft) (us		+E/-W (usft)	Dogleg Rate (°/100usft)	Build Rate (°/100usft)	Turn Rate (°/100usft)	TFO (°)	Target
0.0	0.00	0.00	0.0	0.0	0.0	0.00	0.00	0.00	0.00	

6/5/2023 10:24:24AM



Database:	PEDM	Local Co-ordinate Reference:	Well #303H
Company:	Midland	TVD Reference:	kb = 26' @ 3485.0usft
Project:	Lea County, NM (NAD 83 NME)	MD Reference:	kb = 26' @ 3485.0usft
Site:	Lacey Swiss 1 Fed Com	North Reference:	Grid
Well:	#303H	Survey Calculation Method:	Minimum Curvature
Wellbore:	OH		
Design:	Plan #0.1 RT		

Planned Survey

Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Vertical Section (usft)	Dogleg Rate (°/100usft)	Build Rate (°/100usft)	Turn Rate (°/100usft)
0.0	0.00	0.00	0.0	0.0	0.0	0.0	0.00	0.00	0.00
100.0		0.00	100.0	0.0	0.0	0.0	0.00	0.00	0.00
200.0		0.00	200.0	0.0	0.0	0.0	0.00	0.00	0.00
300.0		0.00	300.0	0.0	0.0	0.0	0.00	0.00	0.00
400.0		0.00	400.0	0.0	0.0	0.0	0.00	0.00	0.00
500.0		0.00	500.0	0.0	0.0	0.0	0.00	0.00	0.00
600.0		0.00	600.0	0.0	0.0	0.0	0.00	0.00	0.00
			700.0	0.0	0.0		0.00	0.00	0.00
700.0		0.00				0.0			
800.0		0.00	800.0	0.0	0.0 0.0	0.0	0.00	0.00	0.00
900.0		0.00	900.0	0.0		0.0	0.00	0.00	0.00
1,000.0		0.00	1,000.0	0.0	0.0	0.0	0.00	0.00	0.00
1,100.0		0.00	1,100.0	0.0	0.0	0.0	0.00	0.00	0.00
1,200.0		0.00	1,200.0	0.0	0.0	0.0	0.00	0.00	0.00
1,300.0		0.00	1,300.0	0.0	0.0	0.0	0.00	0.00	0.00
1,400.0	0.00	0.00	1,400.0	0.0	0.0	0.0	0.00	0.00	0.00
1,500.0	0.00	0.00	1,500.0	0.0	0.0	0.0	0.00	0.00	0.00
1,600.0		0.00	1,600.0	0.0	0.0	0.0	0.00	0.00	0.00
1,653.0		0.00	1,653.0	0.0	0.0	0.0	0.00	0.00	0.00
1,700.0		327.63	1,700.0	0.3	-0.2	-0.3	2.00	2.00	0.00
1,800.0	0 2.94	327.63	1,799.9	3.2	-2.0	-3.1	2.00	2.00	0.00
1,900.0	0 4.94	327.63	1,899.7	9.0	-5.7	-8.6	2.00	2.00	0.00
2,000.0		327.63	1,999.2	17.7	-11.2	-17.0	2.00	2.00	0.00
2,100.0		327.63	2,098.2	29.4	-18.6	-28.2	2.00	2.00	0.00
2,200.0		327.63	2,196.7	44.0	-27.9	-42.2	2.00	2.00	0.00
2,270.4		327.63	2,265.6	56.0	-35.5	-53.7	2.00	2.00	0.00
2,300.0		327.63	2,294.5	61.3	-38.9	-58.9	0.00	0.00	0.00
2,400.0		327.63	2,392.2	79.4	-50.3	-76.2	0.00	0.00	0.00
2,500.0		327.63 327.63	2,489.9	97.4	-61.8	-93.5 -110.9	0.00	0.00	0.00
2,600.0 2,700.0		327.63	2,587.6 2,685.3	115.5 133.6	-73.2 -84.7	-110.9	0.00 0.00	0.00 0.00	0.00 0.00
-									
2,800.0		327.63	2,783.0	151.6	-96.1	-145.6	0.00	0.00	0.00
2,900.0		327.63	2,880.7	169.7	-107.6	-162.9	0.00	0.00	0.00
3,000.0		327.63	2,978.4	187.7	-119.0	-180.2	0.00	0.00	0.00
3,100.0		327.63	3,076.0	205.8	-130.5	-197.6	0.00	0.00	0.00
3,200.0	0 12.35	327.63	3,173.7	223.9	-141.9	-214.9	0.00	0.00	0.00
3,300.0		327.63	3,271.4	241.9	-153.4	-232.2	0.00	0.00	0.00
3,400.0		327.63	3,369.1	260.0	-164.8	-249.6	0.00	0.00	0.00
3,500.0		327.63	3,466.8	278.1	-176.2	-266.9	0.00	0.00	0.00
3,600.0		327.63	3,564.5	296.1	-187.7	-284.3	0.00	0.00	0.00
3,700.0	0 12.35	327.63	3,662.2	314.2	-199.1	-301.6	0.00	0.00	0.00
3,800.0	0 12.35	327.63	3,759.9	332.2	-210.6	-318.9	0.00	0.00	0.00
3,900.0		327.63	3,857.5	350.3	-222.0	-336.3	0.00	0.00	0.00
4,000.0		327.63	3,955.2	368.4	-233.5	-353.6	0.00	0.00	0.00
4,100.0		327.63	4,052.9	386.4	-244.9	-371.0	0.00	0.00	0.00
4,200.0		327.63	4,150.6	404.5	-256.4	-388.3	0.00	0.00	0.00
4,300.0	0 12.35	327.63	4,248.3	422.5	-267.8	-405.6	0.00	0.00	0.00
4,400.0		327.63	4,346.0	440.6	-279.3	-423.0	0.00	0.00	0.00
4,500.0		327.63	4,443.7	458.7	-290.7	-440.3	0.00	0.00	0.00
4,600.0		327.63	4,541.3	476.7	-302.2	-457.6	0.00	0.00	0.00
4,700.0		327.63	4,639.0	494.8	-313.6	-475.0	0.00	0.00	0.00
4,800.0		327.63	4,736.7	512.8	-325.1	-492.3	0.00	0.00	0.00
4,900.0		327.63	4,834.4	530.9	-336.5	-492.3	0.00	0.00	0.00
5,000.0		327.63	4,932.1	549.0	-348.0	-527.0	0.00	0.00	0.00
5,100.0		327.63	5,029.8	567.0	-359.4	-544.3	0.00	0.00	0.00
0,100.0	12.00	521.00	0,020.0	507.0	000.4	0.77.0	0.00	0.00	0.00

6/5/2023 10:24:24AM

COMPASS 5000.16 Build 100



Planned Survey

	(°)	Azimuth (°)	Depth (usft)	+N/-S (usft)	+E/-W (usft)	Section (usft)	Rate (°/100usft)	Rate (°/100usft)	Rate (°/100usft)
5,200.0	12.35	327.63	5,127.5	585.1	-370.9	-561.7	0.00	0.00	0.00
5,300.0	12.35	327.63	5,225.2	603.2	-382.3	-579.0	0.00	0.00	0.00
5,400.0	12.35	327.63	5,322.8	621.2	-393.8	-596.3	0.00	0.00	0.00
5,500.0	12.35	327.63	5,420.5	639.3	-405.2	-613.7	0.00	0.00	0.00
5,600.0	12.35	327.63	5,518.2	657.3	-416.7	-631.0	0.00	0.00	0.00
5,700.0	12.35	327.63	5,615.9	675.4	-410.7	-648.4	0.00	0.00	0.00
5,800.0	12.35	327.63	5,713.6	693.5	-439.6	-665.7	0.00	0.00	0.00
5,900.0	12.35	327.63	5,811.3	711.5	-451.0	-683.0	0.00	0.00	0.00
6,000.0	12.35	327.63	5,909.0	729.6	-462.5	-700.4	0.00	0.00	0.00
6,100.0	12.35	327.63	6,006.7	747.6	-473.9	-717.7	0.00	0.00	0.00
6,200.0	12.35	327.63	6,104.3	765.7	-485.3	-735.1	0.00	0.00	0.00
6,300.0	12.35	327.63	6,202.0	783.8	-496.8	-752.4	0.00	0.00	0.00
6,400.0	12.35	327.63	6,299.7	801.8	-490.8	-769.7	0.00	0.00	0.00
6,400.0 6,500.0	12.35	327.63	6,299.7 6,397.4	819.9	-506.2 -519.7	-789.7	0.00	0.00	0.00
							0.00		
6,600.0 6 700 0	12.35	327.63	6,495.1 6 502 8	837.9 856.0	-531.1	-804.4 821.7	0.00	0.00	0.00
6,700.0	12.35	327.63	6,592.8	856.0	-542.6	-821.7		0.00	0.00
6,800.0	12.35	327.63	6,690.5	874.1	-554.0	-839.1	0.00	0.00	0.00
6,900.0	12.35	327.63	6,788.1	892.1	-565.5	-856.4	0.00	0.00	0.00
7,000.0	12.35	327.63	6,885.8	910.2	-576.9	-873.8	0.00	0.00	0.00
7,100.0	12.35	327.63	6,983.5	928.3	-588.4	-891.1	0.00	0.00	0.00
7,200.0	12.35	327.63	7,081.2	946.3	-599.8	-908.4	0.00	0.00	0.00
7,276.0	12.35	327.63	7,155.4	960.0	-608.5	-921.6	0.00	0.00	0.00
7,300.0	11.87	327.63	7,178.9	964.3	-611.2	-925.7	2.00	-2.00	0.00
7,300.0	9.87	327.63	7,178.9	980.2	-621.3	-923.7	2.00	-2.00	0.00
7,400.0	7.87	327.63	7,375.9	993.2	-629.6	-941.0	2.00	-2.00	0.00
7,600.0	5.87	327.63	7,475.2	1,003.3	-636.0	-963.2	2.00	-2.00	0.00
7,000.0	5.07			1,005.5					
7,700.0	3.87	327.63	7,574.8	1,010.5	-640.5	-970.0	2.00	-2.00	0.00
7,800.0	1.87	327.63	7,674.7	1,014.7	-643.2	-974.1	2.00	-2.00	0.00
7,893.3	0.00	0.00	7,768.0	1,016.0	-644.0	-975.3	2.00	-2.00	0.00
7,900.0	0.00	0.00	7,774.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
8,000.0	0.00	0.00	7,874.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
8,100.0	0.00	0.00	7,974.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
8,200.0	0.00	0.00	8,074.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
8,300.0	0.00	0.00	8,174.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
8,400.0	0.00	0.00	8,274.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
8,500.0	0.00	0.00	8,374.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
				,					
8,600.0	0.00	0.00	8,474.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
8,700.0	0.00	0.00	8,574.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
8,800.0	0.00	0.00	8,674.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
8,900.0	0.00	0.00	8,774.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
9,000.0	0.00	0.00	8,874.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
9,100.0	0.00	0.00	8,974.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
9,200.0	0.00	0.00	9,074.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
9,300.0	0.00	0.00	9,174.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
9,400.0	0.00	0.00	9,274.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
9,500.0	0.00	0.00	9,374.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
9,600.0	0.00	0.00	9,474.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
9,700.0	0.00	0.00	9,574.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
9,800.0	0.00	0.00	9,674.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
9,900.0	0.00	0.00	9,774.7	1,016.0	-644.0	-975.3	0.00	0.00	0.00
9,977.8	0.00	0.00	9,852.5	1,016.0	-644.0	-975.3	0.00	0.00	0.00
KOP(Lacey	Swiss 1 Fed Cor	n #303H)							
10,000.0	2.66	180.00	9,874.7	1,015.5	-644.0	-974.8	12.00	12.00	0.00

6/5/2023 10:24:24AM

Page 4

COMPASS 5000.16 Build 100



Database:	PEDM	Local Co-ordinate Reference:	Well #303H
Company:	Midland	TVD Reference:	kb = 26' @ 3485.0usft
Project:	Lea County, NM (NAD 83 NME)	MD Reference:	kb = 26' @ 3485.0usft
Site:	Lacey Swiss 1 Fed Com	North Reference:	Grid
Well:	#303H	Survey Calculation Method:	Minimum Curvature
Wellbore:	OH		
Design:	Plan #0.1 RT		

Planned Survey

Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Vertical Section (usft)	Dogleg Rate (°/100usft)	Build Rate (°/100usft)	Turn Rate (°/100usft)
10,025.0	5.66	180.00	9,899.6	1,013.7	-644.0	-973.0	12.00	12.00	0.00
10,050.0	8.66	180.00	9,924.4	1,010.6	-644.0	-969.9	12.00	12.00	0.00
10,075.0	11.66	180.00	9,949.0	1,006.1	-644.0	-965.5	12.00	12.00	0.00
10,100.0	14.66	180.00	9,973.4	1,000.5	-644.0	-959.8	12.00	12.00	0.00
10,125.0	17.66	180.00	9,997.4	993.5	-644.0	-952.9	12.00	12.00	0.00
10,150.0	20.66	180.00	10,021.0	985.3	-644.0	-944.7	12.00	12.00	0.00
10,175.0	23.66	180.00	10,044.1	975.9	-644.0	-935.3	12.00	12.00	0.00
10,198.3	26.46	180.00	10,065.2	966.0	-644.0	-925.4	12.00	12.00	0.00
• •	Swiss 1 Fed Corr								
10,200.0	26.66	180.00	10,066.7	965.2	-644.0	-924.7	12.00	12.00	-0.23
10,225.0	29.66	179.94	10,088.8	953.4	-644.0	-912.9	12.00	12.00	-0.21
10,250.0	32.66	179.90	10,110.2	940.5	-644.0	-900.0	12.00	12.00	-0.17
10,275.0	35.66	179.86	10,130.9	926.5	-643.9	-886.0	12.00	12.00	-0.15
10,300.0	38.66	179.83	10,150.8	911.4	-643.9	-870.9	12.00	12.00	-0.13
10,325.0	41.66	179.80	10,169.9	895.2	-643.9	-854.8	12.00	12.00	-0.11
10,350.0	44.66	179.78	10,188.1	878.1	-643.8	-837.7	12.00	12.00	-0.10
10,375.0	47.66	179.76	10,205.4	860.1	-643.7	-819.7	12.00	12.00	-0.09
10,400.0	50.66	179.74	10,221.8	841.2	-643.6	-800.9	12.00	12.00	-0.08
10,425.0	53.66	179.72	10,237.1	821.4	-643.5	-781.2	12.00	12.00	-0.07
10,450.0	56.66	179.70	10,251.4	800.9	-643.4	-760.7	12.00	12.00	-0.07
10,475.0	59.66	179.69	10,264.6	779.7	-643.3	-739.5	12.00	12.00	-0.06
10,500.0	62.66	179.67	10,276.6	757.8	-643.2	-717.6	12.00	12.00	-0.06
10,525.0	65.66	179.66	10,287.5	735.3	-643.1	-695.2	12.00	12.00	-0.06
10,550.0	68.66	179.64	10,297.2	712.3	-642.9	-672.2	12.00	12.00	-0.05
10,575.0	71.66	179.63	10,305.7	688.7	-642.8	-648.7	12.00	12.00	-0.05
10,600.0	74.66	179.62	10,312.9	664.8	-642.6	-624.9	12.00	12.00	-0.05
10,625.0	77.66	179.61	10,318.9	640.5	-642.5	-600.7	12.00	12.00	-0.05
10,650.0	80.66	179.59	10,323.6	616.0	-642.3	-576.2	12.00	12.00	-0.05
10,675.0	83.66	179.58	10,327.0	591.2	-642.1	-551.5	12.00	12.00	-0.05
10,700.0	86.66	179.57	10,329.1	566.3	-641.9	-526.6	12.00	12.00	-0.05
10,725.0	89.66	179.56	10,329.9	541.3	-641.7	-501.7	12.00	12.00	-0.05
10,727.8	90.00	179.56	10,329.9	538.5	-641.7	-498.9	12.00	12.00	-0.05
10,800.0	90.00	179.56	10,329.9	466.3	-641.2	-426.8	0.00	0.00	0.00
10,900.0	90.00	179.56	10,329.9	366.3	-640.4	-327.1	0.00	0.00	0.00
11,000.0	90.00	179.56	10,329.9	266.4	-639.6	-227.3	0.00	0.00	0.00
11,100.0	90.00	179.56	10,330.0	166.4	-638.8	-127.5	0.00	0.00	0.00
11,200.0	90.00	179.56	10,330.0	66.4	-638.1	-27.8	0.00	0.00	0.00
11,300.0	90.00	179.56	10,330.0	-33.6	-637.3	72.0	0.00	0.00	0.00
11,400.0	90.00	179.56	10,330.0	-133.6	-636.5	171.8	0.00	0.00	0.00
11,500.0	90.00	179.56	10,330.0	-233.6	-635.7	271.5	0.00	0.00	0.00
11,600.0	90.00	179.56	10,330.0	-333.6	-635.0	371.3	0.00	0.00	0.00
11,700.0	90.00	179.56	10,330.0	-433.6	-634.2	471.1	0.00	0.00	0.00
11,800.0	90.00	179.56	10,330.0	-533.6	-633.4	570.8	0.00	0.00	0.00
11,900.0	90.00	179.56	10,330.0	-633.6	-632.7	670.6	0.00	0.00	0.00
12,000.0	90.00	179.56	10,330.0	-733.6	-631.9	770.4	0.00	0.00	0.00
12,100.0	90.00	179.56	10,330.0	-833.6	-631.1	870.1	0.00	0.00	0.00
12,200.0	90.00	179.56	10,330.0	-933.6	-630.3	969.9	0.00	0.00	0.00
12,300.0	90.00	179.56	10,330.0	-1,033.6	-629.6	1,069.7	0.00	0.00	0.00
12,400.0	90.00	179.56	10,330.0	-1,133.6	-628.8	1,169.4	0.00	0.00	0.00
12,500.0	90.00	179.56	10,330.0	-1,233.6	-628.0	1,269.2	0.00	0.00	0.00
12,600.0	90.00	179.56	10,330.0	-1,333.6	-627.2	1,369.0	0.00	0.00	0.00
12,700.0	90.00	179.56	10,330.0	-1,433.6	-626.5	1,468.8	0.00	0.00	0.00
12,800.0	90.00	179.56	10,330.0	-1,533.6	-625.7	1,568.5	0.00	0.00	0.00
12,900.0	90.00	179.56	10,330.0	-1,633.6	-624.9	1,668.3	0.00	0.00	0.00

6/5/2023 10:24:24AM

Page 5

COMPASS 5000.16 Build 100

.



Plan #0.1 RT

Planning Report

Planned Survey

Design:

Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Vertical Section (usft)	Dogleg Rate (°/100usft)	Build Rate (°/100usft)	Turn Rate (°/100usft)
13,000.0	90.00	179.56	10,330.0	-1,733.6	-624.2	1,768.1	0.00	0.00	0.00
13,100.0	90.00	179.56	10,330.0	-1,833.6	-623.4	1,867.8	0.00	0.00	0.00
13,200.0	90.00	179.56	10,330.0	-1,933.6	-622.6	1,967.6	0.00	0.00	0.00
13,300.0	90.00	179.56	10,330.0	-2,033.6	-621.8	2,067.4	0.00	0.00	0.00
13,400.0	90.00	179.56	10,330.0	-2,133.6	-621.1	2,167.1	0.00	0.00	0.00
13,500.0	90.00	179.56	10,330.0	-2,233.6	-620.3	2,266.9	0.00	0.00	0.00
13,600.0	90.00	179.56	10,330.0	-2,333.6	-619.5	2,366.7	0.00	0.00	0.00
13,700.0	90.00	179.56	10,330.0	-2,433.6	-618.7	2,466.4	0.00	0.00	0.00
13,800.0	90.00	179.56	10,330.0	-2,533.6	-618.0	2,566.2	0.00	0.00	0.00
13,900.0	90.00	179.56	10,330.0	-2,633.6	-617.2	2,666.0	0.00	0.00	0.00
14,000.0	90.00	179.56	10,330.0	-2,733.6	-616.4	2,765.7	0.00	0.00	0.00
14,100.0	90.00	179.56	10,330.0	-2,833.6	-615.6	2,865.5	0.00	0.00	0.00
14,200.0	90.00	179.56	10,330.0	-2,933.6	-614.9	2,965.3	0.00	0.00	0.00
14,300.0	90.00	179.56	10,330.0	-3,033.6	-614.1	3,065.1	0.00	0.00	0.00
14,400.0	90.00	179.56	10,330.0	-3,133.5	-613.3	3,164.8	0.00	0.00	0.00
14,500.0	90.00	179.56	10,330.0	-3,233.5	-612.6	3,264.6	0.00	0.00	0.00
14,600.0	90.00	179.56	10,330.0	-3,333.5	-611.8	3,364.4	0.00	0.00	0.00
14,700.0	90.00	179.56	10,330.0	-3,433.5	-611.0	3,464.1	0.00	0.00	0.00
14,800.0	90.00	179.56	10,330.0	-3,533.5	-610.2	3,563.9	0.00	0.00	0.00
14,900.0	90.00	179.56	10,330.0	-3,633.5	-609.5	3,663.7	0.00	0.00	0.00
15,000.0	90.00	179.56	10,330.0	-3,733.5	-608.7	3,763.4	0.00	0.00	0.00
15,100.0	90.00	179.56	10,330.0	-3,833.5	-607.9	3,863.2	0.00	0.00	0.00
15,200.0	90.00	179.56	10,330.0	-3,933.5	-607.1	3,963.0	0.00	0.00	0.00
15,300.0	90.00	179.56	10,330.0	-4,033.5	-606.4	4,062.7	0.00	0.00	0.00
15,400.0	90.00	179.56	10,330.0	-4,133.5	-605.6	4,162.5	0.00	0.00	0.00
15,477.5	90.00	179.56	10,330.0	-4,211.0	-605.0	4,239.8	0.00	0.00	0.00
Fed Perf 1(L	acey Swiss 1 Fe	d Com #303H)							
15,500.0	90.00	179.56	10,330.0	-4,233.5	-604.8	4,262.3	0.00	0.00	0.00
15,600.0	90.00	179.56	10,330.0	-4,333.5	-604.1	4,362.0	0.00	0.00	0.00
15,700.0	90.00	179.56	10,330.0	-4,433.5	-603.3	4,461.8	0.00	0.00	0.00
15,800.0	90.00	179.56	10,330.0	-4,533.5	-602.5	4,561.6	0.00	0.00	0.00
15,900.0	90.00	179.56	10,330.0	-4,633.5	-601.7	4,661.3	0.00	0.00	0.00
16,000.0	90.00	179.56	10,330.0	-4,733.5	-601.0	4,761.1	0.00	0.00	0.00
16,100.0	90.00	179.56	10,330.0	-4,833.5	-600.2	4,860.9	0.00	0.00	0.00
16,200.0	90.00	179.56	10,330.0	-4,933.5	-599.5	4,960.7	0.00	0.00	0.00
16,300.0	90.00	179.56	10,330.0	-5,033.5	-598.7	5,060.4	0.00	0.00	0.00
16,400.0	90.00	179.57	10,330.0	-5,133.5	-597.9	5,160.2	0.00	0.00	0.00
16,500.0	90.00	179.57	10,330.0	-5,233.5	-597.2	5,260.0	0.00	0.00	0.00
16,600.0	90.00	179.57	10,330.0	-5,333.5	-596.4	5,359.7	0.00	0.00	0.00
16,700.0	90.00	179.57	10,330.0	-5,433.5	-595.7	5,459.5	0.00	0.00	0.00
16,800.0	90.00	179.57	10,330.0	-5,533.5	-594.9	5,559.3	0.00	0.00	0.00
16,900.0	90.00	179.57	10,330.0	-5,633.5	-594.2	5,659.0	0.00	0.00	0.00
17,000.0	90.00	179.57	10,330.0	-5,733.5	-593.4	5,758.8	0.00	0.00	0.00
17,100.0	90.00	179.57	10,330.0	-5,833.5	-592.7	5,858.6	0.00	0.00	0.00
17,200.0	90.00	179.57	10,330.0	-5,933.5	-591.9	5,958.4	0.00	0.00	0.00
17,300.0	90.00	179.57	10,330.0	-6,033.5	-591.2	6,058.1	0.00	0.00	0.00
17,400.0	90.00	179.57	10,330.0	-6,133.5	-590.4	6,157.9	0.00	0.00	0.00
17,500.0	90.00	179.57	10,330.0	-6,233.5	-589.7	6,257.7	0.00	0.00	0.00
17,600.0	90.00	179.58	10,330.0	-6,333.5	-588.9	6,357.4	0.00	0.00	0.00
17,700.0	90.00	179.58	10,330.0	-6,433.5	-588.2	6,457.2	0.00	0.00	0.00
17,800.0	90.00	179.58	10,330.0	-6,533.4	-587.5	6,557.0	0.00	0.00	0.00
17,900.0	90.00	179.58	10,330.0	-6,633.4	-586.7	6,656.8	0.00	0.00	0.00
18.000.0	90.00	179.58	10,330.0	-6,733.4	-586.0	6,756.5	0.00	0.00	0.00

Released to Imaging: 9/2/2024 10:10:13 AM



Database:	PEDM	Local Co-ordinate Reference:	Well #303H
Company:	Midland	TVD Reference:	kb = 26' @ 3485.0usft
Project:	Lea County, NM (NAD 83 NME)	MD Reference:	kb = 26' @ 3485.0usft
Site:	Lacey Swiss 1 Fed Com	North Reference:	Grid
Well:	#303H	Survey Calculation Method:	Minimum Curvature
Wellbore: Design:	OH Plan #0.1 RT		

Planned Survey

Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Vertical Section (usft)	Dogleg Rate (°/100usft)	Build Rate (°/100usft)	Turn Rate (°/100usft)
18,100.0	90.00	179.58	10,330.0	-6,833.4	-585.2	6,856.3	0.00	0.00	0.00
18,200.0	90.00	179.58	10,330.0	-6,933.4	-584.5	6,956.1	0.00	0.00	0.00
18,300.0	90.00	179.58	10,330.0	-7,033.4	-583.8	7,055.8	0.00	0.00	0.00
18,400.0	90.00	179.58	10,330.0	-7,133.4	-583.1	7,155.6	0.00	0.00	0.00
18,500.0	90.00	179.58	10,330.0	-7,233.4	-582.3	7,255.4	0.00	0.00	0.00
18,600.0	90.00	179.58	10,330.0	-7,333.4	-581.6	7,355.2	0.00	0.00	0.00
18,700.0	90.00	179.59	10,330.0	-7,433.4	-580.9	7,454.9	0.00	0.00	0.00
18,800.0	90.00	179.59	10,330.0	-7,533.4	-580.2	7,554.7	0.00	0.00	0.00
18,900.0	90.00	179.59	10,330.0	-7,633.4	-579.4	7,654.5	0.00	0.00	0.00
19,000.0	90.00	179.59	10,330.0	-7,733.4	-578.7	7,754.2	0.00	0.00	0.00
19,100.0	90.00	179.59	10,330.0	-7,833.4	-578.0	7,854.0	0.00	0.00	0.00
19,200.0	90.00	179.59	10,330.0	-7,933.4	-577.3	7,953.8	0.00	0.00	0.00
19,300.0	90.00	179.59	10,330.0	-8,033.4	-576.6	8,053.6	0.00	0.00	0.00
19,400.0	90.00	179.59	10,330.0	-8,133.4	-575.8	8,153.3	0.00	0.00	0.00
19,500.0	90.00	179.59	10,330.0	-8,233.4	-575.1	8,253.1	0.00	0.00	0.00
19,600.0	90.00	179.59	10,330.0	-8,333.4	-574.4	8,352.9	0.00	0.00	0.00
19,700.0	90.00	179.59	10,330.0	-8,433.4	-573.7	8,452.6	0.00	0.00	0.00
19,800.0	90.00	179.59	10,330.0	-8,533.4	-573.0	8,552.4	0.00	0.00	0.00
19,900.0	90.00	179.60	10,330.0	-8,633.4	-572.3	8,652.2	0.00	0.00	0.00
20,000.0	90.00	179.60	10,330.0	-8,733.4	-571.6	8,752.0	0.00	0.00	0.00
20,100.0	90.00	179.60	10,330.0	-8,833.4	-570.9	8,851.7	0.00	0.00	0.00
20,200.0	90.00	179.60	10,330.0	-8,933.4	-570.2	8,951.5	0.00	0.00	0.00
20,300.0	90.00	179.60	10,330.0	-9,033.4	-569.5	9,051.3	0.00	0.00	0.00
20,400.0	90.00	179.60	10,330.0	-9,133.4	-568.8	9,151.1	0.00	0.00	0.00
20,500.0	90.00	179.60	10,330.0	-9,233.4	-568.1	9,250.8	0.00	0.00	0.00
20,600.0	90.00	179.60	10,330.0	-9,333.4	-567.4	9,350.6	0.00	0.00	0.00
20,655.6	90.00	179.60	10,330.0	-9,389.0	-567.0	9,406.1	0.00	0.00	0.00
PBHI (Lacov	Swiss 1 Fed Co	m #303H)							

Design Targets

Target Name - hit/miss target - Shape	Dip Angle (°)	Dip Dir. (°)	TVD (usft)	+N/-S (usft)	+E/-W (usft)	Northing (usft)	Easting (usft)	Latitude	Longitude
KOP(Lacey Swiss 1 Fed - plan hits target cento - Point	0.00 er	0.00	9,852.5	1,016.0	-644.0	425,309.00	791,602.00	32° 10' 0.002 N	103° 31' 28.354 W
FTP(Lacey Swiss 1 Fed - plan hits target cente - Point	0.00 er	0.00	10,065.2	966.0	-644.0	425,259.00	791,602.00	32° 9' 59.508 N	103° 31' 28.358 W
PBHL(Lacey Swiss 1 Fe - plan hits target cente - Point	0.00 er	0.00	10,330.0	-9,389.0	-567.0	414,904.00	791,679.00	32° 8' 17.037 N	103° 31' 28.367 W
Fed Perf 1(Lacey Swiss - plan hits target cente - Point	0.00 er	0.00	10,330.0	-4,211.0	-605.0	420,082.00	791,641.00	32° 9' 8.277 N	103° 31' 28.357 W

6/5/2023 10:24:24AM

PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

OPERATOR'S NAME:	EOG RESOURCES INC.
WELL NAME & NO.:	LACEY SWISS 1 FED COM 303H
SURFACE HOLE FOOTAGE:	1070'/N & 1542'/E
BOTTOM HOLE FOOTAGE	100'/S & 2178'/E
LOCATION:	Section 1, T.25 S., R.33 E.
COUNTY:	Lea County, New Mexico

COA

H2S	• Yes	O No		
Potash	• None	© Secretary	© R-111-P	
Cave/Karst Potential	• Low	O Medium	O High	
Cave/Karst Potential	Critical			
Variance	○ None	• Flex Hose	O Other	
Wellhead	Conventional	• Multibowl	O Both	
Wellhead Variance	O Diverter			
Other	□4 String	Capitan Reef	WIPP	
Other	□ Fluid Filled	🗆 Pilot Hole	□ Open Annulus	
Cementing	□ Contingency	EchoMeter	Primary Cement	
	Cement Squeeze		Squeeze	
Special Requirements	🗆 Water Disposal	COM	🗆 Unit	
Special Requirements	□ Batch Sundry			
Special Requirements	ll Requirements 🗹 Break Testing		Casing	
Variance		Cementing	Clearance	

A. HYDROGEN SULFIDE

A Hydrogen Sulfide (H2S) Drilling Plan shall be activated AT SPUD. As a result, the Hydrogen Sulfide area must meet Onshore Order 6 requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, please provide measured values and formations to the BLM.

B. CASING

Primary Casing Design:

1. The **13-3/8** inch surface casing shall be set at approximately **1,300** feet (a minimum of 25 feet (Lea County) into the Rustler Anhydrite, above the salt, and below usable fresh water) and cemented to the surface.

- a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
- b. Wait on cement (WOC) time for a primary cement job will be a minimum of <u>8</u> <u>hours</u> or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
- c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
- d. If cement falls back, remedial cementing will be done prior to drilling out that string.
- The 9-5/8 inch intermediate casing shall be set at approximately 5,040 feet TVD. CASING TO BE KEPT AT LEAST HALF FULL DURING RUN FOR COLLAPSE SF. The minimum required fill of cement behind the 9-5/8 inch intermediate casing is:

Option 1 (Single Stage):

• Cement to surface. If cement does not circulate see B.1.a, c-d above.

Option 2:

Operator has proposed to cement in two stages by conventionally cementing the first stage and performing a bradenhead squeeze on the second stage, contingent upon no returns to surface.

- a. First stage: Operator will cement with intent to reach the top of the **Brushy** Canyon
- b. Second stage:
 - Operator will perform bradenhead squeeze and top-out. Cement to surface. If cement does not reach surface, the appropriate BLM office shall be notified.

Operator has proposed to pump down 13-3/8" X 9-5/8" annulus. <u>Operator must top</u> <u>out cement after the bradenhead squeeze and verify cement to surface. Operator</u> <u>can also check TOC with Echo-meter. CBL must be run from TD of the 9-5/8"</u> <u>casing to surface if confidence is lacking on the quality of the bradenhead squeeze</u> <u>cement job. Submit results to BLM.</u> If cement does not tie-back into the previous casing shoe, a third stage remediation BH may be performed. The appropriate BLM office shall be notified.

Bradenhead squeeze in the production interval is only as an edge case remediation measure and is NOT approved in this COA. If production cement job experiences losses and a bradenhead squeeze is needed for tie-back, BLM Engineering should be notified prior to job with volumes and planned wellbore schematic. CBL will be needed when this occurs.

3. The **5-1**/2 inch production casing shall be set at approximately **20,676** feet The minimum required fill of cement behind the **5-1**/2 inch production casing is:

Option 1 (Single Stage):

• Cement should tie-back at least **200 feet** into previous casing string. Operator shall provide method of verification.

Alternate Casing Design:

- 1. The **10-3/4** inch surface casing shall be set at approximately **1,300** feet (a minimum of 25 feet (Lea County) into the Rustler Anhydrite, above the salt, and below usable fresh water) and cemented to the surface.
 - e. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
 - f. Wait on cement (WOC) time for a primary cement job will be a minimum of <u>8</u> <u>hours</u> or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
 - g. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
 - h. If cement falls back, remedial cementing will be done prior to drilling out that string.
- The 8-5/8 inch intermediate casing shall be set at approximately 5,040 feet TVD. CASING TO BE KEPT AT LEAST HALF FULL DURING RUN FOR COLLAPSE SF. The minimum required fill of cement behind the 8-5/8 inch intermediate casing is:

Option 1 (Single Stage):

• Cement to surface. If cement does not circulate see B.1.a, c-d above.

Option 2:

Operator has proposed to cement in two stages by conventionally cementing the first stage and performing a bradenhead squeeze on the second stage, contingent upon no returns to surface.

- c. First stage: Operator will cement with intent to reach the top of the **Brushy** Canyon
- d. Second stage:
 - Operator will perform bradenhead squeeze and top-out. Cement to surface. If cement does not reach surface, the appropriate BLM office shall be notified.

Operator has proposed to pump down 10-3/4" X 8-5/8" annulus. <u>Operator must top</u> <u>out cement after the bradenhead squeeze and verify cement to surface. Operator</u> <u>can also check TOC with Echo-meter. CBL must be run from TD of the 8-5/8"</u> <u>casing to surface if confidence is lacking on the quality of the bradenhead squeeze</u> <u>cement job. Submit results to BLM.</u>

If cement does not tie-back into the previous casing shoe, a third stage remediation BH may be performed. The appropriate BLM office shall be notified.

Bradenhead squeeze in the production interval is only as an edge case remediation measure and is NOT approved in this COA. If production cement job experiences losses and a bradenhead squeeze is needed for tie-back, BLM Engineering should be notified prior to job with volumes and planned wellbore schematic. CBL will be needed when this occurs.

3. The **5-1**/2 inch production casing shall be set at approximately **20,676** feet The minimum required fill of cement behind the **5-1**/2 inch production casing is:

Option 1 (Single Stage):

• Cement should tie-back at least **200 feet** into previous casing string. Operator shall provide method of verification.

C. PRESSURE CONTROL

- 1. Variance approved to use flex line from BOP to choke manifold. Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).'
- Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi. Variance is approved to use a 5000 (5M) Annular which shall be tested to 3500 (70% Working Pressure) psi.
 - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
 - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
 - c. Manufacturer representative shall install the test plug for the initial BOP test.
 - d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
 - e. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.

D. SPECIAL REQUIREMENT (S)

Communitization Agreement

- The operator will submit a Communitization Agreement to the Santa Fe Office, 301 Dinosaur Trail Santa Fe, New Mexico 87508, at least 90 days before the anticipated date of first production from a well subject to a spacing order issued by the New Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.
- The operator will submit an as-drilled survey well plat of the well completion, but are not limited to, those specified in Onshore Order 1 and 43 CFR part 3170 Subpart 3172.
- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. <u>When the Communitization Agreement number is known, it shall also be on the sign.</u>

(Note: For a minimum 5M BOPE or less (Utilizing a 10M BOPE system) BOPE Break Testing Variance

• BOPE Break Testing is ONLY permitted for 5M BOPE or less. (Annular preventer

must be tested to a minimum of 70% of BOPE working pressure and shall be higher than the MASP)

- BOPE Break Testing is NOT permitted to drilling the production hole section.
- Variance only pertains to the intermediate hole-sections and no deeper than the Bone Springs formation.
- While in transfer between wells, the BOPE shall be secured by the hydraulic carrier or cradle.
- Any well control event while drilling require notification to the BLM Petroleum Engineer (**575-706-2779**) prior to the commencement of any BOPE Break Testing operations.
- A full BOPE test is required prior to drilling the first deep intermediate hole section. If any subsequent hole interval is deeper than the first, a full BOPE test will be required. (200' TVD tolerance between intermediate shoes is allowable).
- The BLM is to be contacted (575-689-5981 Lea County) 4 hours prior to BOPE tests.
- As a minimum, a full BOPE test shall be performed at 21-day intervals.
- In the event any repairs or replacement of the BOPE is required, the BOPE shall test as per 43 CFR part 3170 Subpart 3172.
- If in the event break testing is not utilized, then a full BOPE test would be conducted.

Offline Cementing

Operator has been (**Approved**) to pump the proposed cement program offline in the **Surface and intermediate(s) intervals**.

Offline cementing should commence within 24 hours of landing the casing for the interval.

Notify the BLM 4hrs prior to cementing offline at Lea County: 575-689-5981.

Casing Clearance:

- Salt washout annular variance in place.
- Overlap clearance OK for production interval.

Operator shall clean up cycles until wellbore is clear of cuttings and any large debris, ensure cutting sizes are adequate "coffee ground or less" before cementing.

GENERAL REQUIREMENTS

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)
 - If well located in Eddy County

Page 6 of 11

EMAIL or call the Carlsbad Field Office, 620 East Greene St., Carlsbad, NM 88220,

BLM_NM_CFO_DrillingNotifications@BLM.GOV (575) 361-2822

- If well located in Lea County Call the Hobbs Field Station, 414 West Taylor, Hobbs NM 88240, (575) 689-5981
- 1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
 - a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).
 - b. When the operator proposes to set surface casing with Spudder Rig
 - Notify the BLM when moving in and removing the Spudder Rig.
 - Notify the BLM when moving in the 2nd Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
 - BOP/BOPE test to be conducted per **43 CFR part 3170 Subpart 3172** as soon as 2nd Rig is rigged up on well.
- 2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.
- 3. The record of the drilling rate along with the GR/N well log run from TD to surface (horizontal well vertical portion of hole) shall be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies. The Rustler top and top and bottom of Salt are to be recorded on the Completion Report.

A. CASING

1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or

if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.

- <u>Wait on cement (WOC) for Potash Areas:</u> After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends, 2) until cement has been in place at least <u>24 hours</u>. WOC time will be recorded in the driller's log. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 3. <u>Wait on cement (WOC) for Water Basin:</u> After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least <u>8 hours</u>. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing integrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 4. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.
- 5. No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.
- 6. On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.
- 7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.
- 8. Whenever a casing string is cemented in the R-111-P potash area, the NMOCD requirements shall be followed.
- B. PRESSURE CONTROL
- All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in 43 CFR part 3170 Subpart 3172 and API STD 53 Sec. 5.3.

- 2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.
- 3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.
- 4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:
 - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
 - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
 - c. Manufacturer representative shall install the test plug for the initial BOP test.
 - d. Whenever any seal subject to test pressure is broken, all the tests in 43
 CFR part 3170 Subpart 3172 must be followed.
 - e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
 - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead cement), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
 - b. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been

done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the cement plug. The BOPE test can be initiated after bumping the cement plug with the casing valve open. (only applies to single stage cement jobs, prior to the cement setting up.)

- c. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer and can be initiated immediately with the casing valve open. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to 43 CFR part 3170 Subpart 3172 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for water basin (8 hours) or potash (24 hours) or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
- d. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.
- e. The results of the test shall be reported to the appropriate BLM office.
- f. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- g. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- h. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per 43 CFR part 3170 Subpart 3172.

C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.

KPI 2/22/2024

10,000 PSI BOP Annular Variance Request (EOG Variance 1c)

EOG Resources request a variance to use a 5000 psi annular BOP with a 10,000 psi BOP stack. The component and compatibility tables along with the general well control plans demonstrate how the 5000 psi annular BOP will be protected from pressures that exceed its rated working pressure (RWP). The pressure at which the control of the wellbore is transferred from the annular preventer to another available preventer will not exceed 3500 psi (70% of the RWP of the 5000 psi annular BOP).


1. Component and Preventer Compatibility Tables

The tables below outlines the tubulars and the compatible preventers in use. This table, combined with the drilling fluid, documents that two barriers to flow will be maintained at all times.

12-1/4" Intermediate Hole Section 10M psi requirement								
Component	OD	Primary Preventer	RWP	Alternate Preventer(s)	RWP			
Drillpipe	5.000" or	Annular	5M	Upper 3.5 - 5.5" VBR	10M			
	4.500"			Lower 3.5 - 5.5" VBR	10M			
HWDP	5.000" or	Annular	5M	Upper 3.5 - 5.5" VBR	10M			
	4.500"			Lower 3.5 - 5.5" VBR	10M			
Jars	6.500″	Annular	5M	Upper 3.5 - 5.5" VBR	10M			
				Lower 3.5 - 5.5" VBR	10M			
DCs and MWD tools	6.500" - 8.000"	Annular	5M	-	-			
Mud Motor	8.000" – 9.625"	Annular	5M	-	-			
1 st Intermediate casing	9.625"	Annular	5M	-	-			
Open-hole	-	Blind Rams	10M	-	-			

8-3/4" Production Hole Section 10M psi requirement							
Component	OD	Primary Preventer	RWP	Alternate Preventer(s)	RWP		
Drillpipe	5.000" or	Annular	5M	Upper 3.5 - 5.5" VBR	10M		
	4.500"			Lower 3.5 - 5.5" VBR	10M		
HWDP	5.000" or	Annular	5M	Upper 3.5 - 5.5" VBR	10M		
	4.500"			Lower 3.5 - 5.5" VBR	10M		
Jars	6.500"	Annular	5M	Upper 3.5 - 5.5" VBR	10M		
				Lower 3.5 - 5.5" VBR	10M		
DCs and MWD tools	6.500" - 8.000"	Annular	5M	-	-		
Mud Motor	6.750" – 8.000"	Annular	5M	-	-		
2 nd Intermediate casing	7.625″	Annular	5M	-	-		
Open-hole	-	Blind Rams	10M	-	-		

VBR = Variable Bore Ram

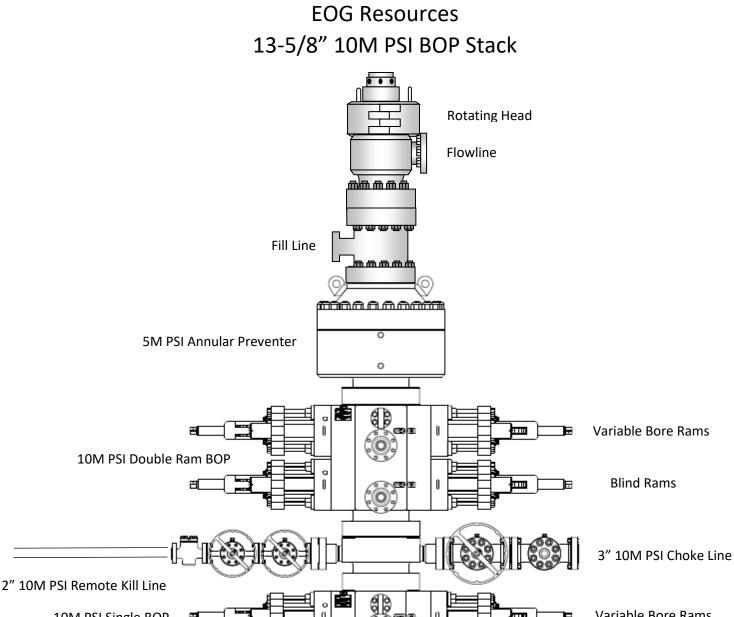

Variable Bore Rams

111

13-5/8" 10M PSI Multi-Bowl Wellhead

10M PSI Single BOP

2. Well Control Procedures

Below are the minimal high-level tasks prescribed to assure a proper shut-in while drilling, tripping, running casing, pipe out of the hole (open hole), and moving the BHA through the BOPs. At least one well control drill will be performed weekly per crew to demonstrate compliance with the procedure and well control plan. The well control drill will be recorded in the daily drilling log. The type of drill will be determined by the ongoing operations, but reasonable attempts will be made to vary the type of drill conducted (pit, trip, open hole, choke, etc.). This well control plan will be available for review by rig personnel in the EOG Resources drilling supervisor's office on location, and on the rig floor. All BOP equipment will be tested as per Onshore O&G Order No. 2 with the exception of the 5000 psi annular which will be tested to 100% of its RWP.

General Procedure While Drilling

- 1. Sound alarm (alert crew)
- 2. Space out drill string
- 3. Shut down pumps (stop pumps and rotary)
- 4. Shut-in Well (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
 - a. SIDPP and SICP
 - b. Pit gain
 - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach 70% or greater of the RWP of the annular preventer, confirm spacing and close the upper variable bore rams.

General Procedure While Tripping

- 1. Sound alarm (alert crew)
- 2. Stab full opening safety valve and close
- 3. Space out drill string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
 - a. SIDPP and SICP
 - b. Pit gain
 - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach 70% or greater of the RWP of the annular preventer, confirm spacing and close the upper variable bore rams.

General Procedure While Running Production Casing

- 1. Sound alarm (alert crew)
- 2. Stab crossover and full opening safety valve and close
- 3. Space out string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
 - a. SIDPP and SICP
 - b. Pit gain
 - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach 70% or greater of the RWP of the annular preventer, confirm spacing and close the upper variable bore rams.

General Procedure With No Pipe In Hole (Open Hole)

- 1. Sound alarm (alert crew)
- 2. Shut-in with blind rams. (HCR and choke will already be in the closed position.)
- 3. Confirm shut-in
- 4. Notify toolpusher/company representative
- 5. Read and record the following:
 - a. SICP
 - b. Pit gain
 - c. Time
- 6. Regroup and identify forward plan

General Procedures While Pulling BHA thru Stack

- 1. PRIOR to pulling last joint of drillpipe thru the stack.
 - a. Perform flowcheck, if flowing:
 - b. Sound alarm (alert crew)
 - c. Stab full opening safety valve and close
 - d. Space out drill string with tool joint just beneath the upper variable bore rams.
 - e. Shut-in using upper variable bore rams. (HCR and choke will already be in the closed position.)
 - f. Confirm shut-in
 - g. Notify toolpusher/company representative
 - h. Read and record the following:
 - i. SIDPP and SICP
 - ii. Pit gain
 - iii. Time
 - i. Regroup and identify forward plan

- 2. With BHA in the stack and compatible ram preventer and pipe combo immediately available.
 - a. Sound alarm (alert crew)
 - b. Stab crossover and full opening safety valve and close
 - c. Space out drill string with upset just beneath the upper variable bore rams.
 - d. Shut-in using upper variable bore rams. (HCR and choke will already be in the closed position.)
 - e. Confirm shut-in
 - f. Notify toolpusher/company representative
 - g. Read and record the following:
 - i. SIDPP and SICP
 - ii. Pit gain
 - iii. Time
 - h. Regroup and identify forward plan
- 3. With BHA in the stack and NO compatible ram preventer and pipe combo immediately available.
 - a. Sound alarm (alert crew)
 - b. If possible to pick up high enough, pull string clear of the stack and follow "Open Hole" scenario.
 - c. If impossible to pick up high enough to pull the string clear of the stack:
 - d. Stab crossover, make up one joint/stand of drillpipe, and full opening safety valve and close
 - e. Space out drill string with tooljoint just beneath the upper variable bore ram.
 - f. Shut-in using upper variable bore ram. (HCR and choke will already be in the closed position.)
 - g. Confirm shut-in
 - h. Notify toolpusher/company representative
 - i. Read and record the following:
 - i. SIDPP and SICP
 - ii. Pit gain
 - iii. Time
 - j. Regroup and identify forward plan

Seog resources Offline Intermediate Cementing Procedure

Cement Program

1. No changes to the cement program will take place for offline cementing.

Summarized Operational Procedure for Intermediate Casing

- 1. Run casing as per normal operations. While running casing, conduct negative pressure test and confirm integrity of the float equipment back pressure valves.
 - a. Float equipment is equipped with two back pressure valves rated to a minimum of 5,000 psi.
- 2. Land production casing on mandrel hanger through BOP.
 - a. If casing is unable to be landed with a mandrel hanger, then the **casing will be cemented online**.
- 3. Break circulation and confirm no restrictions.
 - a. Ensure no blockage of float equipment and appropriate annular returns.
 - b. Perform flow check to confirm well is static.
- 4. Set pack-off
 - a. If utilizing a fluted/ported mandrel hanger, ensure well is static on the annulus and inside the casing by filling the pipe with kill weight fluid, remove landing joint, and set annular packoff through BOP. Pressure test to 5,000 psi for 10 min.
 - b. If utilizing a solid mandrel hanger, ensure well is static on the annulus and inside the casing by filling the pipe with kill weight fluid. Pressure test seals to 5,000 psi for 10 min. Remove landing joint through BOP.
- 5. After confirmation of both annular barriers and the two casing barriers, install TA plug and pressure test to 5,000 psi for 10 min. Notify the BLM with intent to proceed with nipple down and offline cementing.
 - a. Minimum 4 hrs notice.
- 6. With the well secured and BLM notified, nipple down BOP and secure on hydraulic carrier or cradle.
 - a. Note, if any of the barriers fail to test, the BOP stack will not be nippled down until after the cement job has concluded and both lead and tail slurry have reached 500 psi.
- 7. Skid/Walk rig off current well.
- 8. Confirm well is static before removing TA Plug.
 - a. Cementing operations will not proceed until well is under control. (If well is not static, notify BLM and proceed to kill)
 - b. Casing outlet valves will provide access to both the casing ID and annulus. Rig or third party pump truck will kill well prior to cementing.
 - c. Well control plan can be seen in Section B, Well Control Procedures.
 - d. If need be, rig can be moved back over well and BOP nippled back up for any further remediation.

Page | 1

Page 49 of 87

Seog resources

Offline Intermediate Cementing Procedure

- e. Diagram for rig positioning relative to offline cementing can be seen in Figure 4.
- 9. Rig up return lines to take returns from wellhead to pits and rig choke.
 - a. Test all connections and lines from wellhead to choke manifold to 5,000 psi high for 10 min.
 - b. If either test fails, perform corrections and retest before proceeding.
 - c. Return line schematics can be seen in Figure 3.
- 10. Remove TA Plug from the casing.
- 11. Install offline cement tool.
 - a. Current offline cement tool schematics can be seen in Figure 1 (Cameron) and Figure 2 (Cactus).
- 12. Rig up cement head and cementing lines.
 - a. Pressure test cement lines against cement head to 80% of casing burst for 10 min.
- 13. Break circulation on well to confirm no restrictions.
 - a. If gas is present on circulation, well will be shut in and returns rerouted through gas buster.
 - b. Max anticipated time before circulating with cement truck is 6 hrs.
- 14. Pump cement job as per plan.
 - a. At plug bump, test casing to 0.22 psi/ft or 1500 psi, whichever is greater.
 - b. If plug does not bump on calculated, shut down and wait 8 hrs or 500 psi compressive strength, whichever is greater before testing casing.
- 15. Confirm well is static and floats are holding after cement job.
 - a. With floats holding and backside static:
 - i. Remove cement head.
 - b. If floats are leaking:
 - i. Shut-in well and WOC (Wait on Cement) until tail slurry reaches 500 psi compressive strength and the casing is static prior to removing cement head.
 - c. If there is flow on the backside:
 - i. Shut in well and WOC until tail slurry reaches 500 psi compressive strength. Ensure that the casing is static prior to removing cement head.
- 16. Remove offline cement tool.
- 17. Install night cap with pressure gauge for monitoring.
- 18. Test night cap to 5,000 psi for 10 min.

Example Well Control Plan Content

A. Well Control Component Table

The table below, which covers the cementing of the <u>5M MASP (Maximum Allowable Surface Pressure) portion of the well</u>, outlines the well control component rating in use. This table, combined with the mud program, documents that two barriers to flow can be maintained at all times, independent of the BOP nippled up to the wellhead.

Intermediate hole section, 5M requirement

Component	RWP
Pack-off	10M
Casing Wellhead Valves	10M
Annular Wellhead Valves	5M
TA Plug	10M
Float Valves	5M
2" 1502 Lo-Torque Valves	15M

B. Well Control Procedures

Well control procedures are specific to the rig equipment and the operation at the time the kick occurs. Below are the minimal high-level tasks prescribed to assure a proper shut-in while circulating and cementing through the Offline Cement Adapter.

General Procedure While Circulating

- 1. Sound alarm (alert crew).
- 2. Shut down pumps.
- 3. Shut-in Well (close valves to rig pits and open valve to rig choke line. Rig choke will already be in the closed position).
- 4. Confirm shut-in.
- 5. Notify tool pusher/company representative.

Page | 3

Seog resources

Offline Intermediate Cementing Procedure

- 6. Read and record the following:
 - a. SICP (Shut in Casing Pressure) and AP (Annular Pressure)
 - b. Pit gain
 - c. Time
 - d. Regroup and identify forward plan to continue circulating out kick via rig choke and mud/gas separator. Circulate and adjust mud density as needed to control well.

General Procedure While Cementing

- 1. Sound alarm (alert crew).
- 2. Shut down pumps.
- 3. Shut-in Well (close valves to rig pits and open valve to rig choke line. Rig choke will already be in the closed position).
- 4. Confirm shut-in.
- 5. Notify tool pusher/company representative.
- 6. Open rig choke and begin pumping again taking returns through choke manifold and mud/gas separator.
- 7. Continue to place cement until plug bumps.
- 8. At plug bump close rig choke and cement head.
- 9. Read and record the following
 - a. SICP and AP
 - b. Pit gain
 - c. Time
 - d. Shut-in annulus valves on wellhead


General Procedure After Cementing

- 1. Sound alarm (alert crew).
- 2. Shut-in Well (close valves to rig pits and open valve to rig choke line. Rig choke will already be in the closed position).
- 3. Confirm shut-in.
- 4. Notify tool pusher/company representative.
- 5. Read and record the following:
 - a. SICP and AP
 - b. Pit gain
 - c. Time
 - d. Shut-in annulus valves on wellhead

Page | 4

Seog resources Offline Intermediate Cementing Procedure


Figure 1: Cameron TA Plug and Offline Adapter Schematic

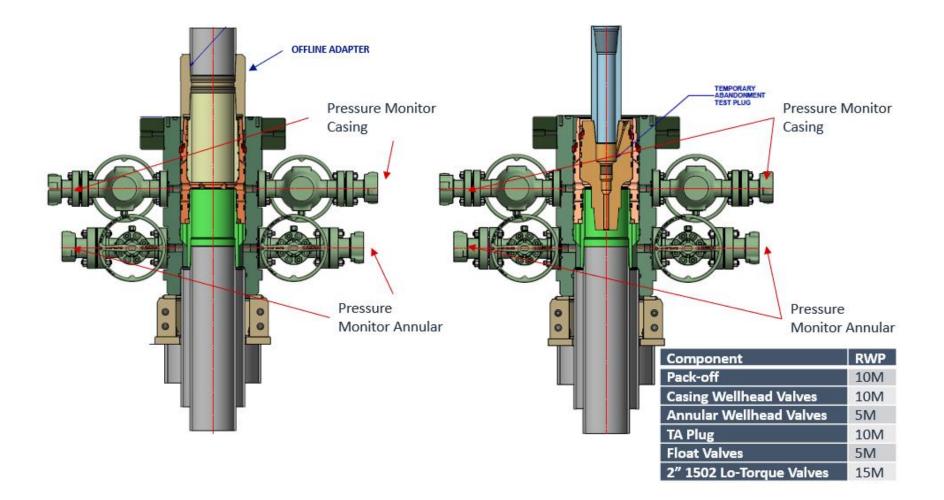

2/24/2022

Page 52 of 87


Offline Intermediate Cementing Procedure

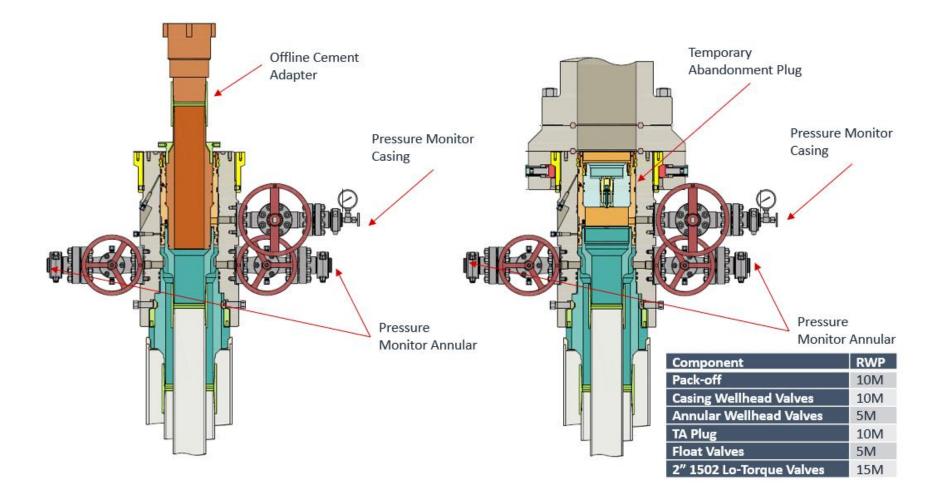

2/24/2022

Seog resources Offline Intermediate Cementing Procedure



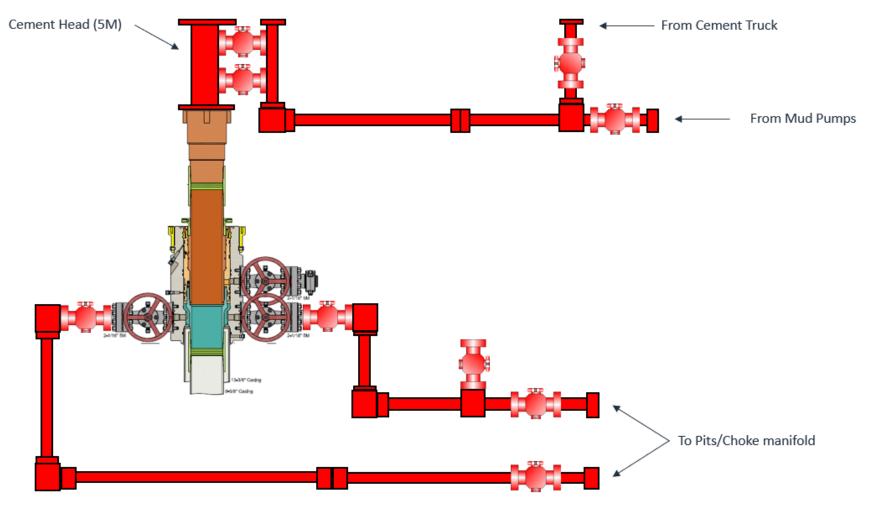

*** All Lines 10M rated working pressure

Page | 7







Salt Section Annular Clearance Variance Request

Daniel Moose

Current Design (Salt Strings)

0.422" Annular clearance requirement

- Casing collars shall have a minimum clearance of 0.422 inches on all sides in the hole/casing annulus, with recognition that variances can be granted for justified exceptions.

- 12.25" Hole x 9.625"40# J55/HCK55 LTC Casing
 - 1.3125" Clearance to casing OD
 - 0.8125" Clearance to coupling OD
- 9.875" Hole x 8.75" 38.5# P110 Sprint-SF Casing
 - 0.5625" Clearance to casing OD
 - 0.433" Clearance to coupling OD

Page 58 of 87

Annular Clearance Variance Request

EOG request permission to allow deviation from the 0.422" annulus clearance requirement for the intermediate (salt) section from Onshore Order #2 under the following conditions:

- The variance is not applicable within the Potash Boundaries or Capitan Reef areas.
- Operator takes responsibility to get casing to set point in the event that the clearance causes stuck pipe issues


Volumetric Hole Size Calculation

Hole Size Calculations Off Cement Volumes

- Known volume of cement pumped
- Known volume of cement returned to surface
- Must not have had any losses
- Must have bumped plug

Average Hole Size


- 12.25" Hole
 - 12.88" Hole
 - 5.13% diameter increase
 - 10.52% area increase
 - 0.63" Average enlargement
 - 0.58" Median enlargement
 - 179 Well Count
- 9.875" Hole
 - 10.30" Hole
 - 4.24% diameter increase
 - 9.64% area increase
 - 0.42" Average enlargement
 - 0.46" Median enlargement
 - 11 Well Count

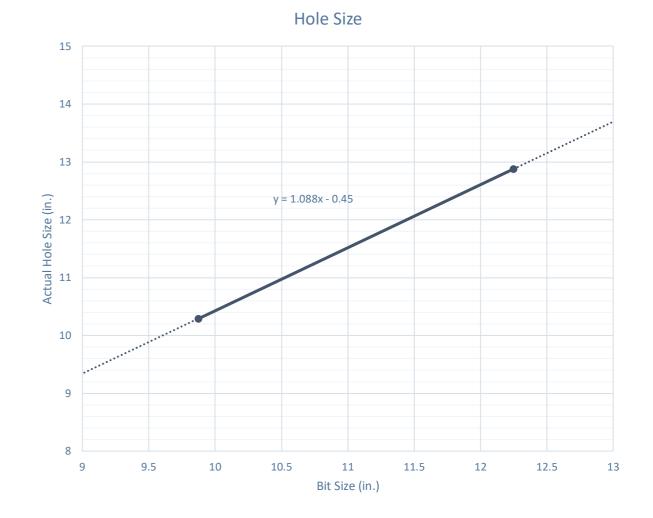

Caliper Hole Size (12.25")

Average Hole Size

- 12.25" Bit
 - 12.76" Hole
 - 4.14% diameter increase
 - 8.44% area increase
 - 0.51" Average enlargement
 - 0.52" Median enlargement
 - Brine

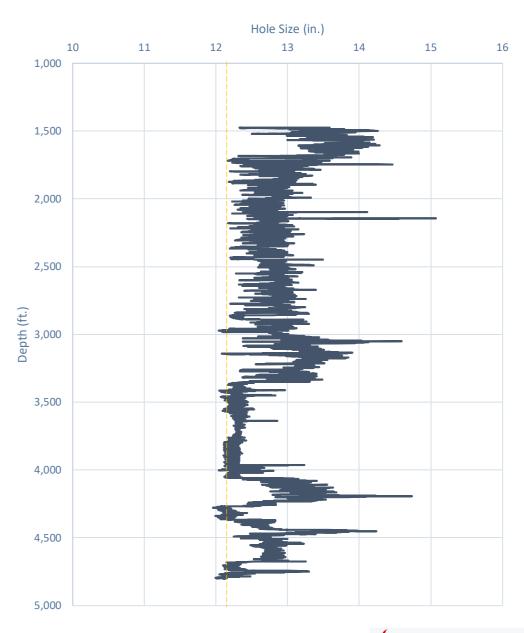


Modelo 10 Fed Com #501H


Caliper Hole Size (9.875")

Average Hole Size

- 9.875" Hole
 - 11.21" Hole
 - 13.54% diameter increase
 - 28.92% area increase
 - 1.33" Average enlargement
 - 1.30" Median enlargement
 - EnerLite

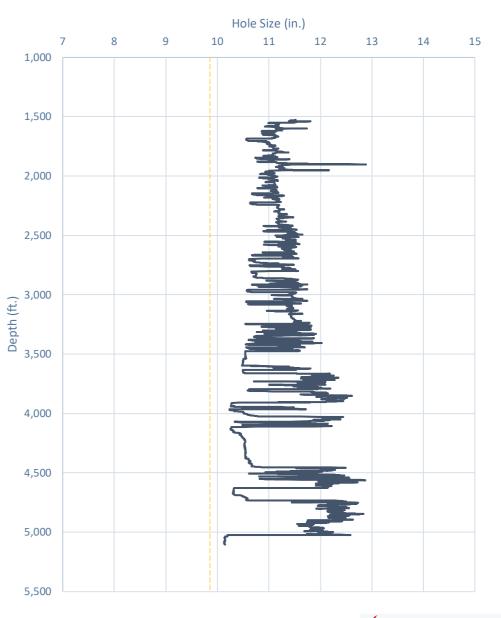

Whirling Wind 11 Fed Com #744H

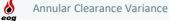

Design A

Proposed 11" Hole with 9.625" 40# J55/HCK55 LTC Casing


- 11" Bit + 0.52" Average hole enlargement = 11.52" Hole Size
 - 0.9475" Clearance to casing OD

$$= \frac{11.52 - 9.625}{2}$$
• 0.4475" Clearance to coupling OD

$$11.52 - 10.625$$

- Previous Shoe 13.375" 54.5# J55 STC
 - 0.995" Clearance to coupling OD (~1,200' overlap)

$$=\frac{12.615-10.625}{2}$$

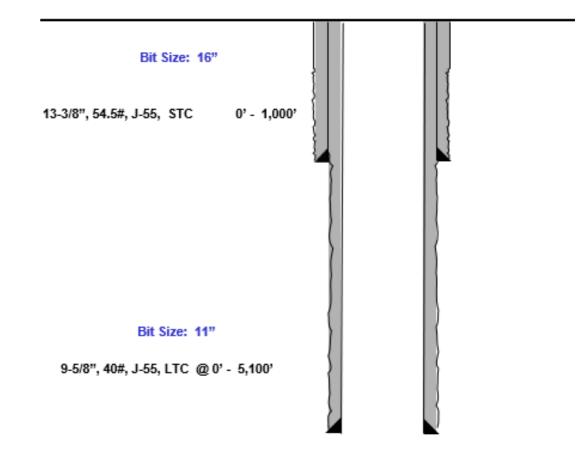

 $\boldsymbol{\diamond}$

Design B







Released to Imaging: 9/2/2024 10:10:13 AM

.

Casing Spec Sheets

PERFORMANCE DATA

API LTC		
Technical	Data	Sheet

9.625 in 40.00 lbs/ft

K55 HC

Tubular Parameters

Size	9.625	in	Minimum Yield	55	ksi
Nominal Weight	40.00	lbs/ft	Minimum Tensile	95	ksi
Grade	K55 HC		Yield Load	629	kips
PE Weight	38.94	lbs/ft	Tensile Load	1088	kips
Wall Thickness	0.395	in	Min. Internal Yield Pressure	3,950	psi
Nominal ID	8.835	in	Collapse Pressure	3600	psi
Drift Diameter	8.750	in		•	·
Nom. Pipe Body Area	11.454	in²			

Connection Parameters

Connection OD	10.625	in
Coupling Length	10.500	in
Threads Per Inch	8	tpi
Standoff Thread Turns	3.50	turns
Make-Up Loss	4.750	in
Min. Internal Yield Pressure	3,950	psi

Pipe Body and API Connections Performance Data

13.375	54.50/0.380	J55

New Search »

Back to Previous List

USC 🔵 Metric

PDF

6/8/2015 10:04:37 AM					
Mechantcal Properties	Ptpe	BTC	LTC	STC	
Minimum Yield Strength	55,000	-	-	-	psi
Maximum Yield Strength	80,000	-	-	-	psi
Minimum Tensile Strength	75,000	-	-	-	psi
Dimensions	Ptpe	втс	LTC	STC	
Outside Diameter	13.375	14.375	-	14.375	in.
Wall Thickness	0.380	-	-	-	in.
Inside Diameter	12.615	12.615	-	12.615	in.
Standard Drift	12.459	12.459	-	12.459	in.
Alternate Drift	-	-	-	-	in.
Nominal Linear Weight, T&C	54.50	-	-	-	lbs/ft
Plain End Weight	52.79	-	-	-	lbs/ft
Performance	Ptpe	BTC	LTC	STC	
Minimum Collapse Pressure	1,130	1,130	-	1,130	psi
Minimum Internal Yield Pressure	2,740	2,740	-	2,740	psi
Minimum Pipe Body Yield Strength	853.00	-	-	-	1000 lbs
Joint Strength	-	909	-	514	1000 lbs
Reference Length	-	11,125	-	6,290	ft
Make-Up Data	Ptpe	втс	LTC	STC	
Make-Up Loss	-	4.81	-	3.50	in.
Minimum Make-Up Torque	-	-	-	3,860	ft-lbs
Maximum Make-Up Torque	-	-	-	6,430	ft-lbs

Casing Spec Sheets

Pipe Body and API Connections Performance Data

10.750 40.50/0.350 J55					PD
New Search »					« Back to Previous L
					USC 🔵 Metr
i/8/2015 10:14:05 AM					
Mechanical Properties	Pipe	BTC	LTC	STC	
Minimum Yield Strength	55,000	-	-	-	psi
Maximum Yield Strength	80,000	-	-		psi
Minimum Tensile Strength	75,000	-	-	-	psi
Dimensions	Pipe	втс	LTC	STC	
Outside Diameter	10.750	11.750	-	11.750	in.
Wall Thickness	0.350	-	-		in.
Inside Diameter	10.050	10.050		10.050	in.
Standard Drift	9.894	9.894	-	9.894	in.
Alternate Drift	-	-	-	-	in.
Nominal Linear Weight, T&C	40.50	-	-	-	lbs/ft
Plain End Weight	38.91	-	-		lbs/ft
Performance	Pipe	втс	LTC	STC	
Minimum Collapse Pressure	1,580	1,580	-	1,580	psi
Minimum Internal Yield Pressure	3,130	3,130	-	3,130	psi
Minimum Pipe Body Yield Strength	629.00	-	-		1000 lbs
Joint Strength	-	700	-	420	1000 lbs
Reference Length	-	11,522	-	6,915	ft
Make-Up Data	Pipe	втс	LTC	STC	
Make-Up Loss		4.81		3.50	in.
Minimum Make-Up Torque		-		3,150	ft-lbs
Maximum Make-Up Torque	-	-	-	5,250	fl-lbs

				AP	I 5CT, 1	0th Ed. C	onnect	ion Data	Shee
O.D. (in) 8.625	WEIGHT (I Nominal: Plain End:	b/ft) 32.00 31.13	WALL (in 0.352	1	ADE 55	* API DRI 7.79	· · /	RBW 87.	
	Aaterial Propert	ies (PE)			F	ipe Body	•	PE)	
	Pipe					Geor	netry		
	/ield Strength:		ksi	Nomir				7.92 i	
	Yield Strength:		ksi		nal Area			9.149 j	
Minimum 1	ensile Strength:		ksi	*Spec	ial/Alt. D			7.875 i	nch
Minimum	Coupling /ield Strength:	•	ksi	Dine	Rody Via	eld Streng	mance	503 k	dina
	Yield Strength:		ksi		ose Resi	-	un.	2,530 p	
	ensile Strength:		ksi	Interna	l Yield Pre			3,930 p	
	enone ou engun.	10	Nor	(API H	istorical)			0,000 p	551
	API Connection Coupling OD: 9				AP	l Connec	tion To	rque	
	STC Perform	ance			:	STC Torq	ue (ft-lk	os)	
STC Interr	al Pressure:	3,930	psi	Min:	2,793	Opti:	3,724	Max:	4,65
STC Joint	-		kips						
	LTC Perform					LTC Torq	•		
	al Pressure:	3,930		Min:	3,130	Opti:	4,174	Max:	5,217
LTC Joint	Strength: Performance - C		kips						
00 0101	eriorinance e					BTC Torq	ue (ft-ll	os)	
BTC Interr	al Pressure:	3,930	psi	follo	w API gui	idelines reg	arding po:	sitional ma	ke up
BTC Joint			kips						
**1			be used unles					silabla un t	ta.
. I	f above API connect	ions do not	100% of pi			n connectio	ns are av	allable up t	10
AND ON AN "A MERCHANTABIL ONLY AND IS BAS INCIDENTAL, PU	N IS PROVIDED BY VALLOUREC S IS" BASIS WITHOUT WARRAN ITY, FITNESS FOR PURPOSE, AC ED ON ESTIMATES THAT HAVE WITWE, EXEMPLARY OR CONSEI DFIT) HOWEVER CAUSED OR AF	ITY OR REPRESENT CURACY OR COMP NOT BEEN VERIFIE QUENTIAL LOSS OF	ATION OF ANY KINI PLETENESS. THE INF ED OR TESTED. IN N R DAMAGE (INCLUD HER SUCH LOSSES (D, WHETHER EX DRMATION COP D EVENT SHALL ING WITHOUT	PRESS OR IMPL NTAINED IN TH VALLOUREC OI LIMITATION, LO /ERE FORESEEA	LIED, INCLUDING V IS DOCUMENT IS F R ITS AFFILIATES B DSS OF USE, LOSS	VITHOUT LIMI PROVIDED FOR E RESPONSIBL OF BARGAIN, L	TATION ANY WAI INFORMATIONA FOR ANY INDIR OSS OF REVENUE	RRANTY OF L PURPOSE ECT, SPECIA E, PROFIT O

eog

Released to Imaging: 9/2/2024 10:10:13 AM

11

See previously attached Drill Plan

10,000 PSI BOP Annular Variance Request (EOG Variance 1c)

EOG Resources request a variance to use a 5000 psi annular BOP with a 10,000 psi BOP stack. The component and compatibility tables along with the general well control plans demonstrate how the 5000 psi annular BOP will be protected from pressures that exceed its rated working pressure (RWP). The pressure at which the control of the wellbore is transferred from the annular preventer to another available preventer will not exceed 3500 psi (70% of the RWP of the 5000 psi annular BOP).


1. Component and Preventer Compatibility Tables

The tables below outlines the tubulars and the compatible preventers in use. This table, combined with the drilling fluid, documents that two barriers to flow will be maintained at all times.

12-1/4" Intermediate Hole Section 10M psi requirement								
Component	OD	Primary Preventer	RWP	Alternate Preventer(s)	RWP			
Drillpipe	5.000" or	Annular	5M	Upper 3.5 - 5.5" VBR	10M			
	4.500"			Lower 3.5 - 5.5" VBR	10M			
HWDP	5.000" or	Annular	5M	Upper 3.5 - 5.5" VBR	10M			
	4.500"			Lower 3.5 - 5.5" VBR	10M			
Jars	6.500"	Annular	5M	Upper 3.5 - 5.5" VBR	10M			
				Lower 3.5 - 5.5" VBR	10M			
DCs and MWD tools	6.500" – 8.000"	Annular	5M	-	-			
Mud Motor	8.000" – 9.625"	Annular	5M	-	-			
1 st Intermediate casing	9.625"	Annular	5M	-	-			
Open-hole	-	Blind Rams	10M	-	-			

8-3/4" Production Hole Section 10M psi requirement							
Component	OD	Primary Preventer	RWP	Alternate Preventer(s)	RWP		
Drillpipe	5.000" or	Annular	5M	Upper 3.5 - 5.5" VBR	10M		
	4.500"			Lower 3.5 - 5.5" VBR	10M		
HWDP	5.000" or	Annular	5M	Upper 3.5 - 5.5" VBR	10M		
	4.500"			Lower 3.5 - 5.5" VBR	10M		
Jars	6.500"	Annular	5M	Upper 3.5 - 5.5" VBR	10M		
				Lower 3.5 - 5.5" VBR	10M		
DCs and MWD tools	6.500" - 8.000"	Annular	5M	-	-		
Mud Motor	6.750" – 8.000"	Annular	5M	-	-		
2 nd Intermediate casing	7.625″	Annular	5M	-	-		
Open-hole	-	Blind Rams	10M	-	-		

VBR = Variable Bore Ram

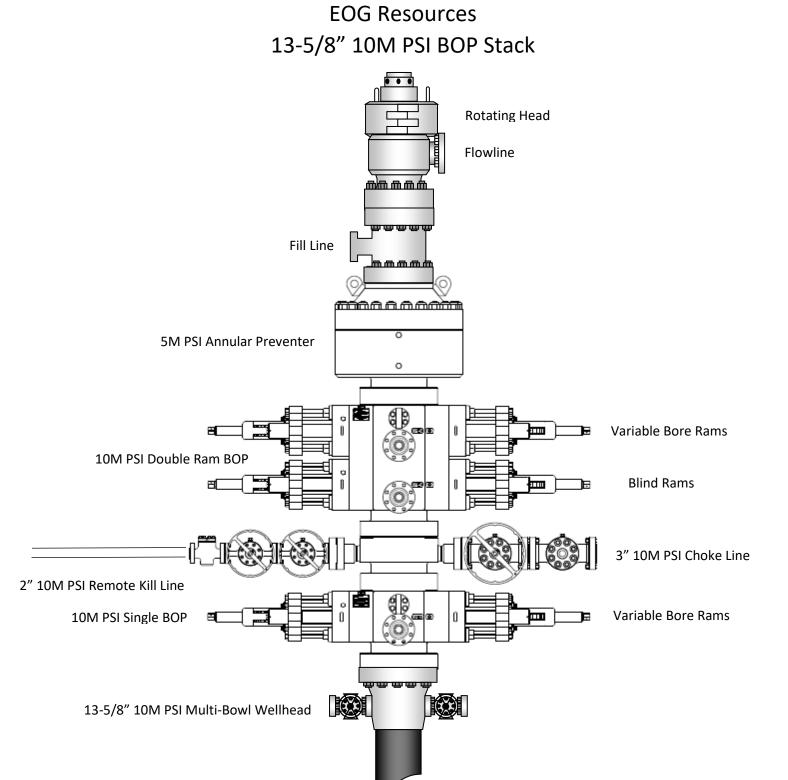

2. Well Control Procedures

Below are the minimal high-level tasks prescribed to assure a proper shut-in while drilling, tripping, running casing, pipe out of the hole (open hole), and moving the BHA through the BOPs. At least one well control drill will be performed weekly per crew to demonstrate compliance with the procedure and well control plan. The well control drill will be recorded in the daily drilling log. The type of drill will be determined by the ongoing operations, but reasonable attempts will be made to vary the type of drill conducted (pit, trip, open hole, choke, etc.). This well control plan will be available for review by rig personnel in the EOG Resources drilling supervisor's office on location, and on the rig floor. All BOP equipment will be tested as per Onshore O&G Order No. 2 with the exception of the 5000 psi annular which will be tested to 100% of its RWP.

General Procedure While Drilling

- 1. Sound alarm (alert crew)
- 2. Space out drill string
- 3. Shut down pumps (stop pumps and rotary)
- 4. Shut-in Well (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
 - a. SIDPP and SICP
 - b. Pit gain
 - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach 70% or greater of the RWP of the annular preventer, confirm spacing and close the upper variable bore rams.

General Procedure While Tripping

- 1. Sound alarm (alert crew)
- 2. Stab full opening safety valve and close
- 3. Space out drill string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
 - a. SIDPP and SICP
 - b. Pit gain
 - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach 70% or greater of the RWP of the annular preventer, confirm spacing and close the upper variable bore rams.

General Procedure While Running Production Casing

- 1. Sound alarm (alert crew)
- 2. Stab crossover and full opening safety valve and close
- 3. Space out string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
 - a. SIDPP and SICP
 - b. Pit gain
 - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach 70% or greater of the RWP of the annular preventer, confirm spacing and close the upper variable bore rams.


General Procedure With No Pipe In Hole (Open Hole)

- 1. Sound alarm (alert crew)
- 2. Shut-in with blind rams. (HCR and choke will already be in the closed position.)
- 3. Confirm shut-in
- 4. Notify toolpusher/company representative
- 5. Read and record the following:
 - a. SICP
 - b. Pit gain
 - c. Time
- 6. Regroup and identify forward plan

General Procedures While Pulling BHA thru Stack

- 1. PRIOR to pulling last joint of drillpipe thru the stack.
 - a. Perform flowcheck, if flowing:
 - b. Sound alarm (alert crew)
 - c. Stab full opening safety valve and close
 - d. Space out drill string with tool joint just beneath the upper variable bore rams.
 - e. Shut-in using upper variable bore rams. (HCR and choke will already be in the closed position.)
 - f. Confirm shut-in
 - g. Notify toolpusher/company representative
 - h. Read and record the following:
 - i. SIDPP and SICP
 - ii. Pit gain
 - iii. Time
 - i. Regroup and identify forward plan

- 2. With BHA in the stack and compatible ram preventer and pipe combo immediately available.
 - a. Sound alarm (alert crew)
 - b. Stab crossover and full opening safety valve and close
 - c. Space out drill string with upset just beneath the upper variable bore rams.
 - d. Shut-in using upper variable bore rams. (HCR and choke will already be in the closed position.)
 - e. Confirm shut-in
 - f. Notify toolpusher/company representative
 - g. Read and record the following:
 - i. SIDPP and SICP
 - ii. Pit gain
 - iii. Time
 - h. Regroup and identify forward plan
- 3. With BHA in the stack and NO compatible ram preventer and pipe combo immediately available.
 - a. Sound alarm (alert crew)
 - b. If possible to pick up high enough, pull string clear of the stack and follow "Open Hole" scenario.
 - c. If impossible to pick up high enough to pull the string clear of the stack:
 - d. Stab crossover, make up one joint/stand of drillpipe, and full opening safety valve and close
 - e. Space out drill string with tooljoint just beneath the upper variable bore ram.
 - f. Shut-in using upper variable bore ram. (HCR and choke will already be in the closed position.)
 - g. Confirm shut-in
 - h. Notify toolpusher/company representative
 - i. Read and record the following:
 - i. SIDPP and SICP
 - ii. Pit gain
 - iii. Time
 - j. Regroup and identify forward plan

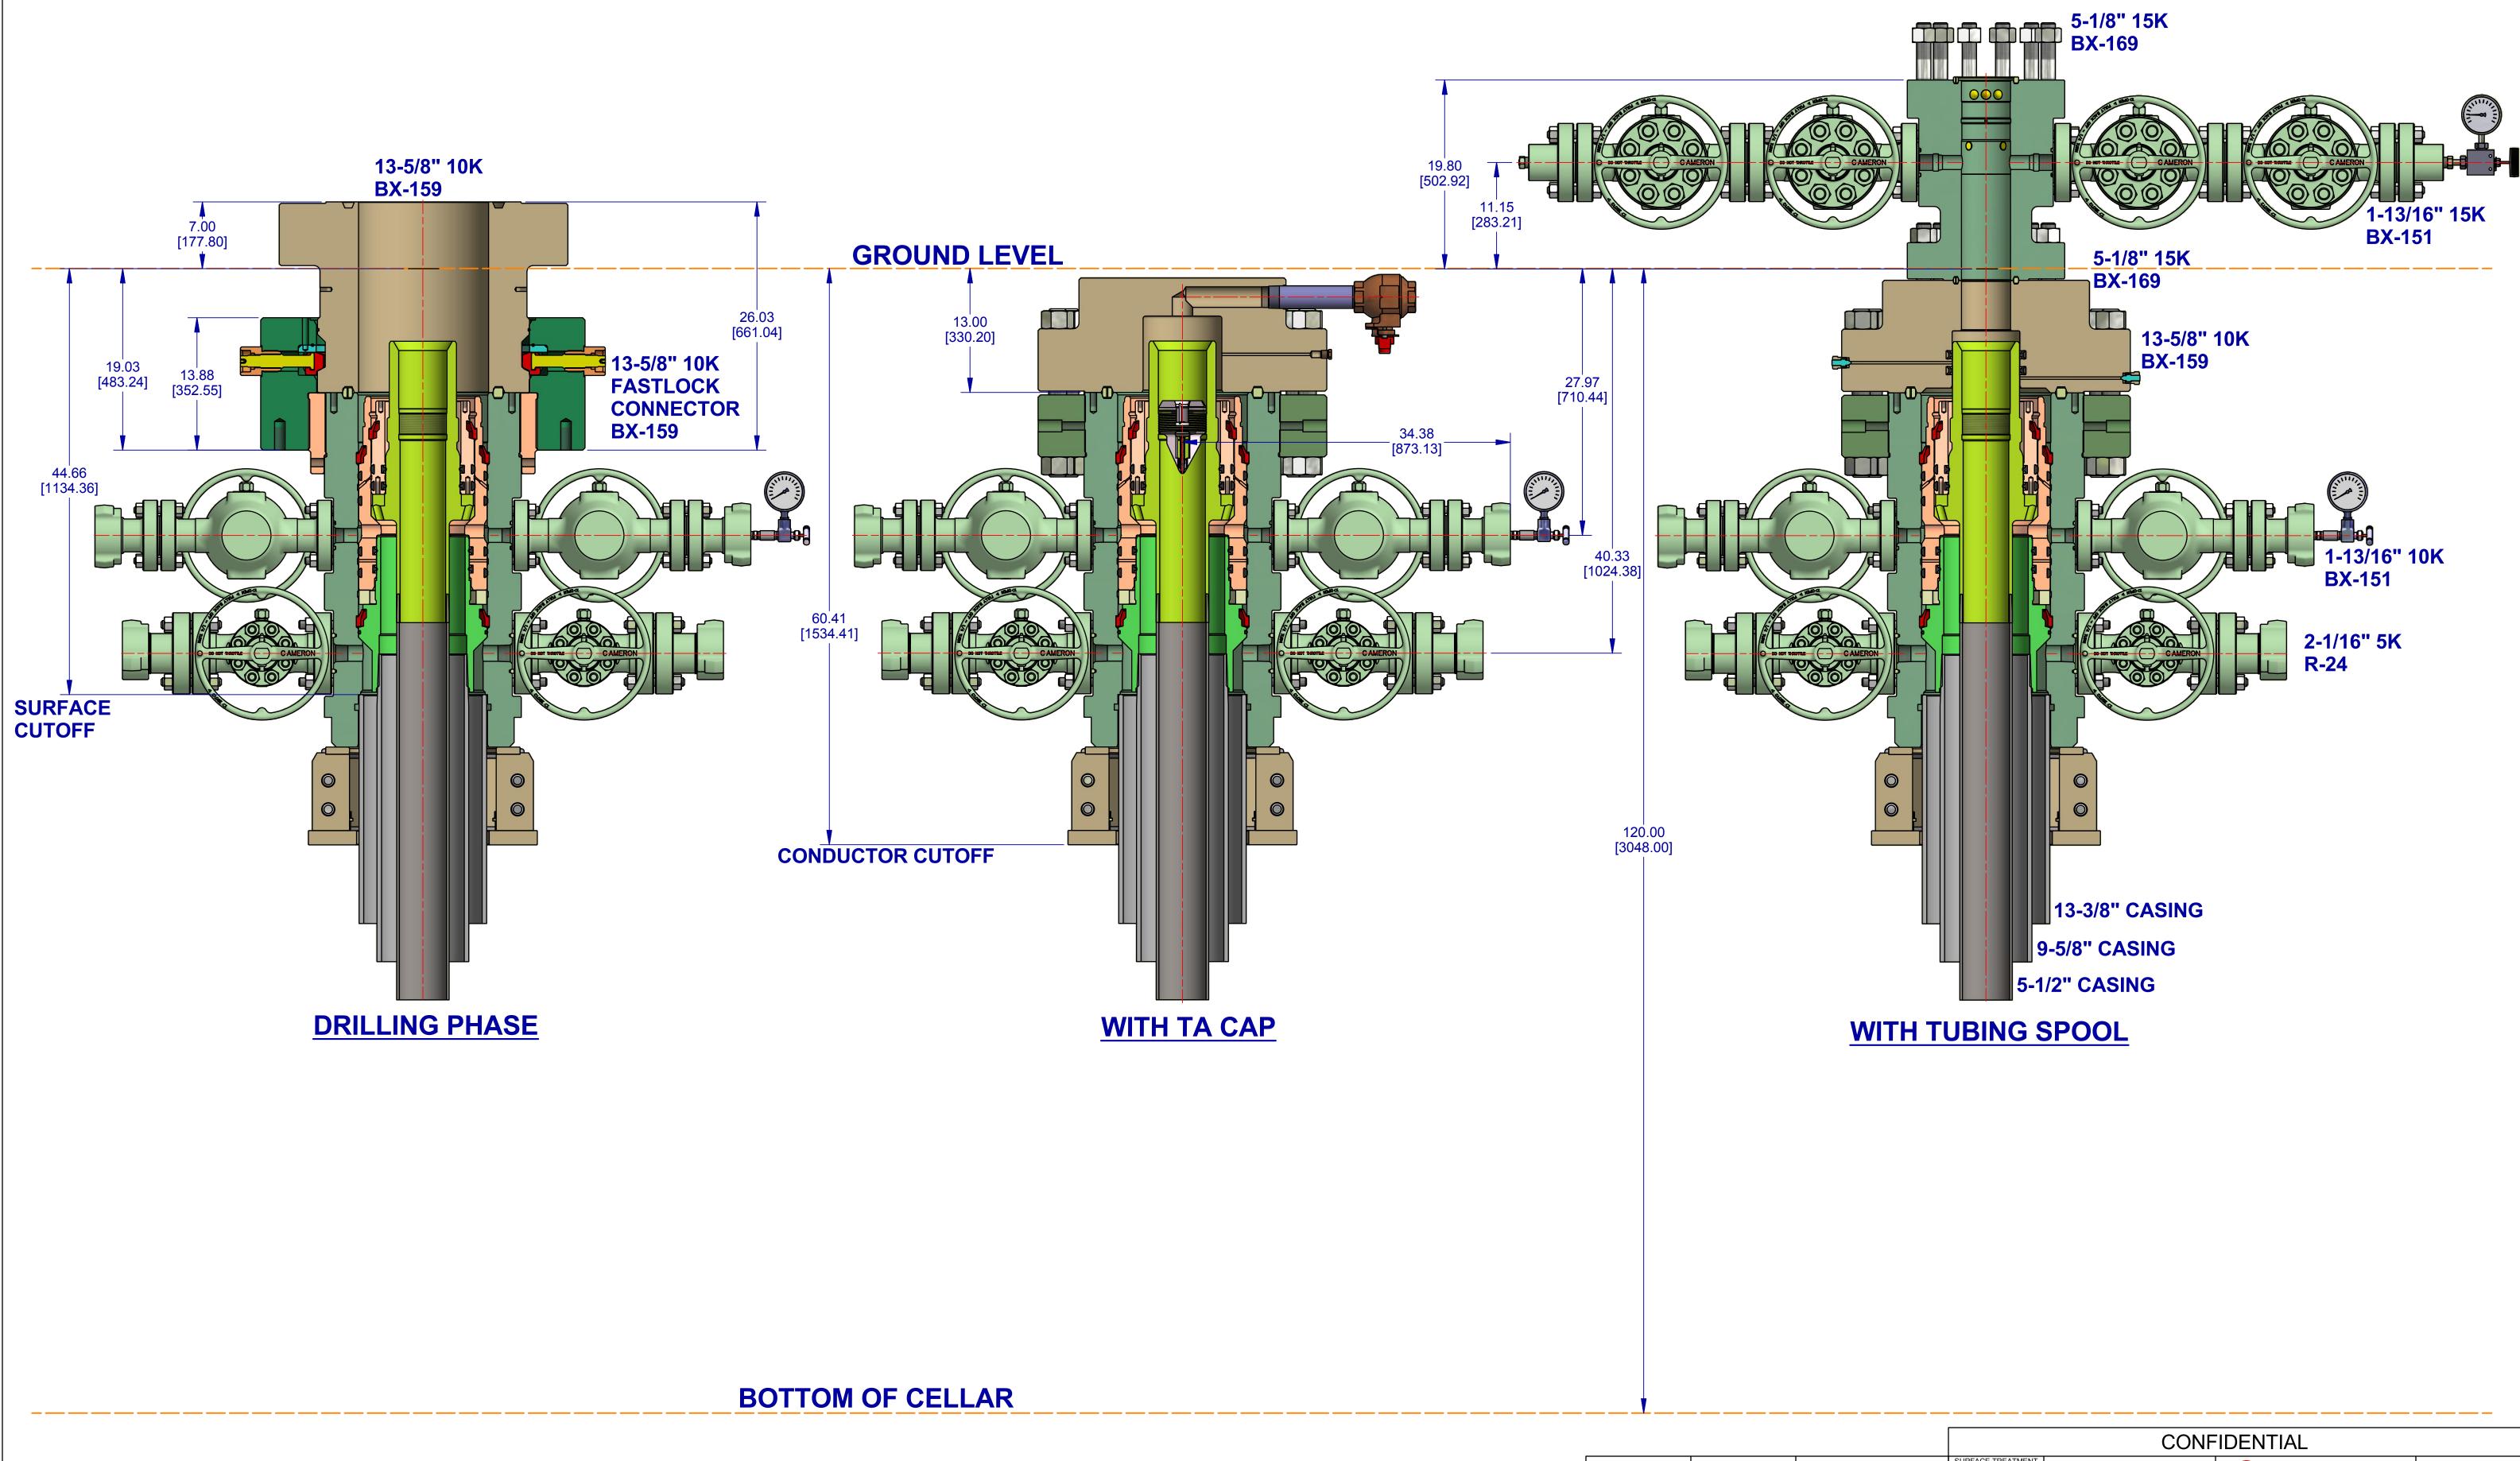

$\square \square \square$	DESIGNED IN INCHES	MAC TOLERAN
	DIMENSIONAL UNITS	OTHERWIS
THIRD ANGLE	INCHES [MILLIMETERS]	.X [0.] → ─ □
MACHINED FILLET RADII . ALL SHARP EDGES .0103 SURFACE FINISH IN MICR INTERPRET DRAWING PEI	± = [] .xx [0.x] ± = []	
	S. SEE B/M FOR MATERIAL ENTS. ITEM NUMBERS NOT OT APPLY.	$\begin{array}{l} 1.00 \\ \pm \end{array} = \begin{bmatrix} 1 \\ 1 \end{bmatrix}$

		CONFIDENTIAL					
ACHINING		SURFACE TREATMENT	DO NOT SCALE			CAMERON	SURFACE
ISE SPEC	CIFIED		DRAWN BY:	DATE			SYSTEMS
	ANGLES		KEN REED	6 Nov 18		A Schlumberger Company	o ro r Emo
	+ °	MATERIAL & HEAT TREAT	CHECKED BY:	DATE		EOG RESOURCES,	INC
	_	-	PA	6 Nov 18		13-5/8" 10K MN-DS WE	
			APPROVED BY:	DATE			
	RA ON		APPROVER NAME	6 Nov 18		13-3/8" X 9-5/8" X 5-	-1/2"
	V ALL MACHINED SURFACES	ESTIMATED 8 WEIGHT:	147.2 LBS INITIAL USE B/M: 3695.5 KG EWR:6503	53762	SHEET 1 OF 1	SD-052491-19-	07 REV: 01
							INVENTOR - D

10,000 PSI BOP Annular Variance Request

EOG Resources request a variance to use a 5000 psi annular BOP with a 10,000 psi BOP stack. The component and compatibility tables along with the general well control plans demonstrate how the 5000 psi annular BOP will be protected from pressures that exceed its rated working pressure (RWP). The pressure at which the control of the wellbore is transferred from the annular preventer to another available preventer will not exceed 3500 psi (70% of the RWP of the 5000 psi annular BOP).


1. Component and Preventer Compatibility Tables

The tables below outlines the tubulars and the compatible preventers in use. This table, combined with the drilling fluid, documents that two barriers to flow will be maintained at all times.

9-7/8" & 8-3/4" Intermediate Hole Section 10M psi requirement						
Component	OD	Primary Preventer	RWP	Alternate Preventer(s)	RWP	
Drillpipe	4.500"	Annular	5M	Upper 3.5 - 5.5" VBR	10M	
				Lower 3.5 - 5.5" VBR	10M	
HWDP	4.500"	Annular	5M	Upper 3.5 - 5.5" VBR	10M	
				Lower 3.5 - 5.5" VBR	10M	
Jars	4.500"	Annular	5M	Upper 3.5 - 5.5" VBR	10M	
				Lower 3.5 - 5.5" VBR	10M	
DCs and MWD tools	6.500 - 8.000"	Annular	5M	-	-	
Mud Motor	6.750 - 8.000"	Annular	5M	-	-	
Intermediate casing	7.625″	Annular	5M	-	-	
Open-hole	-	Blind Rams	10M	-	-	

6-3/4" Production Hole Section 10M psi requirement					
Component	OD	Primary Preventer	RWP	Alternate Preventer(s)	RWP
Drillpipe	4.500"	Annular	5M	Upper 3.5 - 5.5" VBR	10M
				Lower 3.5 - 5.5" VBR	10M
HWDP	4.500"	Annular	5M	Upper 3.5 - 5.5" VBR	10M
				Lower 3.5 - 5.5" VBR	10M
DCs and MWD tools	4.750 – 5.500"	Annular	5M	Upper 3.5 - 5.5" VBR	10M
				Lower 3.5 - 5.5" VBR	10M
Mud Motor	4.750 - 5.500"	Annular	5M	Upper 3.5 - 5.5" VBR	10M
				Lower 3.5 - 5.5" VBR	10M
Mud Motor	5.500 – 5.750"	Annular	5M	-	-
Production casing	5.500"	Annular	5M	Upper 3.5 - 5.5" VBR	10M
				Lower 3.5 - 5.5" VBR	10M
Open-hole	-	Blind Rams	10M	-	-

VBR = Variable Bore Ram

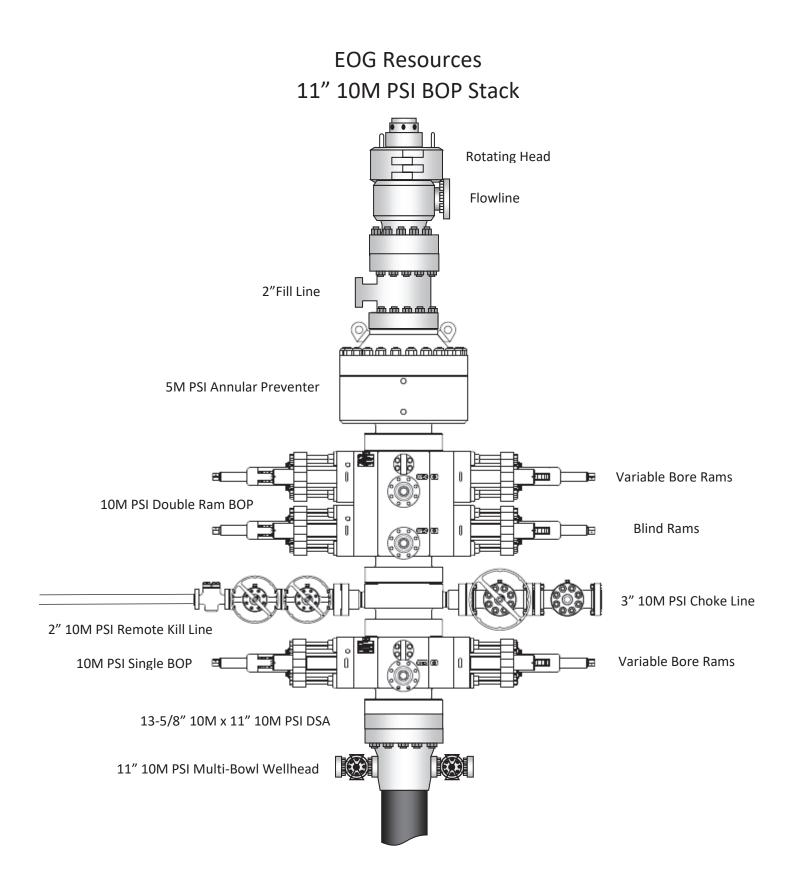

2. Well Control Procedures

Below are the minimal high-level tasks prescribed to assure a proper shut-in while drilling, tripping, running casing, pipe out of the hole (open hole), and moving the BHA through the BOPs. At least one well control drill will be performed weekly per crew to demonstrate compliance with the procedure and well control plan. The well control drill will be recorded in the daily drilling log. The type of drill will be determined by the ongoing operations, but reasonable attempts will be made to vary the type of drill conducted (pit, trip, open hole, choke, etc.). This well control plan will be available for review by rig personnel in the EOG Resources drilling supervisor's office on location, and on the rig floor. All BOP equipment will be tested as per Onshore O&G Order No. 2 with the exception of the 5000 psi annular which will be tested to 100% of its RWP.

General Procedure While Drilling

- 1. Sound alarm (alert crew)
- 2. Space out drill string
- 3. Shut down pumps (stop pumps and rotary)
- 4. Shut-in Well (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
 - a. SIDPP and SICP
 - b. Pit gain
 - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach 70% or greater of the RWP of the annular preventer, confirm spacing and close the upper variable bore rams.

General Procedure While Tripping

- 1. Sound alarm (alert crew)
- 2. Stab full opening safety valve and close
- 3. Space out drill string
- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
 - a. SIDPP and SICP
 - b. Pit gain
 - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach 70% or greater of the RWP of the annular preventer, confirm spacing and close the upper variable bore rams.

General Procedure While Running Production Casing

- 1. Sound alarm (alert crew)
- 2. Stab crossover and full opening safety valve and close
- 3. Space out string

- 4. Shut-in (uppermost applicable BOP, typically annular preventer first. HCR and choke will already be in the closed position.)
- 5. Confirm shut-in
- 6. Notify toolpusher/company representative
- 7. Read and record the following:
 - a. SIDPP and SICP
 - b. Pit gain
 - c. Time
- 8. Regroup and identify forward plan
- 9. If pressure has built or is anticipated during the kill to reach 70% or greater of the RWP of the annular preventer, confirm spacing and close the upper variable bore rams.

General Procedure With No Pipe In Hole (Open Hole)

- 1. Sound alarm (alert crew)
- 2. Shut-in with blind rams. (HCR and choke will already be in the closed position.)
- 3. Confirm shut-in
- 4. Notify toolpusher/company representative
- 5. Read and record the following:
 - a. SICP
 - b. Pit gain
 - c. Time
- 6. Regroup and identify forward plan

General Procedures While Pulling BHA thru Stack

- 1. PRIOR to pulling last joint of drillpipe thru the stack.
 - a. Perform flowcheck, if flowing:
 - b. Sound alarm (alert crew)
 - c. Stab full opening safety valve and close
 - d. Space out drill string with tool joint just beneath the upper variable bore rams.
 - e. Shut-in using upper variable bore rams. (HCR and choke will already be in the closed position.)
 - f. Confirm shut-in
 - g. Notify toolpusher/company representative
 - h. Read and record the following:
 - i. SIDPP and SICP
 - ii. Pit gain
 - iii. Time
 - i. Regroup and identify forward plan
- 2. With BHA in the stack and compatible ram preventer and pipe combo immediately available.
 - a. Sound alarm (alert crew)
 - b. Stab crossover and full opening safety valve and close
 - c. Space out drill string with upset just beneath the upper variable bore rams.
 - d. Shut-in using upper variable bore rams. (HCR and choke will already be in the closed position.)
 - e. Confirm shut-in
 - f. Notify toolpusher/company representative
 - g. Read and record the following:
 - i. SIDPP and SICP

- ii. Pit gain
- iii. Time
- h. Regroup and identify forward plan
- 3. With BHA in the stack and NO compatible ram preventer and pipe combo immediately available.
 - a. Sound alarm (alert crew)
 - b. If possible to pick up high enough, pull string clear of the stack and follow "Open Hole" scenario.
 - c. If impossible to pick up high enough to pull the string clear of the stack:
 - d. Stab crossover, make up one joint/stand of drillpipe, and full opening safety valve and close
 - e. Space out drill string with tooljoint just beneath the upper variable bore ram.
 - f. Shut-in using upper variable bore ram. (HCR and choke will already be in the closed position.)
 - g. Confirm shut-in
 - h. Notify toolpusher/company representative
 - i. Read and record the following:
 - i. SIDPP and SICP
 - ii. Pit gain
 - iii. Time
 - j. Regroup and identify forward plan

Offline Intermediate Cementing Procedure

Cement Program

1. No changes to the cement program will take place for offline cementing.

Summarized Operational Procedure for Intermediate Casing

- 1. Run casing as per normal operations. While running casing, conduct negative pressure test and confirm integrity of the float equipment back pressure valves.
 - a. Float equipment is equipped with two back pressure valves rated to a minimum of 5,000 psi.
- 2. Land production casing on mandrel hanger through BOP.
 - a. If casing is unable to be landed with a mandrel hanger, then the **casing will be cemented online**.
- 3. Break circulation and confirm no restrictions.
 - a. Ensure no blockage of float equipment and appropriate annular returns.
 - b. Perform flow check to confirm well is static.
- 4. Set pack-off
 - a. If utilizing a fluted/ported mandrel hanger, ensure well is static on the annulus and inside the casing by filling the pipe with kill weight fluid, remove landing joint, and set annular packoff through BOP. Pressure test to 5,000 psi for 10 min.
 - b. If utilizing a solid mandrel hanger, ensure well is static on the annulus and inside the casing by filling the pipe with kill weight fluid. Pressure test seals to 5,000 psi for 10 min. Remove landing joint through BOP.
- 5. After confirmation of both annular barriers and the two casing barriers, install TA plug and pressure test to 5,000 psi for 10 min. Notify the BLM with intent to proceed with nipple down and offline cementing.
 - a. Minimum 4 hrs notice.
- 6. With the well secured and BLM notified, nipple down BOP and secure on hydraulic carrier or cradle.
 - a. Note, if any of the barriers fail to test, the BOP stack will not be nippled down until after the cement job has concluded and both lead and tail slurry have reached 500 psi.
- 7. Skid/Walk rig off current well.
- 8. Confirm well is static before removing TA Plug.
 - a. Cementing operations will not proceed until well is under control. (If well is not static, notify BLM and proceed to kill)
 - b. Casing outlet valves will provide access to both the casing ID and annulus. Rig or third party pump truck will kill well prior to cementing.
 - c. Well control plan can be seen in Section B, Well Control Procedures.
 - d. If need be, rig can be moved back over well and BOP nippled back up for any further remediation.

Page | 1

Page 80 of 87

Seog resources

Offline Intermediate Cementing Procedure

- e. Diagram for rig positioning relative to offline cementing can be seen in Figure 4.
- 9. Rig up return lines to take returns from wellhead to pits and rig choke.
 - a. Test all connections and lines from wellhead to choke manifold to 5,000 psi high for 10 min.
 - b. If either test fails, perform corrections and retest before proceeding.
 - c. Return line schematics can be seen in Figure 3.
- 10. Remove TA Plug from the casing.
- 11. Install offline cement tool.
 - a. Current offline cement tool schematics can be seen in Figure 1 (Cameron) and Figure 2 (Cactus).
- 12. Rig up cement head and cementing lines.
 - a. Pressure test cement lines against cement head to 80% of casing burst for 10 min.
- 13. Break circulation on well to confirm no restrictions.
 - a. If gas is present on circulation, well will be shut in and returns rerouted through gas buster.
 - b. Max anticipated time before circulating with cement truck is 6 hrs.
- 14. Pump cement job as per plan.
 - a. At plug bump, test casing to 0.22 psi/ft or 1500 psi, whichever is greater.
 - b. If plug does not bump on calculated, shut down and wait 8 hrs or 500 psi compressive strength, whichever is greater before testing casing.
- 15. Confirm well is static and floats are holding after cement job.
 - a. With floats holding and backside static:
 - i. Remove cement head.
 - b. If floats are leaking:
 - i. Shut-in well and WOC (Wait on Cement) until tail slurry reaches 500 psi compressive strength and the casing is static prior to removing cement head.
 - c. If there is flow on the backside:
 - i. Shut in well and WOC until tail slurry reaches 500 psi compressive strength. Ensure that the casing is static prior to removing cement head.
- 16. Remove offline cement tool.
- 17. Install night cap with pressure gauge for monitoring.
- 18. Test night cap to 5,000 psi for 10 min.

Example Well Control Plan Content

A. Well Control Component Table

The table below, which covers the cementing of the <u>5M MASP (Maximum Allowable Surface Pressure) portion of the well</u>, outlines the well control component rating in use. This table, combined with the mud program, documents that two barriers to flow can be maintained at all times, independent of the BOP nippled up to the wellhead.

Intermediate hole section, 5M requirement

Component	RWP
Pack-off	10M
Casing Wellhead Valves	10M
Annular Wellhead Valves	5M
TA Plug	10M
Float Valves	5M
2" 1502 Lo-Torque Valves	15M

B. Well Control Procedures

Well control procedures are specific to the rig equipment and the operation at the time the kick occurs. Below are the minimal high-level tasks prescribed to assure a proper shut-in while circulating and cementing through the Offline Cement Adapter.

General Procedure While Circulating

- 1. Sound alarm (alert crew).
- 2. Shut down pumps.
- 3. Shut-in Well (close valves to rig pits and open valve to rig choke line. Rig choke will already be in the closed position).
- 4. Confirm shut-in.
- 5. Notify tool pusher/company representative.

Page | 3

Seog resources

Offline Intermediate Cementing Procedure

- 6. Read and record the following:
 - a. SICP (Shut in Casing Pressure) and AP (Annular Pressure)
 - b. Pit gain
 - c. Time
 - d. Regroup and identify forward plan to continue circulating out kick via rig choke and mud/gas separator. Circulate and adjust mud density as needed to control well.

General Procedure While Cementing

- 1. Sound alarm (alert crew).
- 2. Shut down pumps.
- 3. Shut-in Well (close valves to rig pits and open valve to rig choke line. Rig choke will already be in the closed position).
- 4. Confirm shut-in.
- 5. Notify tool pusher/company representative.
- 6. Open rig choke and begin pumping again taking returns through choke manifold and mud/gas separator.
- 7. Continue to place cement until plug bumps.
- 8. At plug bump close rig choke and cement head.
- 9. Read and record the following
 - a. SICP and AP
 - b. Pit gain
 - c. Time
 - d. Shut-in annulus valves on wellhead

General Procedure After Cementing

- 1. Sound alarm (alert crew).
- 2. Shut-in Well (close valves to rig pits and open valve to rig choke line. Rig choke will already be in the closed position).
- 3. Confirm shut-in.
- 4. Notify tool pusher/company representative.
- 5. Read and record the following:
 - a. SICP and AP
 - b. Pit gain
 - c. Time
 - d. Shut-in annulus valves on wellhead


Page | 4

Seog resources Offline Intermediate Cementing Procedure

Figure 1: Cameron TA Plug and Offline Adapter Schematic




Offline Intermediate Cementing Procedure

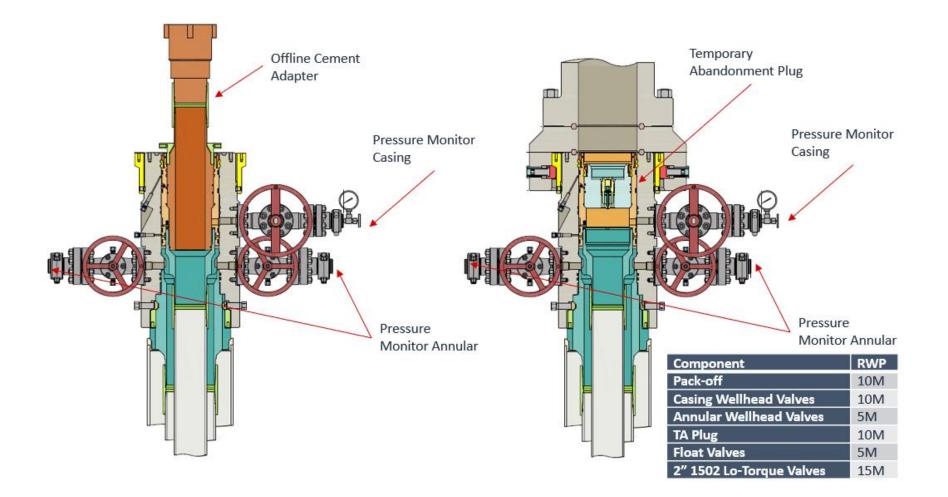

2/24/2022

Seog resources Offline Intermediate Cementing Procedure




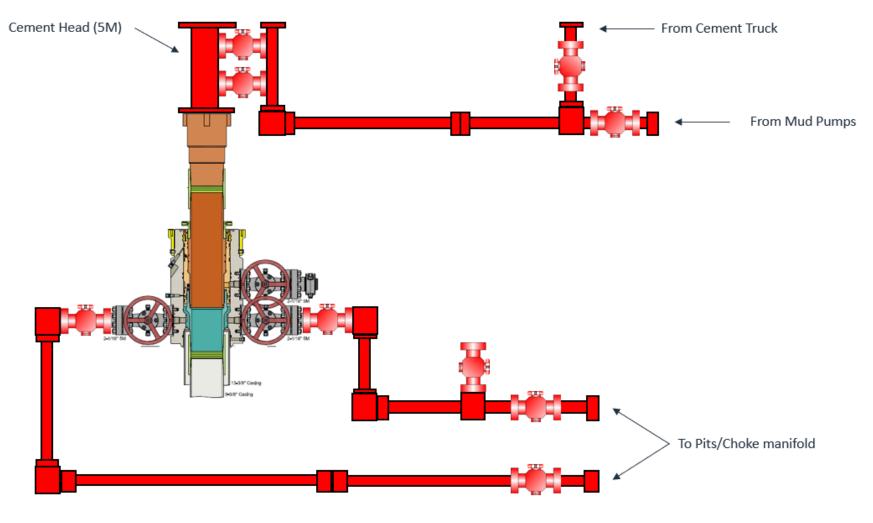

*** All Lines 10M rated working pressure

Page | 7



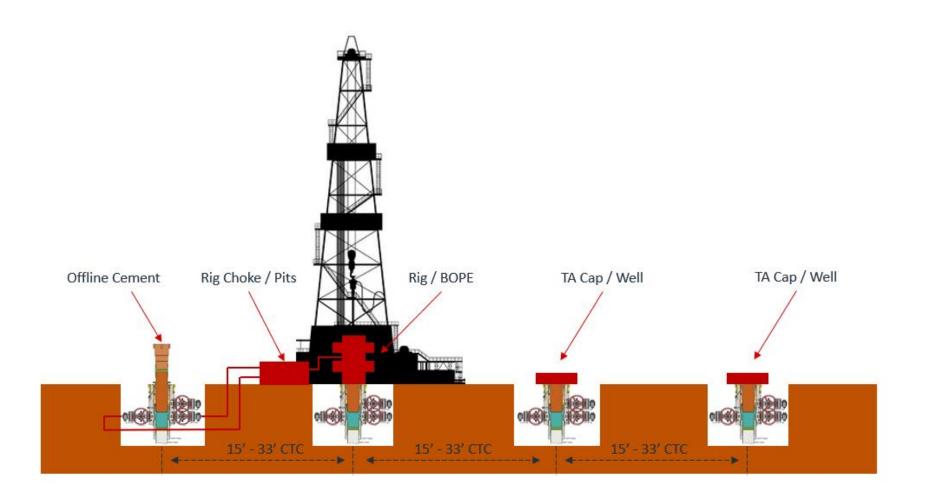

District I 1625 N. French Dr., Hobbs, NM 88240 Phone:(575) 393-6161 Fax:(575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III

1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

District IV

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3470 Fax: (505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. Santa Fe, NM 87505

CONDITIONS

Operator:	OGRID:	
EOG RESOURCES INC	7377	
5509 Champions Drive	Action Number:	
Midland, TX 79706	376801	
	Action Type:	
	[C-101] BLM - Federal/Indian Land Lease (Form 3160-3)	

CONDITIONS

CONDING		
Created By	Condition	Condition Date
pkautz	Will require a File As Drilled C-102 and a Directional Survey with the C-104	9/2/2024
pkautz	Once the well is spud, to prevent ground water contamination through whole or partial conduits from the surface, the operator shall drill without interruption through the fresh water zone or zones and shall immediately set in cement the water protection string	9/2/2024
pkautz	Oil base muds are not to be used until fresh water zones are cased and cemented providing isolation from the oil or diesel. This includes synthetic oils. Oil based mud, drilling fluids and solids must be contained in a steel closed loop system	9/2/2024
pkautz	Cement is required to circulate on both surface and intermediate1 strings of casing	9/2/2024
pkautz	If cement does not circulate on any string, a CBL is required for that string of casing	9/2/2024

CONDITIONS

Action 376801