Sundry Print Regeo

U.S. Department of the Interior BUREAU OF LAND MANAGEMENT

Well Name: POKER LAKE UNIT Well Location: T24S / R29E / SEC 12 / County or Parish/State: EDDY /

SENE / 32.2343173 / -103.9315847

Well Number: 281 Type of Well: OIL WELL Allottee or Tribe Name:

Lease Number: NMLC070175A Unit or CA Name: POKER LAKE **Unit or CA Number:** NMNM71016G

DELAWARE C

US Well Number: 3001535083 Operator: XTO PERMIAN OPERATING LLC

Notice of Intent

Sundry ID: 2813154

Type of Submission: Notice of Intent Type of Action: Other

Date Sundry Submitted: 09/20/2024 **Time Sundry Submitted:** 04:07

Date proposed operation will begin: 10/20/2024

Procedure Description: XTO Permian Operating LLC., respectfully requests approval to Re-Enter and Rework the Temporary Abandonment of the above mentioned well per the attached procedure. BLM witnessed & approved field MIT ran on 8/5/24 but at later dates field MIT's ran and witnessed by NMOCD did not pass, could not fix issue.

Surface Disturbance

Is any additional surface disturbance proposed?: No

NOI Attachments

Procedure Description

 $PLU_281_Procedure_Post_TA_Remediation_20240920160422.pdf$

Page 1 of 2

eceived by OCD: 10/14/2024 6:14:23 AM
Well Name: POKER LAKE UNIT

Well Location: T24S / R29E / SEC 12 /

SENE / 32.2343173 / -103.9315847

County or Parish/State: EDD 200

NM

Zip:

Well Number: 281

Type of Well: OIL WELL

Allottee or Tribe Name:

Lease Number: NMLC070175A

Unit or CA Name: POKER LAKE

DELAWARE C

Unit or CA Number:

NMNM71016G

US Well Number: 3001535083

Operator: XTO PERMIAN OPERATING

LLC

Conditions of Approval

Specialist Review

TA COA 20241010152529.pdf

Operator

I certify that the foregoing is true and correct. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction. Electronic submission of Sundry Notices through this system satisfies regulations requiring a

Operator Electronic Signature: SHERRY MORROW Signed on: SEP 20, 2024 04:05 PM

Name: XTO PERMIAN OPERATING LLC

Title: Regulatory Analyst

Street Address: 6401 HOLIDAY HILL ROAD BLDG 5

City: MIDLAND State: TX

Phone: (432) 218-3671

Email address: SHERRY.MORROW@EXXONMOBIL.COM

Field

Representative Name:

Street Address:

City: State:

Phone:

Email address:

BLM Point of Contact

BLM POC Name: ZOTA M STEVENS **BLM POC Title:** Petroleum Engineer

BLM POC Phone: 5752345998 BLM POC Email Address: ZSTEVENS@BLM.GOV

Disposition: Approved **Disposition Date:** 10/10/2024

Signature: Zota Stevens

Page 2 of 2

TEMPORARILY ABANDON WELLBORE (Post TA Remediation) POKER LAKE UNIT 281 EDDY COUNTY, NEW MEXICO Class II

MASIP	MAOP	MAWP	Surface Csg Yield
1,000 psi	1,000 psi	3,000 psi	3930 PSI

SUMMARY: Plug and abandon wellbore according to BLM regulations.


- 1) MIRU prep rig. Set open top steel pit for plugging.
- 2) ND WH and NU 3K manual BOP. Function test BOP.
- 3) MIRU WOR
- 4) RIH w/ packer set 100′ from surface, load annulus and tubing (if not full) and test above packer (tubing/casing annulus) then test below packer.
- 5) RIH to 6800' and repeat tests.
 - a. If leak is below (CIBP leakage), dump 35 feet of cement and pressure test again. Continue to step 6
 - b. If leak is above (Casing leak), hunt for hole and submit NOI to P&A the well.
- 6) Circulate salt gel to the surface.
- 7) Perform state witnessed MIT to 500 psi for 30 minutes. Must start and end at ZERO on a 1000 psi chart.
- 8) ND BOP. RDMO PU, transport trucks, and pump truck.
- 9) Pull fluid from steel tank and haul to disposal. Release steel tank.




Schematic - Vertical with Perfs

Well Name: Poker Lake Unit 281

	SAP Cost Center ID 1138371001	Permit Number		State/Province New Mexico		County Eddy	
Surface Location T24S-R29E-S12	Spud 11/2		Original KB Ele 3,165.00	evation (ft)	Ground Elevation (ft) 3,148.00		KB-Ground Distance (ft) 17.00

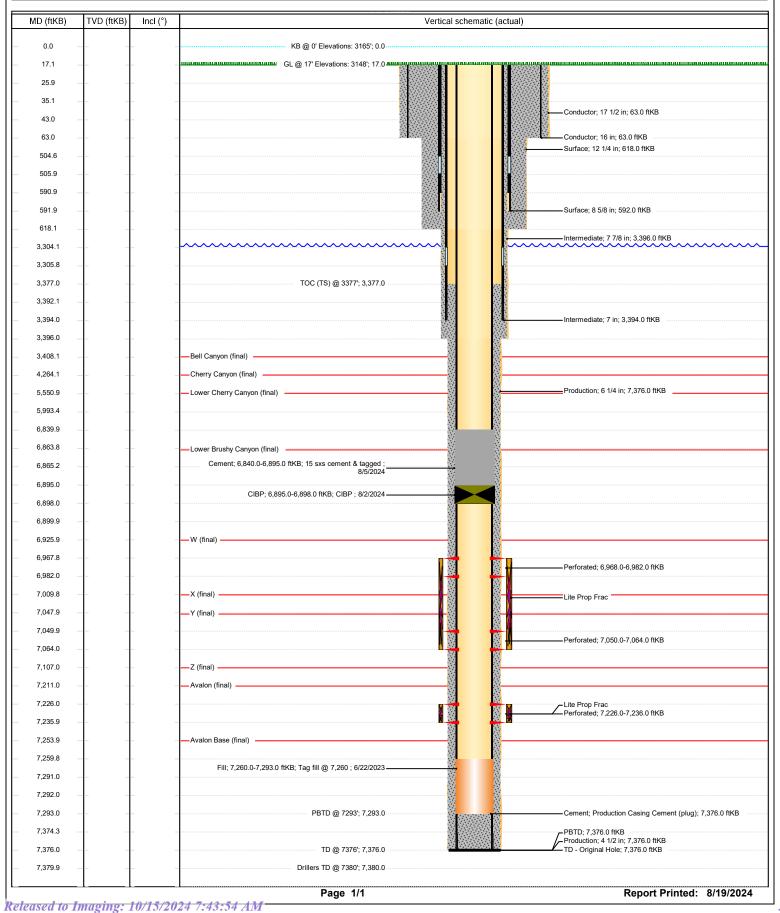

PLU 281 - Proposed WBD TA ReEnter

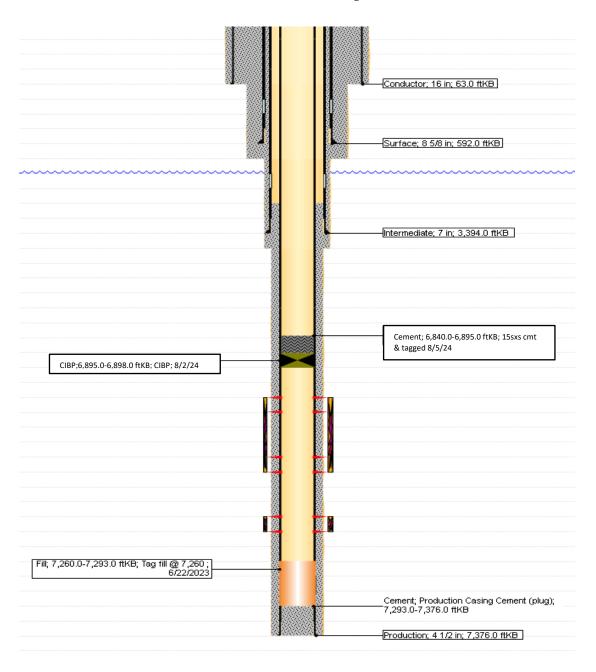

a) If leak is below (CIBP leakage) Dump 35' of Cement & PT b) If leak is above (Casing leak) hunt for hole and submit NOI to P&A

BUREAU OF LAND MANAGEMENT

Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

Conditions of Approval for Temporary Abandonment of Wells

Definition: A temporarily abandoned well is a completion that is not capable of production in paying quantities, but which may have future value. Pursuant to 43 CFR 3162.3-4 (c), no well may be temporarily abandoned for more than 30 days without the prior approval of the authorized officer.

- 1. TA status will be effective for a period of up to one year from the date of sundry approval and can be renewed annually thereafter per IM NM-2016-017.
- 2. A bridge plug (CIBP) must be installed 50 to 100 feet above any open perforations or open hole. The CIBP must be capped with either a minimum of 25 sacks of cement if placed with tubing or 35 feet of cement if placed with a bailer. The top of the cement must be verified by tagging.
- 3. The wellbore must be filled with corrosion inhibited fluid and pressure tested to 500 psi. The casing shall be capable of holding this pressure for at least 30 minutes. If the well does not pass the casing integrity test, then the operator shall, within 30 days, submit a procedure to either repair the casing or to plug and abandon the well.
- 4. Contact the appropriate BLM office at least 24 hours prior to the scheduled Casing Integrity Test. For wells in Eddy County, 575-361-2822; Lea County 575-393-3612.
- 5. All downhole production/injection equipment (tubing, rods, etc.) shall be removed from the casing if it is not isolated by a packer.
- 6. A bradenhead test must be conducted. If the test indicates a problem, a remedial plan and time frame for remediation shall be submitted within ninety (90) days of the test.
- 7. Submit a subsequent Sundry Notice (Form 3160-5) with the following information:
 - a. A well bore diagram with all perforations, CIBP's, and tops of cement on CIBP's.
 - b. A description of the temporary abandonment procedure.
 - c. A clear copy or the original of the pressure test chart.

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 392173

CONDITIONS

Operator:	OGRID:
XTO PERMIAN OPERATING LLC.	373075
6401 HOLIDAY HILL ROAD	Action Number:
MIDLAND, TX 79707	392173
	Action Type:
	[C-103] NOI Temporary Abandonment (C-103I)

CONDITIONS

Created By	Condition	Condition Date
gcordero	workover as approved by BLM	10/15/2024