Form 3160-3 FORM APPROVED OMB No. 1004-0137 (June 2015) Expires: January 31, 2018 **UNITED STATES** DEPARTMENT OF THE INTERIOR 5. Lease Serial No. BUREAU OF LAND MANAGEMENT APPLICATION FOR PERMIT TO DRILL OR REENTER 6. If Indian, Allotee or Tribe Name 7. If Unit or CA Agreement, Name and No. DRILL REENTER 1a. Type of work: 1b. Type of Well: Oil Well Gas Well Other 8. Lease Name and Well No. 1c. Type of Completion: Hydraulic Fracturing Single Zone Multiple Zone 2. Name of Operator 9. API Well No. 30-025-53760 10. Field and Pool, or Exploratory 3a. Address 3b. Phone No. (include area code) 4. Location of Well (Report location clearly and in accordance with any State requirements.\*) 11. Sec., T. R. M. or Blk. and Survey or Area At surface At proposed prod. zone 14. Distance in miles and direction from nearest town or post office\* 12. County or Parish 13. State 15. Distance from proposed\* 16. No of acres in lease 17. Spacing Unit dedicated to this well location to nearest property or lease line, ft. (Also to nearest drig. unit line, if any) 18. Distance from proposed location\* 19. Proposed Depth 20. BLM/BIA Bond No. in file to nearest well, drilling, completed, applied for, on this lease, ft. 21. Elevations (Show whether DF, KDB, RT, GL, etc.) 22. Approximate date work will start\* 23. Estimated duration 24. Attachments The following, completed in accordance with the requirements of Onshore Oil and Gas Order No. 1, and the Hydraulic Fracturing rule per 43 CFR 3162.3-3 (as applicable) 1. Well plat certified by a registered surveyor. 4. Bond to cover the operations unless covered by an existing bond on file (see 2. A Drilling Plan. Item 20 above). 3. A Surface Use Plan (if the location is on National Forest System Lands, the 5. Operator certification. SUPO must be filed with the appropriate Forest Service Office). 6. Such other site specific information and/or plans as may be requested by the 25. Signature Name (Printed/Typed) Date Title Approved by (Signature) Name (Printed/Typed) Date Title Office Application approval does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Conditions of approval, if any, are attached. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

APPROVED WITH CONDITIONS Released to Imaging: 10/22/2024 1:11:41 PM Approval Date: 10/04/2024

\*(Instructions on page 2)

<u>C-102</u>					State of New ls & Natural	v Mexico l Resources	 Department	;	Revise	ed July 9, 2024	
Submit Electronic: Via OCD Permitti			0,	*		ION DIVIS	1		Initial Submittal		
								Submittal Type:	Amended Report		
								Type.	As Drilled		
		V	ELL LO	CATIO	N AND AC	REAGE DE	EDICATIO	N PLAT			
	-025-537	760		7088	Pool Na	wC-0	)25 G-08 S	S2535340	);BONE SI	PRING	
Property Code  3  OGRID No.	36422		Property Name Operator Name		HUNEKE	FED COM			Well Number  Ground Level Eleve	138H	
22	28937		Operator Ivanie		DOR PRODI	DDUCTION COMPANY 3373'					
Surface Owner:	State Fee	Tribal Federal				Mineral Owner:	State Fee Tribal	l Federal			
					Surface	Location					
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the N/S	Feet from the E/W	Latitude		Longitude	County	
J	30	24-S	36-E	-	2404' S	1810' E	N 32.1878	3144   W 1	03.3014117	LEA	
		1			Bottom Ho	le Location		ı	1		
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the N/S	Feet from the E/W	Latitude		Longitude	County	
1	18	24-S	36-E	-	2530' S	1191' E	N 32.2171	953 W 1	03.2995106	LEA	
	1- en D e	· wulpe	· ••• II • DI				GVAD	In the			
Dedicated Acres	Infill or Deti	ining Well Defini	ing Well API		l	Overlapping Spacing	Unit (Y/N)	Consolidat	ed Code		
320						77 U.O. d. January		·· □v - □n			
Order Numbers						!	nder Common Owners	hip: Yes 110	0		
					Kick Off P						
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the N/S		Latitude		Longitude	County	
Н	30	24-S	36-E	-	2591' N	1191' E	N 32.1886	5009   VV I	03.2994127	LEA	
					First Take I	Point (FTP)					
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the N/S	Feet from the E/W	Latitude	$\overline{}$	Longitude	County	
Н	30	24-S	36-E		2541' N	1191' E	N 32.1887	′383   W 1	03.2994132	LEA	
					Last Take I	Point (LTP)					
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the N/S	Feet from the E/W	Latitude		Longitude	County	
ı	18	24-S	36-E	-	2530' S	1191' E	N 32.2171	953 W 1	03.2995106	LEA	
Unitized Area or Ar	ea of Uniform I	ntrest		Spacing Unity	Type	al Vertical	Ground	d Floor Elevation	3373'		
OPERATO  I hereby certify			tained herein	is true and	complete to the		RS CERTIFICA		this plat was plotte	d from field	
that this organ in the land in well at this loo or unleased my	rization eithe scluding the p cation pursuc ineral interes	er owns a work proposed bottom ant to a contra st, or to a volu	king interest on hole location act with an or untary pooling	or unleased n n or has a rig wner of a wo		notes of actual		me or under m	y supervision, and t		
or unleased mineral interest, or to a voluntary pooling agreement or a compulsory pooling order heretofore entered by the division.  If this well is a horizontal well, I further certify that this organization has received The consent of at least one lessee or owner of a working interest or unleased mineral interest in each tract (in the target pool or formation) in which any part of the well's completed interval will be located or obtained a compulsory					Par 2	1 16 B					
pooling order j	from the divi					l Profile	9124	/			
Debbie C	reed		UO/ 2	29/2024	7	<b>1</b>	WAL SUL				
Signature Deb	bie Cre	ed	Date			Signature and Seal of	of Professional Survey	yor Date			
Print Name debt	ie.cree	d@mata	dorreso	urces.co	om	Certificate Number	Date	of Survey 04/21/2021	·		

C-102 Submit Electronically		, Minerals	ate of New & Natura	l Resource		nent	Revised July 9, 2024		
Via OCD Permitting		OIL CON	SERVAT	ION DIV	ISION		Submittal	Initial Submittal	
							Type:	Amended Report	
Property Name and Well Number								As Drilled	
		Н	JNEKE FE	D COM 1	38H				
					l				
	12	7			7	8	_		
	13	18		 	18	17			
		ļ		!		l I			
		LOT 1	- · · - · · -	— NAD27 - —	NAD27 X=821063.64				
SURFACE LOCATION (SHL)				X=819744.42 Y=444337.29	Y=444346.45 NAD83	 		BLM PERF. POINT (BPP2)	
NEW MEXICO EAST			  -  -	NAD83 X=860930.33 —	X=862249.58 - Y=444405.79	1		NEW MEXICO EAST NAD 1983	
NAD 1983 X=860575 Y=433593		LOT 2	L—-	Y=444396.62	<b>3</b>			X=861158 Y=436476	
LAT.: N 32.1878144 LONG.: W 103.3014117				LPP-BHL	7 - 1191' - 5			LAT.: N 32.1957218 LONG.: W 103.2994371	
NAD 1927 X=819388 Y=433534			l		<b>V</b>	NAD		NAD 1927 X=819972 Y=436416	
LAT.: N 32.1876877		LOT 3	<u> </u>	2530′	<del>[</del> ] · · — · · <del>/</del>	X=8210 Y=4417	06.28	LAT.: N 32.1955950 LONG.: W 103.2989716	
LONG.: W 103.3009465 2404' FSL 1810' FEL						NAD X=8622 Y=4417	83.05	0' FNL 1191' FEL	
KICK OFF POINT (KOP)	13	LOT 4 18		BPP3-	1191'—1	17	00.04	BLM PERF. POINT (BPP3)	
NEW MEXICO EAST NAD 1983	24	19		1	19	20		NEW MEXICO EAST NAD 1983	
X=861190 Y=433885 LAT.: N 32.1886009			: 	i 		1		X=861092 Y=441758 LAT.: N 32.2102419	
LONG.: W 103.2994127		LOT 1		! ! !				LONG.: W 103.2994868 NAD 1927	
NAD 1927 X=820004 Y=433826			+ · · · - · · - :	<u>-</u>	10353	NAD2 X=82113	30.10	X=819906 Y=441699	
LAT.: N 32.1884740 LONG.: W 103.2989475			NMNM 138904	į	359.28°	Y=43906 NAD8	33	LAT.: N 32.2101152 LONG.: W 103.2990206	
2591' FNL 1191' FEL		LOT 2	: 100004 	<u> </u> 	S = 35	X=86231 Y=43912	24.82	0' FNL 1191' FEL	
FIRST PERF. POINT (FPP)  NEW MEXICO EAST			:		4	Ĭ		LAST PERF. POINT (LPP) ITOM HOLE LOCATION (BHL)	
NAD 1983						NAD	27	NEW MEXICO EAST NAD 1983	
X=861190 Y=433935 LAT.: N 32.1887383		<u>LOT3</u>	: <b>+</b> · · · <del></del> · · · -	<u> </u>	<u> </u>	X=82116 Y=43642		X=861060 Y=444288	
LONG.: W 103.2994132 NAD 1927						NAD8 X=86234	48.74	LAT.: N 32.2171953 LONG.: W 103.2995106	
X=820003 Y=433876 LAT.: N 32.1886115		LOT 4	!		1191'—	Y=43648	33.85	NAD 1927 X=819874 Y=444228	
LONG.: W 103.2989480	24	19	<u> </u>	BPP2	<b>1</b> 0-1	161— −		LAT.: N 32.2170686 LONG.: W 103.2990441	
2541' FNL 1191' FEL  BLM PERF. POINT (BPP1)	25	30			30	729		2530' FSL 1191' FEL	
NEW MEXICO EAST					ERPP1	1			
NAD 1983 X=861174 Y=435155		LOT 1  LOT 2		2591	1191'	4			
LAT.: N 32.1920926 LONG.: W 103.2994247		l .	:   NAD27	64.62° 1.4′		1		RVEYORS CERTIFICATION	
NAD 1927	R-35-E	R-36-E	NAD27 : X=819876.20 Y=433774.95	% KOP	1191'—	7	plat u made	by certify that the well location shown on this as plotted from field notes of actual surveys by me or under my supervision, and that the	
X=819988 Y=435096 LAT.: N 32.1919658	T-24-S.	T-24-S, I	NAD83 X=861062.5			987	04/21 Date of		
LONG.: W 103.2989593 1320' FNL 1191' FEL	<u> </u>	ř	Y=433833.9	SHL	05 00 	= 359.		re and Seal of Professional Surveyor:	
1020 1112 1101 1 2		LOT 3	:		<i>1810'</i> : NAD27	A A		CEL M. BAP	
			+ · - · · -	2404′	X=821195.60 Y=433785.13	†		CEL M. BAR	
		LOTA	138909		NAD83 X=862381.94	]			
	25	10T 4 30	:		Y=433844.18	29	_	25116	
	<del>3</del> 6	31			31	1 32		2 / Haro 4 / 2 /	
								10NAL SIF	
Released to Imaging: 10/22/2024 1	:11:41 PM							MAL 30	

# State of New Mexico Energy, Minerals and Natural Resources Department

Submit Electronically
Via E-permitting

2,200

2,200

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

### NATURAL GAS MANAGEMENT PLAN

This Natural Gas Management Plan must be submitted with each Application for Permit to Drill (APD) for a new or recompleted well.

# Section 1 – Plan Description Effective May 25, 2021

I. Operator: Matador P	roduction C	ompany	_OGRID: <u>2289</u>	37	Date:	10/10/2024
II. Type: ★Original □	Amendment of	due to □ 19.15.27.9.□	0(6)(a) NMAC [	□ 19.15.27.9.D(6	)(b) NMAC □ Ot	her.
If Other, please describe:						
III. Well(s): Provide the be recompleted from a sin					vells proposed to b	be drilled or proposed to
Well Name	API	ULSTR	Footages	Anticipated Oil BBL/D	Anticipated Gas MCF/D	Anticipated Produced Water BBL/D
Huneke Fed Com #137H	TBD	J-30-24S-36E	2,429' FSL & 1,810' FEL	900	1,300	1,500
Huneke Fed Com #138H	TBD	J-30-24S-36E	2,404' FSL & 1,810' FEL	900	1,300	1,500

2,429' FSL & 1,740' FEL

2,404' FSL & 1,740' FEL 800

800

1,800

1,800

Huneke Fed Com #213H

Huneke Fed Com #214H

TBD

TBD

J-30-24S-36E

J-30-24S-36E

IV. Central Delivery Point Name: Weinberger-Bivins TB

[See 19.15.27.9(D)(1) NMAC]

V. Anticipated Schedule: Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

Well Name	API	Spud Date	TD Reached Date	Completion Commencement Date	Initial Flow Back Date	First Production Date
Huneke Fed Com #137H	TBD	04/23/2025	05/18/2025	06/10/2025	09/20/2025	09/20/2025
Huneke Fed Com #138H	TBD	07/11/2025	08/10/2025	08/23/2025	09/28/2025	09/28/2025
Huneke Fed Com #213H	TBD	05/19/2025	06/14/2025	06/27/2025	09/23/2025	09/23/2025
Huneke Fed Com #214H	TBD	06/15/2025	07/10/2025	07/18/2025	09/26/2025	09/26/2025

VI. Separation Equipment: Attach a complete description of how Operator will size separation equipment to optimize gas capture.

VII. Operational Practices: Attach a complete description of the actions Operator will take to comply with the requirements of Subsection A through F of 19.15.27.8 NMAC.

VIII. Best Management Practices: Attach a complete description of Operator's best management practices to minimize venting during active and planned maintenance.

### Section 2 – Enhanced Plan EFFECTIVE APRIL 1, 2022

Beginning April 1, 2022, an operator that is not in compliance with its statewide natural gas capture requirement for the applicable reporting area must complete this section.

Operator certifies that it is not required to complete this section because Operator is in compliance with its statewide natural gas capture requirement for the applicable reporting area.

### IX. Anticipated Natural Gas Production:

Well	API	Anticipated Average Natural Gas Rate MCF/D	Anticipated Volume of Natural Gas for the First Year MCF

### X. Natural Gas Gathering System (NGGS):

Operator	System	ULSTR of Tie-in	Anticipated Gathering Start Date	Available Maximum Daily Capacity of System Segment Tie-in

- **XI.** Map.  $\square$  Attach an accurate and legible map depicting the location of the well(s), the anticipated pipeline route(s) connecting the production operations to the existing or planned interconnect of the natural gas gathering system(s), and the maximum daily capacity of the segment or portion of the natural gas gathering system(s) to which the well(s) will be connected.
- XII. Line Capacity. The natural gas gathering system  $\square$  will  $\square$  will not have capacity to gather 100% of the anticipated natural gas production volume from the well prior to the date of first production.
- XIII. Line Pressure. Operator □does □does not anticipate that its existing well(s) connected to the same segment, or portion, of the natural gas gathering system(s) described above will continue to meet anticipated increases in line pressure caused by the new well(s).
- ☐ Attach Operator's plan to manage production in response to the increased line pressure.
- XIV. Confidentiality: □ Operator asserts confidentiality pursuant to Section 71-2-8 NMSA 1978 for the information provided in Section 2 as provided in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and attaches a full description of the specific information for which confidentiality is asserted and the basis for such assertion.

(i)

# Section 3 - Certifications Effective May 25, 2021

Operator certifies that, after reasonable inquiry and based on the available information at the time of submittal: Operator will be able to connect the well(s) to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system; or ☐ Operator will not be able to connect to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system. If Operator checks this box, Operator will select one of the following: Well Shut-In. 

Operator will shut-in and not produce the well until it submits the certification required by Paragraph (4) of Subsection D of 19.15.27.9 NMAC; or Venting and Flaring Plan. 

Operator has attached a venting and flaring plan that evaluates and selects one or more of the potential alternative beneficial uses for the natural gas until a natural gas gathering system is available, including: power generation on lease; (a) (b) power generation for grid; compression on lease; (c) liquids removal on lease; (d) reinjection for underground storage; (e) reinjection for temporary storage; (f) reinjection for enhanced oil recovery; (g) (h) fuel cell production; and

## Section 4 - Notices

1. If, at any time after Operator submits this Natural Gas Management Plan and before the well is spud:

other alternative beneficial uses approved by the division.

- (a) Operator becomes aware that the natural gas gathering system it planned to connect the well(s) to has become unavailable or will not have capacity to transport one hundred percent of the production from the well(s), no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised venting and flaring plan containing the information specified in Paragraph (5) of Subsection D of 19.15.27.9 NMAC; or
- (b) Operator becomes aware that it has, cumulatively for the year, become out of compliance with its baseline natural gas capture rate or natural gas capture requirement, no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised Natural Gas Management Plan for each well it plans to spud during the next 90 days containing the information specified in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and shall file an update for each Natural Gas Management Plan until Operator is back in compliance with its baseline natural gas capture rate or natural gas capture requirement.
- 2. OCD may deny or conditionally approve an APD if Operator does not make a certification, fails to submit an adequate venting and flaring plan which includes alternative beneficial uses for the anticipated volume of natural gas produced, or if OCD determines that Operator will not have adequate natural gas takeaway capacity at the time a well will be spud.

I certify that, after reasonable inquiry, the statements in and attached to this Natural Gas Management Plan are true and correct to the best of my knowledge and acknowledge that a false statement may be subject to civil and criminal penalties under the Oil and Gas Act.

Signature: Gscar July			
Printed Name: Oscar Gonzalez			
Title: Production Engineer			
E-mail Address: ogonzalez@matadorresources.com			
Date: 10/10/2024			
Phone: 972 – 629 – 2147			
OIL CONS	ERVATION DIVISION		
(Only applicable when	n submitted as a standalone f	orm)	
Approved By:			
Title;			
Approval Date:			
Conditions of Approval:			

### Addendum to Natural Gas Management Plan for Matador's

# Huneke Fed Com #137H, Huneke Fed Com #138H, Huneke Fed Com #213H, Huneke Fed Com #214H

### VI. Separation Equipment

Flow from the wells will be routed via a flowline to a 48"x15" three phase separator dedicated to the well. The first stage separators are sized with input from BRE ProMax and API 12J. Anticipated production rates can be seen in the below table. Liquid retention times at expected maximum rates will be >3 minutes. Gas will be routed from the first stage separator to sales. Hydrocarbon liquids are dumped from the first stage separator and commingled to one or more heater treaters. The flash gas from the heater treater(s) could either be sent to sales or routed to a compressor if the sales line pressure is higher than the MAWP of the heater treater (125 psi). From the heater treaters, hydrocarbon liquid will be routed to the tanks where vapor is compressed by a VRU if technically feasible to either sales or a compressor if the sales line pressure is higher than the VRU's maximum discharge pressure (~150 psi). Therefore, Matador has sized our separation equipment to optimize gas capture and our separation equipment is of sufficient size to handle the expected volumes of gas.

Well Name	Anticipated Oil BBL/D	Anticipated Gas MCF/D	Anticipated Produced Water BBL/D
Huneke Fed Com #137H	1,100	1,300	2,000
Huneke Fed Com #138H	1,100	1,300	2,000
Huneke Fed Com #213H	900	800	2,100
Huneke Fed Com #214H	900	800	2,100

### VII. Operation Practices

Although not a complete recitation of all our efforts to comply with a subsection A through F of 19.15.27.8 NMAC, a summary is as follows. During drilling, Matador will have a properly sized flare stack at least 100 feet from the nearest surface hole. During initial flowback we will route the flowback fluids into completion or storage tanks and, to the extent possible, flare rather than vent any gas. We will commence operation of a separator as soon as technically feasible, and have instructed our team that we want to connect the gas to sales as soon as possible but not later than 30 days after initial flowback.

Regarding production operations, we have designed our production facilities to be compliant with the requirements of Part E of 19.15.27.8 NMAC. We will instruct our team to perform the AVOs on the frequency required under the rules. While the well is producing, we will take steps to minimize flaring during maintenance, as set forth below, and we have a process in place for the measuring of any flared gas and the reporting of any reportable flaring events. VII. Best Management Practices

Steps are taken to minimize venting during active or planned maintenance when technically feasible including:

- Isolating the affected component and reducing pressure through process piping
- Blowing down the equipment being maintained to a control device
- Performing preventative maintenance and minimizing the duration of maintenance activities
- Shutting in sources of supply as possible
- Other steps that are available depending on the maintenance being performed

**Huneke Fed Com 138H** 

SHL: 2404' FSL & 1810' FEL Section 30 BHL: 2530' FSL & 1191' FEL Section 18

Township/Range: 24S 36E

**Elevation Above Sea Level: 3373** 

### **Drilling Operation Plan**

Proposed Drilling Depth: 22195' MD / 11171' TVD

Type of well: Horizontal well, no pilot hole

Permitted Well Type: Oil

Geologic Name of Surface Formation: Quaternary Deposits

KOP Lat/Long (NAD83): 32.1886009 N / -103.2994127 W TD Lat/Long (NAD83): 32.2171953 N / -103.2995106 W

### 1. Estimated Tops

Formation	MD (ft)	TVD (ft)	Thickness (ft)	Lithology	Resource
Rustler	1,788	1,788	484	Anhydrite	Barren
Salado (Top of Salt)	2,272	2,272	2,066	Salt	Barren
Capitan	4,338	4,338	1,712	Water/Loss Cir	Barren
Bell Canyon	6,050	6,050	264	Sandstone	Oil/Natural Gas
Cherry Canyon	6,314	6,314	897	Sandstone	Oil/Natural Gas
Brushy Canyon	7,211	7,211	1,150	Sandstone	Oil/Natural Gas
Bone Spring Lime	8,361	8,361	1,303	Limestone	Oil/Natural Gas
1st Bone Spring Sand	9,664	9,664	118	Sandstone	Oil/Natural Gas
2nd Bone Spring Carb	9,782	9,782	348	Carbonate	Oil/Natural Gas
2nd Bone Spring Sand	10,130	10,130	636	Sandstone	Oil/Natural Gas
3rd Bone Spring Carb	10,766	10,766	382	Carbonate	Oil/Natural Gas
КОР	10,882	10,829	-	Sandstone	Oil/Natural Gas
3rd Bone Spring Sand	11,220	11,148		Sandstone	Oil/Natural Gas
TD	22,195	11,171		Shale	Oil/Natural Gas

### 2. Notable Zones

3rd Bone Spring is the goal. All perforations will be within the setback requirements as prescribed or permitted by the New Mexico Oil Conservation Division. OSE estimated ground water depth at this location is 240

### 3. Pressure Control

### Equipment

A 18,000' 10,000-psi BOP stack consisting of 3 rams with 2 pipe rams, 1 blind ram, and one annular preventer will be utilized below surface casing to TD. See attachments for BOP and choke manifold diagrams. An accumulator complying with Title 43 CFR 3172 requirements for the pressure rating of the BOP stack will be present. A rotating head will also be installed as needed.

### **Testing Procedure**

BOP will be inspected and operated as required in Title 43 CFR 3172. Kelly cock and sub equipped with a full opening valve sized to fit the drill pipe and collars will be available on the rig floor in the open position.

A third party company will test the BOPs.

After setting surface casing, a minimum 10M BOPE system will be installed. Test pressures will be 250 psi low and 10,000 psi high with the annular preventer being tested to 250 psi low and 5000 psi high before drilling below surface shoe. In the event that the rig drills multiple wells on the pad and any seal subject to test pressures are broken, a full BOP test will be performed when the rig returns and the 10M BOPE system is reinstalled.

### Variance Request

Matador requests a variance to have the option of running a multi-bowl wellhead assembly for setting the Intermediate 1, and Production Strings. The BOPs will not be tested again unless any flanges are separated.

Matador requests a variance to drill this well using a co-flex line between the BOP and choke manifold. Certification for proposed co-flex hose is attached. The hose is not required by the manufacturer to be anchored. If the specific hose is not available, then one of equal or higher rating will be used.

Matador requests a variance to have the option of batch drilling this well with other wells on the same pad. In the event that this well is batch drilled, the wellbore will be secured with a blind flange of like pressure. When the rig returns to this well and BOPs are installed, the operator will perform a full BOP test.

Matador requests a variance to drill this well using a 5M annular preventer with a 10M BOP ram stack. The "Well Control Plan For 10M MASP Section of Wellbore" is attached.

Matador request the option to offline cement surface casing. The "Offline Cement Procedure - Surface Casing" is attached for review. No changes in cement program are necessary.

Matador request the option to offline cement intermediate casing. The "Offline Cementing - Intermediate Casing" Procedure is attached for review. No changes in cement program are necessary.

Matador request the option to break test the BOP during batch drilling operations. The "Modified BOP Testing Procedure for Batch Drilling" Procedure is attached for review.

### 4. Casing & Cement

All casing will be API and new. See attached casing assumption worksheet.

String	Hole Size (in)	Set MD (ft)	Set TVD (ft)	Casing Size (in)	Wt. (lb/ft)	Grade	Joint	Collapse	Burst	Tension
Surface	17.5	0 - 1813	0 - 1813	13.375	54.5	J-55	BUTT	1.125	1.125	1.8
Intermediate 1	12.25	0 - 6100	0 - 6100	7.625	29.7	P-110	BUTT	1.125	1.125	1.8
	9.875	6100 - 10732	6100 - 10679	7.625	29.7	P-110	BUTT	1.125	1.125	1.8
Production	6.75	0 - 22195	0 - 11171	5.5	20	P-110	Hunting TLW-SC	1.125	1.125	1.8

- All casing strings will be tested in accordance with Title 43 CFR 3172.7(b)(8)
- Rustler top will be validated via drilling parameters (i.e. reduction in ROP) and surface casing setting depth

### revised accordingly if needed

- All non-API joint connections will be of like or greater quality, and as run specification sheets will be on location for review

### Variance Request

Matador request a variance to wave the centralizer requirement for the 7-5/8" casing and the 5-1/2" SF/Flush casing in the 6-3/4" hole.

If a DV tool is used, depth(s) will be adjusted based on hole conditions and cement volumes will be adjusted proportionally. DV tool will be set a minimum of 50 feet below previous casing and a minimum of 200 feet above the current shoe. Lab reports with the 500 psi compressive strength time for the cement will be onsite for review. Option to cancel 2nd stage cement if cement is circulated on 1st stage.

Matador request a variance to utilize a surface setting rig. If this is used, Matador request the option to drill either 17.5" or 20" surface hole, cement volumes will be adjusted accordingly.

Matador request option to switch to Design B (4 string) if losses are observed in Capitan Reef. If losses are observed, an additional intermediate casing string will be ran to isolate losses. No other changes in well design are required.

Primary Cement Design - DV/Packer 2-Stage Cement

String	Туре	Sacks	Yield	Cu. Ft.	Weight	Percent Excess	Top of Cement (ft)	Class	Blend
Surface	Lead	880	1.72	1508	13.5	50%	0	C	5% NaCl + LCM
	Tail	300	1.38	413	14.8	50%	1450	С	5% NaCl + LCM
Intermediate 1 w/ DV @ 4388'	Stg 2 Tail	1660	1.78	2959	13.5	10%	0	C	5% NaCl + LCM
	Stg 1 Lead	2690	1.84	4954	12.5	35%	0	С	5% NaCl + LCM
	Stg 1 Tail	230	1.33	311	13.2	35%	9732	С	5% NaCl + LCM
Production	Tail	900	1.35	1215	13.2	25%	10532	A/C	Fluid Loss + Dispersant + Retarder

### 5. Mud Program

An electronic Pason mud monitoring system complying with Title 43 CFR 3172 will be used. All necessary mud products (barite, bentonite, LCM) for weight addition and fluid loss control will be on location at all times. Mud program is subject to change due to hole conditions.

Hole Section	Hole Size (in)	Mud Type	Interval MD (ft)	Density (lb/gal)	Viscosity	Fluid Loss
Surface	17.5	Spud Mud	0 - 1813	8.3 - 9.2	28-30	NC
Intermediate 1	12.25 & 9.875	Diesel Brine Emulsion	1813 - 10732	8.4 - 9.4	28-30	NC
Production	6.75	OBM/Cut Brine	10732 - 22195	9.5 - 12.1	50-65	<20

### 6. Cores, Test, & Logs

No core or drill stem test is planned.

No electric logs are planned at this time. GR will be collected through the MWD tools from Intermediate casing to TD. CBL with CCL will be run as far as gravity will let it fall to top of curve. We will be running a Neutron log on one of the wells on each pad.

### 7. Down Hole Conditions

No abnormal pressure or temperature is expected. Bottom hole pressure is 7029 psi. Maximum anticipated surface pressure is 4571 psi. Expected bottom hole temperature is 142 F.

In accordance with Title 43 CFR 3176, Matador does not anticipate that there will be enough H2S from the surface to the Bone Spring formations to meet the BLM's minimum requirements for the submission of an "H2S Drilling Operation Plan" or "Public Protection Plan" for the drilling and completion of this well. Since we have an H2S safety package on all wells, attached is an "H2S Drilling Operations Plan". Adequate flare lines will be installed off the mud/gas separator where gas may be flared safely. All personnel will be familiar with all aspects of safe operation of equipment being used.

**Huneke Fed Com 138H** 

SHL: 2404' FSL & 1810' FEL Section 30 BHL: 2530' FSL & 1191' FEL Section 18

Township/Range: 24S 36E

**Elevation Above Sea Level: 3373** 

### Design B (4 string) Differences

- Design B will add an additional intermediate string of casing set at the top of Bell Canyon if significant losses are observed while drilling 12.25" int 1 hole section. If no losses are observed, Design A will be utilized and hole size will be slimmed down from 12.25" to 9.875" and a single 7.625" int string of casing will be ran. Cement and mud designs are adjusted accordingly below, along with the 10-3/4" BUTT-SC casing spec sheet and 4-string wellhead diagram. Proper notification will be given prior to running and cementing casing.

### **Drilling Operation Plan**

Proposed Drilling Depth: 22195' MD / 11171' TVD

Type of well: Horizontal well, no pilot hole

Permitted Well Type: Oil

Geologic Name of Surface Formation: Quaternary Deposits

KOP Lat/Long (NAD83): 32.1886009 N / -103.2994127 W TD Lat/Long (NAD83): 32.2171953 N / -103.2995106 W

### 1. Estimated Tops

Formation	MD (ft)	TVD (ft)	Thickness (ft)	Lithology	Resource
Rustler	1,788	1,788	484	Anhydrite	Barren
Salado (Top of Salt)	2,272	2,272	2,066	Salt	Barren
Capitan	4,338	4,338	1,712	Water/Loss Cir	Barren
Bell Canyon	6,050	6,050	264	Sandstone	Oil/Natural Gas
Cherry Canyon	6,314	6,314	897	Sandstone	Oil/Natural Gas
Brushy Canyon	7,211	7,211	1,150	Sandstone	Oil/Natural Gas
Bone Spring Lime	8,361	8,361	1,303	Limestone	Oil/Natural Gas
1st Bone Spring Sand	9,664	9,664	118	Sandstone	Oil/Natural Gas
2nd Bone Spring Carb	9,782	9,782	348	Carbonate	Oil/Natural Gas
2nd Bone Spring Sand	10,130	10,130	636	Sandstone	Oil/Natural Gas
3rd Bone Spring Carb	10,766	10,766	382	Carbonate	Oil/Natural Gas
KOP	10,882	10,829	-	Sandstone	Oil/Natural Gas
3rd Bone Spring Sand	11,220	11,148		Sandstone	Oil/Natural Gas
TD	22,195	11,171		Shale	Oil/Natural Gas

### 2. Notable Zones

3rd Bone Spring is the goal. All perforations will be within the setback requirements as prescribed or permitted by the New Mexico Oil Conservation Division. OSE estimated ground water depth at this location is 240

### 3. Pressure Control

Equipment

A 18,000' 10,000-psi BOP stack consisting of 3 rams with 2 pipe rams, 1 blind ram, and one annular preventer will be utilized below surface casing to TD. See attachments for BOP and choke manifold diagrams. An accumulator complying with Title 43 CFR 3172 requirements for the pressure rating of the BOP stack will be present. A rotating head will also be installed as needed.

### **Testing Procedure**

BOP will be inspected and operated as required in Title 43 CFR 3172. Kelly cock and sub equipped with a full opening valve sized to fit the drill pipe and collars will be available on the rig floor in the open position.

A third party company will test the BOPs.

After setting surface casing, a minimum 10M BOPE system will be installed. Test pressures will be 250 psi low and 10,000 psi high with the annular preventer being tested to 250 psi low and 5000 psi high before drilling below surface shoe. In the event that the rig drills multiple wells on the pad and any seal subject to test pressures are broken, a full BOP test will be performed when the rig returns and the 10M BOPE system is reinstalled.

#### Variance Request

Matador requests a variance to have the option of running a multi-bowl wellhead assembly for setting the Intermediate 1, Intermediate 2, and Production Strings. The BOPs will not be tested again unless any flanges are separated.

Matador requests a variance to drill this well using a co-flex line between the BOP and choke manifold. Certification for proposed co-flex hose is attached. The hose is not required by the manufacturer to be anchored. If the specific hose is not available, then one of equal or higher rating will be used.

Matador requests a variance to have the option of batch drilling this well with other wells on the same pad. In the event that this well is batch drilled, the wellbore will be secured with a blind flange of like pressure. When the rig returns to this well and BOPs are installed, the operator will perform a full BOP test.

Matador requests a variance to drill this well using a 5M annular preventer with a 10M BOP ram stack. The "Well Control Plan For 10M MASP Section of Wellbore" is attached.

Matador request the option to offline cement surface casing. The "Offline Cement Procedure - Surface Casing" is attached for review. No changes in cement program are necessary.

Matador request the option to offline cement intermediate casing. The "Offline Cementing - Intermediate Casing" Procedure is attached for review. No changes in cement program are necessary.

Matador request the option to break test the BOP during batch drilling operations. The "Modified BOP Testing Procedure for Batch Drilling" Procedure is attached for review.

#### 4. Casing & Cement

All casing will be API and new. See attached casing assumption worksheet.

String	Hole Size (in)	Set MD (ft)	Set TVD (ft)	Casing Size (in)	Wt. (lb/ft)	Grade	Joint	Collapse	Burst	Tension
Surface	17.5	0 - 1813	0 - 1813	13.375	54.5	J-55	BUTT	1.125	1.125	1.8

Intermediate 1	12.25	0 - 6100	0 - 6100	10.75	45.5	HCL-80	BUTT-SC	1.125	1.125	1.8
Intermediate 2	9.875	0 - 10732	0 - 10679	7.625	29.7	P-110	BUTT	1.125	1.125	1.8
Production	6.75	0 - 22195	0 - 11171	5.5	20	P-110	Hunting TLW-SC	1.125	1.125	1.8

- All casing strings will be tested in accordance with Title 43 CFR 3172.7(b)(8)
- Rustler top will be validated via drilling parameters (i.e. reduction in ROP) and surface casing setting depth revised accordingly if needed
- All non-API joint connections will be of like or greater quality, and as run specification sheets will be on location for review

### Variance Request

Matador request a variance to wave the centralizer requirement for the 7-5/8" casing and the 5-1/2" SF/Flush casing in the 6-3/4" hole.

If a DV tool is used, depth(s) will be adjusted based on hole conditions and cement volumes will be adjusted proportionally. DV tool will be set a minimum of 50 feet below previous casing and a minimum of 200 feet above the current shoe. Lab reports with the 500 psi compressive strength time for the cement will be onsite for review. Option to cancel 2nd stage cement if cement is circulated on 1st stage.

Matador request a variance to utilize a surface setting rig. If this is used, Matador request the option to drill either 17.5" or 20" surface hole, cement volumes will be adjusted accordingly.

Matador request option to switch to Design B (4 string) if losses are observed in Capitan Reef. If losses are observed, an additional intermediate casing string will be ran to isolate losses. No other changes in well design are required. The 10-3/4" SC casing spec sheet along with 4-string wellhead diagram are attached.

Primary Cement Design - DV/Packer 2-Stage Cement

String	Туре	Sacks	Yield	Cu. Ft.	Weight	Percent Excess	Top of Cement (ft)	Class	Blend
Surface	Lead	880	1.72	1511	13.5	50%	0	С	5% NaCl + LCM
Surface	Tail	300	1.38	413	14.8	50%	1450	С	5% NaCl + LCM
latara Pata 4	Stg 2 Tail	520	1.78	925	13.5	10%	0	C	5% NaCl + LCM
Intermediate 1 w/ DV @ 4200'	Stg 1 Lead	740	1.84	1359	12.5	50%	0	С	5% NaCl + LCM
1200	Stg 1 Tail	230	1.33	304	14.8	50%	5100	С	5% NaCl + LCM
Intermediate 2	Stg 2 Tail	770	1.78	1371	13.5	10%	0	С	5% NaCl + LCM
w/ DV @ 6150'	Stg 1 Lead	300	3.66	1098	10.3	35%	5900	A/C	Bentonite + 1% CaCL2 + 8% NaCl + LCM
0130	Stg 1 Tail	230	1.38	311	13.2	35%	9732	A/C	5% NaCl + LCM
Production	Tail	900	1.35	1215	13.2	25%	10532	A/C	Fluid Loss + Dispersant + Retarder

### 5. Mud Program

An electronic Pason mud monitoring system complying with Title 43 CFR 3172 will be used. All necessary mud products (barite, bentonite, LCM) for weight addition and fluid loss control will be on location at all times. Mud program is subject to change due to hole conditions.

Hole Section	Hole Size (in)	Mud Type	Interval MD (ft)	Density (lb/gal)	Viscosity	Fluid Loss
Surface	17.5	Spud Mud	0 - 1813	8.3 - 9.2	28-30	NC
Intermediate 1	12.25	Brine	1813 - 6100	9.1 - 10.3	28-30	NC
Intermediate 2	9.875	Cut Brine	6100 - 10732	8.4 - 9.4	28-30	NC
Production	6.75	OBM/Cut Brine	10732 - 22195	9.5 - 12.1	50-65	<20

### 6. Cores, Test, & Logs

No core or drill stem test is planned.

No electric logs are planned at this time. GR will be collected through the MWD tools from Intermediate casing to TD. CBL with CCL will be run as far as gravity will let it fall to top of curve. We will be running a Neutron log on one of the wells on each pad.

### 7. Down Hole Conditions

No abnormal pressure or temperature is expected. Bottom hole pressure is 7029 psi. Maximum anticipated surface pressure is 4571 psi. Expected bottom hole temperature is 142 F.

In accordance with Title 43 CFR 3176, Matador does not anticipate that there will be enough H2S from the surface to the Bone Spring formations to meet the BLM's minimum requirements for the submission of an "H2S Drilling Operation Plan" or "Public Protection Plan" for the drilling and completion of this well. Since we have an H2S safety package on all wells, attached is an "H2S Drilling Operations Plan". Adequate flare lines will be installed off the mud/gas separator where gas may be flared safely. All personnel will be familiar with all aspects of safe operation of equipment being used.

# Casing Specs - 10.75" 45.5lb BUTT-SC




# API 5CT 10.750" 45.50lb/ft HCL80 Casing Performance Data Sheet

Manufactured to specifications of API 5CT 9th edition and bears the API monogram.

Grade	HCL80
Grade	ПСЕОО
	Pipe Body Mechanical Properties
Minimum Yield Strength	80,000 psi
Maximum Yield Strength	95,000 psi
Minimum Tensile Strength	95,000 psi
Maximum Hardness	23.0 HRC
	·
	<u>Sizes</u>
OD	10 3/4
Nominal Wall Thickness	.400 in
Nominal Weight, T&C	45.50 lb/ft
Nominal Weight, PE	44.26 lb/ft
Nominal ID	9.950 in
Standard Drift	9.794 in
Alternate Drift	9.875 in
Coupling Special Clearance	<u>Size</u>
OD	11.25 in
Min. Length	10.625 in
n. Length ameter of Counter Bore	10.890 in
Width of bearing face	.375 in
[	Minimum Performance
Collapse Pressure	2,940 psi
Internal Pressure Yield	5,210 psi
Pipe body Tension Yield	1,040,000 lbs
Joint Strength STC	692,000 lbs
Joint Strength LTC	N/A
Joint Strength BTC	1,063,000 lbs
	Inspection and Testing
Visual	OD Longitidunal and independent 3rd party SEA
Visual	OD EONBRIGARIA AND INCEPTION OF DEATH
NDT	Independent 3rd party full body EMI and End Area Inspection after hydrotest
	Calibration notch sensitivity: 10% of specified wall thickness
	Color code
Pipe ends	<u>Color code</u> One red, one brown and one blue band
Couplings	Red with one brown band
Coupings	Ned with the brown band

# 4-String Wellhead Diagram

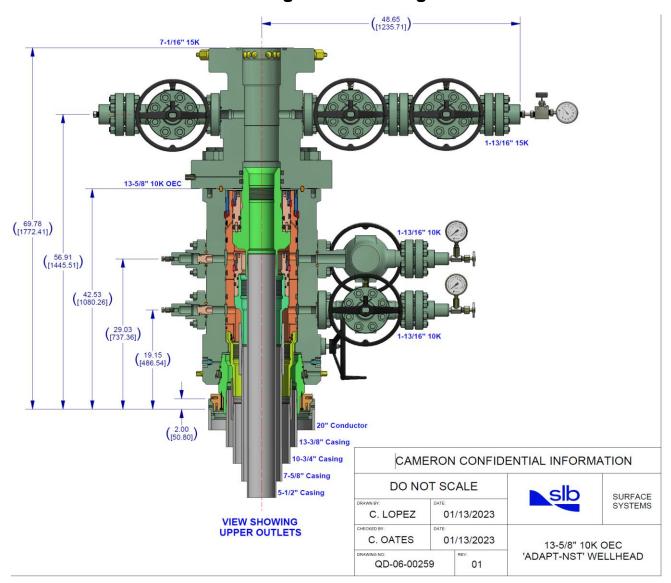

# **Casing Table Specification Sheet**

**Huneke Fed Com 138H** 

SHL: 2404' FSL & 1810' FEL Section 30 BHL: 2530' FSL & 1191' FEL Section 18

Township/Range: 24S 36E

**Elevation Above Sea Level: 3373** 

String	Hole Size (in)	Set MD (ft)	Set TVD (ft)	Casing Size (in)	Wt. (lb/ft)	Grade	Joint	Collapse	Burst	Tension
Surface	17.5	0 - 1813	0 - 1813	13.375	54.5	J-55	BUTT	1.125	1.125	1.8
Intermediate 1	12.25	0 - 6100	0 - 6100	7.625	29.7	P-110	BUTT	1.125	1.125	1.8
Production	6.75	0 - 22195	0 - 11171	5.5	20	P-110	Hunting TLW-SC	1.125	1.125	1.8

# **Casing Design Criteria and Load Case Assumptions**

Huneke Fed Com 138H Township/Range: 24S 36E SHL: 2404' FSL & 1810' FEL Section 30 Elevation Above Sea Level: 3373'

### **Surface Casing**

Collapse:  $DF_c = 1.125$ 

- a. Full Internal Evacuation: Collapse force equal to the mud gradient in which the casing will be run (0.43 psi/ft). The effects of axial load on collapse will be considered.
- b. Cementing: Collapse force equal to the gradient of planned cement slurries to planned depths and an internal force equal to mud gradient of displacement fluid (0.52 psi/ft).

Bust:  $DF_b = 1.125$ 

a. Pressure Test: Casing test per Onshore Oil and Gas Order No. 2 with an external force equal to the mud gradient in which the casing will be run (0.43 psi/ft), which is a more conservative backup force than pore

Tensile:  $DF_f = 1.8$ 

a. Overpull: A downward force of 100,000 lbs is applied at the shoe along with the weight of the casing string utilizing the effects of buoyancy.

### **Intermediate #1 Casing**

Collapse:  $DF_c = 1.125$ 

- a. Full Internal Evacuation: Collapse force equal to the mud gradient in which the casing will be run (0.52 psi/ft). The effects of axial load on collapse will be considered.
- b. Cementing: Collapse force equal to the gradient of planned cement slurries to planned depths and an internal force equal to mud gradient of displacement fluid (0.43 psi/ft).

Bust:  $DF_b = 1.125$ 

- a. Pressure Test: Casing test per Title 43 CFR 3172 with an external force equal to the mud gradient in which the casing will be run (0.52 psi/ft), which is a more conservative backup force than pore pressure.
- b. Gas Kick Profile: Internal burst force at the shoe will be Fracture Pressure at that depth. Surface burst pressure will be fracture gradient at setting depth less a gas gradient to equivalent height of 50 bbl kick with Drill Pipe inside casing and mud gradient with which the next hole section will be run above that (0.47 psi/ft). External force will be equal to the mud gradient in which the casing will be run (0.52 psi/ft), which is a more conservative backup force than pore pressure.
- c. Fracture at Shoe with 1/3 BHP at Surface: Internal burst force at the shoe will be Fracture Pressure at setting depth. Internal burst force at surface will be 1/3 of pore pressure at setting depth. External force will be equal to the mud gradient in which the casing will be run (0.52 psi/ft) which is a more conservative backup force than pore pressure.

Tensile:  $DF_f = 1.8$ 

a. Overpull: A downward force of 100,000 lbs is applied at the shoe along with the weight of the casing string utilizing the effects of buoyancy.

## **Production Casing**

Collapse:  $DF_c = 1.125$ 

- a. Full Internal Evacuation: Collapse force equal to the mud gradient in which the casing will be run (0.65 psi/ft). The effects of axial load on collapse will be considered.
- b. Cementing: Collapse force equal to the gradient of planned cement slurries to planned depths and mud gradient in which the casing will be run above that (0.65 psi/ft) and an internal force equal to mud gradient of displacement fluid (0.43 psi/ft).

Bust:  $DF_b = 1.125$ 

a. Pressure Test: 8000 psi casing test with an external force equal to the mud gradient in which the casing will be run (0.65 psi/ft), which is a more conservative backup force than pore pressure.

# **Casing Design Criteria and Load Case Assumptions**

b. Injection Down Casing: 9500 psi surface injection pressure plus an internal pressure gradient of 0.65 psi/ft with an external force equal to the mud gradient in which the casing will be run (0.65 psi/ft), which is a more conservative backup force than pore pressure.

Tensile:  $DF_f = 1.8$ 

a. Overpull: A downward force of 100,000 lbs is applied at the shoe along with the weight of the casing string utilizing the effects of buoyancy.

# **Offline Cementing - Surface Casing**

Huneke Fed Com 138H Township/Range: 24S 36E SHL: 2404' FSL & 1810' FEL Section 30 Elevation Above Sea Level: 3373'

Matador Production Company requests the option to cement the surface casing string offline as a prudent batch drilling efficiency of acreage development.


### **Cement Program**

No changes to the cement program will take place for offline cementing.

### Offline Cementing Procedure

The operational sequence will be as follows. Well must meet the below requirements to be a candidate for offline cementing, if wellbore conditions change, BLM will be notified.

- · No noticeable wellbore instability.
- Casing installed successfully with no issues.
- No observed shallow gas or other anomalies
- 1. Run casing as per normal operations. While running casing, confirm integrity of the float equipment (float collar and shoe).
- 2. Land casing with mandrel.
- 3. Install cap flange.
- 4. Skid rig to the next well on the pad.
- 5. Rig up on the well in accordance with the diagram shown below.

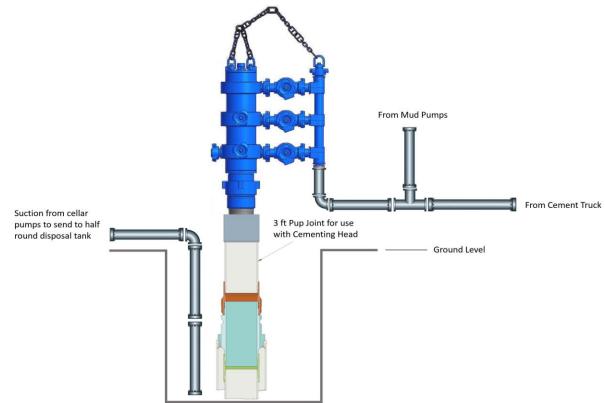

- 6. Circulate bottoms up with cement truck.
  - Max anticipated time before circulating with cement truck is 24 hours.
- 7. Perform cement job, taking returns in the cellar.
- 8. Confirm well is static and floats are holding following the cement job.
- 9. Remove cement equipment and install night cap with pressure gauge for monitoring.

Huneke Fed Com 138H Township/Range: 24S 36E SHL: 2404' FSL & 1810' FEL Section 30 Elevation Above Sea Level: 3373'

Matador Production Company requests the option to cement the intermediate casing string offline as a prudent batch drilling efficiency of acreage development.

### **Cement Program**


No changes to the cement program will take place for offline cementing.

### **Offline Cementing Procedure**

The operational sequence will be as follows. Well must meet the below requirements to be a candidate for offline cementing, if wellbore conditions change, BLM will be notified.


- No noticeable wellbore instability.
- Casing installed successfully with no issues.
- No observed shallow gas or other anomalies
- Intermediate hole section must have a MASP of 5,000 psi or lower.
- 1. Run casing as per normal operations. While running casing, confirm integrity of the float equipment (float collar and shoe).
- 2. Land Intermediate casing with fluted mandrel hanger through BOP stack.
- 3. Remove the landing joint and set packoff through BOP. Pressure test seals to 5,000 psi for 10 minutes. After the test, engage the lockring.
- 4. Notify the BLM 4 hours prior to N/D BOP and offline cementing. Confirm the following barriers are operational:
  - a. Inside Casing: 2 float valves and mud weight sufficient to hold back pore pressure
  - b. Annulus (outside) Casing: Packoff and mud weight sufficient to hold back pore pressure
- 5. Once the well is secure and BLM has been notified, proceed with nippling down BOP and installing cap flange.
- 6. Skid rig to the next well on the pad.
- 7. Rig up lines to take returns from wellhead through the cement choke manifold to the pits.
- 8. Attach a test pump with manifold to the open fitting and pump clean fluid until a stable test pressure of 5,000 psi is achieved. Hold pressure for 15 minutes. After a satisfactory test, bleed off test pressure, remove test pump and reinstall cap flange on the open fitting.
- 9. Attach the test pump to the upper outlet valve and pressure up the void area between the upper and lowermost O-rings until a stable test pressure of 5,000 psi is achieved. After a satisfactory test, bleed off all test pressure and leave the upper valve in the open position.
- 10. Place a mark across the top of the wellhead to monitor possible rotation of the tool during the cement job.
- 11. Install the casing hanger/packoff offline cementing tool. Rig up cement head and cementing lines. Pressure test lines against the cement head as per cement procedure.
- 12. Break circulation on well to confirm no restrictions. If shallow gas is encountered, shut in the well and reroute returns through the gas buster.
  - a. Max anticipated time before circulating with cement truck is 24 hours.
- 13. Establish circulation and cement casing as per plan, taking returns through the two 2-1/16" 5M gate valves on the housing lower outlets. At plug bump, pressure test casing to 0.22 psi/ft per foot of casing string length or 1,500 psi, whichever is greater, but not to exceed 70% of the minimum internal yield.
- With cement in place, confirm well is static and floats are holding. Bleed off the cement pressure and remove cement head.
- 15. Remove the casing hanger/packoff offline cementing tool.
- 16. Install TA cap with pressure gauge for monitoring.

Figure 1: Cactus Offline Cementing Tool Schematic (5M tool)

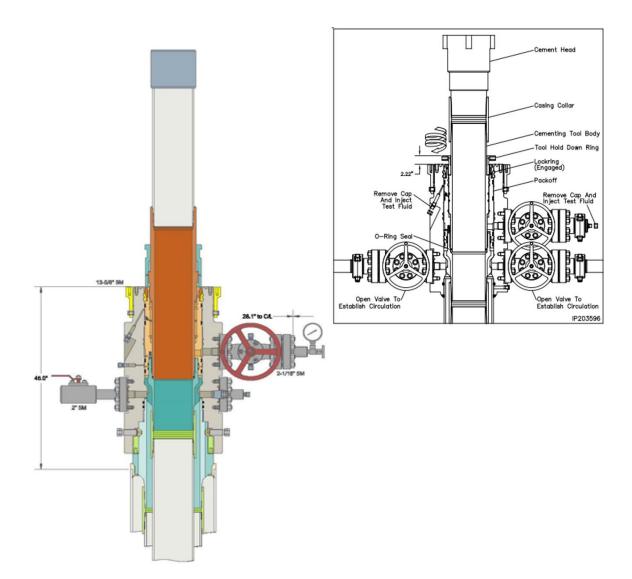


## Figure 2: Step-by-Step schematics procedure

**Step 1:** Landing the mandrel hanger and setting the packoff. The well is sealed with mud, two float valves, and packoff.

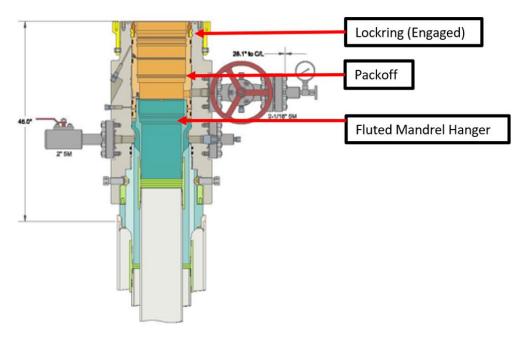

**Step 2:** Install casing hanger/packoff offline cementing tool.

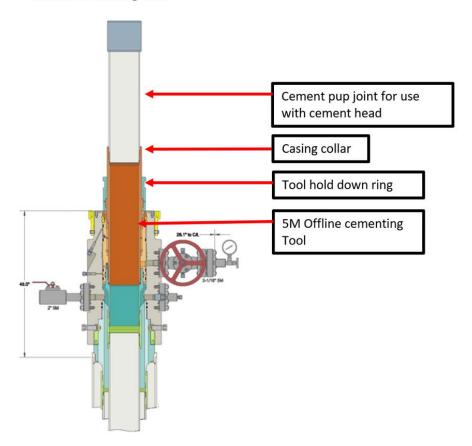


Step 3: Install TA cap with pressure gauge for monitoring.

TA Cap Assembly

Install new ring gasket

# 3-String Wellhead Diagram


Huneke Fed Com 138H SHL: 2404' FSL & 1810' FEL Section 30 Township/Range: 24S 36E Elevation Above Sea Level: 3373'

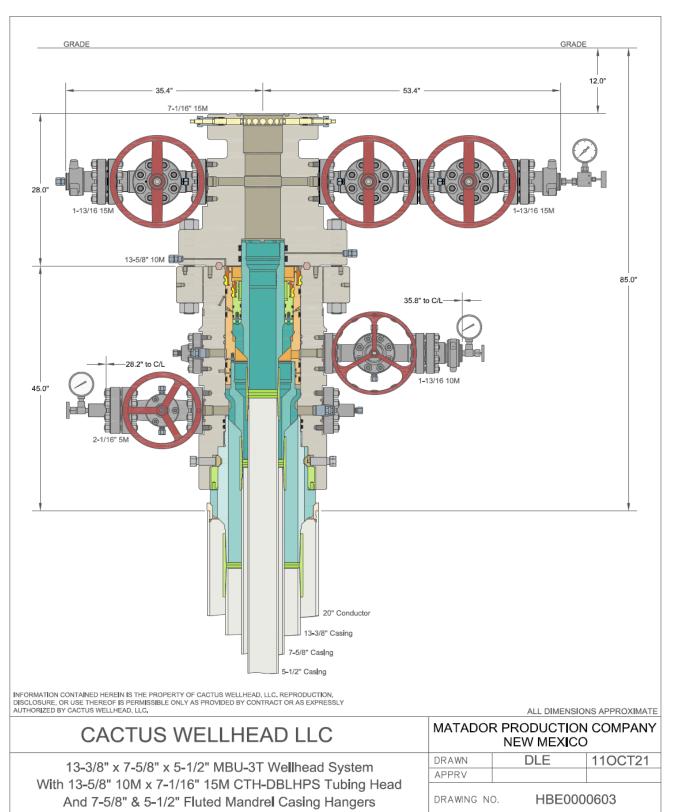

# **Closed-Loop System**

Huneke Fed Com 138H Township/Range: 24S 36E SHL: 2404' FSL & 1810' FEL Section 30 Elevation Above Sea Level: 3373'

# **Closed-Loop System**

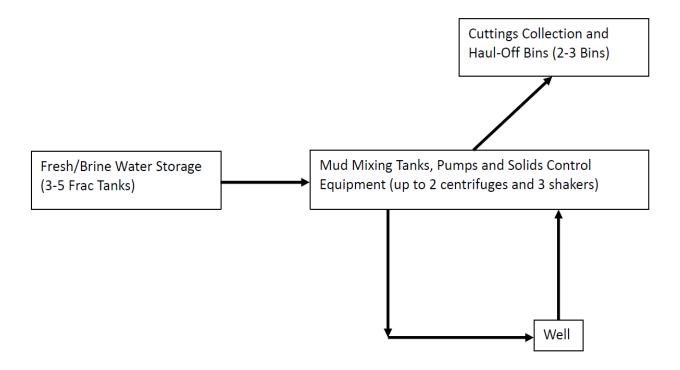

### **Operating and Maintenance Plan:**

During drilling operations, third party service companies will utilize solids control equipment to remove cuttings from the drilling fluids and collect it in haul-off bins. Equipment will be closely monitored at all times while drilling by the derrick man and the service company employees.

### **Closure Plan:**

During drilling operations, third party service companies will haul off drill solids and fluids to an approved disposal facility. At the end of the well, all closed loop equipment will be removed from the location.

# **Matador Production Company**

Antelope Ridge Huneke Huneke Fed Com #138H

Wellbore #1

Plan: BLM Plan #1

# **Standard Planning Report**

23 July, 2024

Database: EDM 5000.14 Single User Db Company: Matador Production Company

Project: Antelope Ridge
Site: Huneke

Well: Huneke Fed Com #138H

Wellbore: Wellbore #1

Design: BLM Plan #1

Local Co-ordinate Reference:

TVD Reference: MD Reference: North Reference:

Survey Calculation Method:

Well Huneke Fed Com #138H

KB @ 3401.5usft KB @ 3401.5usft

Grid

Minimum Curvature

Project Antelope Ridge

Map System:US State Plane 1927 (Exact solution)Geo Datum:NAD 1927 (NADCON CONUS)

New Mexico East 3001

System Datum:

Mean Sea Level

Using geodetic scale factor

Site Huneke

Map Zone:

Northing: 433,558.90 usft Site Position: Latitude: 32° 11' 15.923 N From: Lat/Long Easting: 819,388.05 usft Longitude: 103° 18' 3.408 W **Position Uncertainty:** 0.0 usft Slot Radius: 13-3/16 " **Grid Convergence:** 0.55

Well Huneke Fed Com #138H, Lea County, NM

 Well Position
 +N/-S
 -25.0 usft
 Northing:
 433,533.87 usft
 Latitude:
 32° 11' 15.676 N

 +E/-W
 0.3 usft
 Easting:
 819,388.35 usft
 Longitude:
 103° 18' 3.407 W

Position Uncertainty 0.0 usft Wellhead Elevation: Ground Level: 3,373.0 usft

Wellbore Wellbore #1 Magnetics **Model Name** Sample Date Declination **Dip Angle** Field Strength (°) (°) (nT) 5/19/2021 IGRF2015 6.39 60.02 47,541.43293604

BLM Plan #1 Design Audit Notes: Tie On Depth: Version: Phase: **PROTOTYPE** 0.0 Vertical Section: Depth From (TVD) +N/-S +E/-W Direction (°) (usft) (usft) (usft) 359.28 0.0 0.0 0.0

Plan Survey Tool Program Date 7/23/2024

Depth From (usft) Cusft) Survey (Wellbore) Tool Name Remarks

1 0.0 22,194.8 BLM Plan #1 (Wellbore #1) MWD

OWSG MWD - Standard

Database: EDM 5000.14 Single User Db Company: Matador Production Company

Project: Antelope Ridge
Site: Huneke

Well: Huneke Fed Com #138H

Wellbore: Wellbore #1
Design: BLM Plan #1

Local Co-ordinate Reference:

TVD Reference:
MD Reference:
North Reference:

**Survey Calculation Method:** 

Well Huneke Fed Com #138H

KB @ 3401.5usft KB @ 3401.5usft

Grid

										Plan Sections
Target	TFO (°)	Turn Rate (°/100usft)	Build Rate (°/100usft)	Dogleg Rate (°/100usft)	+E/-W (usft)	+N/-S (usft)	Vertical Depth (usft)	Azimuth (°)	Inclination (°)	Measured Depth (usft)
	0.00	0.00	0.00	0.00	0.0	0.0	0.0	0.00	0.00	0.0
	0.00	0.00	0.00	0.00	0.0	0.0	2,500.0	0.00	0.00	2,500.0
	111.43	0.00	2.00	2.00	26.0	-10.2	2,898.7	111.43	8.00	2,900.0
	0.00	0.00	0.00	0.00	689.7	-270.7	7,972.6	111.43	8.00	8,023.7
	180.00	0.00	-2.00	2.00	715.7	-280.9	8,371.3	0.00	0.00	8,423.7
KOP - Huneke Fed Co	0.00	0.00	0.00	0.00	715.7	-280.9	10,829.5	0.00	0.00	10,882.0
	359.28	0.00	10.00	10.00	708.3	304.7	11,402.3	359.28	91.27	11,794.7
	-89.85	-13.58	0.00	13.58	695.3	403.6	11,400.1	345.70	91.27	11,894.7
	89.84	2.00	0.00	2.00	606.8	1,074.8	11,385.0	359.28	91.27	12,573.4
BHL - Huneke Fed Cc	0.00	0.00	0.00	0.00	485.6	10,693.5	11,171.5	359.28	91.27	22,195.2

Database: EDM 5000.14 Single User Db Company: Matador Production Company

Project: Antelope Ridge
Site: Huneke

Well: Huneke Fed Com #138H

Wellbore: Wellbore #1
Design: BLM Plan #1

Local Co-ordinate Reference:

TVD Reference:
MD Reference:
North Reference:

Survey Calculation Method:

Well Huneke Fed Com #138H

KB @ 3401.5usft KB @ 3401.5usft

Grid

nned Survey									
Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Vertical Section (usft)	Dogleg Rate (°/100usft)	Build Rate (°/100usft)	Turn Rate (°/100usft)
0.0	0.00	0.00	0.0	0.0	0.0	0.0	0.00	0.00	0.00
100.0	0.00	0.00	100.0	0.0	0.0	0.0	0.00	0.00	0.00
200.0	0.00	0.00	200.0	0.0	0.0	0.0	0.00	0.00	0.00
300.0	0.00	0.00	300.0	0.0	0.0	0.0	0.00	0.00	0.00
400.0	0.00	0.00	400.0	0.0	0.0	0.0	0.00	0.00	0.00
500.0	0.00	0.00	500.0	0.0	0.0	0.0	0.00	0.00	0.00
600.0	0.00	0.00	600.0	0.0	0.0	0.0	0.00	0.00	0.00
700.0	0.00	0.00	700.0	0.0	0.0	0.0	0.00	0.00	0.00
800.0	0.00	0.00	800.0	0.0	0.0	0.0	0.00	0.00	0.00
900.0	0.00	0.00	900.0	0.0	0.0	0.0	0.00	0.00	0.00
1,000.0	0.00	0.00	1,000.0	0.0	0.0	0.0	0.00	0.00	0.00
1,100.0	0.00	0.00	1,100.0	0.0	0.0	0.0	0.00	0.00	0.00
1,200.0	0.00	0.00	1,200.0	0.0	0.0	0.0	0.00	0.00	0.00
1,300.0	0.00	0.00	1,300.0	0.0	0.0	0.0	0.00	0.00	0.00
1,400.0	0.00	0.00	1,400.0	0.0	0.0	0.0	0.00	0.00	0.00
1,500.0	0.00	0.00	1,500.0	0.0	0.0	0.0	0.00	0.00	0.00
1,600.0	0.00	0.00	1,600.0	0.0	0.0	0.0	0.00	0.00	0.00
1,700.0	0.00	0.00	1,700.0	0.0	0.0	0.0	0.00	0.00	0.00
1,788.0	0.00	0.00	1,788.0	0.0	0.0	0.0	0.00	0.00	0.00
Rustler	0.00	0.00	4 000 0	0.0	0.0	0.0	0.00	0.00	0.00
1,800.0	0.00	0.00	1,800.0	0.0	0.0	0.0	0.00	0.00	0.00
1,900.0	0.00	0.00	1,900.0	0.0	0.0	0.0	0.00	0.00	0.00
2,000.0	0.00	0.00	2,000.0	0.0	0.0	0.0	0.00	0.00	0.00
2,100.0	0.00	0.00	2,100.0	0.0	0.0	0.0	0.00	0.00	0.00
2,200.0	0.00	0.00	2,200.0	0.0	0.0	0.0	0.00	0.00	0.00
2,272.0	0.00	0.00	2,272.0	0.0	0.0	0.0	0.00	0.00	0.00
Salado									
2,300.0	0.00	0.00	2,300.0	0.0	0.0	0.0	0.00	0.00	0.00
2,400.0	0.00	0.00	2,400.0	0.0	0.0	0.0	0.00	0.00	0.00
2,500.0	0.00	0.00	2,500.0	0.0	0.0	0.0	0.00	0.00	0.00
Start Build	2.00		,						
2,600.0	2.00	111.43	2,600.0	-0.6	1.6	-0.7	2.00	2.00	0.00
2,700.0	4.00	111.43	2,699.8	-2.5	6.5	-2.6	2.00	2.00	0.00
,									
2,800.0	6.00	111.43	2,799.5	-5.7	14.6	-5.9	2.00	2.00	0.00
2,900.0	8.00	111.43	2,898.7	-10.2	26.0	-10.5	2.00	2.00	0.00
	7 hold at 2900.0 N								
3,000.0	8.00	111.43	2,997.7	-15.3	38.9	-15.8	0.00	0.00	0.00
3,100.0	8.00	111.43	3,096.8	-20.4	51.9	-21.0	0.00	0.00	0.00
3,200.0	8.00	111.43	3,195.8	-25.4	64.8	-26.3	0.00	0.00	0.00
3,300.0	8.00	111.43	3,294.8	-30.5	77.8	-31.5	0.00	0.00	0.00
3,400.0	8.00	111.43	3,393.8	-35.6	90.7	-36.7	0.00	0.00	0.00
3,500.0	8.00	111.43	3,492.9	-40.7	103.7	-42.0	0.00	0.00	0.00
3,600.0	8.00	111.43	3,591.9	-45.8	116.6	-47.2	0.00	0.00	0.00
3,700.0	8.00	111.43	3,690.9	-50.9	129.6	-52.5	0.00	0.00	0.00
3,800.0	8.00	111.43	3,789.9	-55.9	142.5	-57.7	0.00	0.00	0.00
3,871.1	8.00	111.43	3,860.4	-59.6	151.8	-61.5	0.00	0.00	0.00
G30:CS14-0			2,000. 1	00.0	101.0	01.0	0.00	0.00	0.00
3.900.0	8.00	111.43	3,889.0	-61.0	155.5	-63.0	0.00	0.00	0.00
4,000.0	8.00	111.43	3,988.0	-66.1	168.5	-68.2	0.00	0.00	0.00
4,100.0	8.00	111.43	4,087.0	-71.2	181.4	-73.5	0.00	0.00	0.00
4,200.0	8.00	111.43	4,186.0	-76.3	194.4	-78.7	0.00	0.00	0.00
4,300.0	8.00	111.43	4,285.1	-81.4	207.3	-84.0	0.00	0.00	0.00
4,355.4	8.00	111.43	4,339.9	-84.2	214.5	-86.9	0.00	0.00	0.00

Database: EDM 5000.14 Single User Db Company: Matador Production Company

Project: Antelope Ridge
Site: Huneke

Well: Huneke Fed Com #138H

Wellbore: Wellbore #1
Design: BLM Plan #1

Local Co-ordinate Reference:

TVD Reference: MD Reference: North Reference:

Survey Calculation Method:

Well Huneke Fed Com #138H

KB @ 3401.5usft KB @ 3401.5usft

Grid

ned Survey									
Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Vertical Section (usft)	Dogleg Rate (°/100usft)	Build Rate (°/100usft)	Turn Rate (°/100usft)
Capitan (T)									
4,400.0 4,500.0	8.00 8.00	111.43 111.43	4,384.1 4,483.1	-86.5 -91.5	220.3 233.2	-89.2 -94.5	0.00 0.00	0.00 0.00	0.00 0.00
4,600.0	8.00	111.43	4,582.2	-96.6	246.2	-99.7	0.00	0.00	0.00
4,700.0	8.00	111.43	4,681.2	-101.7	259.1	-105.0	0.00	0.00	0.00
4,800.0 4,900.0	8.00 8.00	111.43 111.43	4,780.2 4,879.2	-106.8 -111.9	272.1 285.1	-110.2 -115.5	0.00 0.00	0.00 0.00	0.00 0.00
5,000.0	8.00	111.43	4,978.3	-117.0	298.0	-120.7	0.00	0.00	0.00
5,100.0	8.00	111.43	5,077.3	-122.0	311.0	-125.9	0.00	0.00	0.00
5,200.0	8.00	111.43	5,176.3	-127.1	323.9	-131.2	0.00	0.00	0.00
5,300.0	8.00	111.43	5,275.3	-132.2	336.9	-136.4	0.00	0.00	0.00
5,400.0 5,500.0	8.00 8.00	111.43 111.43	5,374.4 5,473.4	-137.3 -142.4	349.8 362.8	-141.7 -146.9	0.00 0.00	0.00 0.00	0.00 0.00
5,600.0	8.00	111.43	5,572.4	-147.5	375.7	-152.2	0.00	0.00	0.00
5,700.0	8.00	111.43	5,671.5	-152.6	388.7	-157.4	0.00	0.00	0.00
5,800.0	8.00	111.43	5,770.5	-157.6	401.7	-162.7	0.00	0.00	0.00
5,900.0	8.00	111.43	5,869.5	-162.7	414.6	-167.9	0.00	0.00	0.00
6,000.0	8.00	111.43	5,968.5	-167.8	427.6	-173.2	0.00	0.00	0.00
6,086.2	8.00	111.43	6,053.9	-172.2	438.7	-177.7	0.00	0.00	0.00
G26: Bell Cyr 6,100.0	1. 8.00	111.43	6,067.6	-172.9	440.5	-178.4	0.00	0.00	0.00
6,200.0	8.00	111.43	6,166.6	-178.0	453.5	-183.7	0.00	0.00	0.00
6,300.0	8.00	111.43	6,265.6	-183.1	466.4	-188.9	0.00	0.00	0.00
6,353.2	8.00	111.43	6,318.2	-185.8	473.3	-191.7	0.00	0.00	0.00
G13: Cherry	Cyn.								
6,400.0	8.00	111.43	6,364.6	-188.1	479.4	-194.2	0.00	0.00	0.00
6,500.0	8.00	111.43	6,463.7	-193.2	492.3	-199.4	0.00	0.00	0.00
6,600.0 6,700.0	8.00 8.00	111.43 111.43	6,562.7 6,661.7	-198.3 -203.4	505.3 518.3	-204.6 -209.9	0.00 0.00	0.00 0.00	0.00 0.00
6,800.0	8.00	111.43	6,760.7	-208.5	531.2	-215.1	0.00	0.00	0.00
6,900.0	8.00	111.43	6,859.8	-213.6	544.2	-220.4	0.00	0.00	0.00
7,000.0	8.00	111.43	6,958.8	-218.7	557.1	-225.6	0.00	0.00	0.00
7,100.0	8.00	111.43	7,057.8	-223.7	570.1	-230.9	0.00	0.00	0.00
7,200.0 7,260.0	8.00 8.00	111.43 111.43	7,156.9 7,216.3	-228.8 -231.9	583.0 590.8	-236.1 -239.3	0.00 0.00	0.00 0.00	0.00 0.00
G7: Brushy C		111.40	7,210.5	-251.9	390.0	-209.0	0.00	0.00	0.00
7,300.0	8.00	111.43	7,255.9	-233.9	596.0	-241.4	0.00	0.00	0.00
7,400.0	8.00	111.43	7,253.9	-239.0	608.9	-241.4	0.00	0.00	0.00
7,500.0	8.00	111.43	7,453.9	-244.1	621.9	-251.9	0.00	0.00	0.00
7,600.0	8.00	111.43	7,553.0	-249.2	634.8	-257.1	0.00	0.00	0.00
7,700.0	8.00	111.43	7,652.0	-254.2	647.8	-262.4	0.00	0.00	0.00
7,800.0	8.00	111.43	7,751.0	-259.3	660.8	-267.6	0.00	0.00	0.00
7,900.0 8,000.0	8.00	111.43 111.43	7,850.0 7,949.1	-264.4 -269.5	673.7 686.7	-272.9 -278.1	0.00	0.00 0.00	0.00 0.00
8,000.0 8,023.7	8.00 8.00	111.43	7,949.1 7,972.6	-269.5 -270.7	689.7	-278.1 -279.4	0.00 0.00	0.00	0.00
Start Drop -2			.,0.2.0	=. •	555.7		5.55	0.00	0.00
8,100.0	6.47	111.43	8,048.2	-274.2	698.7	-283.0	2.00	-2.00	0.00
8,200.0	4.47	111.43	8,147.8	-277.7	707.6	-286.6	2.00	-2.00	0.00
8,300.0	2.47	111.43	8,247.6	-279.9	713.2	-288.9	2.00	-2.00	0.00
8,400.0	0.47	111.43	8,347.5	-280.9	715.6	-289.8	2.00	-2.00	0.00
8,419.9	0.08	111.43	8,367.4	-280.9	715.7	-289.9	2.00	-2.00	0.00
<b>G4: BSGL (C</b> 8,423.7	0.00	0.00	8,371.3	-280.9	715.7	-289.9	2.00	-2.00	0.00

Database: EDM 5000.14 Single User Db Company: Matador Production Company

Project: Antelope Ridge
Site: Huneke

Well: Huneke Fed Com #138H

Wellbore: Wellbore #1
Design: BLM Plan #1

Local Co-ordinate Reference:

TVD Reference:
MD Reference:
North Reference:

Survey Calculation Method:

Well Huneke Fed Com #138H

KB @ 3401.5usft KB @ 3401.5usft

Grid

ed Survey									
									_
Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Vertical Section (usft)	Dogleg Rate (°/100usft)	Build Rate (°/100usft)	Turn Rate (°/100usft)
Start 2458.2	hold at 8423.7 M	ID							
8,500.0	0.00	0.00	8,447.5	-280.9	715.7	-289.9	0.00	0.00	0.00
8,600.0	0.00	0.00	8,547.5	-280.9	715.7	-289.9	0.00	0.00	0.00
8,700.0	0.00	0.00	8,647.5	-280.9	715.7	-289.9	0.00	0.00	0.00
8,707.9	0.00	0.00	8,655.4	-280.9	715.7	-289.9	0.00	0.00	0.00
L6.3: Avalon		0.00	0 747 5	200.0	715 7	200.0	0.00	0.00	0.00
8,800.0	0.00	0.00	8,747.5	-280.9	715.7	-289.9	0.00	0.00	0.00
8,900.0	0.00	0.00	8,847.5	-280.9	715.7	-289.9	0.00	0.00	0.00
9,000.0	0.00	0.00	8,947.5 9,047.5	-280.9	715.7 715.7	-289.9 -289.9	0.00	0.00	0.00
9,100.0 9,200.0	0.00 0.00	0.00 0.00	9,047.5 9,147.5	-280.9 -280.9	715.7 715.7	-289.9 -289.9	0.00 0.00	0.00 0.00	0.00 0.00
9,300.0	0.00	0.00	9,147.5	-280.9 -280.9	715.7	-289.9	0.00	0.00	0.00
9,400.0	0.00	0.00	9,347.5 9,447.5	-280.9	715.7	-289.9	0.00	0.00	0.00
9,500.0 9,600.0	0.00 0.00	0.00 0.00	9,447.5 9,547.5	-280.9 -280.9	715.7 715.7	-289.9 -289.9	0.00 0.00	0.00 0.00	0.00 0.00
9,700.0	0.00	0.00	9,547.5 9,647.5	-280.9 -280.9	715.7 715.7	-289.9 -289.9	0.00	0.00	0.00
9,722.9	0.00	0.00	9,670.4	-280.9	715.7	-289.9	0.00	0.00	0.00
L5.1: FBSG			5,5.5						
9.800.0	0.00	0.00	9,747.5	-280.9	715.7	-289.9	0.00	0.00	0.00
9,840.9	0.00	0.00	9,788.4	-280.9	715.7	-289.9	0.00	0.00	0.00
L4.3: SBSC			.,						
9,900.0	0.00	0.00	9,847.5	-280.9	715.7	-289.9	0.00	0.00	0.00
10,000.0	0.00	0.00	9,947.5	-280.9	715.7	-289.9	0.00	0.00	0.00
10,100.0	0.00	0.00	10,047.5	-280.9	715.7	-289.9	0.00	0.00	0.00
10,188.9	0.00	0.00	10,136.4	-280.9	715.7	-289.9	0.00	0.00	0.00
L4.1: SBSG									
10,200.0	0.00	0.00	10,147.5	-280.9	715.7	-289.9	0.00	0.00	0.00
10,300.0	0.00	0.00	10,247.5	-280.9	715.7	-289.9	0.00	0.00	0.00
10,400.0	0.00	0.00	10,347.5	-280.9	715.7	-289.9	0.00	0.00	0.00
10,500.0	0.00	0.00	10,447.5	-280.9	715.7	-289.9	0.00	0.00	0.00
10,600.0	0.00	0.00	10,547.5	-280.9	715.7	-289.9	0.00	0.00	0.00
10,700.0	0.00	0.00	10,647.5	-280.9	715.7	-289.9	0.00	0.00	0.00
10,800.0	0.00	0.00	10,747.5	-280.9	715.7	-289.9	0.00	0.00	0.00
10,824.9	0.00	0.00	10,772.4	-280.9	715.7	-289.9	0.00	0.00	0.00
L3.3: TBSC 10,882.0	0.00	0.00	10,829.5	-280.9	715.7	-289.9	0.00	0.00	0.00
	0.00 <b>0.00 - KOP - Hu</b> r			-200.9	7 15.7	-209.9	0.00	0.00	0.00
				000					
10,900.0	1.80	359.28	10,847.5	-280.6	715.7	-289.6	10.00	10.00	0.00
11,000.0 11,100.0	11.80	359.28	10,946.7 11,042.3	-268.8 230.0	715.5 715.2	-277.7 -248.9	10.00 10.00	10.00 10.00	0.00
11,100.0	21.80 31.80	359.28 359.28	11,042.3	-239.9 -194.9	715.2 714.6	-248.9 -203.8	10.00	10.00	0.00 0.00
11,220.0	33.81	359.28	11,148.3	-184.0	714.5	-203.6	10.00	10.00	0.00
L3.1: TBSG	33.31	200.20	,			.00.0			3.33
11,300.0	41.80	359.28	11,211.4	-135.0	713.9	-144.0	10.00	10.00	0.00
11,300.0	41.80 51.80	359.28 359.28	11,211.4 11,279.8	-135.0 -62.2	713.9 712.9	-144.0 -71.2	10.00	10.00	0.00
11,500.0	61.80	359.26 359.28	11,334.5	-62.2 21.3	712.9 711.9	-7 1.2 12.4	10.00	10.00	0.00
11,600.0	71.80	359.28	11,373.8	113.1	711.9	104.2	10.00	10.00	0.00
11,700.0	81.80	359.28	11,396.6	210.3	709.5	201.4	10.00	10.00	0.00
11,794.7	91.27	359.28	11,402.3	304.7	708.3	295.8	10.00	10.00	0.00
	91.27 8.58 TFO -89.85	339.20	11,402.3	304.7	100.3	290.6	10.00	10.00	0.00
11,800.0	91.27	358.55	11,402.2	310.1	708.2	301.1	13.58	0.03	-13.58
11,832.0	91.28	354.22	11,401.5	341.9	706.2	333.0	13.58	0.03	-13.58

Database: EDM 5000.14 Single User Db Company: Matador Production Company

Project: Antelope Ridge
Site: Huneke

Well: Huneke Fed Com #138H

Wellbore: Wellbore #1
Design: BLM Plan #1

Local Co-ordinate Reference:

TVD Reference:
MD Reference:
North Reference:

**Survey Calculation Method:** 

Well Huneke Fed Com #138H

KB @ 3401.5usft KB @ 3401.5usft

Grid

Minimum Curvature

•		DLIVI FIAIT#1								
ed Surve	∍y									
Measi	oth	Inclination	Azimuth	Vertical Depth	+N/-S	+E/-W	Vertical Section	Dogleg Rate	Build Rate	Turn Rate
(us	ft)	(°)	(°)	(usft)	(usft)	(usft)	(usft)	(°/100usft)	(°/100usft)	(°/100usft)
FTD.	- Hunaka	Fed Com 138H								
	,894.7	91.27	345.70	11,400.1	403.6	695.3	394.8	13.58	-0.01	-13.58
		) TFO 89.84	343.70	11,400.1	+03.0	090.0	334.0	13.30	-0.01	-10.00
	,900.0	91.27	345.81	11,400.0	408.8	694.0	400.0	2.00	0.01	2.00
11,	,900.0	91.27	343.01	11,400.0	400.0		400.0			2.00
12,	,000.0	91.27	347.81	11,397.8	506.1	671.2	497.6	2.00	0.00	2.00
	,100.0	91.28	349.81	11,395.5	604.2	651.8	595.9	2.00	0.00	2.00
	,200.0	91.28	351.81	11,393.3	702.9	635.8	694.8	2.00	0.00	2.00
	,300.0	91.28	353.81	11,391.1	802.0	623.3	794.2	2.00	0.00	2.00
12,	,400.0	91.28	355.81	11,388.8	901.6	614.2	893.8	2.00	0.00	2.00
12,	,500.0	91.27	357.81	11,386.6	1,001.4	608.7	993.7	2.00	0.00	2.00
12,	,573.4	91.27	359.28	11,385.0	1,074.8	606.8	1,067.1	2.00	0.00	2.00
Start	9621.8 h	old at 12573.4 M	ИD							
	,600.0	91.27	359.28	11,384.4	1,101.4	606.5	1,093.7	0.00	0.00	0.00
	,700.0	91.27	359.28	11,382.2	1,201.3	605.2	1,193.6	0.00	0.00	0.00
12,	,800.0	91.27	359.28	11,379.9	1,301.3	604.0	1,293.6	0.00	0.00	0.00
12	,900.0	91.27	359.28	11,377.7	1,401.3	602.7	1,393.6	0.00	0.00	0.00
	,900.0	91.27	359.26 359.28	11,377.7	1,501.2	601.4	1,493.6	0.00	0.00	0.00
	,060.5	91.27	359.28	11,374.2	1,561.7	600.7	1,554.1	0.00	0.00	0.00
		e Fed Com 138		11,074.2	1,001.7	000.7	1,004.1	0.00	0.00	0.00
	,100.0	91.27	359.28	11,373.3	1,601.2	600.2	1,593.5	0.00	0.00	0.00
	,100.0	91.27	359.28	11,373.3	1,701.2	598.9	1,693.5	0.00	0.00	0.00
				*						
	,300.0	91.27	359.28	11,368.8	1,801.1	597.7	1,793.5	0.00	0.00	0.00
	,400.0	91.27	359.28	11,366.6	1,901.1	596.4	1,893.5	0.00	0.00	0.00
	,500.0	91.27	359.28	11,364.4	2,001.1	595.1	1,993.4	0.00	0.00	0.00
	,600.0	91.27	359.28	11,362.2	2,101.0	593.9	2,093.4	0.00	0.00	0.00
13,	,700.0	91.27	359.28	11,360.0	2,201.0	592.6	2,193.4	0.00	0.00	0.00
13,	,800.0	91.27	359.28	11,357.8	2,301.0	591.4	2,293.4	0.00	0.00	0.00
13,	,900.0	91.27	359.28	11,355.5	2,400.9	590.1	2,393.3	0.00	0.00	0.00
14,	,000.0	91.27	359.28	11,353.3	2,500.9	588.8	2,493.3	0.00	0.00	0.00
14,	,100.0	91.27	359.28	11,351.1	2,600.9	587.6	2,593.3	0.00	0.00	0.00
14,	,200.0	91.27	359.28	11,348.9	2,700.9	586.3	2,693.3	0.00	0.00	0.00
1/	,300.0	91.27	359.28	11,346.7	2,800.8	585.1	2,793.2	0.00	0.00	0.00
	,380.7	91.27	359.28	11,344.9	2,881.5	584.0	2,873.9	0.00	0.00	0.00
		e Fed Com 138		11,044.0	2,001.0	304.0	2,010.0	0.00	0.00	0.00
	,400.0	91.27	л 359.28	11,344.4	2,900.8	583.8	2,893.2	0.00	0.00	0.00
	, <del>4</del> 00.0 ,500.0	91.27	359.26 359.28	11,344.4	3,000.8	582.5	2,093.2	0.00	0.00	0.00
	,600.0	91.27	359.28	11,342.2	3,100.7	581.3	3,093.2	0.00	0.00	0.00
	,700.0	91.27	359.28	11,337.8	3,200.7	580.0	3,193.1	0.00	0.00	0.00
	,800.0	91.27	359.28	11,335.6	3,300.7	578.8	3,293.1	0.00	0.00	0.00
	,900.0	91.27	359.28	11,333.4	3,400.6	577.5	3,393.1	0.00	0.00	0.00
	,000.0	91.27	359.28	11,331.1	3,500.6	576.2	3,493.1	0.00	0.00	0.00
15,	,100.0	91.27	359.28	11,328.9	3,600.6	575.0	3,593.0	0.00	0.00	0.00
15,	,200.0	91.27	359.28	11,326.7	3,700.5	573.7	3,693.0	0.00	0.00	0.00
	,300.0	91.27	359.28	11,324.5	3,800.5	572.5	3,793.0	0.00	0.00	0.00
15,	,400.0	91.27	359.28	11,322.3	3,900.5	571.2	3,893.0	0.00	0.00	0.00
	,500.0	91.27	359.28	11,320.0	4,000.4	569.9	3,993.0	0.00	0.00	0.00
15,	,600.0	91.27	359.28	11,317.8	4,100.4	568.7	4,092.9	0.00	0.00	0.00
15	,700.0	91.27	359.28	11,315.6	4,200.4	567.4	4,192.9	0.00	0.00	0.00
	,700.0	91.27	359.28	11,313.4	4,300.3	566.2	4,192.9	0.00	0.00	0.00
	,900.0	91.27	359.28	11,313.4	4,400.3	564.9	4,392.9	0.00	0.00	0.00
	,000.0	91.27	359.28	11,308.9	4,500.3	563.7	4,492.8	0.00	0.00	0.00
	,100.0	91.27	359.28	11,306.7	4,600.2	562.4	4,592.8	0.00	0.00	0.00
16,	,200.0	91.27	359.28	11,304.5	4,700.2	561.1	4,692.8	0.00	0.00	0.00

Database: EDM 5000.14 Single User Db Company: Matador Production Company

Project: Antelope Ridge
Site: Huneke

Well: Huneke Fed Com #138H

Wellbore: Wellbore #1
Design: BLM Plan #1

Local Co-ordinate Reference:

TVD Reference:
MD Reference:
North Reference:

Survey Calculation Method:

Well Huneke Fed Com #138H

KB @ 3401.5usft KB @ 3401.5usft

Grid

Minimum Curvature

Planned Survey									
Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Vertical Section (usft)	Dogleg Rate (°/100usft)	Build Rate (°/100usft)	Turn Rate (°/100usft)
16,300.0	91.27	359.28	11,302.3	4,800.2	559.9	4,792.8	0.00	0.00	0.00
16,400.0	91.27	359.28	11,300.1	4,900.1	558.6	4,892.7	0.00	0.00	0.00
16,500.0	91.27	359.28	11,297.9	5,000.1	557.4	4,992.7	0.00	0.00	0.00
16,600.0	91.27	359.28	11,295.6	5,100.1	556.1	5,092.7	0.00	0.00	0.00
16,700.0	91.27	359.28	11,293.4	5,200.0	554.8	5,192.7	0.00	0.00	0.00
16,800.0	91.27	359.28	11,291.2	5,300.0	553.6	5,292.6	0.00	0.00	0.00
16,900.0	91.27	359.28	11,289.0	5,400.0	552.3	5,392.6	0.00	0.00	0.00
17,000.0	91.27	359.28	11,286.8	5,499.9	551.1	5,492.6	0.00	0.00	0.00
17,100.0	91.27	359.28	11,284.5	5,599.9	549.8	5,592.6	0.00	0.00	0.00
17,200.0	91.27	359.28	11,282.3	5,699.9	548.5	5,692.5	0.00	0.00	0.00
17,300.0	91.27	359.28	11,280.1	5,799.8	547.3	5,792.5	0.00	0.00	0.00
17,400.0	91.27	359.28	11,277.9	5,899.8	546.0	5,892.5	0.00	0.00	0.00
17,500.0	91.27	359.28	11,275.7	5,999.8	544.8	5,992.5	0.00	0.00	0.00
17,600.0	91.27	359.28	11,273.4	6,099.7	543.5	6,092.4	0.00	0.00	0.00
17,700.0	91.27	359.28	11,271.2	6,199.7	542.2	6,192.4	0.00	0.00	0.00
17,800.0	91.27	359.28	11,269.0	6,299.7	541.0	6,292.4	0.00	0.00	0.00
17,900.0	91.27	359.28	11,266.8	6,399.6	539.7	6,392.4	0.00	0.00	0.00
18,000.0	91.27	359.28	11,264.6	6,499.6	538.5	6,492.3	0.00	0.00	0.00
18,100.0	91.27	359.28	11,262.4	6,599.6	537.2	6,592.3	0.00	0.00	0.00
18,200.0	91.27	359.28	11,260.1	6,699.5	535.9	6,692.3	0.00	0.00	0.00
18,300.0	91.27	359.28	11,257.9	6,799.5	534.7	6,792.3	0.00	0.00	0.00
18,400.0	91.27	359.28	11,255.7	6,899.5	533.4	6,892.2	0.00	0.00	0.00
18,500.0	91.27	359.28	11,253.5	6,999.5	532.2	6,992.2	0.00	0.00	0.00
18,600.0	91.27	359.28	11,251.3	7,099.4	530.9	7,092.2	0.00	0.00	0.00
18,700.0	91.27	359.28	11,249.0	7,199.4	529.6	7,192.2	0.00	0.00	0.00
18,800.0	91.27	359.28	11,246.8	7,299.4	528.4	7,292.1	0.00	0.00	0.00
18,900.0	91.27	359.28	11,244.6	7,399.3	527.1	7,392.1	0.00	0.00	0.00
19,000.0	91.27	359.28	11,242.4	7,499.3	525.9	7,492.1	0.00	0.00	0.00
19,100.0	91.27	359.28	11,240.2	7,599.3	524.6	7,592.1	0.00	0.00	0.00
19,200.0	91.27	359.28	11,238.0	7,699.2	523.3	7,692.0	0.00	0.00	0.00
19,300.0	91.27	359.28	11,235.7	7,799.2	522.1	7,792.0	0.00	0.00	0.00
19,400.0	91.27	359.28	11,233.5	7,899.2	520.8	7,892.0	0.00	0.00	0.00
19,500.0	91.27	359.28	11,231.3	7,999.1	519.6	7,992.0	0.00	0.00	0.00
19,600.0	91.27	359.28	11,229.1	8,099.1	518.3	8,091.9	0.00	0.00	0.00
19,664.5	91.27	359.28	11,227.6	8,163.6	517.5	8,156.5	0.00	0.00	0.00
BPP3 - Hunel	ke Fed Com 138	ВН							
19,700.0	91.27	359.28	11,226.9	8,199.1	517.0	8,191.9	0.00	0.00	0.00
19,800.0	91.27	359.28	11,224.6	8,299.0	515.8	8,291.9	0.00	0.00	0.00
19,900.0	91.27	359.28	11,222.4	8,399.0	514.5	8,391.9	0.00	0.00	0.00
20,000.0	91.27	359.28	11,220.2	8,499.0	513.3	8,491.8	0.00	0.00	0.00
20,100.0	91.27	359.28	11,218.0	8,598.9	512.0	8,591.8	0.00	0.00	0.00
20,200.0	91.27	359.28	11,215.8	8,698.9	510.8	8,691.8	0.00	0.00	0.00
20,300.0	91.27	359.28	11,213.5	8,798.9	509.5	8,791.8	0.00	0.00	0.00
20,400.0	91.27	359.28	11,211.3	8,898.8	508.2	8,891.7	0.00	0.00	0.00
20,500.0	91.27	359.28	11,209.1	8,998.8	507.0	8,991.7	0.00	0.00	0.00
20,600.0	91.27	359.28	11,206.9	9,098.8	505.7	9,091.7	0.00	0.00	0.00
20,700.0	91.27	359.28	11,204.7	9,198.7	504.5	9,191.7	0.00	0.00	0.00
20,800.0	91.27	359.28	11,202.5	9,298.7	503.2	9,291.6	0.00	0.00	0.00
20,900.0	91.27	359.28	11,200.2	9,398.7	501.9	9,391.6	0.00	0.00	0.00
21,000.0	91.27	359.28	11,198.0	9,498.6	500.7	9,491.6	0.00	0.00	0.00
21,100.0	91.27	359.28	11,195.8	9,598.6	499.4	9,591.6	0.00	0.00	0.00
21,200.0	91.27	359.28	11,193.6	9,698.6	498.2	9,691.5	0.00	0.00	0.00
21,300.0	91.27	359.28	11,191.4	9,798.5	496.9	9,791.5	0.00	0.00	0.00
21,400.0	91.27	359.28	11,189.1	9,898.5	495.6	9,891.5	0.00	0.00	0.00

Database: EDM 5000.14 Single User Db Company: Matador Production Company

Project: Antelope Ridge
Site: Huneke

Well: Huneke Fed Com #138H

Wellbore: Wellbore #1
Design: BLM Plan #1

Local Co-ordinate Reference:

**Survey Calculation Method:** 

TVD Reference:
MD Reference:
North Reference:

Well Huneke Fed Com #138H

KB @ 3401.5usft KB @ 3401.5usft

Grid Minimum Curvature

lanned Survey									
Measured Depth (usft)	Inclination (°)	Azimuth (°)	Vertical Depth (usft)	+N/-S (usft)	+E/-W (usft)	Vertical Section (usft)	Dogleg Rate (°/100usft)	Build Rate (°/100usft)	Turn Rate (°/100usft)
21,500.0	91.27	359.28	11,186.9	9,998.5	494.4	9,991.5	0.00	0.00	0.00
21,600.0	91.27	359.28	11,184.7	10,098.4	493.1	10,091.4	0.00	0.00	0.00
21,700.0	91.27	359.28	11,182.5	10,198.4	491.9	10,191.4	0.00	0.00	0.00
21,800.0	91.27	359.28	11,180.3	10,298.4	490.6	10,291.4	0.00	0.00	0.00
21,900.0	91.27	359.28	11,178.1	10,398.3	489.3	10,391.4	0.00	0.00	0.00
22,000.0	91.27	359.28	11,175.8	10,498.3	488.1	10,491.4	0.00	0.00	0.00
22,100.0	91.27	359.28	11,173.6	10,598.3	486.8	10,591.3	0.00	0.00	0.00
22,195.2	91.27	359.28	11,171.5	10,693.5	485.6	10,686.5	0.00	0.00	0.00
TD at 22195	.2 - BHL - Hunek	e Fed Com #13	вн						

Design Targets									
Target Name - hit/miss target - Shape	Dip Angle (°)	Dip Dir. (°)	TVD (usft)	+N/-S (usft)	+E/-W (usft)	Northing (usft)	Easting (usft)	Latitude	Longitude
KOP - Huneke Fed Com - plan hits target cer - Point		0.00	10,829.5	-280.9	715.7	433,253.00	820,104.00	32° 11' 12.828 N	103° 17' 55.112 W
BHL - Huneke Fed Com - plan hits target cer - Point	0.00 iter	0.00	11,171.5	10,693.5	485.6	444,228.00	819,874.00	32° 13' 1.446 N	103° 17' 56.560 W
BPP3 - Huneke Fed Cor - plan misses target - Point		0.00 usft at 19664	11,227.6 .5usft MD (1	8,163.6 11227.6 TVD, 8	517.4 3163.6 N, 517.	441,697.85 .5 E)	819,905.76	32° 12' 36.407 N	103° 17' 56.473 W
BPP2 - Huneke Fed Cor - plan misses target - Point		0.00 usft at 14380	11,344.9 ).7usft MD (1	2,881.5 11344.9 TVD, 2	583.9 2881.5 N, 584.	436,415.35 .0 E)	819,972.28	32° 11' 44.132 N	103° 17' 56.291 W
BPP1 - Huneke Fed Cor - plan misses target - Point		0.00 usft at 13060	11,374.2 ).5usft MD (1	1,561.7 11374.2 TVD, 1	600.6 1561.7 N, 600.	435,095.56 7 E)	819,988.90	32° 11' 31.071 N	103° 17' 56.245 W
FTP - Huneke Fed Com - plan misses target - Point	0.00 center by 0.1u	0.00 usft at 11832	11,401.5 .0usft MD (1	341.9 11401.5 TVD, 3	706.1 342.0 N, 706.2	433,875.80 E)	820,094.41	32° 11' 18.992 N	103° 17' 55.154 W

Database: EDM 5000.14 Single User Db Company: Matador Production Company

Project: Antelope Ridge
Site: Huneke

 Well:
 Huneke Fed Com #138H

 Wellbore:
 Wellbore #1

 Design:
 BLM Plan #1

Local Co-ordinate Reference:

TVD Reference: MD Reference: North Reference:

Survey Calculation Method:

Well Huneke Fed Com #138H

KB @ 3401.5usft KB @ 3401.5usft

Grid

Minimum Curvature

rmations							
	Measured Depth (usft)	Vertical Depth (usft)	Name	Lithology	Dip (°)	Dip Direction (°)	
	1,788.0	1,788.0	Rustler		-1.27	359.28	
	2,272.0	2,272.0	Salado		-1.27	359.28	
	3,871.1	3,860.4	G30:CS14-CSB		-1.27	359.28	
	4,355.4	4,339.9	Capitan (T)		-1.27	359.28	
	6,086.2	6,053.9	G26: Bell Cyn.		-1.27	359.28	
	6,353.2	6,318.2	G13: Cherry Cyn.		-1.27	359.28	
	7,260.0	7,216.3	G7: Brushy Cyn.		-1.27	359.28	
	8,419.9	8,367.4	G4: BSGL (CS9)		-1.27	359.28	
	8,707.9	8,655.4	L6.3: Avalon Carb		-1.27	359.28	
	9,722.9	9,670.4	L5.1: FBSG		-1.27	359.28	
	9,840.9	9,788.4	L4.3: SBSC		-1.27	359.28	
	10,188.9	10,136.4	L4.1: SBSG		-1.27	359.28	
	10,824.9	10,772.4	L3.3: TBSC		-1.27	359.28	
	11,220.0	11,148.3	L3.1: TBSG		-1.27	359.28	

Plan Annotations				
Measured Depth	Vertical Depth	Local Coord	dinates +E/-W	
(usft)	(usft)	(usft)	(usft)	Comment
2,500.0	2,500.0	0.0	0.0	Start Build 2.00
2,900.0	2,898.7	-10.2	26.0	Start 5123.7 hold at 2900.0 MD
8,023.7	7,972.6	-270.7	689.7	Start Drop -2.00
8,423.7	8,371.3	-280.9	715.7	Start 2458.2 hold at 8423.7 MD
10,882.0	10,829.5	-280.9	715.7	Start Build 10.00
11,794.7	11,402.3	304.7	708.3	Start DLS 13.58 TFO -89.85
11,894.7	11,400.1	403.6	695.3	Start DLS 2.00 TFO 89.84
12,573.4	11,385.0	1,074.8	606.8	Start 9621.8 hold at 12573.4 MD
22,195.2	11,171.5	10,693.5	485.6	TD at 22195.2

# **Matador Production Company**

Antelope Ridge Huneke Huneke Fed Com #138H

Wellbore #1 BLM Plan #1

# **Anticollision Summary Report**

23 July, 2024

## **Anticollision Summary Report**

**TVD Reference:** 

MD Reference:

Company: Matador Production Company

Project: Antelope Ridge Huneke Reference Site: 0.0 usft Site Error:

Reference Well: Huneke Fed Com #138H

Well Error: 0.0 usft

Reference Wellbore Wellbore #1

Reference Design: BLM Plan #1 Local Co-ordinate Reference:

KB @ 3401.5usft

Well Huneke Fed Com #138H

KB @ 3401.5usft

North Reference: Grid

**Survey Calculation Method:** Minimum Curvature

Output errors are at 2.00 sigma

EDM 5000.14 Single User Db Database:

Offset TVD Reference: Offset Datum

Reference BLM Plan #1

Filter type: NO GLOBAL FILTER: Using user defined selection & filtering criteria

Interpolation Method: Stations Error Model: **ISCWSA** 

Depth Range: Unlimited Scan Method: Closest Approach 3D Maximum center-center distance of 10,000.0 usft Results Limited by: Error Surface: Pedal Curve Warning Levels Evaluated at: 2.00 Sigma **Casing Method:** Not applied

Date 7/23/2024 **Survey Tool Program** 

> From То

(usft) (usft) Survey (Wellbore) **Tool Name** Description

0.0 22,194.8 BLM Plan #1 (Wellbore #1) MWD OWSG MWD - Standard

te Name Offset Well - Wellbore - Design	Reference Measured Depth (usft)	Offset Measured Depth (usft)	Dista Between Centres (usft)	nce Between Ellipses (usft)	Separation Factor	Warning
vins						
Bivins Fed Com #137H - Wellbore #1 - BLM Plan #1 Bivins Fed Com #137H - Wellbore #1 - BLM Plan #1 Bivins Fed Com #138H - Wellbore #1 - BLM Plan #1 Bivins Fed Com #138H - Wellbore #1 - BLM Plan #1 Bivins Fed Com #213H - Wellbore #1 - BLM Plan #1 Bivins Fed Com #213H - Wellbore #1 - BLM Plan #1 Bivins Fed Com #213H - Wellbore #1 - BLM Plan #1 Bivins Fed Com #214H - Wellbore #1 - BLM Plan #1	12,200.0 12,209.5 2,044.4 11,650.0 1,500.0 2,000.0 2,415.6	11,459.9 11,457.5 2,048.6 11,783.4 1,500.0 1,598.9 2,007.7 2,422.4	97.2 96.8 83.4 89.5 120.0 120.5 136.4 38.7	13.2 13.2 69.2 8.0 109.8 109.5 122.5 21.8	1.158 L 5.861 C 1.099 L 11.662 C 10.948 E 9.826 S	Level 2, ES, SF CC ES
luneke						
Huneke Fed Com #137H - Wellbore #1 - BLM Plan #1 Huneke Fed Com #137H - Wellbore #1 - BLM Plan #1 Huneke Fed Com #213H - Wellbore #1 - BLM Plan #1 Huneke Fed Com #214H - Wellbore #1 - BLM Plan #1 Huneke Fed Com #214H - Wellbore #1 - BLM Plan #1	1,893.9 1,900.0 3,163.8 1,000.0 22,195.2	1,894.4 1,900.5 3,163.4 1,000.0 22,374.1	19.9 19.9 33.2 70.0 881.7	6.8 6.8 11.2 63.3 525.2	1.520 ( 1.516 E 1.511 ( 10.432 ( 2.473 S	ES, SF CC, ES, SF CC, ES
( Stewart						
K Stewart #211H - Wellbore #1 - 3 Mile Prelim K Stewart #211H - Wellbore #1 - 3 Mile Prelim	11,779.6 22,195.2	14,301.7 24,715.7	1,141.5 1,218.3	1,043.6 818.5	11.653 ( 3.048 E	
onnie King						
Lonnie King Fed Com #135H - Wellbore #1 - BLM Plan # Lonnie King Fed Com #135H - Wellbore #1 - BLM Plan # Lonnie King Fed Com #135H - Wellbore #1 - BLM Plan # Lonnie King Fed Com #136H - Wellbore #1 - BLM Plan # Lonnie King Fed Com #136H - Wellbore #1 - BLM Plan # Lonnie King Fed Com #212H - Wellbore #1 - BLM Plan # Lonnie King Fed Com #212H - Wellbore #1 - BLM Plan #	900.0 1,100.0 22,195.2 19,351.2 22,195.2 2,751.3 22,195.2	902.0 1,088.8 22,351.3 19,540.5 22,384.1 2,950.4 22,497.2	2,434.3 2,434.9 3,431.6 1,722.4 1,723.0 2,230.8 2,595.2	2,428.3 2,427.5 3,069.9 1,452.5 1,364.6 2,210.8 2,235.8	405.790 ( 331.673 E 9.488 S 6.384 ( 4.807 E 111.540 ( 7.220 S	ES BF CC ES, SF CC, ES
Neinberger Neinberger						
Weinberger Fed Com #136H - Wellbore #1 - BLM Plan # Weinberger Fed Com #136H - Wellbore #1 - BLM Plan # Weinberger Fed Com #212H - Wellbore #1 - BLM Plan # Weinberger Fed Com #212H - Wellbore #1 - BLM Plan # Weinberger Fed Com #212H - Wellbore #1 - BLM Plan #	12,319.7 12,400.0 2,564.1 12,359.0 12,500.0	11,413.1 11,387.1 2,619.0 11,355.2 11,317.6	1,823.6 1,826.2 2,447.1 2,448.0 2,455.1	1,740.1 1,742.5 2,429.0 2,364.6 2,371.2	21.834 ( 21.832 S 134.900 ( 29.346 E 29.266 S	SF CC ES

# PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

**OPERATOR'S NAME:** MATADOR PRODUCTION COMPANY

WELL NAME & NO.: HUNEKE FED COM 138H

**APD ID:** 10400077949

**LOCATION:** Section 30, T.24 S., R.36 E. NMP.

COUNTY: Lea County, New Mexico

COA

$H_2S$	0	No	© Yes			
Potash /	None	Secretary	C R-111-Q	☐ Open Annulus		
WIPP				$\square$ WIPP		
Cave / Karst	• Low	Medium	C High	Critical		
Wellhead	Conventional	<ul><li>Multibowl</li></ul>	O Both	<ul><li>Diverter</li></ul>		
Cementing	☐ Primary Squeeze	☐ Cont. Squeeze	☐ EchoMeter	DV Tool		
Special Req	Capitan Reef	☐ Water Disposal	▼ COM	Unit		
Waste Prev.	C Self-Certification	C Waste Min. Plan	APD Submitted p	prior to 06/10/2024		
Additional	▼ Flex Hose	☐ Casing Clearance	☐ Pilot Hole	Break Testing		
Language	☐ Four-String	Offline Cementing	Fluid-Filled			

## A. HYDROGEN SULFIDE

A Hydrogen Sulfide (H<sub>2</sub>S) Drilling Plan shall be activated **AT SPUD**. As a result, the Hydrogen Sulfide area must meet **43 CFR 3176** requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, please provide measured values and formations to the BLM.

### **B. CASING DESIGN**

## **Primary Casing Program**

**Note:** Surface casing set depth adjusted per BLM geologist's recommendation: "The operator proposes to set surface casing at 1813 feet, which may be in the salt. Instead set surface casing at 1460 feet. If salt is encountered, set casing a minimum of 25 feet above the salt."

- 1. The 13-3/8 inch surface casing shall be set at approximately 1460 ft. (a minimum of 25 feet (Lea County) into the Rustler Anhydrite and above the salt) and cemented to the surface. If salt is encountered, set casing at least 25 ft. above the salt.
  - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic-type temperature

- survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
- b. Wait on cement (WOC) time for a primary cement job will be a minimum of <u>8</u> hours or 500 psi compressive strength, whichever is greater. (This is to include the lead cement)
- c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 psi compressive strength, whichever is greater.
- d. If cement falls back, remedial cementing will be done prior to drilling out that string.

**Note:** Operator has requested to have option to drill either 17-1/2" or 20" surface hole. Both hole sizes meet title 43 CFR 3172 clearance requirements between casing-coupling and hole. This option is granted; adjust cement volume accordingly.

- 2. The 7-5/8 inch, 29.7 #/ft. P-110 EC (or P-110 HC) intermediate casing shall be set at approximately 10,732 ft. (10,679 ft. TVD). Hole size changes from 12-1/4" to 9-7/8" at approximately 6,100 ft. The minimum required fill of cement behind the 7-5/8 inch intermediate casing is:
  - **Option 1 (Single stage): Cement to surface.** If cement does not circulate see B.1.a, c-d above. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to **Capitan Reef**.
  - **Option 2** (Two-stage): Operator has proposed a DV tool, the depth may be adjusted as long as the cement is changed proportionally. The DV tool may be cancelled if cement circulates to surface on the first stage.
    - **First stage to DV tool:** Cement to circulate. If cement does not circulate off the DV tool, contact the appropriate BLM office before proceeding with second stage cement job.
    - Second stage above DV tool: Cement to surface. If cement does not circulate see B.1.a, c-d above. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to Capitan Reef.

**Note:** The intermediate casing must be kept fluid-filled to meet BLM's minimum collapse design requirements.

- ❖ In <u>Capitan Reef Areas</u> if cement does not circulate to surface on the first two casing strings, the cement on the 3<sup>rd</sup> casing string must come to surface.
- ❖ Special Capitan Reef requirements. If lost circulation (50% or greater) occurs below the Base of the Salt, the operator shall do the following: (Use this for 3 string wells in the Capitan Reef, if 4 string well ensure FW based mud used across the Capitan interval)

- Switch to fresh-water mud to protect the Capitan Reef and use freshwater mud until setting the intermediate casing. The appropriate BLM office is to be notified for a PET to witness the switch to fresh water.
- Daily drilling reports from the Base of the Salt to the setting of the intermediate casing are to be submitted to the BLM CFO engineering staff via e-mail by 0800 hours each morning. Any lost circulation encountered is to be recorded on these drilling reports. The daily drilling report should show mud volume per shift/tour. Failure to submit these reports will result in an Incidence of Non-Compliance being issued for failure to comply with the Conditions of Approval. If not already planned, the operator shall run a caliper survey for the intermediate well bore and submit to the appropriate BLM office.
- 3. Operator has proposed to set 5-1/2 inch production casing at approximately 22,195 ft. (11,171 ft. TVD). The minimum required fill of cement behind the 5-1/2 in. production casing is:
  - Cement should tie-back at least 50 feet on top of Capitan Reef top or 200 feet into the previous casing, whichever is greater. Operator shall provide method of verification.

# **Alternate Casing Program**

**Note:** Surface casing set depth adjusted per BLM geologist's recommendation: "The operator proposes to set surface casing at 1813 feet, which may be in the salt. Instead set surface casing at 1460 feet. If salt is encountered, set casing a minimum of 25 feet above the salt."

- 1. The 13-3/8 inch surface casing shall be set at approximately 1460 ft. (a minimum of 25 feet (Lea County) into the Rustler Anhydrite and above the salt) and cemented to the surface. If salt is encountered, set casing at least 25 ft. above the salt.
  - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic-type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
  - b. Wait on cement (WOC) time for a primary cement job will be a minimum of <u>8</u> <u>hours</u> or <u>500</u> psi compressive strength, whichever is greater. (This is to include the lead cement)
  - c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 psi compressive strength, whichever is greater.
  - d. If cement falls back, remedial cementing will be done prior to drilling out that string.

**Note:** Operator has requested to have option to drill either 17-1/2" or 20" surface hole. Both hole sizes meet title 43 CFR 3172 clearance requirements between casing-coupling and hole. This option is granted; adjust cement volume accordingly.

2. The 10-3/4 inch, 45.5 #/ft. HCL-80, 1<sup>st</sup> intermediate casing shall be set at approximately 6,100 ft. (6,100 ft. TVD) The minimum required fill of cement behind the 10-3/4 inch intermediate casing is:

Option 1 (Single stage): Cement to surface. If cement does not circulate see B.1.a, c-d above. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to Capitan Reef.

<u>Option 2 (Two-stage):</u> Operator has proposed a DV tool, the depth may be adjusted as long as the cement is changed proportionally. The DV tool may be cancelled if cement circulates to surface on the first stage.

- **First stage to DV tool:** Cement to circulate. If cement does not circulate off the DV tool, contact the appropriate BLM office before proceeding with second stage cement job.
- Second stage above DV tool: Cement to surface. If cement does not circulate see B.1.a, c-d above. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to Capitan Reef.

**Note:** Excess cement for 2<sup>nd</sup> stage is below the BLM recommendation of 25%, more cement might be needed.

**Note:** 1<sup>st</sup> intermediate casing must be kept fluid-filled to meet BLM's minimum collapse design requirements.

- ❖ In <u>Capitan Reef Areas</u> if cement does not circulate to surface on the first two casing strings, the cement on the 3<sup>rd</sup> casing string must come to surface.
- ❖ Special Capitan Reef requirements. If lost circulation (50% or greater) occurs below the Base of the Salt, the operator shall do the following:
  (Use this for 3 string wells in the Capitan Reef, if 4 string well ensure FW based mud used across the Capitan interval)
  - Switch to fresh-water mud to protect the Capitan Reef and use freshwater mud until setting the intermediate casing. The appropriate BLM office is to be notified for a PET to witness the switch to fresh water.
  - Daily drilling reports from the Base of the Salt to the setting of the intermediate
    casing are to be submitted to the BLM CFO engineering staff via e-mail by
    0800 hours each morning. Any lost circulation encountered is to be recorded on
    these drilling reports. The daily drilling report should show mud volume per
    shift/tour. Failure to submit these reports will result in an Incidence of NonCompliance being issued for failure to comply with the Conditions of Approval.

If not already planned, the operator shall run a caliper survey for the intermediate well bore and submit to the appropriate BLM office.

**3.** The **7-5/8 inch**, 29.7 #/ft. P-110 EC (or P-110 HC), 2<sup>nd</sup> intermediate casing shall be set at approximately **10,732 ft.** (10,679 ft. TVD) The minimum required fill of cement behind the **7-5/8** inch intermediate casing is:

Option 1 (Single Stage): Cement should tie-back at least 50 feet on top of Capitan Reef top or 200 feet into the previous casing, whichever is greater. Operator shall provide method of verification. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to Capitan reef.

**Option 2 (Two-Stage):** Operator has proposed a DV tool(s), the depth may be adjusted as long as the cement is changed proportionally. The DV tool(s) may be cancelled if cement circulates to surface on the first stage.

DV tool(s) shall be set a minimum of 50' below previous shoe and a minimum of 200' above current shoe. Operator shall contact the BLM if DV tool(s) depth cannot be set in this range. If an ECP is used, it is to be set a minimum of 50' below the shoe to provide cement across the shoe. If it cannot be set below the shoe, a CBL shall be run to verify cement coverage.

In Capitan Reef a DV tool shall be set a maximum of 200' above the top of Capitan Reef.

- a. First stage to DV tool(s): Cement to circulate. If cement does not circulate off the DV tool(s), contact the appropriate BLM office before proceeding with second stage cement job.
- b. Second stage above DV tool(s):
  - Cement should tie-back at least **50 feet** on top of Capitan Reef top **or 200 feet** into the previous casing, whichever is greater. Operator shall provide method of verification. Wait on cement (WOC) time for a primary cement job is to include the lead cement slurry due to Capitan reef.

**Note:** The 2<sup>nd</sup> intermediate casing must be kept fluid-filled to meet BLM's minimum collapse design requirements.

- **4.** Operator has proposed to set **5-1/2 inch** production casing at approximately **22,195 ft.** (11,171 ft. TVD). The minimum required fill of cement behind the **5-1/2 in.** production casing is:
  - Cement should tie-back at least 200 feet into previous casing string. Operator shall provide method of verification.

# **Offline Cementing**

Operator has been (**Approved**) to pump the proposed cement program offline in the **Surface and intermediate(s) intervals**. Offline cementing should commence within 24 hours of landing the casing for the interval. Notify the BLM 4hrs prior to cementing offline at **Lea County:** 575-689-5981.

### C. PRESSURE CONTROL

- 1. Variance approved to use **flex line** from BOP to choke manifold. Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).
- 2. Operator has proposed a **multi-bowl wellhead** assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **10,000 (10M)** psi. **Variance is approved to use a 5M annular preventer with 10M BOP/BOPE.** The BOP/BOPE and annular preventer shall be pressure-tested in accordance with **title 43 CFR 3172 and API Standard 53.** 
  - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
  - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
  - c. Manufacturer representative shall install the test plug for the initial BOP test.
  - d. If the cement does not circulate and one-inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
  - e. Whenever any seal subject to test pressure is broken, all the tests in the **title** 43 CFR 3172.6(b)(9) must be followed.

## **BOPE Break Testing Variance (Approved)**

(Note: For a minimum 5M BOPE or less (Utilizing a 10M BOPE system)

- BOPE Break Testing is ONLY permitted for 5M BOPE or less. (Annular preventer must be tested to a minimum of 70% of BOPE working pressure and shall be higher than the MASP)
- BOPE Break Testing is NOT permitted to drilling the production hole section.
- Variance only pertains to the intermediate hole-sections and no deeper than the Bone Springs formation.
- While in transfer between wells, the BOPE shall be secured by the hydraulic carrier or cradle.
- Any well control event while drilling require notification to the BLM Petroleum Engineer (575-706-2779) prior to the commencement of any BOPE Break Testing operations.

- A full BOPE test is required prior to drilling the first deep intermediate hole section. If any subsequent hole interval is deeper than the first, a full BOPE test will be required. (200' TVD tolerance between intermediate shoes is allowable).
- The BLM is to be contacted (575-689-5981 Lea County) 4 hours prior to BOPE tests.
- As a minimum, a full BOPE test shall be performed at 21-day intervals.
- In the event any repairs or replacement of the BOPE is required, the BOPE shall test as per 43 CFR part 3170 Subpart 3172.
- If in the event break testing is not utilized, then a full BOPE test would be conducted.

# D. SPECIAL REQUIREMENT (S)

## **Communitization Agreement**

- The operator will submit a Communitization Agreement to the Santa Fe Office, 301 Dinosaur Trail Santa Fe, New Mexico 87508, at least 90 days before the anticipated date of first production from a well subject to a spacing order issued by the New Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.
- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. When the Communitization Agreement number is known, it shall also be on the sign.

# **GENERAL REQUIREMENTS**

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)

## **Contact Lea County Petroleum Engineering Inspection Staff:**

Call the Hobbs Field Station, 414 West Taylor, Hobbs NM 88240, (575) 689-5981.

- 1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
  - a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).
  - b. When the operator proposes to set surface casing with Spudder Rig
    - i. Notify the BLM when moving in and removing the Spudder Rig.
    - ii. Notify the BLM when moving in the 2<sup>nd</sup> Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
    - iii. BOP/BOPE test to be conducted per **43 CFR 3172** as soon as 2<sup>nd</sup> Rig is rigged up on well.
- 2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the doghouse or stairway area.
- For intervals in which cement to surface is required, cement to surface should be verified with a visual check and density or pH check to differentiate cement from spacer and drilling mud. The results should be documented in the driller's log and daily reports.

### A. CASING

- 1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.
- 2. Wait on cement (WOC) for Potash Areas: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends of both lead and tail cement, 2) until cement has been in place at least 8 hours. WOC time will be

- recorded in the driller's log. The casing integrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 3. Wait on cement (WOC) for Water Basin: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least 8 hours. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing integrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- **4.** Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.
- **5.** No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.
- **6.** On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.
- 7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.
- **8.** Whenever a casing string is cemented in the R-111-Q potash area, the NMOCD requirements shall be followed.

### **B. PRESSURE CONTROL**

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in 43 CFR 3172.
- 2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.

- 3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.
- 4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:
  - i. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
  - ii. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
  - iii. Manufacturer representative shall install the test plug for the initial BOP test.
  - iv. Whenever any seal subject to test pressure is broken, all the tests in 43 CFR 3172.6(b)(9) must be followed.
  - v. If the cement does not circulate and one-inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
  - i. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead cement), whichever is greater. However, if the float does not hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
  - ii. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the cement plug. The BOPE test can be initiated after bumping the cement plug with the casing valve open. (Only applies to single stage cement jobs, prior to the cement setting up.)
  - iii. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer and can be initiated immediately with the casing valve open. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to 43 CFR **3172** with the pressure not to exceed 70% of the burst rating for the casing.

- Any test against the casing must meet the WOC time for 8 hours or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
- iv. The test shall be run on a 5000-psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one-hour chart. A circular chart shall have a maximum 2-hour clock. If a twelve hour or twenty-four-hour chart is used, tester shall make a notation that it is run with a two hour clock.
- v. The results of the test shall be reported to the appropriate BLM office.
- vi. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- vii. The BOP/BOPE test shall include a low-pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- viii. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per 43 CFR 3172.

### C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

## D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area. Porto-johns and trash containers will be on-location during fracturing operations or any other crewintensive operations.

SA 10/02/2024

# Hydrogen Sulfide Drilling Operations Plan Matador Resources

## 1 H2S safety instructions to the following:

- Characteristics of H2S
- Physical effects and hazards
- Principal and operation of H2S detectors, warning system and briefing areas
- Evacuation procedures, routes and first aid
- Proper use of safety equipment & life support systems
- Essential personnel meeting medical evaluation criteria will receive additional training on the proper use of 30min pressure demand air packs

## 2 H2S Detection and Alarm Systems:

- H2S sensor/detectors to be located on the drilling rig floor, in the base of the sub structure / cellar area, on the mud pits in the shale shaker area. Additional H2S detectors may be placed as deemed necessary
- An audio alarm system will be installed on the derrick floor and in the doghouse

## 3 Windsocks and / Wind Streamers:

- Windsocks at mud pit area should be high enough to be visible
- Windsock on the rig floor and / top of doghouse should be high enough to be visible

## 4 Condition Flags and Signs:

- Warning sign on access road to location
- Flags to be displayed on sign at entrance to location
  - o Green Flag Normal Safe Operation Condition
  - Yellow Flag Potential Pressure and Danger
  - Red Flag Danger (H2S present in dangerous concentrations) Only H2S trained personnel admitted on location

## 5 Well Control Equipment:

• See Exhibit E-1

### 6 Communication:

- While working under masks chalkboards will be used for communications
- Hand signals will be used where chalk board is inappropriate
- Two way radio will be used to communicate off location in case of emergency help is required. In most cases cellular telephones will be available at most drilling foreman's trailer or living quarters.

## 7 Drilling Stem Testing:

• No DST cores are planned at this time

- 8 Drilling contractor supervisor will be required to be familiar with the effects H2S has on tubulars good and other mechanical equipment
- 9 If H2S is encountered, mud system will be altered if necessary to maintain control of formation. A mud gas separator will be brought into service along with H2S scavengers if necessary
- 11 Emergency Contacts
  - See exhibit E-6

# HYDROGEN SULFIDE CONTINGENCY PLAN Drilling, Testing, & Completion

# MRC ENERGY CO.

Reviewers ------ Operations Manager ----- Operations Supt. ----- Staff RES ----- Field Supt. Blake Hermes---Engineering

H2S Contingency Plan # 0165 Revision# 0

This H2S Contingency Plan is subject to updating

Effective date: July 8, 2015

# TABLE OF CONTENTS

I.	INTRODUCTION	3
II.	PURPOSE	4
	A. Operating Procedures	5
	B. Procedures to be Initiated Prior to reaching H2S Contingency Plan Compliance	6
	C. Drilling Below Contingency Plan Depth	7
	D. Procedures program	7
III.	CONDITIONS & H <sub>2</sub> S EMERGENCY PROCEDURES	10
	A. Definition of Operational "Conditions"	10
	B. H2S Emergency Procedures; In Scope Personnel	12
	C. Instructions for Igniting the Well	16
	<ul><li>D. Coring</li><li>E. Normal Operations</li></ul>	17 18
IV.	E. Normal Operations SAFETY EQUIPMENT	21
V.	TOXICITY OF VARIOUS GASES	23
VI.	PROPERTIES OF GASES	24
VII.	TREATMENT PROCEDURES FOR H2S POISONING	25
VIII.	BREATHING AIR EQUIPMENT DRILLS ON/OFF DUTY	26
IX.	HYDROGEN SULFIDE TRAINING CURRICULUM	27
х.	FIT TEST	29
XI.	H2S EQUIPMENT LIST	30
XII.	EMERGENCY PHONE NUMBERS	32
XIII.	EVACUATION OF GENERAL PUBLIC	37
XIV.	SEPCO EMERGENCY PHONE NUMBERS AND DIRECTIONS TO WELL SITE	38
XV.	ROE MAP (RADIUS OF EXPOSURE)	39
XVI.	RESIDENCE LIST WITHIN ROE	40

## INTRODUCTION

The H2S equipment will be rigged up 2 days prior to reaching a potential H2S containing zone. Drilling into any potential H2S zone shall not commence until the on-site MRC Drilling Supervisor has confirmed this plan in place.

The onsite Drilling Foreman will give Total Safety one week (7 days) notice to prepare for rig up of H2S equipment)

To be effective, the plan requires the cooperation and effort of each person participating in the drilling of an H<sub>2</sub>S well. Each person must know his/her responsibilities and all emergency and safety procedures. He/she should thoroughly understand and be able to use with accuracy, all safety equipment while performing his/her normal duties, if the circumstance should arise. He/she should therefore familiarize himself/herself with the location of all safety equipment and check to see that it is properly stored, easily accessible at all times, and routinely maintained.

It is the intention of MRC ENERGY CO. and the Drilling Contractor to make every effort to provide adequate safeguards against harm to persons on the rig and in the immediate vicinity from the effects of hydrogen sulfide, which may be released into the atmosphere under emergency conditions. However, the initiative rests with the individual in utilizing the safeguards provided. The ideas and suggestions of the individuals involved in the drilling of this well are highly welcomed and act as a fundamental tool for providing the safest working conditions possible.

The drilling representative is required to enforce these procedures. They are set up for your safety and the safety of all others.

## II. PURPOSE

It is MRC Energy Co.'s intent to provide a safe working place, not only for its employees, but also for other contractors who are aiding in the drilling of this well. The safety of the general public is of utmost concern. All precautions will be taken to keep a safe working environment and protect the public.

There is a possibility of encountering toxic hydrogen sulfide gas. Safety procedures must be adhered to in order to protect all personnel connected with the operations as well as people living within the area.

The MRC Energy Co. representative will enforce all aspects of the H2S Contingency Plan. This job will become easier by a careful study of the following pages and training and informing all personnel that will be working on the well, their duties and responsibilities.

### A. OPERATING PROCEDURES

## **DEFINITIONS:**

For purpose of this plan, on-site personnel shall be referred to as "In Scope Personnel" or "Out of Scope Personnel", per the following definitions:

**In Scope Personnel** – Personnel who will be working or otherwise present in potential H2S release areas, including the rig floor, cellar, pits, and shaker areas.

Out of Scope Personnel – Personnel who will not be working or Otherwise present in potential H2S areas. Such personnel include rig Site visitor, delivery and camp services personnel.

## **GENERAL:**

Before this H<sub>2</sub>S contingency plan becomes operational, all regularly assigned In Scope Personnel (primarily the MRC, drilling contractor, and certain service personnel,) shall be thoroughly trained in the use of breathing equipment, emergency procedures, and responsibilities. Total Safety Technician or a designee assigned by the MRC Drilling Foreman shall keep a list of all personnel who have been through the on-site H<sub>2</sub>S training program at the drill site.

All In Scope Personnel shall be given H2S training and the steps to be taken during H2S conditions under which the well may be drilled. General information will be explained about toxic gases, as well as the physiological effects of H<sub>2</sub>S and the various classified operating conditions. In addition, the reader will be informed his/her general responsibility concerning safety equipment and emergency procedures.

The Total Safety H<sub>2</sub>S Safety Technician or MRC on-site RSE Technician shall make available the H2S Contingency Plan for all personnel to review.

Without exception, all personnel that arrive on location must proceed directly to and sign-in with the on-site MRC RSE Technician. In Scope Personnel will be required to complete an on-site H2S training and respirator fit testing before starting work, or produce evidence that they have received equivalent training. Out of Scope Personnel will be required to complete a site H2S awareness and general safety briefing. This briefing will consist of a H2S hazard overview, alarm review and required response to alarms.

# B. PROCEDURES TO BE INITIATED PRIOR TO H2S CONTINGENCY PLAN COMPLIANCE:

A list of emergency phone numbers and contacts will be on location and posted at the following locations:

- 1. MRC ENERGY CO.'S Representative's Office
- 2. Drilling Contractor's, Toolpusher Office
- 3. Living Quarters Area

All safety equipment and H<sub>2</sub>S related hardware must be set up as required by MRC Energy Co. with regard to location of briefing areas, breathing equipment, etc. All safety equipment must be inspected periodically (at least weekly) with particular attention to resuscitators and breathing equipment.

In Scope Personnel working in the well site area will be assigned breathing apparatus. Operator and drilling contractor personnel required to work in the following areas will be provided with Self Contained Breathing Apparatus:

- 1. Rig Floor
- 2. Mud Pits
- 3. Derrick
- 4. Shale Shaker
- 5. Cellar

The Total Safety H<sub>2</sub>S Safety Technician will be responsible for rigging up all H<sub>2</sub>S continuous monitoring-type detectors. The Total Safety Technician will monitor and bump test the detector units periodically (at least at least once a week to test alarm function during drilling conditions. In the event H<sub>2</sub>S is detected, or when drilling in a zone confirmed to contain H<sub>2</sub>S, the units shall be bump tested at least once every 24 hours. A bump test/calibration log will be kept on location. All results will be reported to the MRC on-site Drilling Foreman.

All Total Safety H2S equipment will be maintained and inspected by a Total Safety Technician on at least a Weekly basis.

## C. DRILLING BELOW CONTINGENCY PLAN DEPTH

H2S response drills will be held at least once per week if possible or as often as necessary to acquaint the crews and service company personnel of their responsibilities and the proper procedures to shut-in a well. Initial drills will be performed until crews demonstrate competency donning and working under mask. After the MRC Energy Co.'s representative is satisfied with initial blowout drill procedures, a drill will be conducted weekly with each crew, as necessary. The H2S Safety Technician or designee will conduct safety talks and maintain the safety equipment, consult and carry out the instructions of the drilling supervisor. All personnel allowed in the well work area during drilling or testing operations will be instructed in the use of breathing equipment until supervisory personnel are satisfied that they are capable of using it.

After familiarization, each person must perform a drill with breathing equipment. The drill should include getting the breathing equipment, donning the breathing apparatus, and performing expected duties for a short period. A record shall be kept of all personnel drilled and the date of the drill. H2S training records will be kept on location for all personnel.

Rig crews and service company personnel shall be made aware of the location of spare air bottles, resuscitation equipment, portable fire extinguishers, H<sub>2</sub>S monitors and detectors. Knowledge of the location of the H<sub>2</sub>S monitors and detectors are vital in determining as our gas location and the severity of the emergency conditions.

After any device has initially detected H2S, all areas of poor ventilation shall be inspected periodically by means of a portable H<sub>2</sub>S detector instrument. The buddy system will be utilized. (When an alarm sounds, personnel will don an SCBA, shut the well in, and proceed to SBA for roll call. The H2S Technician or designee will mask up, with a buddy and will verify source of H2S and report back to the on-site MRC Foreman.)

### D. PROCEDURES PROGRAM

### 1. Drill Site

- a. The drilling rig will be located to allow prevailing winds to blow across the reserve pit.
- b. A Safe Briefing Area will be provided with a breathing air cascade trailer and or 30-minute SCBA's at the Primary Area. Personnel will assemble at the most up-wind station under alarm conditions, or when so ordered by the MRC Energy Co. representative, the Contractor representative, or

- the Total Safety H<sub>2</sub>S Safety Technician. Windsocks or streamers will be anchored to various strategic places on a pole about 10 feet high, so it is in easy view from the rig floor at all times.
- c. Warning signs will be posted on the perimeters. "No Smoking" signs will be posted by MRC Energy Co.as well.
- d. One multi-channel automatic H<sub>2</sub>S monitor will be provided by Total Safety and the detector heads will be at the shale shaker, bell nipple, mud pits, rig floor, and quarter's area. The monitor will be located inside HSE or Company man trailer. Should the alarm be shut off to silence the sirens, the blinker light must continue to warn of H<sub>2</sub>S presence. The Total Safety H2S Safety Technician or designee will continuously monitor the detectors and will reactivate the alarm if H<sub>2</sub>S concentrations increase to a dangerous level.
- e. A method of escape will be open at all times.
- f. If available, land line telephone service will be provided or cell phones provided. (Primary communications provided)
- g. A rig communication system will be provided, as needed.
- h. A gas trap, choke manifold, and degasser will be installed.
- i. A kill line, securely anchored and of ample strength, will be laid to the well-head from a safe location. This line is to be used only in an emergency.

## General

- a. The MRC Energy Co. representative and/or the Contractor's Toolpusher will be available at all times. The drilling supervisor, while on duty, will have complete charge of the rig and location operations and will take whatever action is deemed necessary to insure personnel safety, to protect the well, and to prevent damage.
  - b. A Mud Engineer will be on location at all times when drilling takes place at the depth H<sub>2</sub>S may be expected. The mud engineer will be able to verify the presence or absence of H2S.

# III. CONDITIONS AND EMERGENCY PROCEDURES A. DEFINITION OF OPERATIONAL "CONDITIONS"

CONDITION I "POSSIBLE DANGER"

Warning Flags

Green

Alarms No Alarm. Less than 10 ppm

Characterized By: Drilling operations in zones that may

contain hydrogen sulfide. This condition remains in effect unless  $H_2S$  is detected and it becomes necessary to go to Condition II.

General Action: a. Be alert for a condition change

b. Check all safety equipment for availability and proper functioning.

c. Perform all drills for familiarization and proficiency.

**CONDITION II** "MODERATE DANGER"

Warning Flags Yellow

Alarms: Actuates at 10 ppm. Continuous flashing

light.

Characterized By: Drilling operations in zones containing

hydrogen sulfide. This condition will remain in effect until adding chemicals to the mud system neutralizes the hydrogen sulfide or it becomes necessary to go to

Condition III.

General Action: a. Be alert for a condition change

b. WHEN DRILLING AHEAD -

Driller and designated crewmember will don 30 min SCBA, shut-in the well and immediately proceed to the

Safe Briefing Area.

WHEN TRIPPING – Driller and two designated crewmembers will don 30 min SCBA, shut in the well and immediately proceed to the Safe Briefing Area. The Derrickman will

don a 5-minute escape pack, descend to the rig floor, don a 30-min SCBA (if necessary) and immediately proceed to the Safe Briefing Area.

- c. All In Scope Personnel will proceed directly to the appropriate Safe Briefing Area.
- d. Remain in safe briefing area, take roll call and wait for instructions
- e. Contact the Total H2S Technician if not on location.
- f. Personnel shall ensure that their breathing apparatus is properly fitted and operational before entering an H<sub>2</sub>S contaminated area to provide assistance to anyone who may be injured or overcome by toxic gases.
- g. All Out of Scope Personnel will report to the appropriate Safe Briefing Area.

## CONDITION III "EXTREME DANGER"

Warning Flags

Red

Alarms

Actuate at 15 ppm. Continuous Sirens and Flashing Lights

Characterized by:

Critical well operations which pose an immediate threat of  $H_2S$  exposure to on-site personnel and a potential threat to the public.

General Action:

a. WHEN DRILLING AHEAD Driller and designated crewmember
will don 30 min SCBA, shut-in the
well and immediately proceed to the
Safe Briefing Area.

WHEN TRIPPING – Driller and two designated crewmembers will don 30

min SCBA, shut in the well and immediately proceed to the Safe Briefing Area. The Derrickman will don a 5-minute escape pack, descend to the rig floor, don a 30-min SCBA (if necessary) and immediately proceed to the Safe Briefing Area.

- b. All In Scope Personnel should don SCBA if nearby and immediately proceed to Safe Briefing Area. If SCBA in not nearby at time of alarm, DO NOT GO TOWARDS RIG AREA, but proceed directly to the Safe Briefing Area
- c. All out of Scope Personnel shall evacuate the location.
- d. Remain in the Safe Briefing Area, take roll call and wait for instructions.
- e. Contact the Total H2S Technician if not on location.
- f. Personnel shall ensure that their breathing apparatus is properly fitted and operational before entering an H<sub>2</sub>S contaminated area to provide assistance to anyone who may be injured or overcome by toxic gases. Use the buddy system.
- g. Remain in safe briefing area, take roll call and wait for instructions.
- h. A cascade breathing air systems shall be mobilized and utilized to conduct any additional on rig work required to correct the H2S release condition.
- i. If well is ignited do not assume area is safe. SO2 is hazardous and not all H2S will burn.

## H<sub>2</sub>S EMERGENCY PROCEDURES; IN SCOPE PERSONNEL

# A. Day To Day Drilling Operations

- 1. Upon discovering a release of H<sub>2</sub>S gas in the ambient air by warning alarms or in any other way **Do Not Panic**.
- 2. Hold your breath donning the nearest Self Contained Breathing Apparatus and rapidly move up or across-wind away from the areas where H<sub>2</sub>S sensing devices are in place, to the closest available safe briefing area. Continue to use breathing apparatus until it has been determined that the exposure of H<sub>2</sub>S gas in the ambient air no longer exists. **Do Not Panic!**
- 3. Utilize the "Buddy System", i.e.; select and pair up each person participating in the drilling of an H<sub>2</sub>S well prior to an emergency situation.
- 4. Help anyone who is overcome or affected by the H<sub>2</sub>S gas by taking him/her up-wind out of the contaminated area. (This should be done utilizing an SCBA and with a buddy.)
- 5. Take necessary steps to confirm the release of the H<sub>2</sub>S gas into the ambient air.
  - When an H2S alarm activates, two designated personnel using the buddy system, while wearing their self contained breathing apparatus, will determine by the read-out on the fixed monitor which sensing device has detected the release of the H<sub>2</sub>S gas.
  - They will utilize the hand-held sniffer type device at the particular sensing point disclosed on the fixed monitor to corroborate the fact that H<sub>2</sub>S gas has actually been released. This will rule out the possibility of a false alarm. This will be done with a buddy and under mask after reporting to the Safe Briefing Area for roll call and instructions by on-site MRC Foreman.
- 6. Refer to the Emergency Phone Numbers and call emergency personnel.
- 7. Take the necessary steps to suppress the release of H<sub>2</sub>S gas into the ambient air. Comply with the MRC Energy Co. Representative to physically suppress the release of H<sub>2</sub>S gas at the actual release point.

8. Check all of MRC Energy Co.'s monitoring devices and increase gasmonitoring activities with the portable hand-operated H<sub>2</sub>S and gas detector units.

## Do Not Panic!

The MRC Energy Co. representative will assess the situation and with assistance of the Contractor's Representative and Total Safety's  $H_2S$  Safety Technician or on site designee, will assign duties to each person to bring the situation under control.

## B. RESPONSIBILITIES OF WELL-SITE PERSONNEL

In the event of a release of potentially hazardous amounts of  $H_2S$ , all personnel will immediately don their protective breathing apparatus, the well will be shut in and personnel will proceed upwind to the nearest designated safe briefing area for roll call and instructions by MRC Foreman. Consideration will be given to evacuating Out of Scope Personnel, as situation warrants.

## 1. MRC ENERGY CO.'S Well-site Representatives

- a. If MRC Energy Co.'s well-site representative is incapacitated or not on location, this responsibility will fall to the Toolpusher/Driller.
- b. Immediately upon assessing the situation, set this plan into Action by initiating the proper procedures to contain the gas and notify the appropriate people and agencies.
- c. Ensure that the alarm area indicated by the fixed H<sub>2</sub>S Monitor is checked and verified with a portable H<sub>2</sub>S detector. (Safety Technician if on location or MRC assigned designee with a buddy utilizing SCBA's)
- d. Consult Pusher/driller of remedial actions as needed.
- e. Ensure that non-essential personnel proceed to the safe briefing area.
- f. Ensure location entrance barricades are positioned. Keep the number of persons on location to a minimum during hazardous operations.

- g. Consult each contractor, Service Company and all others allowed to enter the site, that H2S gas may be encountered and the potential hazards that may exist.
- h. Authorize the evacuation of local residents if  $H_2S$  threatens Their safety.
  - i. Non essential personnel should be evacuated from location if Situation warrants.

## 2. Toolpusher

- a. Toolpusher/Driller will assume responsibilities of MRC Energy Co.'s well-site representative if that person is incapacitated or not on location.
- b. Ensure that the alarm area indicated by the fixed H<sub>2</sub>S monitor is checked and verified with a portable H<sub>2</sub>S gas detector. (Alarm area indicated by the monitor will be Checked by the H2S Technician and a buddy, under mask.) This will be done after checking in and roll call at the Upwind Safe Briefing Area.
- c. Confer with MRC Energy Co.'s well-site representative or superintendent and direct remedial action to suppress the H<sub>2</sub>S and control the well.
- d. Ensure that personnel at the safe briefing area are instructed on emergency actions required.
- e. Ensure that personnel at the drill floor area are instructed on emergency actions required.
- f. Ensure that all personnel observe the appropriate safety and emergency procedures.
- g. Ensure that all persons are accounted for and provided emergency assistance as necessary.

## 3. Mud Engineer

- a. Run a sulfide check on the flowline mud.
- b. Take steps to determine the source of the H<sub>2</sub>S and suppress it. Lime and H<sub>2</sub>S scavenger shall be added to the mud as necessary.

# 4. Total H<sub>2</sub>S Safety Technician, if on location, or MRC Designee

- a. H2S Safety Technician or designee don nearest SCBA and report to Safe Briefing Area for roll call, take a buddy masked up and check monitor and verify with a portable H<sub>2</sub>S detector the alarm area indicated by the fixed H<sub>2</sub>S monitor. Advise the Toolpusher/Driller and MRC Energy Co.'s well-site representative of findings. Record all findings.
- b. If H<sub>2</sub>S is flared, check for sulfur dioxide (SO<sub>2</sub>) near the flare as necessary. Take hourly readings at different perimeters, log readings and record on location.
- c. Ensure that personnel at the safe briefing area are instructed on emergency actions required.
- d. Ensure that the appropriate warning flags are displayed.
- e. Ensure that all personnel are in S.C.B.A. as necessary.
- f. Ensure that all persons are accounted for and provide emergency assistance as necessary.
- g. Be prepared to evacuate rig if order is issued.

### 5. General Personnel & Visitors

a. All In Scope Personnel, if not specifically designated to shut the well in or control the well, shall proceed to the (upwind) safe briefing area. All Out of Scope Personnel shall immediately proceed to the appropriate (upwind) safe briefing area or evacuate the site as conditions warrant.

- b. During any emergency, use the "buddy" system to prevent anyone from entering or being left in a gas area alone, even wearing breathing apparatus.
- c. Provide assistance to anyone who may be injured or overcome by toxic gases. Personnel shall ensure that their breathing apparatus is properly fitted and operational before entering a potentially H<sub>2</sub>S contaminated area.
- d. Remain in safe briefing area and wait for instructions.

## C. INSTRUCTIONS FOR IGNITING THE WELL

1. The Toolpusher/Driller will confer with MRC Energy Co.'s well-site representative who will secure the approval of the "Texas Wells Delivery Manager, prior to igniting the well, if at all possible.

The Toolpusher/Driller will be responsible for igniting the well in the event of severe well control problems. This decision should be made only as a last resort in situations where it is clear that:

- a. Human life and property are endangered, or
- b. There is no hope of controlling the well under current conditions.
- 2. Once the decision has been made, the following procedures should be followed:
  - a. Two people wearing self-contained breathing apparatus will be needed for the actual lighting of the well. They must first establish the flammable perimeter by using an explosimeter. This should be established at 30% to 40% of the lower flammable limits.
  - b. After the flammable perimeter has been established and everyone removed from the area, the ignition team should select a site upwind of the well from which to ignite the well. This site should offer the maximum protection and have a clear path for retreat from the area.

- c. The ignition team should have safety belts and lifeline attached and manned before attempting ignition. If the leak is not ignited on the first attempt, move in 20 to 30 feet and fire again. Continue to monitor with the explosimeter and NEVER fire from an area with over 75% of the Lower Explosive Limit (LEL). If having trouble igniting the well, try firing 40 degrees to 90 degrees on either side of the well.
- d. If ignition is not possible due to the makeup of the gas, the toxic perimeter must be established and evacuation continued until the well is contained.
- e. All personnel must act only as directed by the person in charge of the operations.

NOTE: After the well is ignited, burning hydrogen sulfide (H<sub>2</sub>S) will convert to sulfur dioxide (SO<sub>2</sub>), which is also a highly toxic gas.

### DO NOT ASSUME THE AREA IS SAFE AFTER THE WELL IS IGNITED

## D. CORING PROCEDURES

Only essential personnel shall be on the rig floor. Ten (10) stands prior to retrieving core barrel; all personnel on drill floor and in derrick shall confirm self-Contained breathing apparatus available and ready for use.

A Total H2S Technician will don a SCBA with a buddy assigned from the rig crew, and continuously monitor for H2S at each connection. Any levels detected will require operations to be shut down and all involved personnel to don SCBAs. Precautions will remain in place until barrel is laid down.

All involved personnel will don SCBAs when removing the inner barrel from the outer barrel. SCBAs can be removed once the absence of H2S in confirmed by the Total H2S Technician.

Cores will be appropriately marked and sealed for transportation.

# **Normal Operations**

# 1. Responsibilities of well-site personnel

# a. Well-site Representative

- 1. Notify H<sub>2</sub>S Technician of expected date to reach Contingency Plan implementation depth (Two (2) days prior to reaching suspected H<sub>2</sub>S bearing zone) or prior to starting well work.
- 2. Ensure H<sub>2</sub>S Safety Technician completes rig-up procedures prior to reaching Contingency Plan effective depth.
- 3. Restrict the number of personnel at the drilling rig or well site to a minimum while drilling, starting well work, testing or coring.
- 4. Ensure weekly H<sub>2</sub>S drills/training are performed, if possible.

# B. Toolpusher

- 1. Ensure that necessary H<sub>2</sub>S safety equipment is provided on the rig, and that it is properly inspected and maintained.
- 2. Ensure that all personnel that work in the well area, are thoroughly trained in the use of H<sub>2</sub>S safety equipment and periodic drills are held to maintain an adequate level of proficiency.

# C. In Scope Personnel

- 1. Remain clean-shaven. Beards and long sideburns do not allow a proper facepiece seal.
- 2. Receive H<sub>2</sub>S safety training on location, or confirm prior training by certification that is one year within date.
- 3. Familiarize yourself with the rig's Contingency Plan.
- 4. Inspect and practice putting on your breathing apparatus.

- 5. Know the location of the "safe briefing areas".
- 6. Keep yourself "wind conscious". Be prepared to quickly move upwind and away in the event of any emergency involving release of H<sub>2</sub>S.

# D. Total Safety H<sub>2</sub>S Safety Technician or MRC Designee

- 1. Conduct training as necessary to ensure all personnel working in well area are familiar with the contingency procedures and the operation of emergency equipment.
- 2. Check all H<sub>2</sub>S safety equipment to ensure that it is ready for emergency use:
  - Check pressure weekly for each shift on breathing apparatus (both 30-minute and hippacks) to make sure they are charged to full volume.
  - Check pressure on cascade air bottles, if on location, to see that they are capable of recharging breathing apparatus.
  - Check oxygen resuscitator, if on location, to ensure that it is charged to full volume.
  - Check H<sub>2</sub>S detectors weekly for each shift (fixed and portable), and explosimeter, to ensure they are working properly.
- 3. Provide a weekly report to MRC Energy Co.'s well-site representative documenting:
  - Calibrations performed on H<sub>2</sub>S detectors.
  - Proper location and working order of H<sub>2</sub>S safety equipment.
  - Attendance of all personnel, trained or retrained, and their company.
  - Weekly drills, if held and a list of personnel participating and summary of actions.

# **OUT OF SCOPE PERSONNEL**

MRC Energy Co. policy will not require Out of Scope Personnel to be clean shaven, have processed medical questionnaires, fit testing, or have certified H2S Training.

#### **SAFETY EQUIPMENT**

All respirators will be designed, selected, used and maintained in conformance with ANSI Z88.2, American National Standard for respiratory protection.

Personal protective equipment must be provided and used. Those who are expected to use respiratory equipment in case of an emergency will be carefully instructed in the proper use and told why the equipment is being used. Careful attention will be given to the minute details in order to avoid possible misuse of the equipment during periods of extreme stress.

Self-contained breathing apparatus provides complete respiratory and eye protection in any concentration of toxic gases and under any condition of oxygen deficiency. The wearer is independent of the surrounding atmosphere because he/she is breathing with a system admitting no outside air. It consists of a full face mask, breathing tube, pressure demand regulator, air supply cylinder, and harness. Pure breathing air from the supply cylinder flows to the mask automatically through the pressure demand regulator which reduces the pressure to a breathing level. Upon inhalation, air flows into the mask at a rate precisely regulated to the user's demand. Upon exhalation, the flow to the mask stops and the exhaled breath passes through a valve in the face piece to the surrounding atmosphere. The apparatus includes an alarm & gauge which warns the wearer to leave the contaminated area for a new cylinder of air or cylinder refill.

The derrickman is provided with a full face piece unit attached to a 5– minute escape cylinder. He will also have his own self-contained 30-minute unit breathing apparatus located on the drilling floor. He will use the 5-minute unit to exit the derrick to the floor, donning the 30-minute unit located on the floor, if needed.

All respiratory protective equipment, when not in use, should be stored in a clean, cool, dry place, and out of direct sunlight to retard the deterioration of rubber parts. After each use, the mask assembly will be scrubbed with soap and water, rinsed thoroughly, and dried. Air cylinders can be recharged to a full condition from a cascade system.

Personnel in each crew will be trained in the proper techniques of bottle filling.

The primary piece of equipment to be utilized, should anyone be overcome by hydrogen sulfide, is the oxygen resuscitator, if on location.

When asphyxiation occurs, the victim must be moved to fresh air and immediately given artificial respiration. In order to assure readiness, the bottles of oxygen will be checked at regular intervals and an extra tank kept on hand.

Hand-operated pump-type detectors incorporating detector tubes will give more accurate readings of hydrogen sulfide. The pump-type draws air to be tested through the detector tube containing lead acetate-silica gel granules. Presence of hydrogen sulfide in the air sample is shown by the development of a dark brown stain on the granules, which is the

scale reading of the concentration of hydrogen sulfide. By changing the type of detector tube used, this detector may also be used for sulfur dioxide  $(SO_2)$  detection when hydrogen sulfide  $(H_2S)$  is being burned in the flare area.

Provisions must be made for the storage of all safety equipment as is evident from the foregoing discussion. All equipment must be stored in an available location so that anyone engaged in normal work situations is no more than "one breath away' from a mask.

#### V – TOXICITY OF VARIOUS GASES

l athal	Chemical	Specific		
Lethal Common Name ppm <sup>4</sup>	Formula	Gravity <sup>1</sup>	PEL (OSHA) <sup>2</sup>	STEL <sup>3</sup>
Hydrogen Cyanide 300	HCN	0.94	10	150
Hydrogen Sulfide	H <sub>2</sub> S	1.18	20 Pea	ak- 50ppm
Note: The ACGIH(7) red	commends a TW	A(6) value of 10	opm as the TLV(5) for	H2S and an STEL of
15ppm. Sulfur Dioxide 1000	SO <sub>2</sub>	2.21	2	5 ppm
Chlorine	$CL_2$	2.45	1	
Carbon Monoxide 1000	СО	0.97	35	200/1 Hour
Carbon Dioxide 10%	CO <sub>2</sub>	1.52	5000	5%
Methane	CH <sub>4</sub>	0.55	90000	

 $<sup>^{1}</sup>$  Air = 1.0

**TLV** – Threshold Limit Value; a concentration recommended by the American Conference of Governmental Industrial Hygienists (ACGIH)

**TWA –** Time Weighted Average; the average concentration of contaminant one can be exposed to over a given eight-hour period.

**ACGIH –** (American Conference of Governmental Industrial Hygienists) is an organization comprised of Occupational Health Professionals believed by many to be the top experts in the field of Industrial Hygiene. They are recognized as an expert rexource by OSHA. The ACGIH releases a biannual publication "Threshold Limit Values and Biological Indices" that many safety professionals consider to be the authoritative document on airborne contaminants.

Reference: API RP-49, September 1974 - Reissued August 1978

<sup>&</sup>lt;sup>2</sup> Permissible - Concentration at which is believed that all workers may repeatedly be exposed, day after day, without adverse effect.

<sup>&</sup>lt;sup>3</sup> **STEL -** Short Term Exposure Limit. A 15-minute time weighted average.

<sup>&</sup>lt;sup>4</sup> **Lethal -** Concentration that will cause death with short-term exposure.

# VI. PROPERTIES OF GASES

## A. CARBON DIOXIDE

- 1. Carbon Dioxide (CO<sub>2</sub>) is usually considered inert and is commonly used to extinguish fires. It is 1.52 times heavier than air and will concentrate in low areas of still air. Humans cannot breathe air containing more than 10% CO<sub>2</sub> without losing conscience or becoming disorientation in a few minutes. Continued exposure to CO<sub>2</sub> after being affected will cause convulsions, coma, and respiratory failure.
- 2. The threshold limit of  $CO_2$  is 5000 ppm. Short-term exposure to 50,000 ppm (5%) is reasonable. This gas is colorless, odorless, and can be tolerated in relatively high concentrations.

# B. HYDROGEN SULFIDE

- 1. Hydrogen Sulfide  $(H_2S)$  is a colorless, transparent, flammable gas. It is heavier than air and, hence, may accumulate in low places.
- 2. Although the slightest presence of H<sub>2</sub>S in the air is normally detectable by its characteristic "rotten egg" odor, it is dangerous to rely on the odor as a means of detecting excessive concentrations because the sense of smell is rapidly lost, allowing lethal concentrations to be accumulated without warning. The following table indicates the poisonous nature of H<sub>2</sub>S.

CONCENTRATION		TRATION	EFFECTS	
% H <sub>2</sub> S	PPM	GR/100 SCF <sup>1</sup>		
0.001	10	.65	Safe for 8 hours without respirator. Obvious and unpleasant odor.	
0.0015	15	0.975	Safe for 15 minutes of exposure without respirator.	
0.01	100	6.48	Kills smell in 3-15 minutes; may sting eyes and throat.	
0.02	200	12.96	Kills smell quickly; stings eyes and throat.	
0.05	500	32.96	Dizziness; breathing ceases in a few minutes; need prompt artificial respiration.	
0.07	700	45.92	Rapid Unconsciousness; death will result if not rescued promptly.	
0.1	1000	64.80	Instant unconsciousness, followed by death within minutes.	

<sup>&</sup>lt;sup>1</sup> Grains per 100 Cubic Feet

# VII. Treatment Procedures for Hydrogen Sulfide Poisoning

- A. Remove the victim to fresh air.
- B. If breathing has ceased or is labored, begin resuscitation immediately.

Note: This is the quickest and preferred method of clearing victim's lungs of contaminated air; however, under disaster conditions, it may not be practical to move the victim to fresh air. In such instances, where those rendering first aid must continue to wear masks, a resuscitator should be used.

- C. Apply resuscitator to help purge H<sub>2</sub>S from the blood stream.
- D. Keep the victim at rest and prevent chilling.
- E. Get victim under physician's care as soon as possible.

# C. <u>SULPHUR DIOXIDE</u>

- 1. Sulfur Dioxide (SO<sub>2</sub>) is a colorless, non-flammable, transparent gas.
- 2. SO<sub>2</sub> is produced during the burning of H<sub>2</sub>S. Although SO<sub>2</sub> is heavier than air, it can be picked up by a breeze and carried downwind at elevated temperatures. Since SO<sub>2</sub> is extremely irritating to the eyes and mucous membranes of the upper respiratory tract, it has exceptionally good warning powers in this respect. The following table indicates the toxic nature of SO<sub>2</sub>:

CONCEN	TRATION	EFFECTS	
% SO <sub>2</sub>	PPM		
0.0005	3 to 5	Pungent odor, normally a person can detect $SO_2$ in this range.	
0.0012	12	Throat irritation, coughing, constriction of the chest, tearing and smarting of eyes.	
0.015	150	So irritating that it can only be endured for a few minutes.	
.05	500	Causes a sense of suffocation, event with the first breath.	

# VIII. BREATHING AIR EQUIPMENT DRILLS FOR ON & OFF DUTY PERSONNEL

An H<sub>2</sub>S Drill and Training Session must be given once a week to ALL on-duty personnel with off duty personnel. On-duty and Off-duty personnel will reverse roles on alternate drills.

An H2S drill and training session must be given once a week to all off-duty personnel in coincidence with on-duty personnel reversing roles on alternate drills.

The purpose of this drill is to instruct the crews in the operation and use of breathing air and H<sub>2</sub>S related emergency equipment and to allow the personnel to become acquainted with using the equipment under working conditions. The crews should be trained to put on the breathing air equipment within one minute when required or requested to do so.

The following procedure should be used for weekly drills. The MRC supervisor must be satisfied that the crews are proficient with the equipment.

- 1. All personnel should be informed that a drill will be held.
- 2. The Total H2S Safety Technician or a designee assigned by the MRC Drilling Foreman should initiate the drill by signaling as he/she would if H2S was detected.
- 3. Personnel should don their breathing apparatus.
- 4. Once the breathing air equipment is on, the H2S Technician should check all personnel to insure proper operation.

A training and information session will be conducted after each drill to answer any H<sub>2</sub>S related questions and to cover any gaps identified from one of the following topics:

- · Condition II, and III alerts and steps to be taken by all personnel.
- The importance of wind direction when dealing with  $H_2S$ .
- · Proper use and storage of all types of breathing equipment.
- · Proper use and storage of oxygen resuscitators.
- · Proper use and storage of H<sub>2</sub>S detectors (Mini Checks or equivalent).
- The "buddy system" and the procedure for rescuing a person overcome by  $H_2S$ .
- · Responsibilities and duties.
- · Location of H<sub>2</sub>S safety equipment.
- Other parts of the "H<sub>2</sub>S Contingency Plan" that should be reviewed.

NOTE: A record of attendance must be kept for weekly drills and training sessions.

# IX. HYDROGEN SULFIDE TRAINING CURRICULUM

(FOR EMPLOYERS, VISITORS, AND CONTRACTORS)

EACH PERSON WILL BE INFORMED ON THE RESTRICTIONS OF HAVING BEARDS AND CONTACT LENS. THEY WILL ALSO BE INFORMED OF THE AVAILABILITY OF SPECTACLE KITS.

AFTER THE H2S EQUIPMENT IS RIGGED UP, ALL IN SCOPE PERSONNEL WILL BE H2S TRAINED AND PUT THROUGH A DRILL. ANY DEFICIENCIES WILL BE CORRECTED.

Training Completion cards are good for one year and will indicate date of completion or expiration. Personnel previously trained on another facility and visiting, must attend a "supplemental briefing" on H2S equipment and procedures before beginning duty. Visitors who remain on the location more than 24 hours must receive full H2S training given all crew members. A "supplemental briefing" will include but not be limited to: Location of respirators, familiarization with safe briefing areas, alarms with instruction on responsibilities in the event of a release and hazards of H2S and (SO2, if applicable). A training and drill log will be kept.

Topics for full H2S training shall include the following equipment if on location, but not be limited to the following:

#### 1. **Brief Introduction on H2S**

- A. Slide or Computer presentation (If Available)
- B. H2S material will be distributed
- C. Re-emphasize the properties, toxicity, and hazards of H2S
- D. Source of SO2 (if applicable)

#### 2. **H2S Detection**

- A. Description of H2S sensors
- B. Description of warning system (how it works & it's location)
- C. Actual location of H2S sensors
- D. Instruction on use of pump type detector (Gastec)
- E. Use of card detectors, ampoules, or dosimeters
- F. Use of combustible gas detector
- G. Other personnel detectors used
- H. Alarm conditions I & II,
- I. SO2 alarms (if applicable)

#### 3. **H2S Protection**

- A. Types of breathing apparatus provided (30-minute SCBA & 5-minute SCBA (with voice diaphragms for communication if supplied)
- B. Principle of how breathing apparatus works
- C. Demonstration on how to use breathing apparatus
- D. Location of breathing apparatus

# 4. Cascade System

- A. Description of cascade system
- B. How system works
- C. Cascade location of rig with reference to briefing areas
- D. How to use cascade system (with 5-minute hose work line units & refill, if supplied)
- E. Importance of wind direction and actual location of Windsocks
- F. Purpose of compressor/function (if one is on site)

## 5. **H2S Rescue and First Aid**

- A. Importance of wind direction
- B. Safe briefing area
- C. Buddy system
- D. H2S symptoms
- E. Methods of rescue

## 6. Hands on Training

- A. Donning/familiarization of SCBA 30-minue unit
- B. Donning/familiarization of SKADA 5- MIN. Packs
- C. Familiarization of cascades
- D. Use of O2 resuscitator
- E. Alarm conditions upwind briefing areas, etc...
- F. Duties and responsibilities of all personnel
- G. Procedures for evacuation
- H. Search and Rescue teams

#### 7. Certification

A. Testing on material covered

# TOTAL SAFETY US INC., FIT TEST

# X. EMPLOYEE INFORMATION Employee Name: \_\_\_\_\_ Date: \_\_\_\_ Date of Employee Medical Evaluation: \_\_\_\_\_ Medical Status (circle): Unrestricted Limitations on Use Use Not Authorized RESPIRATOR INFORMATIOIN Respirator Type (Dustmask, SCBA, etc):\_\_\_\_\_ Brand: Size: (circle): XS S M L XLFIT TEST INFORMATION Type of Fit Test Performed: Quantitative Fit Factor:\_\_\_\_ Porta Count Fittester 3000 Fit Factor:\_\_\_\_ **Oualitative Irritant Smoke** Passed / Failed Passed / Failed Isoamyl Acetate (Banana Oil) Saccharin Passed / Failed **Bitrex** Passed / Failed I hereby certify that this fittest was conducted in accordance with the OSHA Fit Testing Protocols found in Appendix A of 1910.134.

31

Fit Tester Name (Print):

Signature:\_\_\_\_\_ Date:

#### XI. H<sub>2</sub>S SAFETY SERVICES

HYDROGEN SULFIDE SAFETY PACKAGE – Contained on location in Total Safety H2S Equipment Trailer, unless otherwise noted:

#### RESPIRATORY SAFETY SYSTEMS

#### QTY DESCRIPTION

- 30-Minute Pressure Demand SCBA (4-Primary Safe Briefing Area, 4-Secondary Safe Briefing Area, 4-floor with one of these for derrick man)
- 9 Hose Line 5-minute Work Unit w/Escape Cylinder (1 in derrick, 6 on drill floor, 1 in mud pit wt area, 1 in shaker area)

The following shall be part of the package if requested by the MRC Foremen (at least one trailer with cascade system is required to be located in the MRC Magnolia asset for use as needed)

- 1 Breathing air cascade of 10 bottles w/regulator
- 2 Refill lines to refill 30-minute units on location
- 6-Man manifold that can be rigged up to work area on floor, if needed
- 6 25 foot hose lines
- 2 50 foot hose lines
- 100 Feet of hose line to rig cascade up to 12 man manifold on floor
- 12 30-minute Self Contained Breathing apparatus

#### **DETECTION AND ALARM SAFETY SYSTEM**

- H2S Fixed Monitor w/8Channels (Loc determined at rig up) suggested. (Mud pit area, shaker area, bell nipple area, floor/driller area, & outside quarters)
- 5 H2S Sensors
- Explosion Proof Alarms (Light and Siren)
  (1 on floor, 1 in work area, 1 in trailer area where quarters are located)
- 2 Personal H2S monitors
- 1 Portable Tri-Gas Hand Held Meter (O2, LEL, H2S)
- 1 Sensidyne/Gastech Manual Pump Type Detector
- 8 Boxes H2S Tubes Various Ranges
- 2 Boxes SO2 Tubes Various Ranges
- 1 Calibration Gas
- 1 Set Paper Work for Records: Training, Cal, Inspection, other

# ADDITIONAL SAFETY RELATED EQUIPMENT

# QTY DESCRIPTION

- Windsocks with Pole and Bracket
- 1 Set Well Condition Sign w/Green, Yellow, Red Flags
- 1 Primary Safe Briefing Area Sign
- 1 Secondary Safe Briefing Area Sign
- 6 Operating Condition Signs for Work Areas & Living Quarters

# TRAILER WITH BREATHING AIR CASCADE WILL ALSO INCLUDE THE FOLLOWING:

This equipment will be part of the H2S equipment stored in the trailer, when on location

- 1 First aid kit
- 1 Fire Blanket
- 1 Eye wash station
- 2 Safety Harness w/150' safety line

# XII. EMERGENCY PHONE NUMBERS (Updated March 18, 2009)

# **EMERGENCY PHONE NUMBERS**

MRC Energy Co. Emergency Phone #
MRC Energy Co. Permian Operations Phone-----MRC Energy Co. Production
113 Daw Rd
Mansfield LA 71052

Title	Names	Phone	Cell
Operations Manager			
Operation Supt.			
Operations			
Supervisor			
Operations			
Supervisor			
Office Supervisor			
HSE			
Scheduler Planner			

**Hydrogen Sulfide Safety Consultants** 

Total Safety W. Bender	575-392-2973	After Hours 24 Hour Call		
Blvd. Hobbs, NM		Center Through Office		
		Number		
Tommy Throckmorton	575-392-2973	940-268-9614		
Operations Manager				
Rodney Jourdan Sales	575-392-2973	432-349-3928		
Contact				

# MRC Energy Co. MEDICAL RESPONSE PLAN AND IT'S MEDICAL PROTOCOLS WILL BE FOLLOWED

MEDICAL COORDINATOR # -----

**Emergency Numbers & Directions** 

# **Hospitals (911)**

Artesia General Hospital		
702 N. 13 <sup>th</sup> St.	Main Phone Number	575-748-3333
Artesia, NM 88210		
Nor-Lea General Hospital		
1600 N. Main Ave.	Main Phone Number	575-396-6611
Lovington, NM 88260		
Lea Regional Medical		
Center	Main Phone Number	575-492-5260
5419 N. Lovington Hwy		
Hobbs, NM 88240		
Carlsbad General Hospital		
2430 W. Pierce St.	Main Phone Number	575-887-4100
Carlsbad, NM		
<b>Lovelace Regional Hospital</b>		
117 E. 19 <sup>th</sup> St	Main Phone Number	575-627-7000
Roswell, NM 88201		
Winkler Co. Memorial		
Hospital	Main Phone Number	432-586-8299
821 Jeffee Dr.		
Kermit, Texas 79745		
<b>Reeves County Hospital</b>		
2323 Texas St.	Main Phone Number	432-447-3551
Pecos, Texas 79772		

State Police (911)

Texas DPS Loving co. 225 N.Pecos	Office Number	432-377-2411
Mentone, Texas 79754		
Texas DPS Winkler Co.		
100 E Winkler	Office Number	432-586-3465
Kermit, Texas 79745		
Texas DPS Pecos Co.		
148 N I-20 Frontage RD	Office Number	432-447-3532
Pecos, Texas 79772		
New Mexico State Police		
3300 W. Main St	Office Number	575-748-9718
Artesia, NM		
New Mexico State Police		
304 N. Canyon St	Office Number	575-885-3137
Carlsbad, NM 88220		
New Mexico State Police		
5100 Jack Gomez Blvd.	Office Number	575-392-5588
Hobbs, NM 88240		

**Local Law Enforcement (911) (Sheriff)** 

Edeal Eaw Empleement ()	/ (Bilelili)	
Reeves Co. Sheriff	Off N. N.	422 445 4001
500 N. Oak ST	Office Number	432-445-4901
Pecos, Texas 79722		
Winkler Co. Sheriff		
1300 Bellaire St.	Office Number	432-586-3461
Kermit, Texas 79745		
Loving Co. Sheriff		
Courthouse	Office Number	432-377-2411
Mentone, Texas		
Lea Co. Sheriff		
1417 S. Commercial St.	Office Number	
Lovington, NM 88260		
Eddy Co. Sheriff		
305 N 7th St.	Office Number	575-766-9888
Artesia, NM 88210		
Eddy Co. Sheriff		
305 N 7th St.	Office Number	575-746-9888
Carlsbad, NM 88220		

Federal & State Agencies

OSHA Lubbock Area		
Office	Main Number	806-472-7681 EXT 7685
1205 Texas Av. Room 806		
Lubbock, Texas 79401		
New Mexico Environment		
Department	Joe Fresquez	575-623-3935
400 N Pennsylvania		
Roswell, NM 88201		
Texas Railroad		
Commission	Main Number	844-773-0305
Midland, Texas		
BLM Carlsbad, NM Field		
Office	Main Number	575-234-5972
620 E. Green ST		
Carlsbad, NM 88220		
<b>BLM Hobbs Field Station</b>		
414 W. Taylor Rd.	Main Number	575-393-3612
Hobbs, NM 88240		
<b>BLM Roswell District</b>		
Office	Main Number	575-627-0272
2909 W. Second St.		
Roswell, NM 88201		
TECQ Texas Commission		
on Environmental Quality	Main Number	800-832-8224
New Mexico OCD		
U.S. Environmental		
<b>Protection Agency Region</b>	Main Number	214-655-2222
6		
Texas/New Mexico		
National Response Center		
Toxic Chemicals & Oil	Main Number	800-424-8802
Spills		
	II.	

**Rig Company** 

Tug Company		

#### XIII. EVACUATION OF THE GENERAL PUBLIC

The procedure to be used in alerting nearby persons in the event of any occurrence that could pose a threat to life or property will be arranged and completed with public officials in detail, prior to drilling into the hydrogen sulfide formations.

In the event of an actual emergency, the following steps will be immediately taken:

- The MRC Energy Co.'s representative will dispatch sufficient personnel to immediately warn each resident and transients down-wind within radius of exposure from the well site. Then warn all residence in the radius of exposure. Additional evacuation zones may be necessary as the situation warrants.
- 2. The MRC Energy Co.'s representative will immediately notify proper authorities, including the Sheriff's Office, Highway Patrol, and any other public officials as described above and will enlist their assistance in warning residents and transients in the calculated radius of exposure.
- 3. The MRC Energy Co.'s representative will dispatch sufficient personnel to divert traffic in the vicinity away from the potentially dangerous area. A guard to the entrance of the well site will be posted to monitor essential and non essential traffic.

## 4. General:

- A. The area included within the radius of exposure is considered to be the zone of maximum potential hazard from a hydrogen sulfide gas escape. Immediate evacuation of public areas, in accordance with the provisions of this contingency plan, is imperative. When it is determined that conditions exist which create an additional area (beyond the initial zone of maximum potential hazard) vulnerable to possible hazard, public areas in the additional hazardous area will be evacuated in accordance with the contingency plan.
- B. In the event of a disaster, after the public areas have been evacuated and traffic stopped, it is expected that local civil authorities will have arrived and within a few hours will have assumed direction of and control of the public, including all public areas. MRC Energy Co. will cooperate with these authorities to the fullest extent and will exert every effort by careful advice to such authorities to prevent panic or rumors.
- C. MRC Energy Co. will dispatch appropriate management personnel at the disaster site as soon as possible. The company's personnel

- will cooperate with and provide such information to civil authorities as they might require.
- D. One of the products of the combustion of hydrogen sulfide is sulfur dioxide (SO<sub>2</sub>). Under certain conditions this gas may be equally as dangerous as H<sub>2</sub>S. A pump type detector device, which determines the percent of SO<sub>2</sub> in air through concentrations in ppm, will be available. Although normal air movement is sufficient to dissipate this material to safe levels, the SO<sub>2</sub> detector should be utilized to check concentrations in the proximity of the well once every hour, or as necessary and the situation warrants. Also, if any low areas are suspected of having high concentrations, personnel should be made aware of these areas, and steps should be taken to determine whether or not these low areas are hazardous.

Exhibit E-6: H2S Contingency Plan Emergency Contacts Matador Resources Company

Company Office			
Matador Resources Company	(972)-371-5200		
Key Personnel			
Name	Title	Office	Mobile
Billy Goodwin	Vice President Drilling	972-371-5210	817-522-2928
Gary Martin	Drilling Superintendent		601-669-1774
Dee Smith	Drilling Superintendent	972-371-5447	972-822-1010
Blake Hermes	Drilling Engineer	972-371-5485	713-876-8558
	Construction Superintendent		
	Construction Superintendent		
<u>Artesia</u>			
Ambulance		911	
State Police		575-746-2703	
City Police		575-746-2703	
Sheriff's Office		575-746-9888	
Fire Department		575-746-2701	
Local Emergency Planning Committee		575-746-2122	
New Mexico Oil Conservation Division		575-748-1283	
Carlsbad			
Ambulance		911	
State Police		575-885-3137	
City Police		575-885-2111	
Sheriff's Office		575-887-7551	
Fire Department		575-887-3798	
Local Emergency Planning Committee		575-887-6544	
New Mexico Oil Conservation Division		575-887-6544	
Santa Fe			
New Mexico Emergency Response Comiss		505-476-9600	
New Mexico Emergency Response Comission (Santa Fe) 24 hrs		505-827-9126	
New Mexico State Emergency Operations	Center	505-476-9635	
<u>National</u>			
National Emegency Response Center (Was	shington, D.C.)	800-424-8802	
Medical			
Flight for Life- 4000 24th St.; Lubbock, TX		806-743-9911	
Aerocare- R3, Box 49F; Lubbock, TX		806-747-8923	
Med Flight Air Amb- 2301 Yale Blvd S.E., D		505-842-4433	
SB Air Med Service- 2505 Clark Carr Loop	S.E.; Albuquerque, NM	505-842-4949	
<u>Other</u>			
Boots & Coots IWC		800-256-9688	or 281-931-8884
Cudd Pressure Control		432-699-0139	or 432-563-3356
Haliburton		575-746-2757	
B.J. Services		575-746-3569	

# **Modified BOP Testing Procedure for Batch Drilling**


Huneke Fed Com 138H Township/Range: 24S 36E SHL: 2404' FSL & 1810' FEL Section 30 Elevation Above Sea Level: 3373'

Matador Production Company requests a variance to allow break testing the Blowout Preventer Equipment (BOPE) as prudent in batch drilling operations. Matador requests a variance from 43 CFR 3172.6(b)(9)(iv)(C) to only test broken pressure seals on the BOPE during batch (skid) drilling operations with multiple wells on the same pad.

#### **Justification**

The Bureau of Land Management began issuing and revising Onshore Orders pertaining the exploration and development of oil and gas operations on federal onshore and Indian leases in 1983. These orders were later published in 1988, specifically OOGO No. 2 "Drilling Operations on Federal and Indian Oil and Gas Leases" was published November 18, 1988, and has since been the governing standard for over 30 years. This order was later codified in 43 CFR Subpart 3172 on June 16, 2023 with no substantive changes to the content. During which time, the oil and gas industry has seen significant advancements in technology and processes that facilitate safer and more efficient operations, some of those being improvements in rig and wellhead design. The improvements in rig design allow for the BOP stack to remain connected and intact while skidding and the changes in wellhead design complement this feature by utilizing quick connects from BOP to wellhead. The combination of these technologies allow for the rig to skid to the next well while only breaking two pressure sealing connections.

American Petroleum Institute (API) standards, specifications and recommended practices are considered an industry standard and are commonly referenced in 43 CFR 3172 and routinely used in APD COA's. API Standard 53 "Well Control Equipment Systems for Drilling Wells" recognizes break testing as an acceptable practice during batch drilling operations, specifically in API Std 53 Section 5.3.7.1.

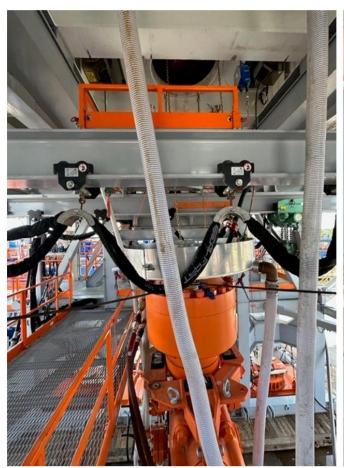



Figures 1 & 2: BOP winch system picture with walking capabilities.

# **Modified BOP Testing Procedure for Batch Drilling**

With these enhancements to operations, Matador Production Company believes that break testing during batch drilling operations meets, and in most cases, exceeds the BLM's intent of 43 CFR 3172.6(b)(9)(iv)(C).

This variance request will be referenced and attached in all APDs seeking approval for break testing and will receive approval prior to implementing this variance.

#### Procedure

- 1. Matador Production Company will follow the below guidelines prior to implementing break testing variance:
  - a. A full BOP test will be conducted on the first well on the pad.
    - Full BOP test will be conducted every 21 days per API Std 53, which is above 43 CFR 3172.6(b)(9)(iv)(D) 30 day requirement.
    - Annular type preventers tested to 70% RWP per API Std 53, which is above 43 CFR 3172.6(b)(9)(iii) 50% requirement.
    - Full BOP test will be conducted prior to drilling out any production hole sections.
  - The deepest first intermediate hole section will be drilled first.
    - All subsequent intermediate hole sections will be at same depth or shallower.
    - The calculated maximum anticipated surface pressure (MASP) for intermediate hole section will be below 4500 psi.
    - If any well control events are encountered, a full BOP test will be performed on subsequent well.
- After performing a full BOP test on first well, the intermediate hole section will be drilled and cased per design, two breaks will be made on the BOP equipment:
  - a. One between the BOP quick connect adapter and wellhead.
  - One between the HCR valve and choke line connection.
- Following that, the BOP will be lifted up from the wellhead using a hydraulic or winch system. The two connections will be broken as seen in Figure 3.
- Once skidding to subsequent well is complete, the BOP will be installed on wellhead and the HCR-to-Choke line break will be reconnected.
- 5. The test plug will then be installed into wellhead.
- A shell test will then be performed, testing both connections broken as seen in Figure 4.
  - The test will consist of a 250 psi low test and a high test equal to the BOP rating value submitted in the APD and as approved in COAs.
  - a. Break test procedure is the same for both 5M and 10M systems, only test pressures change.
- Following a successful shell test, a function test of the lower pipe rams, blind rams, and annular preventer will be performed.
- For multi-well pads, the same procedure will be followed for subsequent wells only if the next intermediate hole section can be drilled and cased with the 21-day BOP test window. If unable to be drilled in that time, a full BOP test will be performed.

# **Modified BOP Testing Procedure for Batch Drilling**

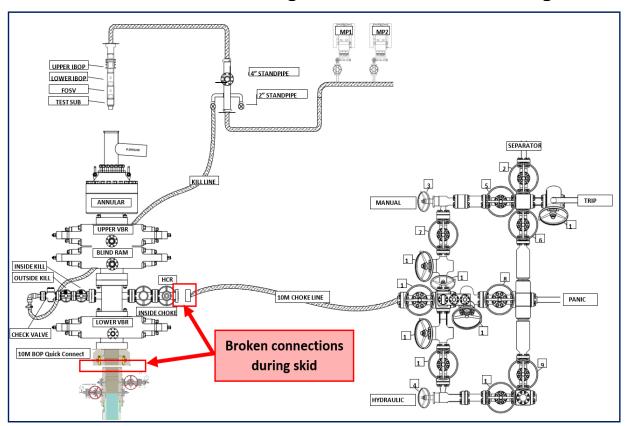


Figure 3: Shows which connections are broken during the skidding process


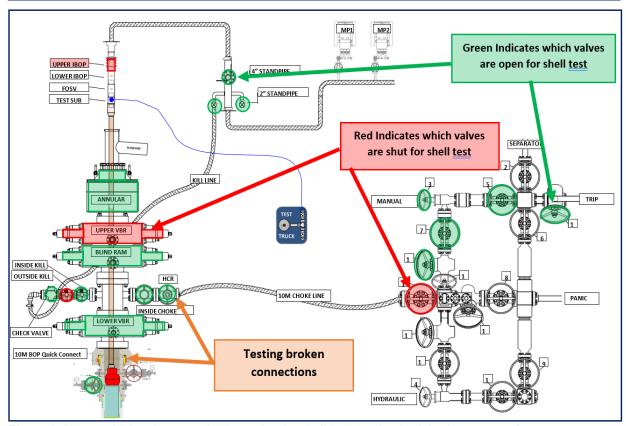


Figure 4: Shows which valves are shut/open for the shell test, testing both broken connections

# 10M Choke Manifold Arrangement

Huneke Fed Com 138H SHL: 2404' FSL & 1810' FEL Section 30 Township/Range: 24S 36E Elevation Above Sea Level: 3373'

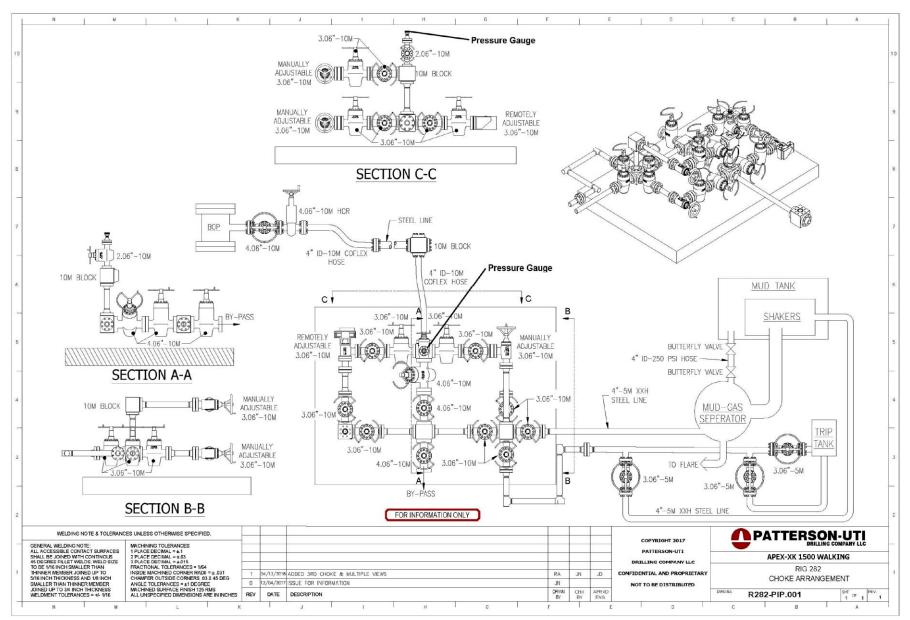



Huneke Fed Com 138H SHL: 2404' FSL & 1810' FEL Section 30

Township/Range: 24S 36E Elevation Above Sea Level: 3373'





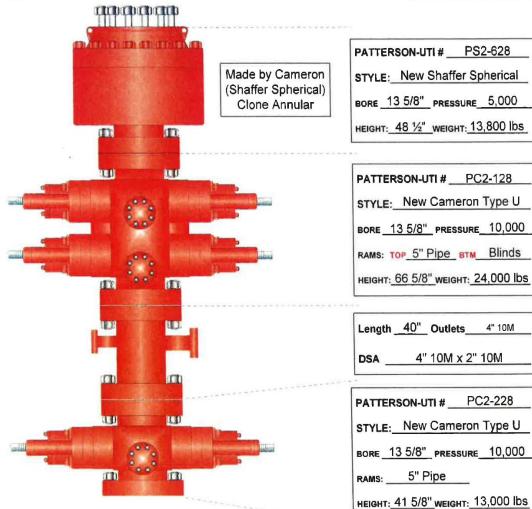

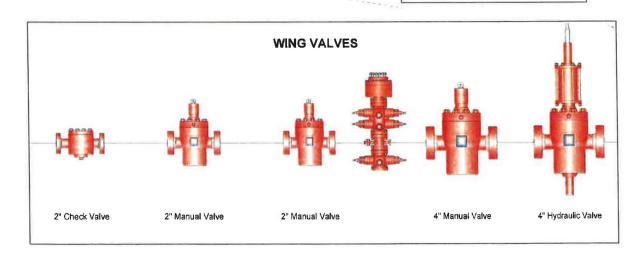

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II

811 S. First St., Artesia, NM 88210 Phone:(575) 748-1283 Fax:(575) 748-9720 District III 1000 Rio Brazos Rd., Aztec, NM 87410

Phone:(505) 334-6178 Fax:(505) 334-6170 1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

**State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505** 

CONDITIONS

Action 392001

#### **CONDITIONS**

Operator:	OGRID:
MATADOR PRODUCTION COMPANY	228937
One Lincoln Centre	Action Number:
Dallas, TX 75240	392001
	Action Type:
	[C-101] BLM - Federal/Indian Land Lease (Form 3160-3)

#### CONDITIONS

Created By	Condition	Condition Date
pkautz	Will require a File As Drilled C-102 and a Directional Survey with the C-104	10/22/2024
pkautz	Once the well is spud, to prevent ground water contamination through whole or partial conduits from the surface, the operator shall drill without interruption through the fresh water zone or zones and shall immediately set in cement the water protection string	10/22/2024
pkautz	Oil base muds are not to be used until fresh water zones are cased and cemented providing isolation from the oil or diesel. This includes synthetic oils. Oil based mud, drilling fluids and solids must be contained in a steel closed loop system	10/22/2024
pkautz	Cement is required to circulate on both surface and intermediate1 strings of casing	10/22/2024
pkautz	If cement does not circulate on any string, a CBL is required for that string of casing	10/22/2024