Form 3160-3 FORM APPROVED OMB No. 1004-0137 (June 2015) Expires: January 31, 2018 **UNITED STATES** DEPARTMENT OF THE INTERIOR 5. Lease Serial No. BUREAU OF LAND MANAGEMENT APPLICATION FOR PERMIT TO DRILL OR REENTER 6. If Indian, Allotee or Tribe Name 7. If Unit or CA Agreement, Name and No. DRILL REENTER 1a. Type of work: 1b. Type of Well: Oil Well Gas Well Other 8. Lease Name and Well No. 1c. Type of Completion: Hydraulic Fracturing Single Zone Multiple Zone 2. Name of Operator 9. API Well No. 30-025-53789 3a. Address 3b. Phone No. (include area code) 10. Field and Pool, or Exploratory 4. Location of Well (Report location clearly and in accordance with any State requirements.\*) 11. Sec., T. R. M. or Blk. and Survey or Area At surface At proposed prod. zone 14. Distance in miles and direction from nearest town or post office\* 12. County or Parish 13. State 15. Distance from proposed\* 16. No of acres in lease 17. Spacing Unit dedicated to this well location to nearest property or lease line, ft. (Also to nearest drig. unit line, if any) 18. Distance from proposed location\* 19. Proposed Depth 20. BLM/BIA Bond No. in file to nearest well, drilling, completed, applied for, on this lease, ft. 21. Elevations (Show whether DF, KDB, RT, GL, etc.) 22. Approximate date work will start\* 23. Estimated duration 24. Attachments The following, completed in accordance with the requirements of Onshore Oil and Gas Order No. 1, and the Hydraulic Fracturing rule per 43 CFR 3162.3-3 (as applicable) 1. Well plat certified by a registered surveyor. 4. Bond to cover the operations unless covered by an existing bond on file (see 2. A Drilling Plan. Item 20 above). 3. A Surface Use Plan (if the location is on National Forest System Lands, the 5. Operator certification. SUPO must be filed with the appropriate Forest Service Office). 6. Such other site specific information and/or plans as may be requested by the 25. Signature Name (Printed/Typed) Date Title Approved by (Signature) Name (Printed/Typed) Date Title Office Application approval does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon. Conditions of approval, if any, are attached. Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency

of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction



District I 1625 N. French Dr., I

District III

1625 N. French Dr., Hobbs, NM 88240 Phone: (575) 393-6161 Fax: (575) 393-0720 District II

811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

1000 Rio Brazos Road, Aztec, NM 87410 Phone: (505) 334-6178 Fax: (505) 334-6170 <u>District IV</u>

1220 S. St. Francis Dr., Santa Fe, NM 87505 Phone: (505) 476-3460 Fax: (505) 476-3462 State of New Mexico

Energy, Minerals & Natural Resources Department OIL CONSERVATION DIVISION 1220 South St. Francis Dr.

Santa Fe, NM 87505

Form C-102
Revised August 1, 2011
Submit one copy to appropriate
District Office

☐ AMENDED REPORT


#### WELL LOCATION AND ACREAGE DEDICATION PLAT

<sup>1</sup> API Number <sup>2</sup> Pool Code [53800] SAND DUNES;BONE SPRING			
<sup>4</sup> Property Code	5 P	Property Name	<sup>6</sup> Well Number
320993	STRAY C	AT 8-5 FED COM	516H
<sup>7</sup> OGRID No.	8 0	<sup>8</sup> Operator Name	
6137	DEVON ENERGY PR	ODUCTION COMPANY, L.P.	3618.1

#### <sup>10</sup> Surface Location

UL or lot no.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
P	8	23 S	32 E		601	SOUTH	1174	EAST	LEA
			п	Bottom H	Iole Location	If Different Fr	om Surface		
UL or lot no.	Section	Township	Range	Lot Idn	Feet from the	North/South line	Feet from the	East/West line	County
1	5	23 S	32 E		20	NORTH	330	EAST	LEA
12 Dedicated Acre	es 13 Joint	or Infill 14	Consolidation	n Code			15 Order No.		
319.49									

No allowable will be assigned to this completion until all interests have been consolidated or a non-standard unit has been approved by the division.

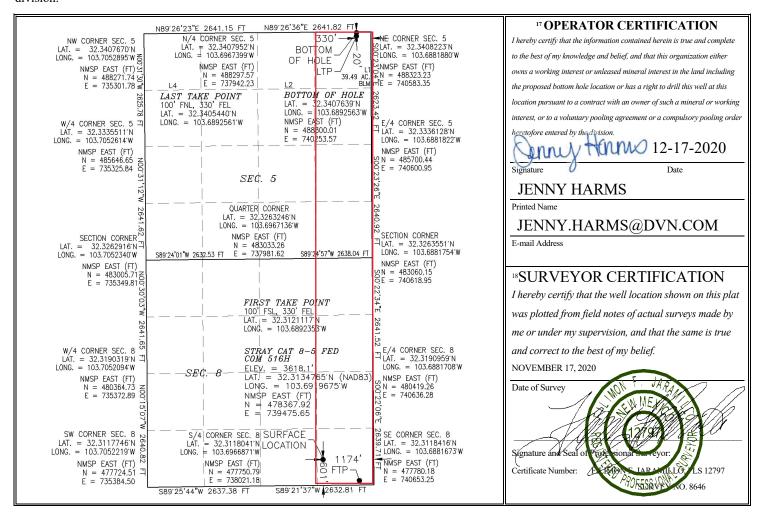

Inten	t X	As Dril	led										
API#													
DΕ\	rator Nai /ON EN MPANY	IERGY F	RODUC	CTION	I		perty N RAY C		8-5 FE	ED CC	DΜ		Well Number 516H
Kick C	Off Point	(KOP)				I							
UL	Section 8	Township 23S	Range 32E	Lot	Feet 41 FSL		From N	I/S	Feet 330 FI	EL F	rom E/W	County LEA	
Latitu 32.	ide 3118561	19		<u> </u>	Longitu		92353	3				NAD 83	
First 1	Γake Poir	nt (FTP)											
UL P	Section 8	Township 23S	Range 32E	Lot	Feet 100		From N		Feet 330		rom E/W AST	County LEA	
132.3	<sup>ide</sup> 312111	7			Longitu 103.6		2353			•		NAD 83	
Last T	ake Poin	t (LTP)											
UL A	Section 5	Township 23S	Range 32E	Lot 1	Feet 100		m N/S DRTH	Feet		rom E/V	V Cour		
132.3	<sup>ide</sup> 340544	.0			Longitu 103.6		2561	•	1		NAD 83	)	
											<b>,</b>		
Is this	well the	defining v	vell for th	e Horiz	ontal Sp	oacin	g Unit?		NO				
Is this	well an	infill well?		YES	]								
	l is yes p ng Unit.	lease prov	ide API if	availab	le, Opei	rator	Name	and v	vell nun	nber fo	or Defin	ing well fo	r Horizontal
API#													
Ope	rator Nai	me:	1			Pro	perty N	lame	:				Well Number
													V7.0C /20 /2010

KZ 06/29/2018

## State of New Mexico Energy, Minerals and Natural Resources Department

Submit Electronically Via E-permitting

Oil Conservation Division 1220 South St. Francis Dr. Santa Fe, NM 87505

# NATURAL GAS MANAGEMENT PLAN

This Natural Gas Management Plan must be submitted with each Application for Permit to Drill (APD) for a new or recompleted well.

## Section 1 – Plan Description Effective May 25, 2021

I. Operator: Devon End	ergy Productio	n Company, L.P.	OGRID:	6137		Date:04_/	20 / 2023
<b>II. Type:</b> ☑ Original ☐ Amendment due to ☐ 19.15.27.9.D(6)(a) NMAC ☐ 19.15.27.9.D(6)(b) NMAC ☐ Other.							
If Other, please describe	:						
III. Well(s): Provide the be recompleted from a s					wells pr	oposed to be dr	illed or proposed to
Well Name	API	ULSTR	Footages	Anticipated Oil BBL/D		cipated MCF/D F	Anticipated Produced Water BBL/D
See Attached							
IV. Central Delivery Po V. Anticipated Schedul proposed to be recomple	e: Provide the		tion for each nev		vell or se		27.9(D)(1) NMAC] osed to be drilled or
proposed to be recomple	aca from a sing	sie wen paa or con	nected to a centi	ar derivery point.			
Well Name	API	Spud Date	TD Reached Date	Completion Commencement		Initial Flow Back Date	First Production Date
See Attached							
VI. Separation Equipm VII. Operational Pract Subsection A through F VIII. Best Managemen during active and planne	tices: 🗵 Attac of 19.15.27.8 I	h a complete descr NMAC.	ription of the ac	tions Operator wil	l take to	o comply with	the requirements of

# Section 2 – Enhanced Plan EFFECTIVE APRIL 1, 2022

Beginning April 1, 2022, an operator that is not in compliance with its statewide natural gas capture requirement for the applicable reporting area must complete this section.

🗵 Operator certifies that it is not required to complete this section because Operator is in compliance with its statewide natural gas capture requirement for the applicable reporting area.

#### IX. Anticipated Natural Gas Production:

Well	API	Anticipated Average Natural Gas Rate MCF/D	Anticipated Volume of Natural Gas for the First Year MCF

#### X. Natural Gas Gathering System (NGGS):

Operator	System	ULSTR of Tie-in	Anticipated Gathering Start Date	Available Maximum Daily Capacity of System Segment Tie-in

XI. Map. $\square$ Attach an accurate and legible map depicting the location of the well(s), the anticipated pipeline route(s) connecting the
production operations to the existing or planned interconnect of the natural gas gathering system(s), and the maximum daily capacity of
the segment or portion of the natural gas gathering system(s) to which the well(s) will be connected.

XII. Line Capacity. The natural	gas gathering system	□ will □ will r	not have capacity to	o gather 10	00% of the antic	ipated nat	tural gas
production volume from the well	prior to the date of firs	t production.					

XIII. Line Pressure. Operator $\square$ does $\square$ does not anticipate that its existing well(s) connected to the same segment, or portion, of the same segment is a connected to the same segment.	he
natural gas gathering system(s) described above will continue to meet anticipated increases in line pressure caused by the new well(s)	).

l Attach (	Onerator's nla	an to managa	nroduction i	n response to	the increased	l line pressure

XIV. Confidentiality: $\sqcup$ Operator asserts confidentiality pursuant to Section 71-2-8 NMSA 1978 for the information pro	vided in
Section 2 as provided in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and attaches a full description of the specific info	ormation
for which confidentiality is asserted and the basis for such assertion.	

(h)

(i)

# Section 3 - Certifications <u>Effective May 25, 2021</u>

Operator certifies that, after reasonable inquiry and based on the available information at the time of submittal: 🗵 Operator will be able to connect the well(s) to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system; or ☐ Operator will not be able to connect to a natural gas gathering system in the general area with sufficient capacity to transport one hundred percent of the anticipated volume of natural gas produced from the well(s) commencing on the date of first production, taking into account the current and anticipated volumes of produced natural gas from other wells connected to the pipeline gathering system. If Operator checks this box, Operator will select one of the following: Well Shut-In. ☐ Operator will shut-in and not produce the well until it submits the certification required by Paragraph (4) of Subsection D of 19.15.27.9 NMAC; or Venting and Flaring Plan. 

Operator has attached a venting and flaring plan that evaluates and selects one or more of the potential alternative beneficial uses for the natural gas until a natural gas gathering system is available, including: power generation on lease; (a) power generation for grid; **(b)** (c) compression on lease; (d) liquids removal on lease; (e) reinjection for underground storage; **(f)** reinjection for temporary storage; reinjection for enhanced oil recovery; (g)

# Section 4 - Notices

1. If, at any time after Operator submits this Natural Gas Management Plan and before the well is spud:

other alternative beneficial uses approved by the division.

fuel cell production; and

- (a) Operator becomes aware that the natural gas gathering system it planned to connect the well(s) to has become unavailable or will not have capacity to transport one hundred percent of the production from the well(s), no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised venting and flaring plan containing the information specified in Paragraph (5) of Subsection D of 19.15.27.9 NMAC; or
- (b) Operator becomes aware that it has, cumulatively for the year, become out of compliance with its baseline natural gas capture rate or natural gas capture requirement, no later than 20 days after becoming aware of such information, Operator shall submit for OCD's approval a new or revised Natural Gas Management Plan for each well it plans to spud during the next 90 days containing the information specified in Paragraph (2) of Subsection D of 19.15.27.9 NMAC, and shall file an update for each Natural Gas Management Plan until Operator is back in compliance with its baseline natural gas capture rate or natural gas capture requirement.
- 2. OCD may deny or conditionally approve an APD if Operator does not make a certification, fails to submit an adequate venting and flaring plan which includes alternative beneficial uses for the anticipated volume of natural gas produced, or if OCD determines that Operator will not have adequate natural gas takeaway capacity at the time a well will be spud.

I certify that, after reasonable inquiry, the statements in and attached to this Natural Gas Management Plan are true and correct to the best of my knowledge and acknowledge that a false statement may be subject to civil and criminal penalties under the Oil and Gas Act.

Signature:
Printed Name: Jeff Walla
Title: Surface Land and Regulatory Manager
E-mail Address:
Date:
Phone:
OIL CONSERVATION DIVISION
(Only applicable when submitted as a standalone form)
Approved By:
Title:
Approval Date:
Conditions of Approval:

# NATURAL GAS MANAGEMENT PLAN Section 1 - Plan Description

III. Well(s): Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

Well Name	API	ULSTR & FOOTAGE	Anticipated Gas/Oil/Water	Central Delivery Point Name:
STRAY CAT 8-5 FED COM 516H	n/a	8-23S-32E, 601 FSL & 1174 FEL	(+/-)3270mcfd/(+/-)1344bopd/(+/-)2353bwpd	STRAY CAT 8 CTB 5
STRAY CAT 8-5 FED COM 515H	n/a	8-23S-32E, 601 FSL & 1204 FEL	(+/-)3270mcfd/(+/-)1344bopd/(+/-)2353bwpd	STRAY CAT 8 CTB 5
STRAY CAT 8-5 FED COM 514H	n/a	8-23S-32E, 602 FSL & 1234 FEL	(+/-)3270mcfd/(+/-)1344bopd/(+/-)2353bwpd	STRAY CAT 8 CTB 5

V. Anticipated Schedule: Provide the following information for each new or recompleted well or set of wells proposed to be drilled or proposed to be recompleted from a single well pad or connected to a central delivery point.

				Completion		
				Commencement		
Well Name	API	Spud Date	TD Reached Date	Date	Initial Flow back Date	First Production Date
STRAY CAT 8-5 FED COM 516H	n/a	10/15/2026	11/14/2026	3/14/2027	3/14/2027	3/14/2027
STRAY CAT 8-5 FED COM 515H	n/a	10/15/2026	11/14/2026	3/14/2027	3/14/2027	3/14/2027
STRAY CAT 8-5 FED COM 514H	n/a	10/15/2026	11/14/2026	3/14/2027	3/14/2027	3/14/2027

<sup>\*</sup> Dates subject to change



#### VI. Separation Equipment

Devon Energy Production Company, L.P. utilizes a "stage separation" process in which oil and gas separation is carried out through a series of separators operating at successively reduced pressures. Hydrocarbon liquids are produced into a high-pressure inlet separator, then carried through one or more lower pressure separation vessels before entering the storage tanks. The purpose of this separation process is to attain maximum recovery of liquid hydrocarbons from the fluids and allow maximum capture of produced gas into the sales pipeline. Devon utilizes a series of Low-Pressure Compression units to capture gas off the staged separation and send it to the sales pipeline. This process minimizes the amount of flash gas that enters the end-stage storage tanks that is subsequently vented or flared.



#### VII. Operational Practices

Devon Energy Production Company, L. P. will employ best management practices and control technologies to maximize the recovery and minimize waste of natural gas through venting and flaring.

- During drilling operations, Devon will utilize flares and/or combustors to capture and control
  natural gas, where technically feasible. If flaring is deemed technically in-feasible, Devon will
  employ best management practices to minimize or reduce venting to the extent possible.
- During completions operations, Devon will utilize Green Completion methods to capture gas
  produced during well completions that is otherwise vented or flared. If capture is technically
  in-feasible, flares and/or combustors will be used to capture and control flow back fluids
  entering into frac tanks during initial flowback. Upon indication of first measurable hydrocarbon
  volumes, Devon will turn operations to onsite separation vessels and flow to the gathering
  pipeline.
- During production operations, Devon will take every practical effort to minimize waste of natural gas through venting and flaring by:
  - Designing and constructing facilities in a manner consistent to achieve maximum capture and control of hydrocarbon liquids & produced gas
  - Utilizing a closed-loop capture system to collect and route produced gas to sales line via low pressure compression, or to a flare/combustor
  - o Flaring in lieu of venting, where technically feasible
  - Utilizing auto-ignitors or continuous pilots, with thermocouples connected to Scada, to quickly detect and resolve issues related to malfunctioning flares/combustors
  - Employ the use of automatic tank gauging to minimize storage tank venting during loading events
  - Installing air-driven or electric-driven pneumatics & combustion engines, where technically feasible to minimize venting to the atmosphere
  - Confirm equipment is properly maintained and repaired through a preventative maintenance and repair program to ensure equipment meets all manufacturer specifications
  - Conduct and document AVO inspections on the frequency set forth in Part 27 to detect and repair any onsite leaks as quickly and efficiently as is feasible



#### VIII. Best Management Practices during Maintenance

Devon Energy Production Company, L.P. will utilize best management practices to minimize venting during active and planned maintenance activities. Devon is operating under guidance that production facilities permitted under NOI permits have no provisions to allow high pressure flaring and high pressure flaring is only allowed in disruption scenarios so long as the duration is less than eight hours. When technically feasible, flaring during maintenance activities will be utilized in lieu of venting to the atmosphere. Devon will work with third-party operators during scheduled maintenance of downstream pipeline or processing plants to address those events ahead of time to minimize venting. Actions considered include identifying alternative capture approaches or planning to temporarily reduce production or shut in the well to address these circumstances.

## 1. Geologic Formations

TVD of target	9377	Pilot hole depth	N/A
MD at TD:	19685	Deepest expected fresh water	

#### **Basin**

D (1	XX7 4 /3-47* 1	
(TVD)	Bearing/Target	Hazards*
from KB	Zone?	
1023		
1351		
4483		
4668		
5586		
6858		
8525		
8740		
	1023 1351 4483 4668 5586 6858 8525	(TVD) Bearing/Target Tom KB Zone?  1023  1351  4483  4668  5586  6858  8525

<sup>\*</sup>H2S, water flows, loss of circulation, abnormal pressures, etc.

2. Casing Program

		Wt				Interval	Casing	Interval
Hole Size	Csg. Size	(PPF)	Grade	Conn	From (MD)	To (MD)	From (TVD)	To (TVD)
17 1/2	13 3/8	48	H40	ВТС	0	1048	0	1048
12 1/4	9 5/8	40	J-55	ВТС	0	4583	0	4583
8 3/4	5 1/2	17	P110	ВТС	0	19685	0	9377

<sup>•</sup> All casing strings will be tested in accordance with Onshore Oil and Gas Order #2 IILB.1.h Must have table for continengcy casing.

3. Cementing Program (3-String Primary Design)

Casing	# Sks	TOC	Wt. (lb/gal)	Yld (ft3/sack)	Slurry Description
Surface	797	Surf	13.2	1.4	Lead: Class C Cement + additives
Int 1	499	Surf	9.0	3.3	Lead: Class C Cement + additives
1111. 1	154	500' above shoe	13.2	1.4	Tail: Class H / C + additives
Int 1	As Needed	Surf	9.0	3.3	Squeeze Lead: Class C Cement + additives
Intermediate	499	Surf	9.0	3.3	Lead: Class C Cement + additives
Squeeze	154	500' above shoe	13.2	1.4	Tail: Class H / C + additives
Duo do oti o u	409	500' tieback	9.0	3.3	Lead: Class H /C + additives
Production	2086	KOP	13.2	1.4	Tail: Class H / C + additives

If a DV tool is ran the depth(s) will be adjusted based on hole conditions and cement volumes will be adjusted proportionally. Slurry weights will be adjusted based on estimated fracture gradient of the formation. DV tool will be set a minimum of 50 feet below previous casing and a minimum of 200 feet above current shoe. If cement is not returned to surface during the primary cement job on the surface casing string, a planned top job will be conducted immediately after completion of the primary job.

Casing String	% Excess
Surface	50%
Intermediate	30%
Production	10%

4. Pressure Control Equipment (Three String Design)

BOP installed and tested before drilling which hole?	Size?	Min. Required WP	Туре		✓	Tested to:					
			Anı	nular	X	50% of rated working pressure					
Int 1	13-58"	5M	Blind	l Ram	X						
IIIt I	13-36	3101	Pipe	Ram		5M					
			Doub	le Ram	X	31V1					
			Other*								
		5M	Anı	nular	X	50% of rated working pressure					
Production	13-5/8"		5M	5M	5M	5M	5M	Blind	l Ram	X	
Floduction	13-3/6							Pipe	Ram		5M
						Doub	le Ram	X	31V1		
			Other*								
			Annul	ar (5M)							
			Blind Ram Pipe Ram								
						]					
			Double Ram								
			Other*								

5. Mud Program (Three String Design)

Section	Туре	Weight (ppg)
Surface	FW Gel	8.5-9
Intermediate	Brine	10-10.5
Production	WBM	8.5-9

Sufficient mud materials to maintain mud properties and meet minimum lost circulation and weight increase requirements will be kept on location at all times.

What will be used to monitor the loss or gain of fluid?	PVT/Pason/Visual Monitoring

6. Logging and Testing Procedures

Logging, C	Logging, Coring and Testing							
	Will run GR/CNL from TD to surface (horizontal well - vertical portion of hole). Stated logs run will be in the							
X	Completion Report and sbumitted to the BLM.							
	No logs are planned based on well control or offset log information.							
	Drill stem test? If yes, explain.							
	Coring? If yes, explain.							

Additional	logs planned	Interval
	Resistivity	
	Density	
X	CBL	Production casing
X	Mud log	KOP to TD
	PEX	

7. Drilling Conditions

Condition	Specfiy what type and where?
BH pressure at deepest TVD	4388
Abnormal temperature	No

Mitigation measure for abnormal conditions. Describe. Lost circulation material/sweeps/mud scavengers.

Hydrogren Sulfide (H2S) monitors will be installed prior to drilling out the surface shoe. If H2S is detected in concentrations greater than 100 ppm, the operator will comply with the provisions of Onshore Oil and Gas Order #6. If Hydrogen Sulfide is encountered measured values and formations will be provided to the BLM.

L	encountered	measured varies and formations will be provided to the BLW.					
	N	H2S is present					
ſ	Y	H2S plan attached.					

#### 8. Other facets of operation

Is this a walking operation? Potentially

- 1 If operator elects, drilling rig will batch drill the surface holes and run/cement surface casing; walking the rig to next wells on the pad.
- 2 The drilling rig will then batch drill the intermediate sections and run/cement intermediate casing; the wellbore will be isolated with a blind flange and pressure gauge installed for monitoring the well before walking to the next well.
- 3 The drilling rig will then batch drill the production hole sections on the wells with OBM, run/cement production casing, and install TA caps or tubing heads for completions.

NOTE: During batch operations the drilling rig will be moved from well to well however, it will not be removed from the pad until all wells have production casing run/cemented.

#### Will be pre-setting casing? Potentially

- 1 Spudder rig will move in and batch drill surface hole.
  - a. Rig will utilize fresh water based mud to drill surface hole to TD. Solids control will be handled entirely on a closed loop basis.
- 2 After drilling the surface hole section, the spudder rig will run casing and cement following all of the applicable rules and regulations (OnShore Order 2, all COAs and NMOCD regulations).
- $^{3}$  The wellhead will be installed and tested once the surface casing is cut off and the WOC time has been reached.
- 4 A blind flange with the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with a pressure gauge installed on the wellhead.
- 5 Spudder rig operations is expected to take 4-5 days per well on a multi-well pad.
- 6 The NMOCD will be contacted and notified 24 hours prior to commencing spudder rig operations.
- 7 Drilling operations will be performed with drilling rig. At that time an approved BOP stack will be nippled up and tested on the wellhead before drilling operations commences on each well.
  - a. The NMOCD will be contacted / notified 24 hours before the drilling rig moves back on to the pad with the pre-set surface casing.

Attachments					
X	Directional Plan				
	Other, describe				



#### U.S. Department of the Interior **BUREAU OF LAND MANAGEMENT**

# **Drilling Plan Data Report**

09/03/2024

**APD ID:** 10400066978 Submission Date: 12/17/2020

Operator Name: DEVON ENERGY PRODUCTION COMPANY LP

Well Name: STRAY CAT 8-5 FED COM Well Number: 516H

Well Type: OIL WELL Well Work Type: Drill

Highlighted data reflects the most recent changes

**Show Final Text** 

# **Section 1 - Geologic Formations**

Formation ID	Formation Name	Elevation	True Vertical	Measured Depth	Lithologies	Mineral Resources	Producing Formatio
14049997	UNKNOWN	3618	0	Ö	OTHER : SURFACE	NONE	N
14049998	RUSTLER	2595	1023	1023	SANDSTONE	NONE	N
14049999	SALADO	2267	1351	1351	SALT	NONE	N
14050000	BASE OF SALT	-865	4483	4483	ANHYDRITE	NATURAL GAS, OIL	N
14050001	BELL CANYON	-1050	4668	4668	SANDSTONE	NATURAL GAS, OIL	N
14050002	CHERRY CANYON	-1968	5586	5586	SANDSTONE	NATURAL GAS, OIL	N
14050003	BRUSHY CANYON	-3240	6858	6858	SANDSTONE	NATURAL GAS, OIL	N
14050010	BONE SPRING LIME	-4907	8525	8525	LIMESTONE	NATURAL GAS, OIL	Y
14050004	BONE SPRING	-6066	9684	9684	SANDSTONE	NATURAL GAS, OIL	N
14050006	BONE SPRING 2ND	-6642	10260	10260	SANDSTONE	NATURAL GAS, OIL	N
14050011	BONE SPRING LIME	-7162	10780	10780	LIMESTONE	NATURAL GAS, OIL	N
14050007	BONE SPRING 3RD	-7892	11510	11510	SANDSTONE	NATURAL GAS, OIL	N
14050008	WOLFCAMP	-8292	11910	11910	SHALE	NATURAL GAS, OIL	N
14050009	STRAWN	-9960	13578	13578	LIMESTONE	NATURAL GAS, OIL	N

## **Section 2 - Blowout Prevention**



# Commitment Runs Deep



Design Plan
Operation and Maintenance Plan
Closure Plan

SENM - Closed Loop Systems June 2010

## I. Design Plan

Devon uses MI SWACO closed loop system (CLS). The MI SWACO CLS is designed to maintain drill solids at or below 5%. The equipment is arranged to progressively remove solids from the largest to the smallest size. Drilling fluids can thus be reused and savings is realized on mud and disposal costs. Dewatering may be required with the centrifuges to insure removal of ultra fine solids.

The drilling location is constructed to allow storm water to flow to a central sump normally the cellar. This insures no contamination leaves the drilling pad in the event of a spill. Storm water is reused in the mud system or stored in a reserve fluid tank farm until it can be reused. All lubricants, oils, or chemicals are removed immediately from the ground to prevent the contamination of storm water. An oil trap is normally installed on the sump if an oil spill occurs during a storm.

A tank farm is utilized to store drilling fluids including fresh water and brine fluids. The tank farm is constructed on a 20 ml plastic lined, bermed pad to prevent the contamination of the drilling site during a spill. Fluids from other sites may be stored in these tanks for processing by the solids control equipment and reused in the mud system. At the end of the well the fluids are transported from the tank farm to an adjoining well or to the next well for the rig.


Prior to installing a closed-loop system on site, the topsoil, if present, will be stripped and stockpiled for use as the final cover or fill at the time of closure.

Signs will be posted on the fence surrounding the closed-loop system unless the closed-loop system is located on a site where there is an existing well, that is operated by Devon.

#### II. Operations and Maintenance Plan

*Primary Shakers:* The primary shakers make the first removal of drill solids from the drilling mud as it leaves the well bore. The shakers are sized to handle maximum drilling rate at optimal screen size. The shakers normally remove solids down to 74 microns.

Mud Cleaner: The Mud Cleaner cleans the fluid after it leaves the shakers. A set of hydrocyclones are sized to handle 1.25 to 1.5 times the maximum circulating rate. This ensures all the fluid is being processed to an average cut point of 25 microns. The wet discharged is dewatered on a shaker equipped with ultra fine mesh screens and generally cut at 40 microns.

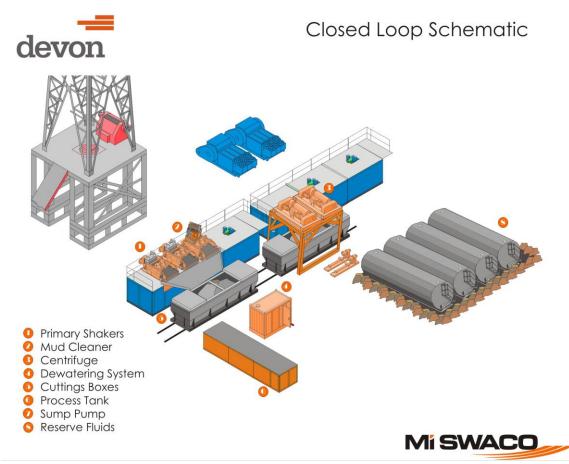

Centrifuges: The centrifuges can be one or two in number depending on the well geometry or depth of well. The centrifuges are sized to maintain low gravity solids at 5% or below. They may or may not need a dewatering system to enhance the removal rates. The centrifuges can make a cut point of 8-10 microns depending on bowl speed, feed rate, solids loading and other factors.

The centrifuge system is designed to work on the active system and be flexible to process incoming fluids from other locations. This set-up is also dependant on well factors.

Dewatering System: The dewatering system is a chemical mixing and dosing system designed to enhance the solids removal of the centrifuge. Not commonly used in shallow wells. It may contain pH adjustment, coagulant mixing and dosing, and polymer mixing and dosing. Chemical flocculation binds ultra fine solids into a mass that is within the centrifuge operating design. The

dewatering system improves the centrifuge cut point to infinity or allows for the return of clear water or brine fluid. This ability allows for the ultimate control of low gravity solids.

Cuttings Boxes: Cuttings boxes are utilized to capture drill solids that are discarded from the solids control equipment. These boxes are set upon a rail system that allows for the removal and replacement of a full box of cuttings with an empty one. They are equipped with a cover that insures no product is spilled into the environment during the transportation phase.

*Process Tank*: (Optional) The process tank allows for the holding and process of fluids that are being transferred into the mud system. Additionally, during times of lost circulation the process tank may hold active fluids that are removed for additional treatment. It can further be used as a mixing tank during well control conditions.

Sump and Sump Pump: The sump is used to collect storm water and the pump is used to transfer this fluid to the active system or to the tank for to hold in reserve. It can also be used to collect fluids that may escape during spills. The location contains drainage ditches that allow the location fluids to drain to the sump.

Reserve Fluids (Tank Farm): A series of frac tanks are used to replace the reserve pit. These are steel tanks that are equipped with a manifold system and a transfer pump. These tanks can contain any number of fluids used during the drilling process. These can include fresh water, cut brine, and saturated salt fluid. The fluid can be from the active well or reclaimed fluid from other locations. A 20 ml liner and berm system is employed to ensure the fluids do not migrate to the environment during a spill.

If a leak develops, the appropriate division district office will be notified within 48 hours of the discovery and the leak will be addressed. Spill prevention is accomplished by maintaining pump packing, hoses, and pipe fittings to insure no leaks are occurring. During an upset condition the source of the spill is isolated and repaired as soon as it is discovered. Free liquid is removed by a diaphragm pump and returned to the mud system. Loose topsoil may be used to stabilize the spill and the contaminated soil is excavated and placed in the cuttings boxes. After the well is finished and the rig has moved, the entire location is scrapped and testing will be performed to determine if a release has occurred.

All trash is kept in a wire mesh enclosure and removed to an approved landfill when full. All spent motor oils are kept in separate containers and they are removed and sent to an approved recycling center. Any spilled lubricants, pipe

dope, or regulated chemicals are removed from soil and sent to landfills approved for these products.

These operations are monitored by Mi Swaco service technicians. Daily logs are maintained to ensure optimal equipment operation and maintenance. Screen and chemical use is logged to maintain inventory control. Fluid properties are monitored and recorded and drilling mud volumes are accounted for in the mud storage farm. This data is kept for end of well review to insure performance goals are met. Lessons learned are logged and used to help with continuous improvement.

A MI SWACO field supervisor manages from 3-5 wells. They are responsible for training personnel, supervising installations, and inspecting sites for compliance of MI SWACO safety and operational policy.

#### III. Closure Plan

A maximum 340' X 340' caliche pad is built per well. All of the trucks and steel tanks fit on this pad. All fluid cuttings go to the steel tanks to be hauled by various trucking companies to an agency approved disposal.

# Devon Energy APD VARIANCE DATA

**OPERATOR NAME:** Devon Energy


## 1. SUMMARY OF Variance:

Devon Energy respectfully requests approval for the following additions to the drilling plan:

1. Potential utilization of a spudder rig to pre-set surface casing.

#### 2. Description of Operations

- 1. A spudder rig contractor may move in their rig to drill the surface hole section and pre-set surface casing on this well.
  - **a.** After drilling the surface hole section, the rig will run casing and cement following all of the applicable rules and regulations (OnShore Order 2, all COAs and NMOCD regulations).
  - **b.** Rig will utilize fresh water based mud to drill surface hole to TD.
- 2. The wellhead will be installed and tested once the surface casing is cut off and the WOC time has been reached.
- **3.** A blind flange with the same pressure rating as the wellhead will be installed to seal the wellbore. Pressure will be monitored with needle valves installed on two wingvalves.
  - **a.** A means for intervention will be maintained while the drilling rig is not over the well.
- **4.** The BLM will be contacted and notified 24 hours prior to commencing spudder rig operations.
- **5.** Drilling operation will be performed with the big rig. At that time an approved BOP stack will be nippled up and tested on the wellhead before drilling operations commences on each well.
  - **a.** The BLM will be contacted / notified 24 hours before the big rig moves back on to the pad with the pre-set surface casing.
- **6.** Devon Energy will have supervision on the rig to ensure compliance with all BLM and NMOCD regulations and to oversee operations.
- 7. Once the rig is removed, Devon Energy will secure the wellhead area by placing a guard rail around the cellar area.

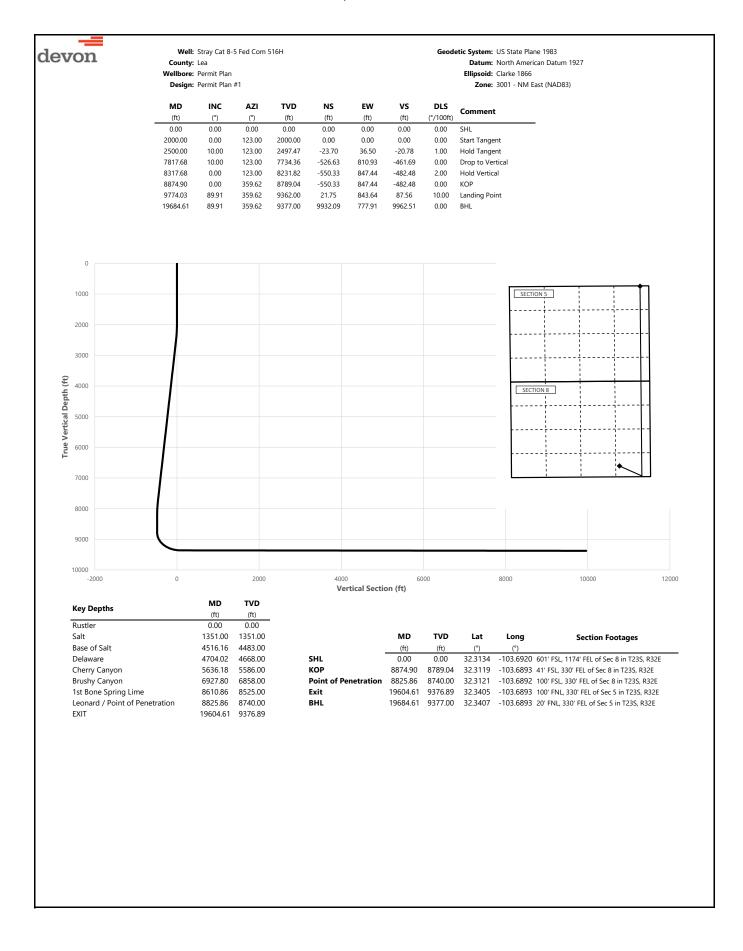



Well: Stray Cat 8-5 Fed Com 516H

County: Lea
Wellbore: Permit Plan
Design: Permit Plan #1

Geodetic System: US State Plane 1983

Datum: North American Datum 1927

Ellipsoid: Clarke 1866

Zone: 3001 - NM East (NAD83)

	Design: Permit Plan #1						<b>Zone:</b> 3001 - NM East (NAD83)			
MD	INC	AZI	TVD	NS	EW	vs	DLS	_		
(ft)	(°)	(°)	(ft)	(ft)	(ft)	(ft)	(°/100ft)	Comment		
0.00	0.00	0.00	0.00	0.00	0.00	0.00	0.00	SHL		
100.00	0.00	123.00	100.00	0.00	0.00	0.00	0.00			
200.00	0.00	123.00	200.00	0.00	0.00	0.00	0.00			
300.00	0.00	123.00	300.00	0.00	0.00	0.00	0.00			
400.00 500.00	0.00	123.00 123.00	400.00 500.00	0.00	0.00	0.00	0.00			
600.00	0.00	123.00	600.00	0.00	0.00	0.00	0.00			
700.00	0.00	123.00	700.00	0.00	0.00	0.00	0.00			
800.00	0.00	123.00	800.00	0.00	0.00	0.00	0.00			
900.00	0.00	123.00	900.00	0.00	0.00	0.00	0.00			
1000.00	0.00	123.00	1000.00	0.00	0.00	0.00	0.00			
1023.00	0.00	123.00	1023.00	0.00	0.00	0.00	0.00	Rustler		
1100.00	0.00	123.00	1100.00	0.00	0.00	0.00	0.00			
1200.00 1300.00	0.00	123.00 123.00	1200.00 1300.00	0.00	0.00	0.00	0.00			
1351.00	0.00	123.00	1351.00	0.00	0.00	0.00	0.00	Salt		
1400.00	0.00	123.00	1400.00	0.00	0.00	0.00	0.00	Sait		
1500.00	0.00	123.00	1500.00	0.00	0.00	0.00	0.00			
1600.00	0.00	123.00	1600.00	0.00	0.00	0.00	0.00			
1700.00	0.00	123.00	1700.00	0.00	0.00	0.00	0.00			
1800.00	0.00	123.00	1800.00	0.00	0.00	0.00	0.00			
1900.00	0.00	123.00	1900.00	0.00	0.00	0.00	0.00			
2000.00	0.00	123.00	2000.00	0.00	0.00	0.00	0.00	Start Tangent		
2100.00	2.00	123.00	2099.98	-0.95	1.46	-0.83	2.00			
2200.00 2300.00	4.00 6.00	123.00 123.00	2199.84 2299.45	-3.80 -8.55	5.85 13.16	-3.33 -7.49	2.00 2.00			
2400.00	8.00	123.00	2398.70	-15.18	23.38	-13.31	2.00			
2500.00	10.00	123.00	2497.47	-23.70	36.50	-20.78	1.00	Hold Tangent		
2600.00	10.00	123.00	2595.95	-33.16	51.06	-29.07	0.00	<b>.</b>		
2700.00	10.00	123.00	2694.43	-42.62	65.63	-37.36	0.00			
2800.00	10.00	123.00	2792.91	-52.08	80.19	-45.66	0.00			
2900.00	10.00	123.00	2891.39	-61.53	94.75	-53.95	0.00			
3000.00	10.00	123.00	2989.87	-70.99	109.32	-62.24	0.00			
3100.00 3200.00	10.00 10.00	123.00 123.00	3088.35	-80.45 -89.91	123.88	-70.53 -78.82	0.00			
3300.00	10.00	123.00	3186.83 3285.31	-99.36	138.44 153.01	-76.62 -87.11	0.00			
3400.00	10.00	123.00	3383.79	-108.82	167.57	-95.40	0.00			
3500.00	10.00	123.00	3482.27	-118.28	182.13	-103.70	0.00			
3600.00	10.00	123.00	3580.75	-127.74	196.70	-111.99	0.00			
3700.00	10.00	123.00	3679.23	-137.19	211.26	-120.28	0.00			
3800.00	10.00	123.00	3777.72	-146.65	225.82	-128.57	0.00			
3900.00	10.00	123.00	3876.20	-156.11	240.39	-136.86	0.00			
4000.00 4100.00	10.00	123.00 123.00	3974.68	-165.57 -175.02	254.95	-145.15	0.00			
4200.00	10.00 10.00	123.00	4073.16 4171.64	-175.02	269.51 284.08	-153.44 -161.74	0.00			
4300.00	10.00	123.00	4270.12	-193.94	298.64	-170.03	0.00			
4400.00	10.00	123.00	4368.60	-203.40	313.21	-178.32	0.00			
4500.00	10.00	123.00	4467.08	-212.85	327.77	-186.61	0.00			
4516.16	10.00	123.00	4483.00	-214.38	330.12	-187.95	0.00	Base of Salt		
4600.00	10.00	123.00	4565.56	-222.31	342.33	-194.90	0.00			
4700.00	10.00	123.00	4664.04	-231.77	356.90	-203.19	0.00	Delegan		
4704.02	10.00	123.00	4668.00	-232.15	357.48	-203.53 211.49	0.00	Delaware		
4800.00 4900.00	10.00 10.00	123.00 123.00	4762.52 4861.00	-241.23 -250.68	371.46 386.02	-211.49 -219.78	0.00			
5000.00	10.00	123.00	4959.48	-250.00	400.59	-219.76	0.00			
5100.00	10.00	123.00	5057.97	-269.60	415.15	-236.36	0.00			
5200.00	10.00	123.00	5156.45	-279.06	429.71	-244.65	0.00			
5300.00	10.00	123.00	5254.93	-288.51	444.28	-252.94	0.00			
5400.00	10.00	123.00	5353.41	-297.97	458.84	-261.23	0.00			
5500.00	10.00	123.00	5451.89	-307.43	473.40	-269.53	0.00			
5600.00	10.00	123.00	5550.37	-316.89	487.97	-277.82	0.00	Characteristics		
5636.18 5700.00	10.00 10.00	123.00	5586.00 5648.85	-320.31 -326.34	493.23 502.53	-280.82 -286.11	0.00	Cherry Canyon		
5800.00	10.00	123.00 123.00	5747.33	-326.34 -335.80	502.53	-286.11 -294.40	0.00			
5900.00	10.00	123.00	5845.81	-345.26	531.66	-302.69	0.00			
6000.00	10.00	123.00	5944.29	-354.72	546.22	-310.98	0.00			
6100.00	10.00	123.00	6042.77	-364.17	560.78	-319.27	0.00			
6200.00	10.00	123.00	6141.25	-373.63	575.35	-327.57	0.00			
6300.00	10.00	123.00	6239.73	-383.09	589.91	-335.86	0.00			
6400.00	10.00	123.00	6338.22	-392.55	604.47	-344.15	0.00			



Well: Stray Cat 8-5 Fed Com 516H

County: Lea
Wellbore: Permit Plan
Design: Permit Plan #1

Geodetic System: US State Plane 1983

Datum: North American Datum 1927 Ellipsoid: Clarke 1866

Zone: 3001 - NM East (NAD83)

	Design: Permit Plan #1						<b>Zone:</b> 3001 - NM East (NAD83)		
MD (ft)	INC (°)	<b>AZI</b> (°)	TVD (ft)	NS (ft)	EW (ft)	VS (ft)	<b>DLS</b> (°/100ft)	Comment	
6500.00	10.00	123.00	6436.70	-402.01	619.04	-352.44	0.00		
6600.00	10.00	123.00	6535.18	-411.46	633.60	-360.73	0.00		
6700.00	10.00	123.00	6633.66	-420.92	648.16	-369.02	0.00		
6800.00	10.00	123.00	6732.14	-430.38	662.73	-377.31	0.00		
6900.00	10.00	123.00	6830.62	-439.84	677.29	-385.61	0.00		
6927.80	10.00	123.00	6858.00	-442.46	681.34	-387.91	0.00	Brushy Canyon	
7000.00	10.00	123.00	6929.10	-449.29	691.85	-393.90	0.00		
7100.00	10.00	123.00	7027.58	-458.75	706.42	-402.19	0.00		
7200.00	10.00	123.00	7126.06	-468.21	720.98	-410.48	0.00		
7300.00	10.00	123.00	7224.54	-477.67	735.54	-418.77	0.00		
7400.00 7500.00	10.00 10.00	123.00 123.00	7323.02 7421.50	-487.12 -496.58	750.11 764.67	-427.06 -435.35	0.00		
7600.00	10.00	123.00	7519.99	-490.36 -506.04	779.23	-433.33 -443.65	0.00		
7700.00	10.00	123.00	7618.47	-515.50	793.80	-451.94	0.00		
7800.00	10.00	123.00	7716.95	-524.95	808.36	-460.23	0.00		
7817.68	10.00	123.00	7734.36	-526.63	810.93	-461.69	0.00	Drop to Vertical	
7900.00	8.35	123.00	7815.62	-533.78	821.94	-467.97	2.00	Stop to Vertical	
8000.00	6.35	123.00	7914.79	-540.75	832.68	-474.08	2.00		
8100.00	4.35	123.00	8014.35	-545.83	840.50	-478.53	2.00		
8200.00	2.35	123.00	8114.18	-549.01	845.41	-481.32	2.00		
8300.00	0.35	123.00	8214.14	-550.30	847.39	-482.45	2.00		
8317.68	0.00	123.00	8231.82	-550.33	847.44	-482.48	2.00	Hold Vertical	
8400.00	0.00	359.62	8314.14	-550.33	847.44	-482.48	0.00		
8500.00	0.00	359.62	8414.14	-550.33	847.44	-482.48	0.00		
8600.00	0.00	359.62	8514.14	-550.33	847.44	-482.48	0.00		
8610.86	0.00	359.62	8525.00	-550.33	847.44	-482.48	0.00	1st Bone Spring Lime	
8700.00	0.00	359.62	8614.14	-550.33	847.44	-482.48	0.00		
8800.00	0.00	359.62	8714.14	-550.33	847.44	-482.48	0.00		
8825.86	0.00	359.62	8740.00	-550.33	847.44	-482.48	0.00	Leonard / Point of Penetration	
8874.90	0.00	359.62	8789.04	-550.33	847.44	-482.48	0.00	KOP	
8900.00	2.51	359.62	8814.14	-549.78	847.43	-481.93	10.00		
9000.00	12.51	359.62	8913.15	-536.73	847.35	-468.92	10.00		
9100.00	22.51	359.62	9008.40	-506.68	847.15	-438.98	10.00		
9200.00	32.51	359.62	9096.98	-460.55	846.84	-393.02	10.00		
9300.00	42.51	359.62	9176.20	-399.74	846.44	-332.42	10.00		
9400.00	52.51 62.51	359.62	9243.66	-326.09	845.95	-259.04	10.00		
9500.00 9600.00	72.51	359.62 359.62	9297.31 9335.51	-241.85 -149.58	845.39 844.78	-175.10 -83.16	10.00 10.00		
9700.00	82.51	359.62	9357.11	-52.07	844.13	14.00	10.00		
9774.03	89.91	359.62	9362.00	21.75	843.64	87.56	10.00	Landing Point	
9800.00	89.91	359.62	9362.04	47.71	843.47	113.43	0.00	Landing Form	
9900.00	89.91	359.62	9362.19	147.71	842.80	213.07	0.00		
10000.00	89.91	359.62	9362.34	247.71	842.14	312.71	0.00		
10100.00	89.91	359.62	9362.49	347.71	841.48	412.35	0.00		
10200.00	89.91	359.62	9362.65	447.71	840.81	511.99	0.00		
10300.00	89.91	359.62	9362.80	547.70	840.15	611.63	0.00		
10400.00	89.91	359.62	9362.95	647.70	839.49	711.27	0.00		
10500.00	89.91	359.62	9363.10	747.70	838.82	810.92	0.00		
10600.00	89.91	359.62	9363.25	847.70	838.16	910.56	0.00		
10700.00	89.91	359.62	9363.40	947.69	837.49	1010.20	0.00		
10800.00	89.91	359.62	9363.55	1047.69	836.83	1109.84	0.00		
10900.00	89.91	359.62	9363.71	1147.69	836.17	1209.48	0.00		
11000.00 11100.00	89.91	359.62	9363.86 9364.01	1247.69	835.50	1309.12	0.00		
11100.00	89.91 89.91	359.62 359.62	9364.01	1347.68 1447.68	834.84 834.18	1408.76 1508.40	0.00		
11300.00	89.91	359.62	9364.10	1547.68	833.51	1608.04	0.00		
11400.00	89.91	359.62	9364.46	1647.68	832.85	1707.68	0.00		
11500.00	89.91	359.62	9364.61	1747.68	832.18	1807.32	0.00		
11600.00	89.91	359.62	9364.77	1847.67	831.52	1906.96	0.00		
11700.00	89.91	359.62	9364.92	1947.67	830.86	2006.60	0.00		
11800.00	89.91	359.62	9365.07	2047.67	830.19	2106.24	0.00		
11900.00	89.91	359.62	9365.22	2147.67	829.53	2205.88	0.00		
12000.00	89.91	359.62	9365.37	2247.66	828.87	2305.52	0.00		
12100.00	89.91	359.62	9365.52	2347.66	828.20	2405.16	0.00		
12200.00	89.91	359.62	9365.68	2447.66	827.54	2504.80	0.00		
12300.00	89.91	359.62	9365.83	2547.66	826.87	2604.44	0.00		
12400.00	89.91	359.62	9365.98	2647.65	826.21	2704.09	0.00		
12500.00	89.91	359.62	9366.13	2747.65	825.55	2803.73	0.00		
12600.00	89.91	359.62	9366.28	2847.65	824.88	2903.37	0.00		
12700.00	89.91	359.62	9366.43	2947.65	824.22	3003.01	0.00		



Well: Stray Cat 8-5 Fed Com 516H

County: Lea
Wellbore: Permit Plan
Design: Permit Plan #1

Geodetic System: US State Plane 1983

Datum: North American Datum 1927

Ellipsoid: Clarke 1866
Zone: 3001 - NM East (NAD83)

MD TVD vs INC AZI NS EW DLS Comment (°/100ft) (ft) (°) (ft) (ft) (ft) (ft) 12800.00 89.91 359.62 9366.58 3047.64 823.56 3102.65 0.00 12900.00 89.91 359.62 9366.74 3147.64 822.89 3202.29 0.00 13000.00 89.91 359.62 9366.89 3247.64 822.23 3301.93 0.00 13100.00 359.62 9367.04 3347.64 3401.57 0.00 89.91 821.56 13200.00 89.91 359.62 9367.19 3447.64 820.90 3501.21 0.00 0.00 13300.00 89.91 359.62 9367.34 3547.63 820.24 3600.85 13400.00 89.91 359.62 9367.49 3647.63 819.57 3700.49 0.00 13500.00 89.91 359.62 9367.64 3747.63 818.91 3800.13 0.00 13600.00 89.91 359.62 9367.80 3847.63 818.25 3899.77 0.00 13700.00 89.91 9367.95 3947.62 817.58 3999.41 0.00 359.62 13800.00 359.62 9368.10 4047.62 4099.05 89.91 816.92 0.00 13900.00 89.91 359.62 9368.25 4147.62 816.25 4198.69 0.00 14000.00 89.91 359.62 9368.40 4247.62 815.59 4298.33 0.00 14100.00 89.91 359.62 9368.55 4347.61 814.93 4397.97 0.00 4497.61 14200.00 89.91 359.62 9368.70 4447.61 814.26 0.00 14300.00 89.91 359.62 9368.86 4547.61 813.60 4597.26 0.00 14400.00 9369.01 4647.61 812.94 4696.90 89.91 359.62 0.00 14500.00 9369.16 4747.61 4796.54 89.91 359.62 812.27 0.00 14600.00 89.91 359.62 9369.31 4847.60 811.61 4896.18 0.00 14700.00 89.91 359.62 9369.46 4947.60 810.94 4995.82 0.00 14800.00 89.91 359.62 9369.61 5047.60 810.28 5095.46 0.00 5195.10 14900.00 89.91 359.62 9369.77 5147.60 809.62 0.00 15000.00 89 91 359 62 9369 92 5247 59 808 95 5294 74 0.00 15100.00 89.91 359.62 9370.07 5347.59 808.29 5394.38 0.00 15200.00 89.91 359.62 9370.22 5447.59 807.63 5494.02 0.00 15300.00 89.91 359.62 9370.37 5547.59 806.96 5593.66 0.00 15400.00 89 91 359.62 9370.52 5647 58 806 30 5693 30 0.00 15500.00 9370.67 5747.58 805.64 5792.94 89.91 359.62 0.00 15600.00 89.91 359.62 9370.83 5847.58 804.97 5892.58 0.00 15700.00 359.62 9370.98 5947.58 804.31 5992.22 0.00 89.91 15800.00 89.91 359.62 9371.13 6047 58 803 64 6091.86 0.00 15900.00 6191.50 89.91 359.62 9371.28 6147.57 802.98 0.00 16000.00 9371.43 6247.57 6291.14 89.91 359.62 802.32 0.00 16100.00 89.91 359.62 9371.58 6347.57 801.65 6390.78 0.00 16200.00 89.91 359.62 9371.73 6447 57 800 99 6490.43 0.00 16300.00 89.91 359.62 9371.89 6547.56 800.33 6590.07 0.00 16400.00 89.91 359.62 9372.04 6647.56 799.66 6689.71 0.00 16500.00 89.91 359.62 9372.19 6747.56 799.00 6789.35 0.00 16600.00 89.91 359.62 9372.34 6847.56 798.33 6888.99 16700.00 9372.49 6947.55 797.67 6988.63 0.00 89.91 359.62 16800.00 89.91 359.62 9372.64 7047.55 797.01 7088.27 0.00 16900.00 89 91 359.62 9372.79 7147 55 796.34 7187.91 0.00 7287.55 17000.00 89.91 359.62 9372.95 7247.55 795.68 0.00 17100.00 89.91 359.62 9373.10 7347.55 795.02 7387.19 0.00 17200.00 89.91 359.62 9373.25 7447.54 794.35 7486.83 0.00 17300.00 89.91 359.62 9373.40 7547.54 793.69 7586.47 0.00 17400.00 89.91 359.62 9373.55 7647.54 793.02 7686.11 0.00 359.62 7785.75 0.00 17500.00 89.91 9373.70 7747.54 792.36 17600.00 89.91 359.62 9373.86 7847.53 791.70 7885.39 0.00 17700.00 89.91 359.62 9374.01 7947.53 791.03 7985.03 0.00 17800.00 89.91 359.62 9374.16 8047.53 790.37 8084.67 0.00 17900.00 89.91 359.62 9374.31 8147.53 789.71 8184.31 0.00 18000.00 89.91 359.62 9374.46 8247.52 789.04 8283.95 0.00 18100.00 9374.61 8347.52 788.38 8383.60 0.00 89.91 359.62 9374.76 8447.52 8483.24 18200.00 89.91 359.62 787.71 0.00 8582 88 18300.00 89 91 359 62 9374 92 8547 52 787.05 0.00 18400.00 89.91 359.62 9375.07 8647.52 786.39 8682.52 0.00 18500.00 89.91 359.62 9375.22 8747.51 785.72 8782.16 89.91 359.62 785.06 8881.80 0.00 18600.00 9375.37 8847.51 18700.00 89.91 359.62 9375.52 8947.51 784.40 8981.44 0.00 18800.00 9375.67 9047.51 783.73 9081.08 89.91 359.62 0.00 18900.00 89.91 359.62 9375.82 9147.50 783.07 9180.72 0.00 19000 00 89 91 359 62 9375 98 9247 50 782 40 9280 36 0.00 19100.00 89.91 359.62 9376.13 9347.50 781.74 9380.00 0.00 9479.64 19200.00 89.91 359.62 9376.28 9447.50 781.08 0.00 9376.43 9547.49 9579.28 19300.00 89.91 359.62 780.41 0.00 19400.00 89 91 359 62 9376 58 9647 49 779 75 9678 92 0.00 19500.00 89.91 359.62 9376.73 9747.49 779.09 9778.56 0.00 19600.00 89.91 359.62 9376.89 9847.49 778.42 9878.20 0.00 9882.79 EXIT 19604.61 89.91 359.62 9376.89 9852.10 778.39 0.00

devon

Well: Stray Cat 8-5 Fed Com 516H


County: Lea
Wellbore: Permit Plan
Design: Permit Plan #1

Geodetic System: US State Plane 1983


Datum: North American Datum 1927

Ellipsoid: Clarke 1866
Zone: 3001 - NM East (NAD83)

MD INC TVD AZI NS EW ٧S DLS Comment (ft) (°) (ft) (ft) (ft) (ft) (°/100ft) 19684.61 89.91 9377.00 9932.09 0.00 BHL 359.62 777.91 9962.51

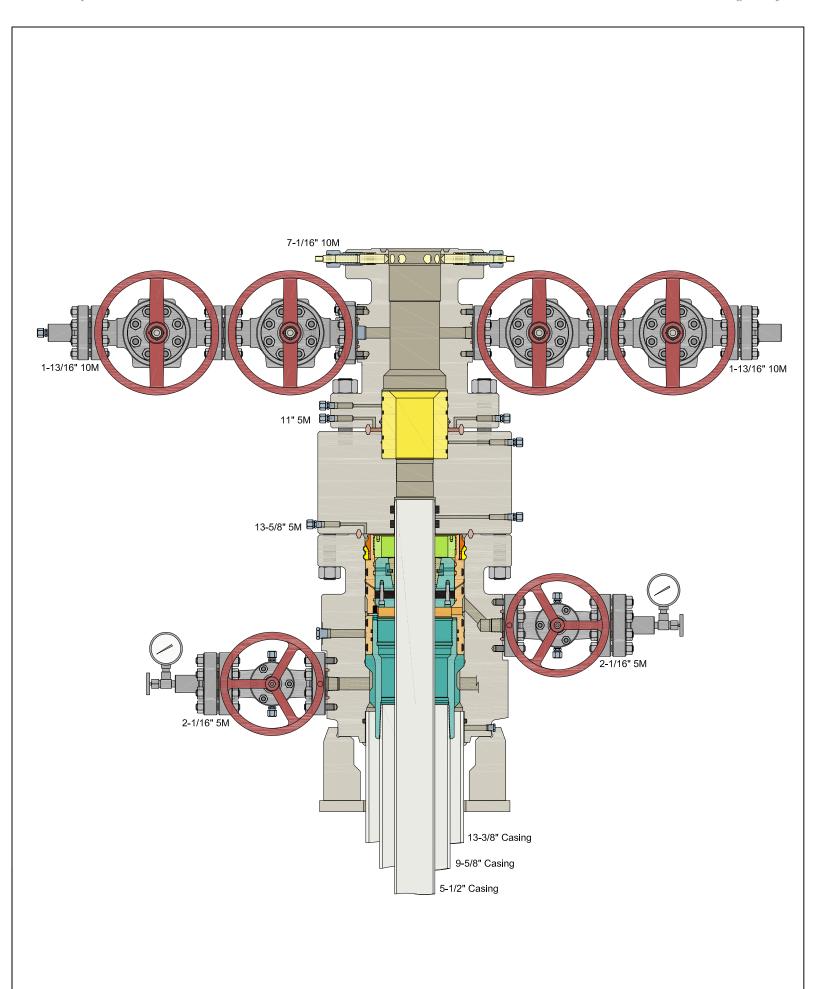

Released to Imaging: 10/25/2024 9:54:46 AM

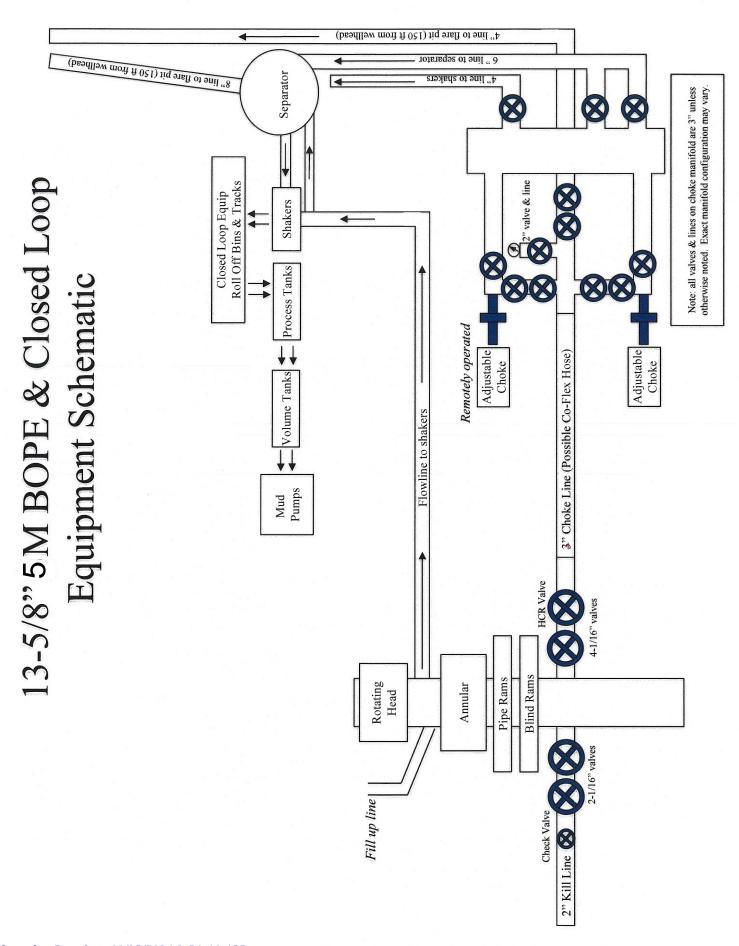

A multibowl wellhead may be used. The BOP will be tested per Onshore Order #2 after installation on the surface casing which will cover testing requirements for a maximum of 30 days. If any seal subject to test pressure is broken the system must be tested.

Devon proposes using a multi-bowl wellhead assembly. This assembly will only be tested when installed on the surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi.


- Wellhead will be installed by wellhead representatives.
- If the welding is performed by a third party, the wellhead representative will monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- Wellhead representative will install the test plug for the initial BOP test.
- Wellhead company will install a solid steel body pack-off to completely isolate the lower head after cementing intermediate casing. After installation of the pack-off, the pack-off and the lower flange will be tested to 5M, as shown on the attached schematic.
   Everything above the pack-off will not have been altered whatsoever from the initial nipple up. Therefore the BOP components will not be retested at that time.
- If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head will be cut and top out operations will be conducted.
- Devon will pressure test all seals above and below the mandrel (but still above the casing) to full working pressure rating.
- Devon will test the casing to 0.22 psi/ft or 1500 psi, whichever is greater, as per Onshore Order #2.

After running the surface casing, a 13-5/8" BOP/BOPE system with a minimum rating of 5M will be installed on the wellhead system and will undergo a 250 psi low pressure test followed by a 5,000 psi high pressure test. The 5,000 psi high and 250 psi low test will cover testing requirements a maximum of 30 days, as per Onshore Order #2. If the well is not complete within 30 days of this BOP test, another full BOP test will be conducted, as per Onshore Order #2.

After running the intermediate casing with a mandrel hanger, the 13-5/8" BOP/BOPE system with a minimum rating of 5M will already be installed on the wellhead.

The pipe rams will be operated and checked each 24 hour period and each time the drill pipe is out of the hole. These tests will be logged in the daily driller's log. A 2" kill line and 3" choke line will be incorporated into the drilling spool below the ram BOP. In addition to the rams and annular preventer, additional BOP accessories include a kelly cock, floor safety valve, choke lines, and choke manifold rated at 5,000 psi WP.

Devon's proposed wellhead manufactures will be FMC Technologies, Cactus Wellhead, or Cameron.

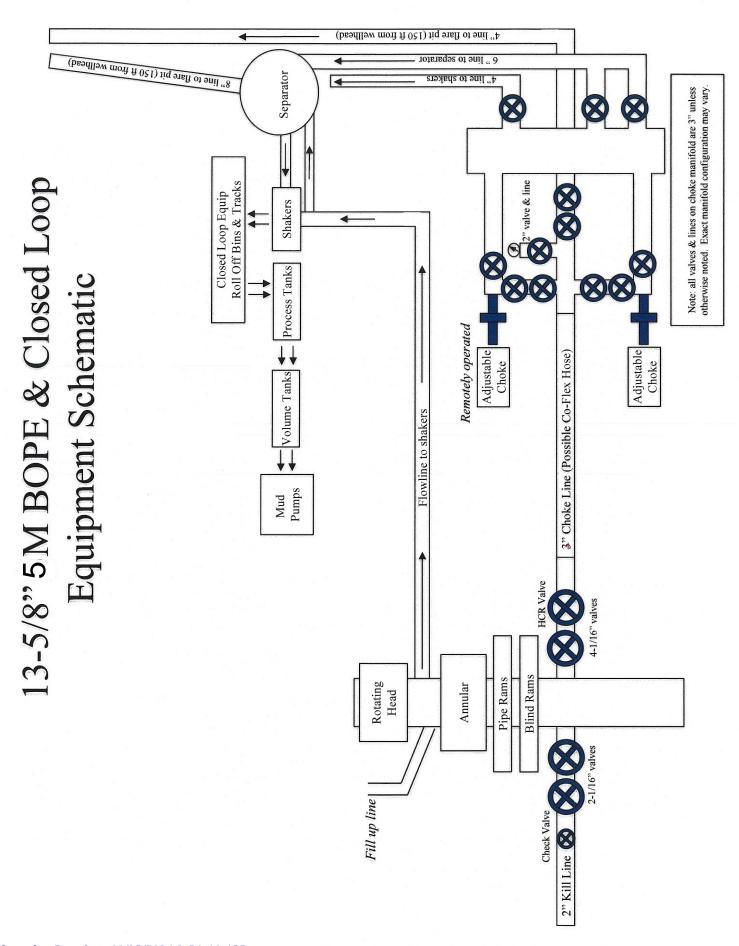

Casing Assumptions and Load Cases

Surface

All casing design assumptions were ran in Stress Check to determine safety factor which meet or exceed both Devon Energy and BLM minimum requirements. All casing strings will be filled while running in hole in order to not exceed collapse rating of the pipe.

Surface Casing Burst Design				
Load Case	<b>External Pressure</b>	Internal Pressure		
Pressure Test	Formation Pore Pressure	Max mud weight of next hole- section plus Test psi		
Drill Ahead	Formation Pore Pressure	Max mud weight of next hole section		
Displace to Gas	Formation Pore Pressure	Dry gas from next casing point		

Surface Casing Collapse Design					
Load Case External Pressure Internal Pressure					
Full Evacuation	Water gradient in cement, mud None				
	above TOC				
Cementing	Wet cement weight	Water (8.33ppg)			

Surface Casing Tension Design					
Load Case Assumptions					
Overpull	100kips				
Runing in hole	3 ft/s				
Service Loads	N/A				

Casing Assumptions and Load Cases

Intermediate

All casing design assumptions were ran in Stress Check to determine safety factor which meet or exceed both Devon Energy and BLM minimum requirements. All casing strings will be filled while running in hole in order to not exceed collapse rating of the pipe.

Intermediate Casing Burst Design				
Load Case External Pressure Internal Pressure				
Pressure Test	Formation Pore Pressure	Max mud weight of next hole- section plus Test psi		
Drill Ahead	Formation Pore Pressure	Max mud weight of next hole section		
Fracture @ Shoe	Formation Pore Pressure	Dry gas		

Intermediate Casing Collapse Design					
Load Case External Pressure Internal Pressure					
Full Evacuation	Water gradient in cement, mud	None			
	above TOC				
Cementing	Wet cement weight	Water (8.33ppg)			

Intermediate Casing Tension Design				
Load Case Assumptions				
Overpull	100kips			
Runing in hole	2 ft/s			
Service Loads	N/A			

Casing Assumptions and Load Cases

Production

All casing design assumptions were ran in Stress Check to determine safety factor which meet or exceed both Devon Energy and BLM minimum requirements. All casing strings will be filled while running in hole in order to not exceed collapse rating of the pipe.

Production Casing Burst Design		
Load Case	External Pressure	Internal Pressure
Pressure Test	Formation Pore Pressure	Fluid in hole (water or produced
		water) + test psi
Tubing Leak	Formation Pore Pressure	Packer @ KOP, leak below
		surface 8.6 ppg packer fluid
Stimulation	Formation Pore Pressure	Max frac pressure with heaviest
		frac fluid

Production Casing Collapse Design			
Load Case	External Pressure	Internal Pressure	
Full Evacuation	Water gradient in cement, mud above TOC.	None	
Cementing	Wet cement weight	Water (8.33ppg)	

Production Casing Tension Design		
Load Case	Assumptions	
Overpull	100kips	
Runing in hole	2 ft/s	
Service Loads	N/A	

# PECOS DISTRICT DRILLING CONDITIONS OF APPROVAL

**OPERATOR'S NAME:** | **Devon Energy Production Company LP** 

LEASE NO.: NMNM098826

**LOCATION:** Section 8, T.23 S., R.32 E., NMPM

**COUNTY:** Lea County, New Mexico

Sundry ID: N/A

WELL NAME & NO.: Stray Cat 8-5 Fed Com 514H

**SURFACE HOLE FOOTAGE:** 602'/S & 1234'/E **BOTTOM HOLE FOOTAGE** 20'/N & 990'/E

WELL NAME & NO.: Stray Cat 8-5 Fed Com 515H

**SURFACE HOLE FOOTAGE:** 601'/S & 1204'/E **BOTTOM HOLE FOOTAGE** 20'/N & 660'/E

WELL NAME & NO.: | Stray Cat 8-5 Fed Com 516H

**SURFACE HOLE FOOTAGE:** 601'/S & 1174'/E **BOTTOM HOLE FOOTAGE** 20'/N & 330'/E

WELL NAME & NO.: Stray Cat 8-5 Fed Com 524H

**SURFACE HOLE FOOTAGE:** 600'/S & 1779'/E **BOTTOM HOLE FOOTAGE** 20'/N & 2310'/E

WELL NAME & NO.: | Stray Cat 8-5 Fed Com 525H

SURFACE HOLE FOOTAGE: 599'/S & 1749'/E BOTTOM HOLE FOOTAGE 20'/N & 1980'/E

WELL NAME & NO.: | Stray Cat 8-5 Fed Com 526H

**SURFACE HOLE FOOTAGE:** 599'/S & 1719'/E **BOTTOM HOLE FOOTAGE** 20'/N & 1650'/E

COA

H2S	• Yes	□ No	
Potash	None	☐ Secretary	□ R-111-P
Cave/Karst Potential	Low	☐ Medium	High
Cave/Karst Potential	Critical		
Variance	None	<b>○</b> Flex Hose	Other
Wellhead	Conventional	☐ Multibowl	<b>©</b> Both
Wellhead Variance	Diverter		
Other	☐4 String Area	☐ Capitan Reef	□WIPP
Other	▼ Fluid Filled	☐ Pilot Hole	☐ Open Annulus
Cementing		☐ EchoMeter	
Special Requirements	☐ Water Disposal	<b>☑</b> COM	□ Unit
Special Requirements	☐ Break Testing	☐ Offline	
Variance		Cementing	

#### A. HYDROGEN SULFIDE

A Hydrogen Sulfide (H2S) Drilling Plan shall be activated 500 feet prior to drilling into the **Sand Dunes**, **Triste Draw**, **Wildcat**, **and Bone Springs** formation. As a result, the Hydrogen Sulfide area must meet Onshore Order 6 requirements, which includes equipment and personnel/public protection items. If Hydrogen Sulfide is encountered, please provide measured values and formations to the BLM.

#### B. CASING

- 1. The 13-3/8 inch surface casing shall be set at approximately 1135 feet (a minimum of 25 feet (Lea County) into the Rustler Anhydrite and above the salt) and cemented to the surface.
  - a. If cement does not circulate to the surface, the appropriate BLM office shall be notified and a temperature survey utilizing an electronic type temperature survey with surface log readout will be used or a cement bond log shall be run to verify the top of the cement. Temperature survey will be run a minimum of six hours after pumping cement and ideally between 8-10 hours after completing the cement job.
  - b. Wait on cement (WOC) time for a primary cement job will be a minimum of **8** hours or 500 pounds compressive strength, whichever is greater. (This is to include the lead cement)
  - c. Wait on cement (WOC) time for a remedial job will be a minimum of 4 hours after bringing cement to surface or 500 pounds compressive strength, whichever is greater.
  - d. If cement falls back, remedial cementing will be done prior to drilling out that string.

Intermediate casing must be kept fluid filled to meet BLM minimum collapse requirement.

- 2. The minimum required fill of cement behind the 9-5/8 inch intermediate casing is:
  - Cement to surface. If cement does not circulate see B.1.a, c-d above. Cement excess is less than 25%, more cement might be required.

Operator has proposed to pump down 13-3/8" X 9-5/8" annulus after primary cementing stage. Operator must run a CBL from TD of the 9-5/8" casing to surface. Submit results to the BLM.

If cement does not tie-back into the previous casing shoe, a third stage remediation BH may be performed. The appropriate BLM office shall be notified.

- 3. The minimum required fill of cement behind the 5-1/2 inch production casing is:
  - Cement should tie-back at least 200 feet into previous casing string.
     Operator shall provide method of verification.
     Cement excess is less than 25%, more cement might be required.

## C. PRESSURE CONTROL

1. Variance approved to use flex line from BOP to choke manifold. Manufacturer's specification to be readily available. No external damage to flex line. Flex line to be installed as straight as possible (no hard bends).'

2.

# Option 1:

- a. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be **5000 (5M)** psi.
- b. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the 9-5/8 inch intermediate casing shoe shall be 5000 (5M) psi.

# **Option 2:**

Operator has proposed a multi-bowl wellhead assembly. This assembly will only be tested when installed on the 13-3/8 inch surface casing. Minimum working pressure of the blowout preventer (BOP) and related equipment (BOPE) required for drilling below the surface casing shoe shall be 5000 (5M) psi.

- a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
- b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
- c. Manufacturer representative shall install the test plug for the initial BOP test.
- d. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- e. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.

# D. SPECIAL REQUIREMENT (S)

# **Communitization Agreement**

- The operator will submit a Communitization Agreement to the Santa Fe Office, 301 Dinosaur Trail Santa Fe, New Mexico 87508, at least 90 days before the anticipated date of first production from a well subject to a spacing order issued by the New Mexico Oil Conservation Division. The Communitization Agreement will include the signatures of all working interest owners in all Federal and Indian leases subject to the Communitization Agreement (i.e., operating rights owners and lessees of record), or certification that the operator has obtained the written signatures of all such owners and will make those signatures available to the BLM immediately upon request.
- If the operator does not comply with this condition of approval, the BLM may take enforcement actions that include, but are not limited to, those specified in 43 CFR 3163.1.
- In addition, the well sign shall include the surface and bottom hole lease numbers. When the Communitization Agreement number is known, it shall also be on the sign.

# **GENERAL REQUIREMENTS**

The BLM is to be notified in advance for a representative to witness:

- a. Spudding well (minimum of 24 hours)
- b. Setting and/or Cementing of all casing strings (minimum of 4 hours)
- c. BOPE tests (minimum of 4 hours)

  - Lea County
     Call the Hobbs Field Station, 414 West Taylor, Hobbs NM 88240, (575)
     393-3612
- 1. Unless the production casing has been run and cemented or the well has been properly plugged, the drilling rig shall not be removed from over the hole without prior approval.
  - a. In the event the operator has proposed to drill multiple wells utilizing a skid/walking rig. Operator shall secure the wellbore on the current well, after installing and testing the wellhead, by installing a blind flange of like pressure rating to the wellhead and a pressure gauge that can be monitored while drilling is performed on the other well(s).
  - b. When the operator proposes to set surface casing with Spudder Rig
    - Notify the BLM when moving in and removing the Spudder Rig.
    - Notify the BLM when moving in the 2<sup>nd</sup> Rig. Rig to be moved in within 90 days of notification that Spudder Rig has left the location.
    - BOP/BOPE test to be conducted per Onshore Oil and Gas Order No. 2 as soon as 2nd Rig is rigged up on well.
- 2. Floor controls are required for 3M or Greater systems. These controls will be on the rig floor, unobstructed, readily accessible to the driller and will be operational at all times during drilling and/or completion activities. Rig floor is defined as the area immediately around the rotary table; the area immediately above the substructure on which the draw works are located, this does not include the dog house or stairway area.
- 3. The record of the drilling rate along with the GR/N well log run from TD to surface (horizontal well vertical portion of hole) shall be submitted to the BLM office as well as all other logs run on the borehole 30 days from completion. If available, a digital copy of the logs is to be submitted in addition to the paper copies. The Rustler top and top and bottom of Salt are to be recorded on the Completion Report.

#### A. CASING

- 1. Changes to the approved APD casing program need prior approval if the items substituted are of lesser grade or different casing size or are Non-API. The Operator can exchange the components of the proposal with that of superior strength (i.e. changing from J-55 to N-80, or from 36# to 40#). Changes to the approved cement program need prior approval if the altered cement plan has less volume or strength or if the changes are substantial (i.e. Multistage tool, ECP, etc.). The initial wellhead installed on the well will remain on the well with spools used as needed.
- 2. Wait on cement (WOC) for Potash Areas: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi for all cement blends, 2) until cement has been in place at least 24 hours. WOC time will be recorded in the driller's log. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 3. Wait on cement (WOC) for Water Basin: After cementing but before commencing any tests, the casing string shall stand cemented under pressure until both of the following conditions have been met: 1) cement reaches a minimum compressive strength of 500 psi at the shoe, 2) until cement has been in place at least 8 hours. WOC time will be recorded in the driller's log. See individual casing strings for details regarding lead cement slurry requirements. The casing intergrity test can be done (prior to the cement setting up) immediately after bumping the plug.
- 4. Provide compressive strengths including hours to reach required 500 pounds compressive strength prior to cementing each casing string. Have well specific cement details onsite prior to pumping the cement for each casing string.
- 5. No pea gravel permitted for remedial or fall back remedial without prior authorization from the BLM engineer.
- 6. On that portion of any well approved for a 5M BOPE system or greater, a pressure integrity test of each casing shoe shall be performed. Formation at the shoe shall be tested to a minimum of the mud weight equivalent anticipated to control the formation pressure to the next casing depth or at total depth of the well. This test shall be performed before drilling more than 20 feet of new hole.
- 7. If hardband drill pipe is rotated inside casing, returns will be monitored for metal. If metal is found in samples, drill pipe will be pulled and rubber protectors which have a larger diameter than the tool joints of the drill pipe will be installed prior to continuing drilling operations.
- 8. Whenever a casing string is cemented in the R-111-P potash area, the NMOCD requirements shall be followed.
- B. PRESSURE CONTROL

- 1. All blowout preventer (BOP) and related equipment (BOPE) shall comply with well control requirements as described in Onshore Oil and Gas Order No. 2 and API RP 53 Sec. 17.
- 2. If a variance is approved for a flexible hose to be installed from the BOP to the choke manifold, the following requirements apply: The flex line must meet the requirements of API 16C. Check condition of flexible line from BOP to choke manifold, replace if exterior is damaged or if line fails test. Line to be as straight as possible with no hard bends and is to be anchored according to Manufacturer's requirements. The flexible hose can be exchanged with a hose of equal size and equal or greater pressure rating. Anchor requirements, specification sheet and hydrostatic pressure test certification matching the hose in service, to be onsite for review. These documents shall be posted in the company man's trailer and on the rig floor.
- 3. 5M or higher system requires an HCR valve, remote kill line and annular to match. The remote kill line is to be installed prior to testing the system and tested to stack pressure.
- 4. If the operator has proposed a multi-bowl wellhead assembly in the APD. The following requirements must be met:
  - a. Wellhead shall be installed by manufacturer's representatives, submit documentation with subsequent sundry.
  - b. If the welding is performed by a third party, the manufacturer's representative shall monitor the temperature to verify that it does not exceed the maximum temperature of the seal.
  - c. Manufacturer representative shall install the test plug for the initial BOP test.
  - d. Whenever any seal subject to test pressure is broken, all the tests in OOGO2.III.A.2.i must be followed.
  - e. If the cement does not circulate and one inch operations would have been possible with a standard wellhead, the well head shall be cut off, cementing operations performed and another wellhead installed.
- 5. The appropriate BLM office shall be notified a minimum of 4 hours in advance for a representative to witness the tests.
  - a. In a water basin, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. The casing cut-off and BOP installation can be initiated four hours after installing the slips, which will be approximately six hours after bumping the plug. For those casing strings not using slips, the minimum wait time before cut-off is eight hours after bumping the plug. BOP/BOPE testing can begin after cut-off or once cement reaches 500 psi compressive strength (including lead when specified), whichever is greater. However, if the float does not

- hold, cut-off cannot be initiated until cement reaches 500 psi compressive strength (including lead when specified).
- b. In potash areas, for all casing strings utilizing slips, these are to be set as soon as the crew and rig are ready and any fallback cement remediation has been done. For all casing strings, casing cut-off and BOP installation can be initiated at twelve hours after bumping the plug. However, **no tests** shall commence until the cement has had a minimum of 24 hours setup time, except the casing pressure test can be initiated immediately after bumping the plug (only applies to single stage cement jobs).
- c. The tests shall be done by an independent service company utilizing a test plug not a cup or J-packer. The operator also has the option of utilizing an independent tester to test without a plug (i.e. against the casing) pursuant to Onshore Order 2 with the pressure not to exceed 70% of the burst rating for the casing. Any test against the casing must meet the WOC time for water basin (8 hours) or potash (24 hours) or 500 pounds compressive strength, whichever is greater, prior to initiating the test (see casing segment as lead cement may be critical item).
- d. The test shall be run on a 5000 psi chart for a 2-3M BOP/BOP, on a 10000 psi chart for a 5M BOP/BOPE and on a 15000 psi chart for a 10M BOP/BOPE. If a linear chart is used, it shall be a one hour chart. A circular chart shall have a maximum 2 hour clock. If a twelve hour or twenty-four hour chart is used, tester shall make a notation that it is run with a two hour clock.
- e. The results of the test shall be reported to the appropriate BLM office.
- f. All tests are required to be recorded on a calibrated test chart. A copy of the BOP/BOPE test chart and a copy of independent service company test will be submitted to the appropriate BLM office.
- g. The BOP/BOPE test shall include a low pressure test from 250 to 300 psi. The test will be held for a minimum of 10 minutes if test is done with a test plug and 30 minutes without a test plug. This test shall be performed prior to the test at full stack pressure.
- h. BOP/BOPE must be tested by an independent service company within 500 feet of the top of the Wolfcamp formation if the time between the setting of the intermediate casing and reaching this depth exceeds 20 days. This test does not exclude the test prior to drilling out the casing shoe as per Onshore Order No. 2.
- C. DRILLING MUD

Mud system monitoring equipment, with derrick floor indicators and visual and audio alarms, shall be operating before drilling into the Wolfcamp formation, and shall be used until production casing is run and cemented.

# D. WASTE MATERIAL AND FLUIDS

All waste (i.e. drilling fluids, trash, salts, chemicals, sewage, gray water, etc.) created as a result of drilling operations and completion operations shall be safely contained and disposed of properly at a waste disposal facility. No waste material or fluid shall be disposed of on the well location or surrounding area.

Porto-johns and trash containers will be on-location during fracturing operations or any other crew-intensive operations.



Devon Energy Center 333 West Sheridan Avenue Oklahoma City, Oklahoma 73102-5015

# Hydrogen Sulfide (H₂S) Contingency Plan

For

Stray Cat 8-5 Fed Com 516H

Sec-8 T-23S R-32E 601' FSL & 1174' FEL LAT. = 32.3134765' N (NAD83) LONG = 103.6919675' W

**Lea County NM** 

# Stray Cat 8-5 Fed Com 516H This is an open drilling site. H<sub>2</sub>S monitoring equipment and emergency response equipment will be used within 500' of zones known to contain H<sub>2</sub>S, including warning signs, wind indicators and H<sub>2</sub>S monitor. Stray Cat 8-5 Fed Com 516H

Assumed 100 ppm ROE = 3000' (Radius of Exposure)
100 ppm H2S concentration shall trigger activation of this plan.

**Location Road** 

# **Escape**

Crews shall escape upwind of escaping gas in the event of an emergency release of gas. Escape can be facilitated from the location entrance road. Crews should then block the entrance to the location from the lease road so as not to allow anyone traversing into a hazardous area. The blockade should be at a safe distance outside of the ROE. There are no homes or buildings in or near the ROE.

**Assumed 100 ppm ROE = 3000'** 

# 100 ppm H<sub>2</sub>S concentration shall trigger activation of this plan.

# **Emergency Procedures**

In the event of a release of gas containing H<sub>2</sub>S, the first responder(s) must

- Isolate the area and prevent entry by other persons into the 100 ppm ROE.
- Evacuate any public places encompassed by the 100 ppm ROE.
- Be equipped with H<sub>2</sub>S monitors and air packs in order to control the release.
- Use the "buddy system" to ensure no injuries occur during the response
- Take precautions to avoid personal injury during this operation.
- Contact operator and/or local officials to aid in operation. See list of phone numbers attached.
- Have received training in the
  - Detection of H₂S, and
  - Measures for protection against the gas,
  - Equipment used for protection and emergency response.

# **Ignition of Gas Source**

Should control of the well be considered lost and ignition considered, take care to protect against exposure to Sulfur Dioxide (SO<sub>2</sub>). Intentional ignition must be coordinated with the NMOCD and local officials. Additionally the NM State Police may become involved. NM State Police shall be the Incident Command on scene of any major release. Take care to protect downwind whenever there is an ignition of the gas

#### Characteristics of H<sub>2</sub>S and SO<sub>2</sub>

Common	Chemical	Specific	Threshold	Hazardous Limit	Lethal
Name	Formula	Gravity	Limit	Hazardous Limit	Concentration
Hydrogen Sulfide	H <sub>2</sub> S	1.189 Air = 1	10 ppm	100 ppm/hr	600 ppm
Sulfur Dioxide	SO <sub>2</sub>	2.21 Air = 1	2 ppm	N/A	1000 ppm

# **Contacting Authorities**

Devon Energy Corp. personnel must liaison with local and state agencies to ensure a proper response to a major release. Additionally, the OCD must be notified of the release as soon as possible but no later than 4 hours. Agencies will ask for information such as type and volume of release, wind direction, location of release, etc. Be prepared with all information available. The following call list of essential and potential responders has been prepared for use during a release. Devon Energy Corp. Company response must be in coordination with the State of New Mexico's 'Hazardous Materials Emergency Response Plan' (HMER)

# **Hydrogen Sulfide Drilling Operation Plan**

# I. HYDROGEN SULFIDE (H2S) TRAINING

All personnel, whether regularly assigned, contracted, or employed on an unscheduled basis, will receive training from a qualified instructor in the following areas prior to commencing drilling operations on this well:

- 1. The hazards and characteristics of hydrogen sulfide (H<sub>2</sub>S)
- 2. The proper use and maintenance of personal protective equipment and life support systems.
- 3. The proper use of H<sub>2</sub>S detectors, alarms, warning systems, briefing areas, evacuation procedures, and prevailing winds.
- 4. The proper techniques for first aid and rescue procedures.

In addition, supervisory personnel will be trained in the following areas:

- The effects of H<sub>2</sub>S metal components. If high tensile tubulars are to be used, personnel will be trained in their special maintenance requirements.
- 2. Corrective action and shut-in procedures when drilling or reworking a well and blowout prevention and well control procedures.
- 3. The contents and requirements of the H<sub>2</sub>S Drilling Operations Plan and Public Protection Plan.

There will be an initial training session just prior to encountering a known or probable H<sub>2</sub>S zone (within 3 days or 500 feet) and weekly H<sub>2</sub>S and well control drills for all personnel in each crew. The initial training session shall include a review of the site specific H<sub>2</sub>S Drilling Operations Plan and the Public Protection Plan.

# II. HYDROGEN SULFIDE TRAINING

Note: All H<sub>2</sub>S safety equipment and systems will be installed, tested, and operational when drilling reaches a depth of 500 feet above, or three days prior to penetrating the first zone containing or reasonably expected to contain H<sub>2</sub>S.

# 1. Well Control Equipment

- A. Flare line
- B. Choke manifold Remotely Operated
- C. Blind rams and pipe rams to accommodate all pipe sizes with properly sized closing unit
- D. Auxiliary equipment may include if applicable: annular preventer and rotating head.
- E. Mud/Gas Separator

# 2. Protective equipment for essential personnel:

30-minute SCBA units located at briefing areas, as indicated on well site diagram, with escape units available in the top doghouse. As it may be difficult to communicate audibly while wearing these units, hand signals shall be utilized.

# 3. H<sub>2</sub>S detection and monitoring equipment:

Portable H<sub>2</sub>S monitors positioned on location for best coverage and response. These units have warning lights which activate when H<sub>2</sub>S levels reach 10 ppm and audible sirens which activate at 15 ppm. Sensor locations:

- Bell nipple
- Possum Belly/Shale shaker
- Rig floor
- Choke manifold
- Cellar

# Visual warning systems:

- A. Wind direction indicators as shown on well site diagram
- B. Caution/ Danger signs shall be posted on roads providing direct access to locations. Signs will be painted a high visibility yellow with black lettering of sufficient size to be reasonable distance from the immediate location. Bilingual signs will be used when appropriate.

# 4. Mud program:

The mud program has been designed to minimize the volume of H<sub>2</sub>S circulated to surface. Proper mud weight, safe drilling practices and the use of H<sub>2</sub>S scavengers will minimize hazards when penetrating H<sub>2</sub>S bearing zones.

# 5. Metallurgy:

- A. All drill strings, casings, tubing, wellhead, blowout preventer, drilling spool, kill lines, choke manifold lines, and valves shall be H<sub>2</sub>S trim.
- B. All elastomers used for packing and seals shall be H<sub>2</sub>S trim.

#### 6. Communication:

- Company personnel have/use cellular telephones in the field.
- B. Land line (telephone) communications at Office


# 7. Well testing:

- A. Drill stem testing will be performed with a minimum number of personnel in the immediate vicinity, which are necessary to safety and adequately conduct the test. The drill stem testing will be conducted during daylight hours and formation fluids will not be flowed to the surface. All drill-stem-testing operations conducted in an H<sub>2</sub>S environment will use the closed chamber method of testing.
- B. There will be no drill stem testing.

EHS Professional – Laura Wright	Devon En	ergy Corp. Company Call List	
Agency Call List	Drilling Sur	pervisor – Basin – Mark Kramer	405-823-4796
Lea   Lea County   Communication Authority   Say   Sate Police   Sheriff's Office   She	EHS Profe	ssional – Laura Wright	405-439-8129
Lea County Communication Authority   393-39	Agency	Call List	
State Police   392-5    City Police   397-9    Sheriff's Office   393-2    Ambulance   597-9    LEPC (Local Emergency Planning Committee)   393-2    NMOCD   393-6    US Bureau of Land Management   393-3    State Police   385-3    City Police   385-3    LEPC (Local Emergency Planning Committee)   387-3    LEPC (Local Emergency Planning Committee)   387-3    US Bureau of Land Management   387-6    NM Emergency Response Commission (Santa Fe)   (505) 476-9    24 HR   (505) 827-9    National Emergency Response Center   (800) 424-8    National Pollution Control Center: Direct   (703) 872-6    For Oil Spills   (800) 280-7    Emergency Services     Wild Well Control   (915) 699-0139   (915) 563-3    Halliburton   (575) 746-3    Give GPS   Native Air – Emergency Helicopter – Hobbs (TX & NM)   (800) 642-7    Flight For Life - Lubbock, TX   (806) 743-8    Med Flight Air Amb - Albuquerque, NM   (575) 842-4    Lifeguard Air Med Svc. Albuquerque, NM   (800) 222-13			
City Police   397-9:			393-3981
Sheriff's Office   393-2    Ambulance   5    Fire Department   397-9    LEPC (Local Emergency Planning Committee)   393-2    NMOCD   393-6    US Bureau of Land Management   393-3    State Police   885-3    City Police   885-2    Sheriff's Office   887-7    Ambulance   5    Fire Department   885-3    US Bureau of Land Management   887-8    VI Sheriff Sher	<u>(373)</u>		392-5588
Ambulance   Fire Department   397-93     LEPC (Local Emergency Planning Committee)   393-24     NMOCD   393-6     US Bureau of Land Management   393-33     US Bureau of Land Management   393-34     County (575)   State Police   885-3     City Police   885-3     City Police   887-73     Ambulance   587-74     Fire Department   887-3     US Bureau of Land Management   887-3     US Bureau of Land Management   887-6     NM Emergency Response Commission (Santa Fe)   (505) 476-9     24 HR   (505) 827-9     National Emergency Response Center   (800) 424-8     National Pollution Control Center: Direct   (703) 872-6     For Oil Spills   (800) 280-7     Emergency Services     Wild Well Control   (915) 699-0139   (915) 563-3     Halliburton   (575) 746-2     B. J. Services   (575) 746-2     Give GPS   Flight For Life - Lubbock, TX   (806) 747-8     Med Flight Air Amb - Albuquerque, NM   (575) 842-4     Lifeguard Air Med Svc. Albuquerque, NM   (800) 222-1			397-9265
Fire Department			393-2515
LEPC (Local Emergency Planning Committee) 393-20     NMOCD 393-6     US Bureau of Land Management 393-30     US Bureau of Land Management 393-30     State Police 885-3     City Police 887-7     Ambulance 87-7     Ambulance 885-3     LEPC (Local Emergency Planning Committee) 887-3     US Bureau of Land Management 887-6     NM Emergency Response Commission (Santa Fe) (505) 476-90     24 HR (505) 827-9     National Emergency Response Center (800) 424-80     National Pollution Control Center: Direct (703) 872-60     For Oil Spills (800) 280-7     Emergency Services     Wild Well Control (915) 699-0139 (915) 563-3     Halliburton (575) 746-2     B. J. Services (575) 746-3     Give GPS (Fight For Life - Lubbock, TX (806) 747-80     Position: Proceedings (100) (1			911
NMOCD			397-9308
US Bureau of Land Management   393-36			393-2870
Eddy   County (575)   State Police   885-3   2   2   2   2   2   2   2   2   2			393-6161
County (575)         State Police         885-3           City Police         885-2           Sheriff's Office         887-7           Ambulance         887-3           LEPC (Local Emergency Planning Committee)         887-3           US Bureau of Land Management         887-6           NM Emergency Response Commission (Santa Fe)         (505) 476-9           24 HR         (505) 827-9           National Emergency Response Center         (800) 424-8           National Pollution Control Center: Direct         (703) 872-6           For Oil Spills         (800) 280-7           Emergency Services         Wild Well Control         (281) 784-4           Cudd Pressure Control         (915) 699-0139         (915) 563-3           Halliburton         (575) 746-2           B. J. Services         (575) 746-3           Give         Native Air – Emergency Helicopter – Hobbs (TX & NM)         (800) 642-7           GPS         Flight For Life - Lubbock, TX         (806) 743-9           position:         Aerocare - Lubbock, TX         (806) 747-8           Med Flight Air Amb - Albuquerque, NM         (575) 842-4           Lifeguard Air Med Svc. Albuquerque, NM         (800) 222-1		US Bureau of Land Management	393-3612
City Police			
Sheriff's Office		State Police	885-3137
Ambulance   Fire Department   885-3:     LEPC (Local Emergency Planning Committee)   887-3:     US Bureau of Land Management   887-6:     NM Emergency Response Commission (Santa Fe)   (505) 476-9:     24 HR	<u>(575)</u>		885-2111
Fire Department			887-7551
LEPC (Local Emergency Planning Committee)			911
US Bureau of Land Management   887-69     NM Emergency Response Commission (Santa Fe)   (505) 476-99     24 HR			885-3125
NM Emergency Response Commission (Santa Fe)			887-3798
24 HR			887-6544
National Emergency Response Center   (800) 424-86     National Pollution Control Center: Direct   (703) 872-66     For Oil Spills   (800) 280-7     Emergency Services     Wild Well Control   (281) 784-4     Cudd Pressure Control   (915) 699-0139   (915) 563-3     Halliburton   (575) 746-2     B. J. Services   (575) 746-3     Give GPS   Native Air – Emergency Helicopter – Hobbs (TX & NM)   (800) 642-76     GPS   Flight For Life - Lubbock, TX   (806) 743-95     position:   Med Flight Air Amb - Albuquerque, NM   (575) 842-44     Lifeguard Air Med Svc. Albuquerque, NM   (800) 222-15     National Emergency Response Center   (800) 424-86     (800) 424-86   (800) 280-7     (800) 280			(505) 476-9600
National Pollution Control Center: Direct		24 HR	(505) 827-9126
For Oil Spills (800) 280-7  Emergency Services  Wild Well Control (281) 784-4  Cudd Pressure Control (915) 699-0139 (915) 563-33  Halliburton (575) 746-2  B. J. Services (575) 746-33  Give Native Air – Emergency Helicopter – Hobbs (TX & NM) (800) 642-73  Flight For Life - Lubbock, TX (806) 743-93  position: Aerocare - Lubbock, TX (806) 747-83  Med Flight Air Amb - Albuquerque, NM (575) 842-43  Lifeguard Air Med Svc. Albuquerque, NM (800) 222-13			(800) 424-8802
Emergency Services   Wild Well Control (281) 784-4     Cudd Pressure Control (915) 699-0139 (915) 563-33     Halliburton (575) 746-2     B. J. Services (575) 746-33     Give GPS   Native Air – Emergency Helicopter – Hobbs (TX & NM) (800) 642-73     Flight For Life - Lubbock, TX (806) 743-93     Position: Aerocare - Lubbock, TX (806) 747-83     Med Flight Air Amb - Albuquerque, NM (575) 842-44     Lifeguard Air Med Svc. Albuquerque, NM (800) 222-13		National Pollution Control Center: Direct	(703) 872-6000
Wild Well Control       (281) 784-4         Cudd Pressure Control       (915) 699-0139       (915) 563-33         Halliburton       (575) 746-23         B. J. Services       (575) 746-33         Give       Native Air – Emergency Helicopter – Hobbs (TX & NM)       (800) 642-73         GPS       Flight For Life - Lubbock, TX       (806) 743-93         position:       Aerocare - Lubbock, TX       (806) 747-83         Med Flight Air Amb - Albuquerque, NM       (575) 842-43         Lifeguard Air Med Svc. Albuquerque, NM       (800) 222-13		For Oil Spills	(800) 280-7118
Cudd Pressure Control         (915) 699-0139         (915) 563-33           Halliburton         (575) 746-23           B. J. Services         (575) 746-33           Give         Native Air – Emergency Helicopter – Hobbs (TX & NM)         (800) 642-73           GPS         Flight For Life - Lubbock, TX         (806) 743-93           position:         Aerocare - Lubbock, TX         (806) 747-83           Med Flight Air Amb - Albuquerque, NM         (575) 842-44           Lifeguard Air Med Svc. Albuquerque, NM         (800) 222-13		Emergency Services	
Halliburton   (575) 746-27     B. J. Services   (575) 746-37     Give		Wild Well Control	(281) 784-4700
B. J. Services (575) 746-33  Give Native Air – Emergency Helicopter – Hobbs (TX & NM) (800) 642-73  GPS Flight For Life - Lubbock, TX (806) 743-93  position: Aerocare - Lubbock, TX (806) 747-83  Med Flight Air Amb - Albuquerque, NM (575) 842-43  Lifeguard Air Med Svc. Albuquerque, NM (800) 222-13		Cudd Pressure Control (915) 699-0139	(915) 563-3356
Give GPS position:Native Air – Emergency Helicopter – Hobbs (TX & NM)(800) 642-73Position:Flight For Life - Lubbock, TX Aerocare - Lubbock, TX Med Flight Air Amb - Albuquerque, NM(806) 747-83Med Flight Air Amb - Albuquerque, NM Lifeguard Air Med Svc. Albuquerque, NM(575) 842-43		Halliburton	(575) 746-2757
Give GPS position:Native Air – Emergency Helicopter – Hobbs (TX & NM)(800) 642-73Position:Flight For Life - Lubbock, TX Aerocare - Lubbock, TX Med Flight Air Amb - Albuquerque, NM(806) 747-83Med Flight Air Amb - Albuquerque, NM Lifeguard Air Med Svc. Albuquerque, NM(575) 842-43		B. J. Services	(575) 746-3569
GPS position:Flight For Life - Lubbock, TX(806) 743-99Aerocare - Lubbock, TX(806) 747-89Med Flight Air Amb - Albuquerque, NM(575) 842-49Lifeguard Air Med Svc. Albuquerque, NM(800) 222-13	Give		(800) 642-7828
position:Aerocare - Lubbock, TX(806) 747-89Med Flight Air Amb - Albuquerque, NM(575) 842-49Lifeguard Air Med Svc. Albuquerque, NM(800) 222-12			(806) 743-9911
Lifeguard Air Med Svc. Albuquerque, NM (800) 222-12	position:	Aerocare - Lubbock, TX	(806) 747-8923
			(575) 842-4433
Poison Control (24/7) (575) 272-3		Lifeguard Air Med Svc. Albuquerque, NM	(800) 222-1222
(313) 212-3		Poison Control (24/7)	(575) 272-3115
Oil & Gas Pipeline 24 Hour Service (800) 364-43		(800) 364-4366	
NOAA – Website - www.nhc.noaa.gov		NOAA – Website - www.nhc.noaa.gov	

Prepared in conjunction with Dave Small



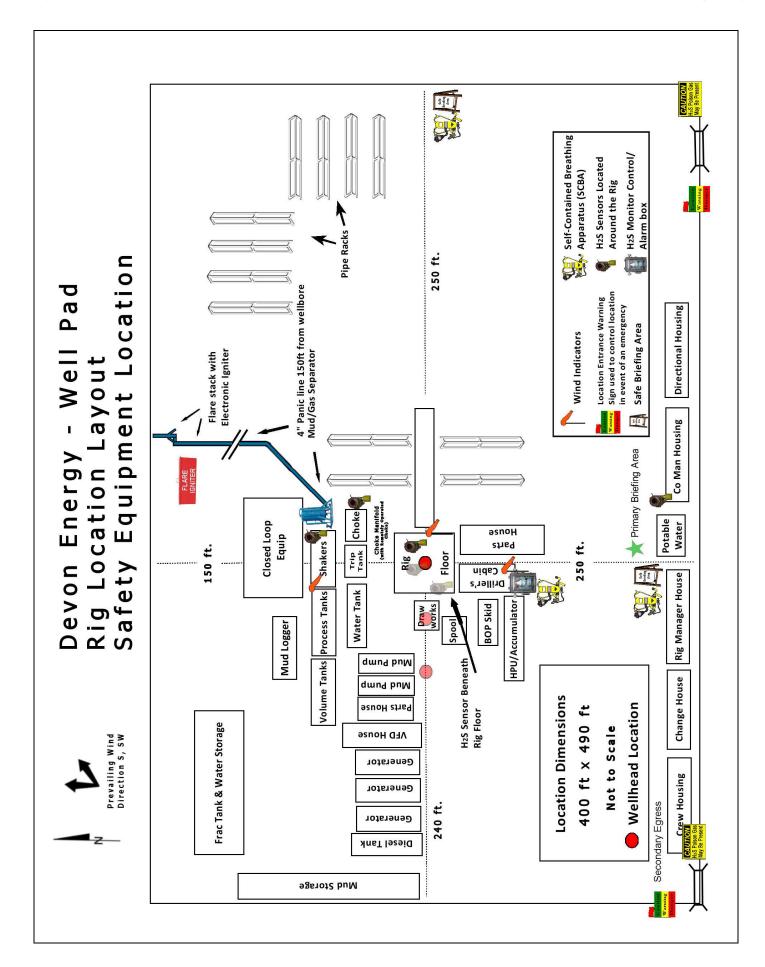

District I
1625 N. French Dr., Hobbs, NM 88240
Phone: (575) 393-6161 Fax: (575) 393-0720

District II 811 S. First St., Artesia, NM 88210 Phone: (575) 748-1283 Fax: (575) 748-9720

District III 1000 Rio Brazos Rd., Aztec, NM 87410 Phone:(505) 334-6178 Fax:(505) 334-6170

1220 S. St Francis Dr., Santa Fe, NM 87505 Phone:(505) 476-3470 Fax:(505) 476-3462

# **State of New Mexico Energy, Minerals and Natural Resources Oil Conservation Division** 1220 S. St Francis Dr. **Santa Fe, NM 87505**

CONDITIONS

Action 393378

## **CONDITIONS**

Operator:	OGRID:	
DEVON ENERGY PRODUCTION COMPANY, LP	6137	
333 West Sheridan Ave.	Action Number:	
Oklahoma City, OK 73102	393378	
	Action Type:	
	[C-101] BLM - Federal/Indian Land Lease (Form 3160-3)	

#### CONDITIONS

Created By	Condition	Condition Date
pkautz	EFFECTIVE DATE FOR SUBMITTING TO OCD THE NEW FORM C-102 WAS 08/01/2024. MUST SUBMIT C-102 ON NEW FORM.	10/25/2024
pkautz	Will require a File As Drilled C-102 and a Directional Survey with the C-104	10/25/2024
pkautz	Once the well is spud, to prevent ground water contamination through whole or partial conduits from the surface, the operator shall drill without interruption through the fresh water zone or zones and shall immediately set in cement the water protection string	10/25/2024
pkautz	Oil base muds are not to be used until fresh water zones are cased and cemented providing isolation from the oil or diesel. This includes synthetic oils. Oil based mud, drilling fluids and solids must be contained in a steel closed loop system	10/25/2024
pkautz	Cement is required to circulate on both surface and intermediate1 strings of casing	10/25/2024
pkautz	If cement does not circulate on any string, a CBL is required for that string of casing	10/25/2024