

Santa Fe Main Office
Phone: (505) 476-3441
General Information
Phone: (505) 629-6116

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

Online Phone Directory Visit:
<https://www.emnrd.nm.gov/ocd/contact-us/>

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

<p>SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)</p>		<p>WELL API NO. 30-015-28544</p>
<p>1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/></p>		<p>5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/></p>
<p>2. Name of Operator Mewbourne Oil Company</p>		<p>6. State Oil & Gas Lease No.</p>
<p>3. Address of Operator P.O. Box 5270 Hobbs, NM 88241</p>		<p>7. Lease Name or Unit Agreement Name State B</p>
<p>4. Well Location Unit Letter D : 660 feet from the North line and 660 feet from the West line Section 33 Township 19S Range 25E NMPM Eddy County</p>		<p>8. Well Number 2</p>
<p>11. Elevation (Show whether DR, RKB, RT, GR, etc.)</p>		<p>9. OGRID Number 14744</p>
<p>10. Pool name or Wildcat Dagger Draw; Upper Penn, North</p>		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

<p>NOTICE OF INTENTION TO:</p> <p>PERFORM REMEDIAL WORK <input type="checkbox"/> PLUG AND ABANDON <input type="checkbox"/> TEMPORARILY ABANDON <input type="checkbox"/> CHANGE PLANS <input type="checkbox"/> PULL OR ALTER CASING <input type="checkbox"/> MULTIPLE COMPL <input type="checkbox"/> DOWNHOLE COMMINGLE <input type="checkbox"/> CLOSED-LOOP SYSTEM <input type="checkbox"/> OTHER: <input type="checkbox"/></p>		<p>SUBSEQUENT REPORT OF:</p> <p>REMEDIAL WORK <input type="checkbox"/> ALTERING CASING <input type="checkbox"/> COMMENCE DRILLING OPNS. <input type="checkbox"/> P AND A <input checked="" type="checkbox"/> CASING/CEMENT JOB <input type="checkbox"/> OTHER: <input type="checkbox"/></p>	
---	--	---	--

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Please find attached Work Summary & As Plugged WBS

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE  TITLE Regulatory Specialist DATE 7/2/25

Type or print name John Harrison E-mail address: john.harrison@mewbourne.com PHONE: 575-393-5905

For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____

Conditions of Approval (if any):

**MOC P&A Summary****Well Name: STATE B 2 P&A****API#:3001528544****Job Category:** P&A**Start Date:** 6/23/2025**Contact Name:** Aaron Taylor**Company:** MOC**6/23/2025**

Operations Summary

Spotted P&A rig & equipment. SDFD.

6/24/2025

Operations Summary

SICP 0#. Dug out WH. RU P&A rig. Unseated pump. POOH & LD rods (found rod pump parted on pull rod). ND WH & NU BOP. Released tbg anchor. MIRU tbg scanners. Started POOH scanning tbg. Scan results thus far as follows: 20 YB, 35 BB, 47 GB, & 27 RB. RDMO tbg scanners. SWI & SDFD. Left EOT @ 3855'. Notified David Alvarado w/NMOCD.

6/25/2025

Operations Summary

SICP 0#. Continued POOH & LD tbg (found tbg parted below tbg anchor). Fish LIH: mud anchor (30.87'), perf sub (4.20'), SN (1.10'), 2 jts 2 7/8" tbg (63.08'), 1/2 jt 2 7/8" tbg (14.74') & (Rod Pump (24')). David Alvarado w/NMOCD gave OK. MIRU JSI WL. RIH w/WL & 5.9" OD gauge ring to 7650'. POOH w/WL. RIH w/WL & CIBP. Set CIBP @ 7640'. POOH w/WL. RIH w/WL & CBL logging tools. Logged well from bottom to surface. Found CMT to surface. SWI & SDFD. Notified David Alvarado w/NMOCD.

6/26/2025

Operations Summary

SICP 0#. Racked & tallied 250 jts 2 3/8 L80 4.7# YB (8020.55 T/Off) from L&R yard. RIH w/tbg open ended to 7640'. Circulated 290 BBLS MLF. Tested csg to 500# for 30 minutes, held OK. Spotted 30 sks class C neat cmt on top of CIBP @7640'. POOH w/3000' of tbg. SWI. SDFD. Notified David Alvarado w/NMOCD.

6/27/2025

Operations Summary

SICP 0#. RIH w/tbg & tagged TOC @ 7483'. POOH & LD tbg to 4500'. Spotted 140 sks class C neat cmt @ 4500'. POOH w/tbg. SWI & SDFWE. Notified David Alvarado w/NMOCD.

6/30/2025

Operations Summary

SICP 0#. RIH w/tbg. Tagged TOC @ 3634'. POOH & LD tbg to 2395'. Spotted 40 sks class C neat cmt. POOH w/tbg & WOC. RIH w/tbg & tagged TOC @ 1254'. POOH to 900'. MIRU Royalty WL truck. RIH w/WL & perf @ 1254'. POOH w/WL. Loaded csg & pressured up to 1000#. Blew well down. RIH w/tbg to 1354'. Spotted 60 sks class C neat cmt. POOH w/tbg. SWI & SDFD. Notified David Alvarado w/NMOCD.


7/1/2025

Operations Summary

SICP 0#. RIH w/tbg & tagged TOC @981'. POOH LD tbg to 450'. Spotted 125 sks class C neat cmt from 450' to surface (Verbal OK from David Alvarado w/NMOCD). POOH w/tbg. RDMO P&A rig. Cut WH off. Topped off csg w/cmt. Installed P&A marker. Notified David Alvarado w/NMOCD. Well P&A'd effective 7-1-25.

State B #2 - As Plugged WBS

660' FNL & 660' FEL, Sec. 33 – T19S – R25E - Eddy Co, NM
API 30-015-28544

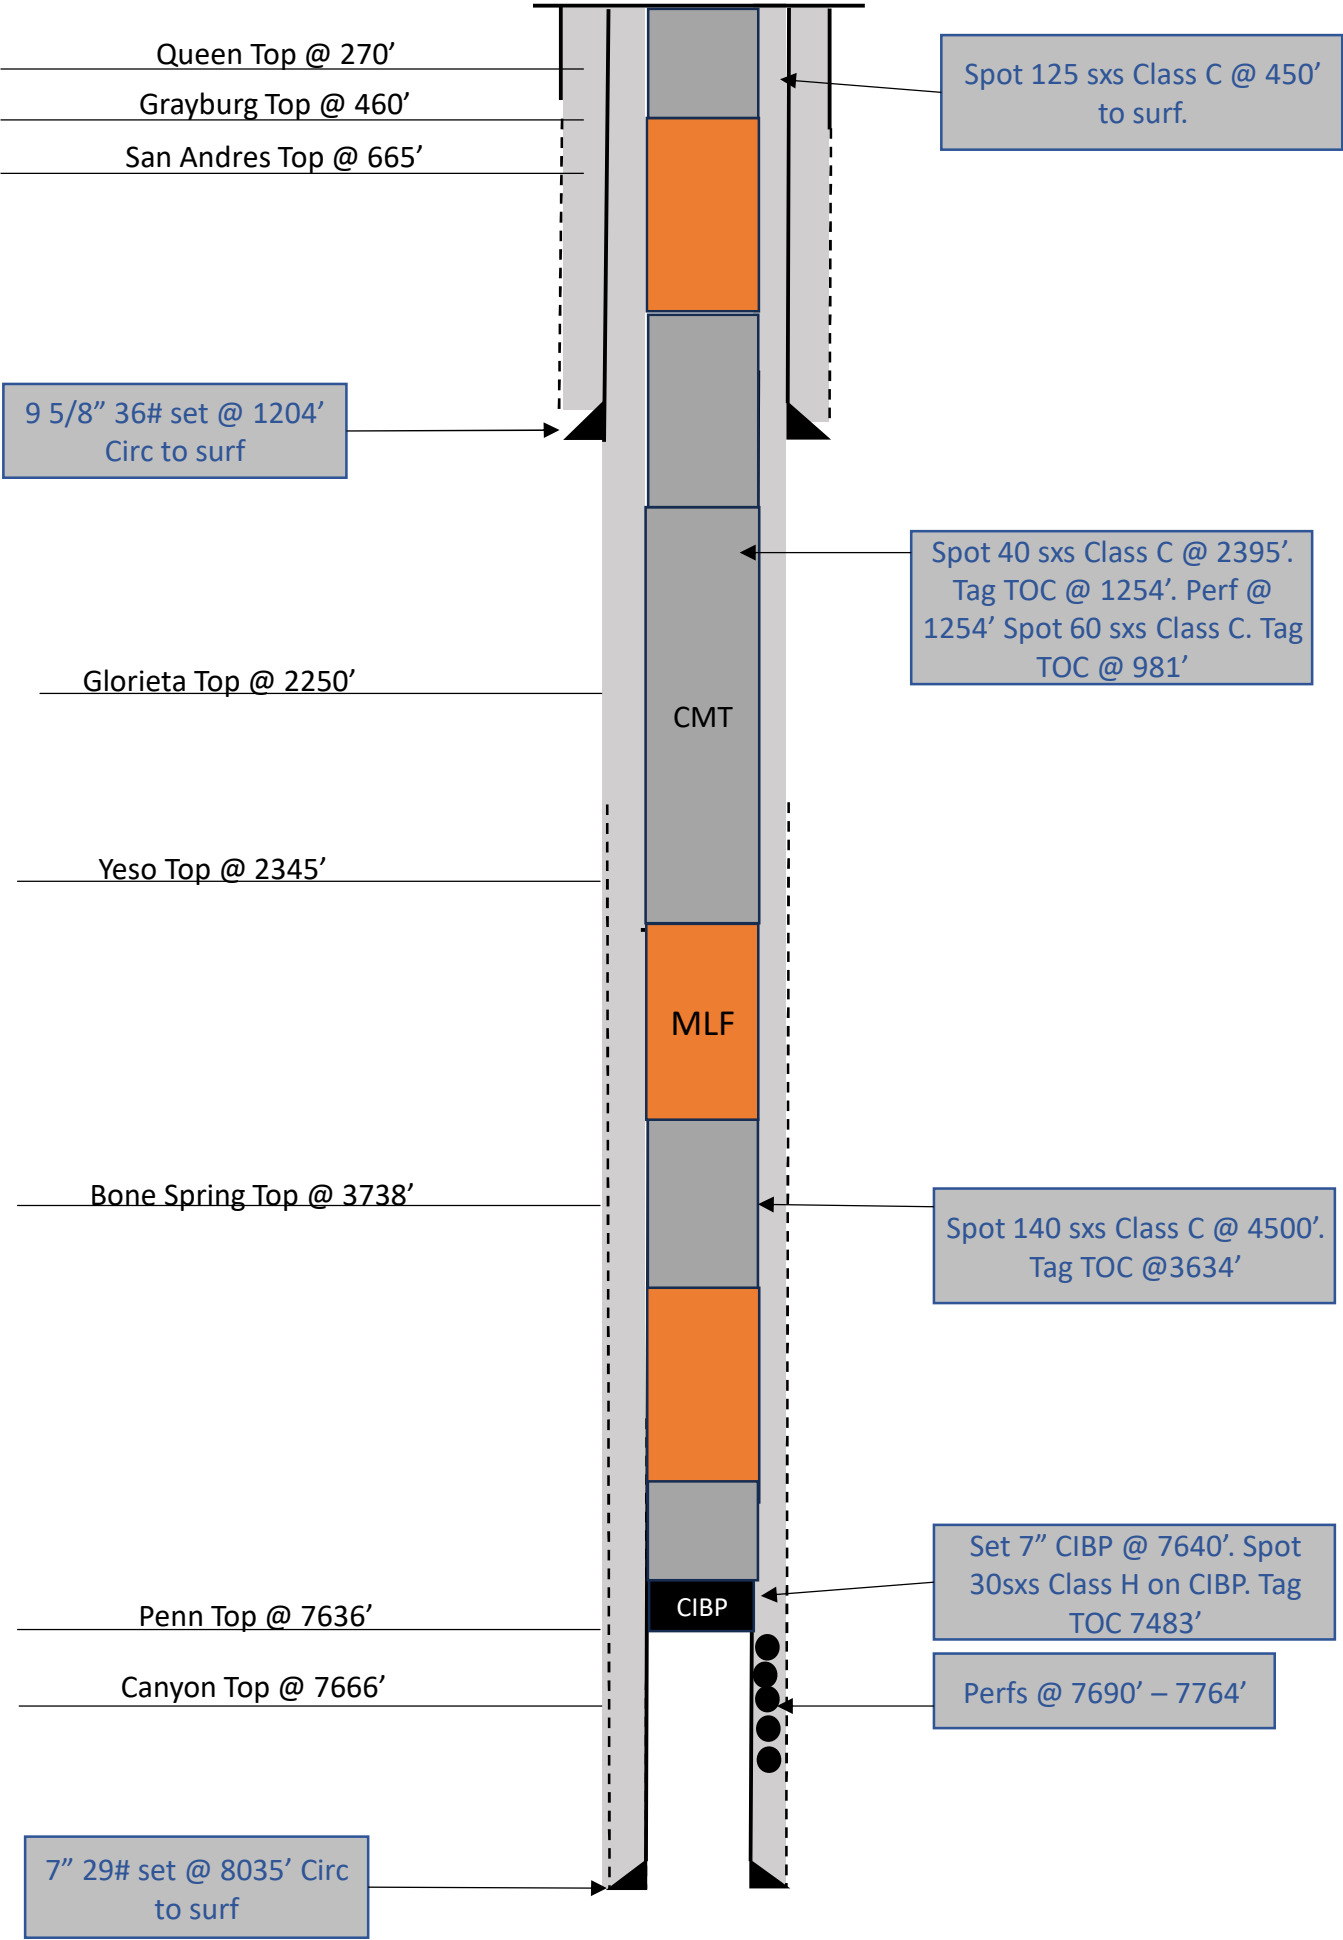

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/ocd/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 481147

CONDITIONS

Operator: MEWBOURNE OIL CO P.O. Box 5270 Hobbs, NM 88241	OGRID: 14744
	Action Number: 481147
	Action Type: [C-103] Sub. Plugging (C-103P)

CONDITIONS

Created By	Condition	Condition Date
gcordero	Clean Location in accordance with 19.15.25.10 NMAC.	8/1/2025
gcordero	Submit C-103Q within one year of plugging.	8/1/2025