

Santa Fe Main Office
Phone: (505) 476-3441
General Information
Phone: (505) 629-6116

State of New Mexico
Energy, Minerals and Natural Resources

Form C-103
Revised July 18, 2013

Online Phone Directory Visit:
<https://www.emnrd.nm.gov/ocd/contact-us/>

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-20094
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Sandlott Energy (Jackie Brewer DBA)		6. State Oil & Gas Lease No.
3. Address of Operator P.O. Box 711 Lovington, NM 88260		7. Lease Name or Unit Agreement Name Resler Yates State
4. Well Location Unit Letter H: 1650 feet from the North line and 990 feet from the East line Section 32 Township 18S Range 28E NMPM Eddy County		8. Well Number #370
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number 154329
10. Pool name or Wildcat (3230) Artesia; Queen-Grayburg-San Andres		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO: PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☒ TEMPORARILY ABANDON ☐ CHANGE PLANS ☐ PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐ DOWNHOLE COMMINGLE ☐ CLOSED-LOOP SYSTEM ☐ OTHER: ☐		SUBSEQUENT REPORT OF: REMEDIAL WORK ☐ ALTERING CASING ☐ COMMENCE DRILLING OPNS. ☐ P AND A ☐ CASING/CEMENT JOB ☐ OTHER: ☐	
--	--	--	--

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Please see attached procedure & wellbore schematics

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE _____ TITLE _____ DATE _____

Type or print name _____ E-mail address: _____ PHONE: _____

For State Use Only

APPROVED BY: _____ TITLE _____ DATE _____

Conditions of Approval (if any):

Well Name: Resler Yates State #370

Location: 1650' FNL 990' FEL

SEC 32 18S 28E

Eddy Co., NM

Date: 8/6/2025

Perfs: 2024'-2036'

Surf Csg: 8 5/8" 24# J55

Tbg: 2 3/8"

Surf Set @: 537'


Tbg Set @: 2011

Prod Csg: 5.5" 14# J55

Prod Set @: 2075'

Procedure:

1. MIRU Plugging Crew
2. ND Wellhead and NU BOP
3. POOH rods and tbg
4. MIRU WL
5. RIH w/ 5.5" CIBP & set @ 1974'. (Top perf @ 2024')
6. Run CBL while POOH w/ WL
7. RIH w/ tbg & tag CIBP
8. Circulate 50 bbls 9# MLF
9. Test csg to 500# for 30 minutes
10. Spot 50 sks Class C neat cmt (487') on top of CIBP. (Grayburg at 2012', Queen at 1587')
11. PU tbg to 750'
12. WOC 4 hrs & tag plug @ 1537' or higher
13. LD pipe to 587'
14. Circulate approximately 61 sks Class C neat cmt to surface
15. WOC & confirm that wellbore remains full
16. Cut off WH & install dry hole marker. Cut off anchors & clean location

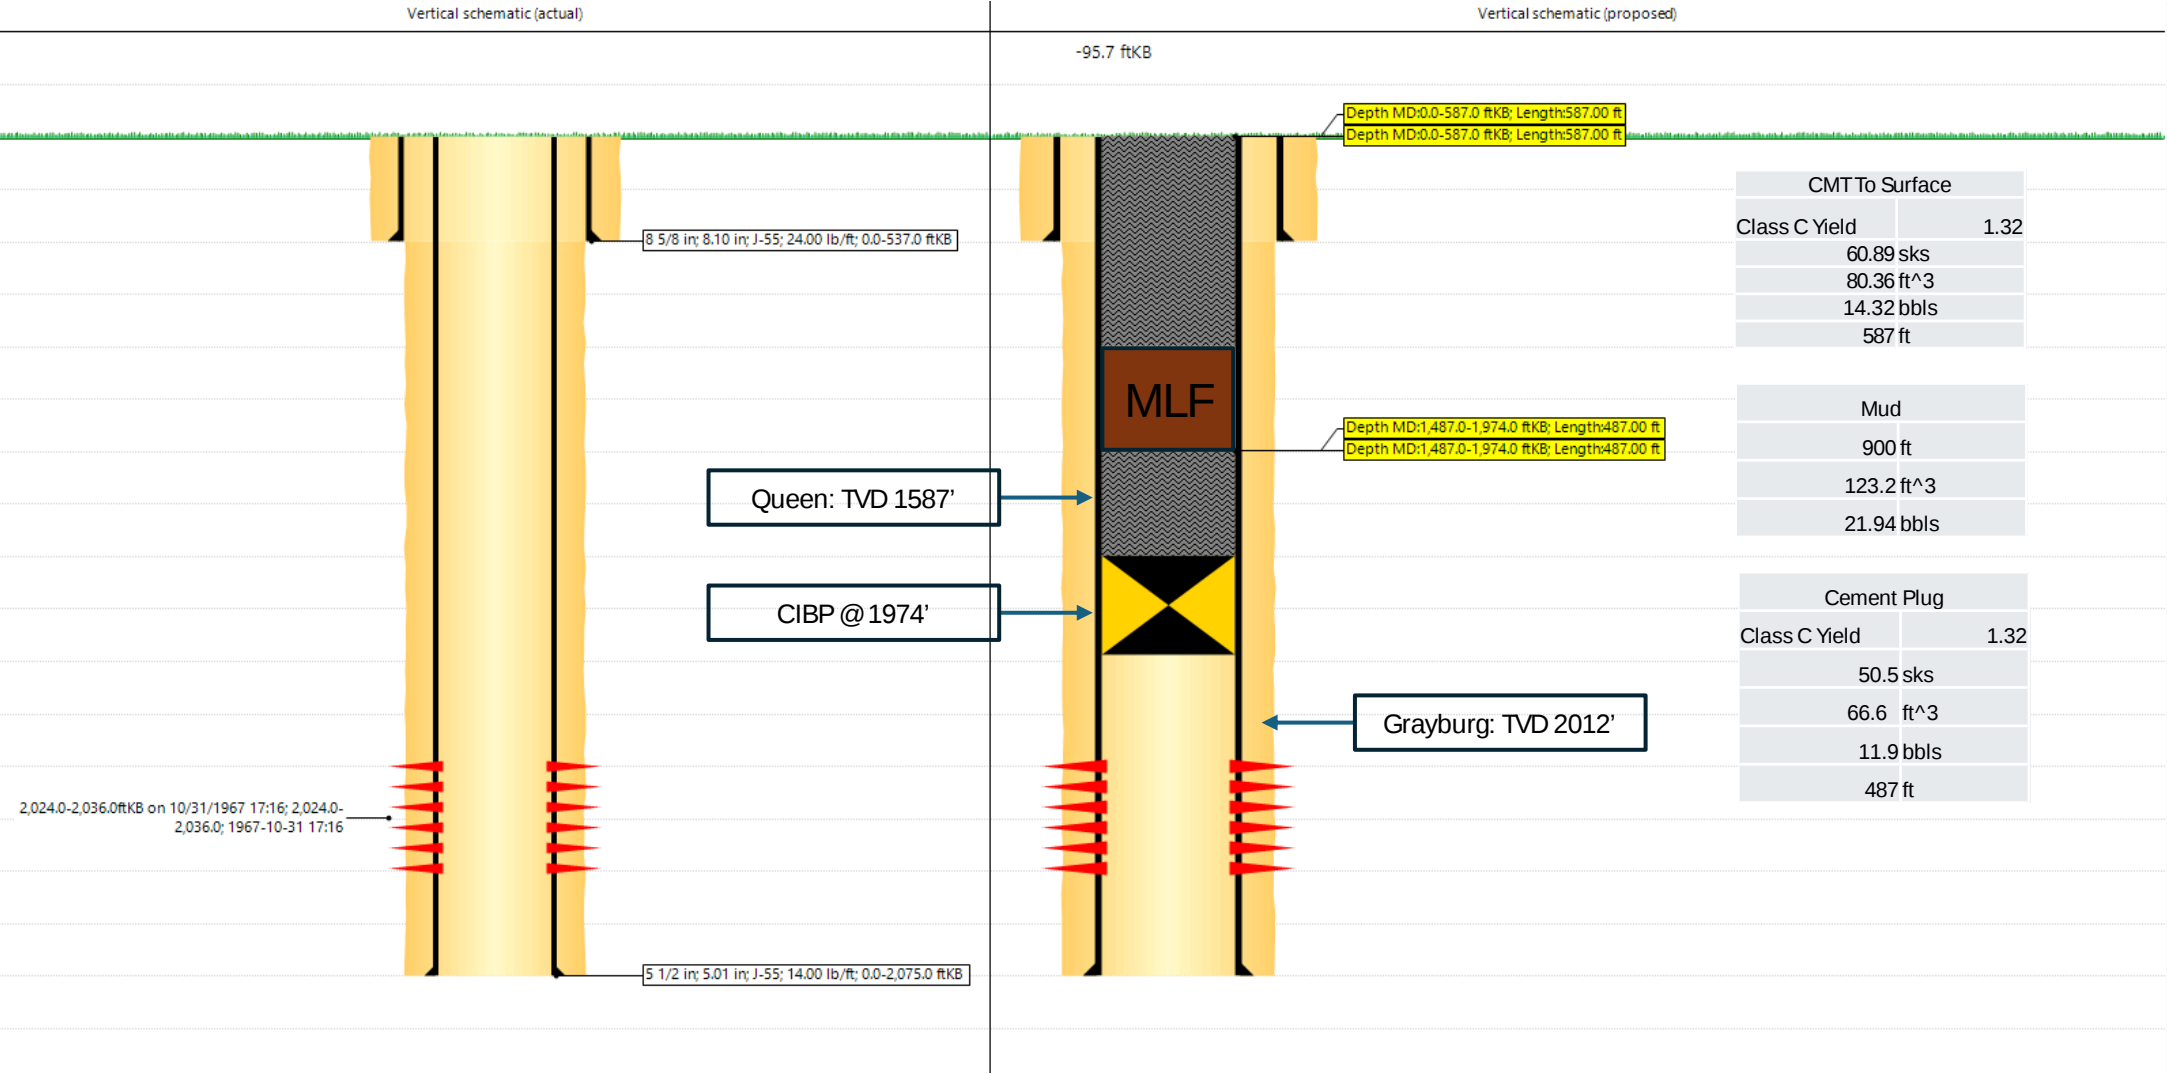

Santa Fe Main Office
Phone: (505) 476-3441
General Information
Phone: (505) 629-6116

Online Phone Directory Visit:

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
Revised July 18, 2013

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-015-21004
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ FEE ☐
2. Name of Operator Sandiott Energy (Jackie Brewer DBA)		6. State Oil & Gas Lease No.
3. Address of Operator P.O. Box 711 Lovington, NM 88260		7. Lease Name or Unit Agreement Name Resler Yates State
4. Well Location Unit Letter <u>11</u> : <u>1050</u> feet from the <u>North</u> line and <u>990</u> feet from the <u>East</u> line Section <u>32</u> Township <u>18N</u> Range <u>28E</u> NMPM <u>1000</u> County		8. Well Number #370
11. Elevation (Show whether DR, RKB, RT, GR, etc.)		9. OGRID Number 154329
10. Pool name or Wildcat (3230) Artesia, Queen-Grayburg-San Andres		

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☐	PLUG AND ABANDON ☒	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	P AND A ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPL ☐	CASING/CEMENT JOB ☐	
DOWNHOLE COMMINGLE ☐			
CLOSED-LOOP SYSTEM ☐			
OTHER: ☐		OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

Please see attached procedure & wellbore schematics

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE

J. Brewer

TITLE

DATE

9/25/2025

Type or print name

E-mail address:

PHONE:

For State Use Only

APPROVED BY:

TITLE

DATE

Conditions of Approval (if any):

Well Name: Resler Yates State #370

Location: 1650' FNL 990' FEL

SEC 32 18S 28E

Eddy Co., NM

Date: 8/6/2025

Perfs: 2024'-2036'

Surf Csg: 8 5/8" 24# J55

Tbg: 2 3/8"

Surf Set @: 537'


Tbg Set @: 2011

Prod Csg: 5.5" 14# J55

Prod Set @: 2075'

Procedure:

1. MIRU Plugging Crew
2. ND Wellhead and NU BOP
3. POOH rods and tbg
4. MIRU WL
5. RIH w/ 5.5" CIBP & set @ 1974'. (Top perf @ 2024')
6. Run CBL while POOH w/ WL
7. RIH w/ tbg & tag CIBP
8. Circulate 50 bbls 9# MLF
9. Test csg to 500# for 30 minutes
10. Spot 50 sks Class C neat cmt (487') on top of CIBP. (Grayburg at 2012', Queen at 1587')
11. PU tbg to 750'
12. WOC 4 hrs & tag plug @ 1537' or higher
13. LD pipe to 587'
14. Circulate approximately 61 sks Class C neat cmt to surface
15. WOC & confirm that wellbore remains full
16. Cut off WH & install dry hole marker. Cut off anchors & clean location

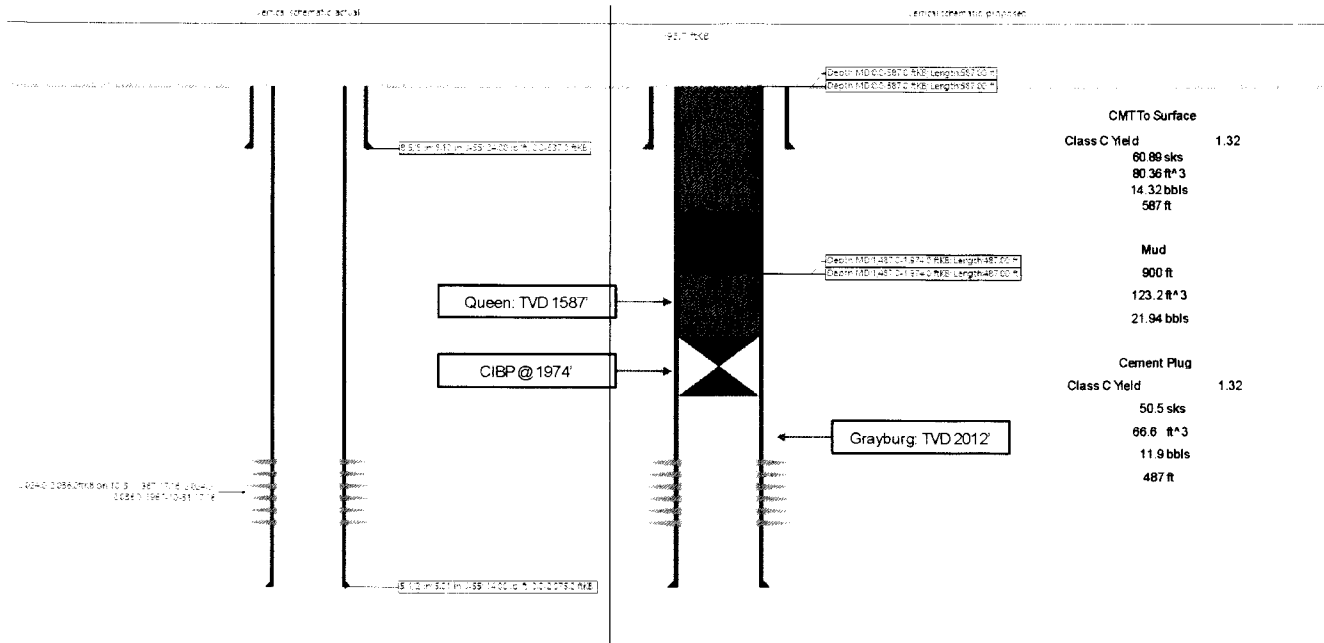

Sante Fe Main Office
Phone: (505) 476-3441

General Information
Phone: (505) 629-6116

Online Phone Directory
<https://www.emnrd.nm.gov/oed/contact-us>

State of New Mexico
Energy, Minerals and Natural Resources
Oil Conservation Division
1220 S. St Francis Dr.
Santa Fe, NM 87505

CONDITIONS

Action 517886

CONDITIONS

Operator: MEWBOURNE OIL CO P.O. Box 5270 Hobbs, NM 88241	OGRID: 14744
	Action Number: 517886
	Action Type: [C-103] NOI Plug & Abandon (C-103F)

CONDITIONS

Created By	Condition	Condition Date
loren.diede	Notify the OCD inspection supervisor via email 24 hours prior to beginning Plug & Abandon (P&A) operations.	10/23/2025
loren.diede	NMOCD does not consider this well to be within the LPCH restricted area and an above ground P&A marker is required. NMOCD requires that plug (s) be added to cover the 7 Rivers = (970') and Yates = (620') formation tops. Submit photo and GPS coordinates of the P&A marker with the final P&A reports. The API# on the marker is to be clearly legible. Run CBL from CIBP to surface. Submit the CBL tif file to NMOCD for uploading into the Well Log File.	10/23/2025