

Submit 3 Copies To Appropriate District
Office
District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
June 19, 2008

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS)		WELL API NO. 30-015-38475
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input checked="" type="checkbox"/> FEE <input type="checkbox"/>
2. Name of Operator Devon Energy Production Co., LP		6. State Oil & Gas Lease No.
3. Address of Operator 20 North Broadway, OKC OK 73102-8260		7. Lease Name or Unit Agreement Name Diamond PWU 22
4. Well Location Unit Letter <u>E</u> : <u>1800</u> feet from the <u>North</u> line and <u>250</u> feet from the <u>West</u> line Section <u>22</u> Township <u>19S</u> Range <u>29E</u> NMPM Eddy County, NM		8. Well Number 2H
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3329' GL		9. OGRID Number 6137
		10. Pool name or Wildcat Turkey Track; Bone Spring

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:


PERFORM REMEDIAL WORK ☐ PLUG AND ABANDON ☐
TEMPORARILY ABANDON ☐ CHANGE PLANS ☐
PULL OR ALTER CASING ☐ MULTIPLE COMPL ☐
DOWNHOLE COMMINGLE ☐

OTHER: ☐

SUBSEQUENT REPORT OF:

REMEDIAL WORK ☐ ALTERING CASING ☐
COMMENCE DRILLING OPNS. ☐ PANDA ☐
CASING/CEMENT JOB ☐

OTHER: DRILLING OPERATIONS ☒

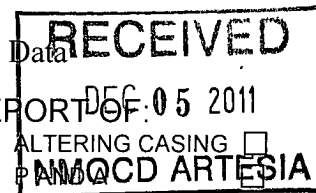

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

10/05/11 MIRU. TD 26" hole, set 20" 106.5# J-55 conductor @ 91'.
10/13/11: TD 17 1/2" hole @ 210'. Ran in 4 jts 13 3/8" 48# H-40 ST&C csg @ 210'. Notified Randy Dade of rqstd permission to set csg @ 197'.
Cmt w/260 sx Cl C. Drop plug, displace cmt, bmp plug, bleed off No cmt returns. Top job lead w/50 sx class C, tail w/125' sx Cl C. Circ 10
sx to surf. WOC 24 hrs.
10/14/11: Tst csg to 1200 psi, hold for 15 min - ok. Perform formation integrity test @ 210' to 14.5 ppg. EWM w/10ppg, brine wtr (50 psi) no leak off.
10/19/11: TD 12 1/4" hole @ 3,526'. Ran 78 jts 9 5/8" 40# J-55 LT&C csg set @ 3,526'. Cmt w/1185 sx Cl C cmt, tail w/300 sx Cl C. Maintain circ
thru out job, circ 192 bbls to surf. WOC. 24 hrs.
10/20/11: Tst casing to 1500 psi for 15 min - ok. CO cmt, D/O plug & float collar. Perform formation FIT tst to 9 ppg. EMW @ 110 psi, no leak off
- good test.
10/27/11: TD pilot hole @ 8,160'. Circ hole clean, run logs.
10/29/11: Set whipstock @ 7,309' - 7,322'. Cmt whipstock 7,024' - 8,160' w/380 sx Cl H cmt. KO of curve.
11/12/11: TD 8 3/4" hole @ 12,482'. Ran 166 jts 5 1/2" 17# P-110 LT&C csg & 116 jts 5 1/2" 17# P-110 BT&C csg @ 12,482'. Cmt 1st
stage w/504 sx Cl H, tail w/1,305 sx Cl H. Drop plug, displace w/fresh wtr, bmp plug, inflate pkr, bleed off pressure, floats held. ECP @
4489-4505' Drop bomb, pressure up, open DV ports. Circ across DV tool w/full returns. DV tool @ 4,486' - 4,493'. Cmt 2nd stage lead
w/215 sx Cl C cmt, tail w/150 Cl C cmt. WOC 24 hrs.
11/13/11: Rig rlsd.

Spud Date:

Rig Release Date:

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE Sr. Staff Engineering Technician DATE 12/01/2011

Type or print name Stephanie A. Ysasaga E-mail address: Stephanie.Ysasaga@dmn.com PHONE: (405)-552-7802

For State Use Only

APPROVED BY: [Signature] TITLE Geologist DATE DEC 05 2011

Conditions of Approval (if any):

204