

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT
SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APL) for such proposals.

SUBMIT IN TRIPLICATE

RECEIVED

OCD Artesia

JUL 18 2012

NMOCD ARTESIA

FORM APPROVED
OMB NO 1004-0135
EXPIRES: March 31, 2007

1a Type of Well	☒ Oil Well	☐ Gas Well	☐ Other
2 Name of Operator	DEVON ENERGY PRODUCTION COMPANY, LP		
3 Address and Telephone No.	20 N. Broadway, Oklahoma City, Ok 73102-8260 405-235-3611		
4 Location of Well (Report location clearly and in accordance with Federal requirements)*	225 FSL 1868 FEL O SEC 8 T25S R29E BHL: 417' FSL 330' FWL PP: 418' FSL 1620' FWL		

5. Lease Serial No	NMNM-99147
6. If Indian, Allottee or Tribe Name	
7. Unit or CA Agreement Name and No.	
8 Well Name and No	Slider 8 Federal 4H
9 API Well No.	30-015-38243
10. Field and Pool, or Exploratory	Willowlake; Bone Spring, Southeast
11. County or Parish State	Eddy NM

12. CHECK APPROPRIATE BOX(es) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
☐ Notice of Intent	☐ Acidize	☐ Deepen	☐ Production (Start/Resume)	☐ Water Shut-Off
☒ Subsequent Report	☐ Alter Casing	☐ Fracture Treat	☐ Reclamation	☐ Well Integrity
☐ Final Abandonment Notice	☐ Casing Repair	☐ New Construction	☐ Recombine	☒ Other Completion Report
	☐ Change Plans	☐ Plug and Abandon	☐ Temporarily Abandon	
	☐ Convert to Injection	☒ Plug Back	☐ Water Disposal	

13 Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work and approximate duration thereof. If the proposal deepens directionally or recompletes horizontally, give subsurface location and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirement, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection)

3/8/11 - 3/16/12 - MIRU PU. ND WH. NU BOP. DO DV @ 5499'. Test 3000 psi, good. CHC. Csg leak 2500-1500 psi, 2 mins, 40 sec. Close valves, isolate pump; still leak. OWU & RIH w/ tbg to PBTD @ 10,539'. CHC. Set pkr @ 5599' test 3000 psi, leaked 1000 psi in 1 min, 50 sec. Rlsd & reset pkr @ 7495'. Leak from 5599' - 9377'. Pkr & tbg to 8491' test 1500 psi, good. Reset pkr @ 8428' test 1500 psi, good. Pump through leak .4 bpm @ 3150 psi; total 15 bbls into leak. SD & leak 1000 psi in 55 secs; 2000 psi in 2 min, 20 sec. to 850 psi in 14 mins. Rlse pkr. RDMO. RU WL & RIH w/ CBL to PBTD 10,540'. Pull to TOC. OWU & RIH w/ TCP Guns. Perf: 9434-36; 9732-34'; 9881-83'; 10030-32'; 10179-81'; 10293-95'; 10407-09'; 10520-22'. RU BJ & frac well w/ 286,600# 20/40 white sd; 153,500# 40/70 white sd; 15,000# 100 mesh white sd (See attached detailed summary). Sundry submitted to BLM to do remedial cement work and was approved and a CBL was run as well as a PT to determine integrity (subsequent logs and chart attached). TOP.

Accepted for record

NMOCD

LR Date 8/3/12

14 I hereby certify that the foregoing is true and correct


Signed Judy A. Barnett Name Judy A. Barnett X8699
Title Regulatory Specialist Date 7/2/2012


(This space for Federal or State Office use)

Approved by _____ Title _____ Date _____
Conditions of approval, if any: _____

I, the undersigned, declare that I am a duly authorized representative of the Bureau of Land Management, Department of the Interior, and I am authorized to make any statement or representation to any matter within its jurisdiction.

*See Instruction on Reverse Side

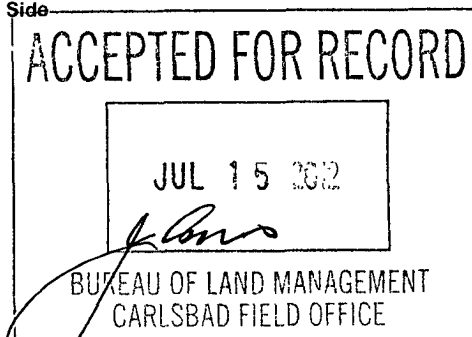

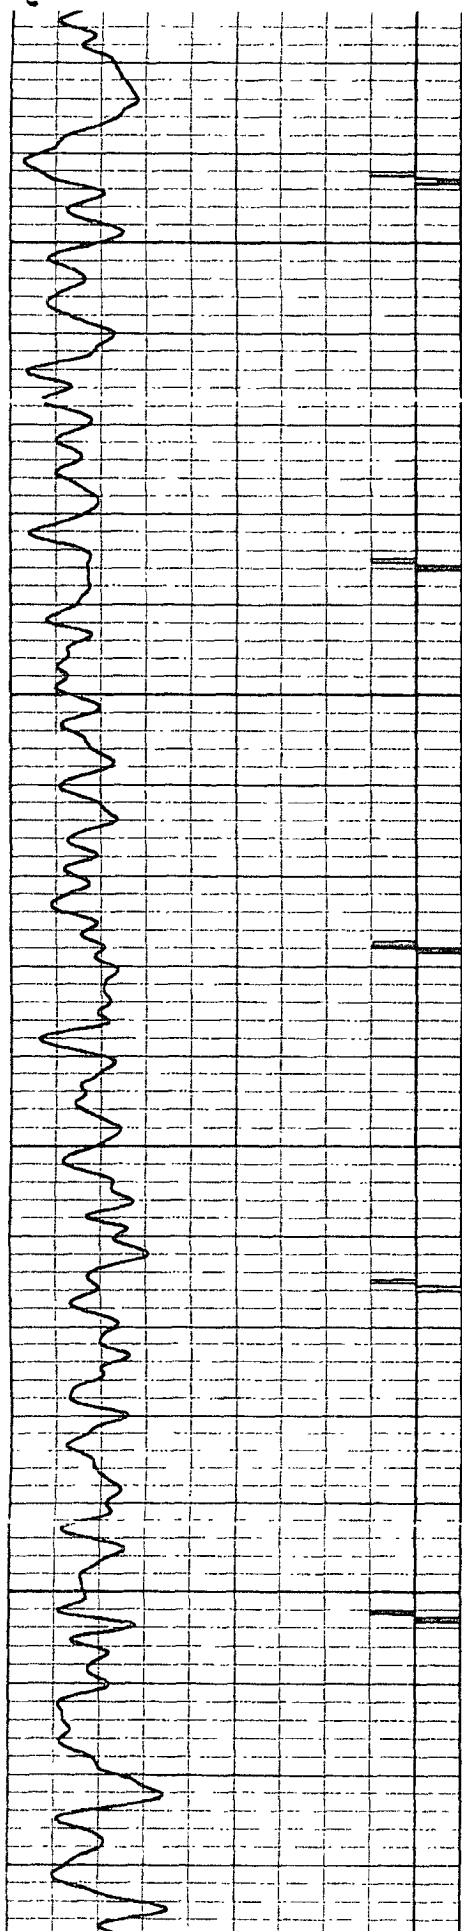

1750

1800

1850

1900

