
ATIC	Form 3160-5 (February 2005) UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT SUNDRY NOTICES AND BEPORTS ON WELLS SUNDRY NOTICES AND BEPORTS ON WELLS	
Form 3160-5 UNITED STATES		
(February 2005) DEPARTMENT OF THE INTERIOR	FORM APPROVED OM B No. 1004-0137 Expires: March 31, 2007	
BUREAU OF LAND MANAGEMENT DEC	5. Lease Serial No. NM 38342	
SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter CENED abandoned well. Use Form 3160-3 (APD) for such proposals.	6. If Indian, Allottee or Tribe Name	
SUBMIT IN TRIPLICATE- Other instructions on reverse side.	7. If Unit or CA/Agreement, Name and/or No.	
1. Type of Well Oil Well C Gas Well C Other	8. Well Name and No.	
2. Name of Operator Pecos River Operating, Inc.	9. API Well No.	
3a. Address 3b. Phone No. (include area code)	30-005-62072	
PO Box 1433, Rosewell, NM 88202-1433 575-622-1001 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 575-622-1001	10. Field and Pool, or Exploratory Area 'Pecos Slope Sbo	
660 FSL,198 FWL, Section, 9 T7s, R26E	11. County or Parish, State	
	Chaves, NM	
12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA		
TYPE OF SUBMISSION TYPE OF ACTION		
Acidize Deepen Production (Star Alter Casing Reclamation		
	Well Integrity	
Change Plans Plug and Abandon Temporarily Aba		
Final Abandonment Notice Convert to Injection Plug Back Water Disposal		
following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.) Set CIBP @4080' and dump, or cmt on top to cober perforated interval. The hole will then be loaded with 9# Fluid persuant to BLM Regulations. WOC TAG Perf & SQZ @750' & attempt to get Circ. If not Circ, Perf SQZ holes @700' & attempt to get Circ around 5-1/2'' after determining Circ or not, Perf SQZ holes @60'. Depending on outcome of previous step; IF NO CIRC @700'-750' fillcasing from 815' to surface inside & out of annulus IF CIRC WAS OBTAINED AT 700'-750' pump a 50sx plug @815'; WOC & tag, if tag is below 715' repump and re-tag plug.		
After plugging is complete, a dry hole marker will be installed.		
Accepted for record · NMOCD SEE ATTACHED FOR		
CONDITIONS OF APPROVALET: INS 8102 9 230		
14. Thereby certify that the foregoing is true and correct		
Name (Printed/Typed) Lesije Olivaresz		
Signature es a Date	1/2/1/18	
THIS SPACE FOR FEDERAL OR STATE OFFICE USE		
Approved by		
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department of agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within the three states any false, fictitious or fraudulent statements or representations as to any matter within the three states any false.		
(Instructions on page 2)		
V /		

Pecos River Operating, Inc.

WELL BORE DIAGRAM

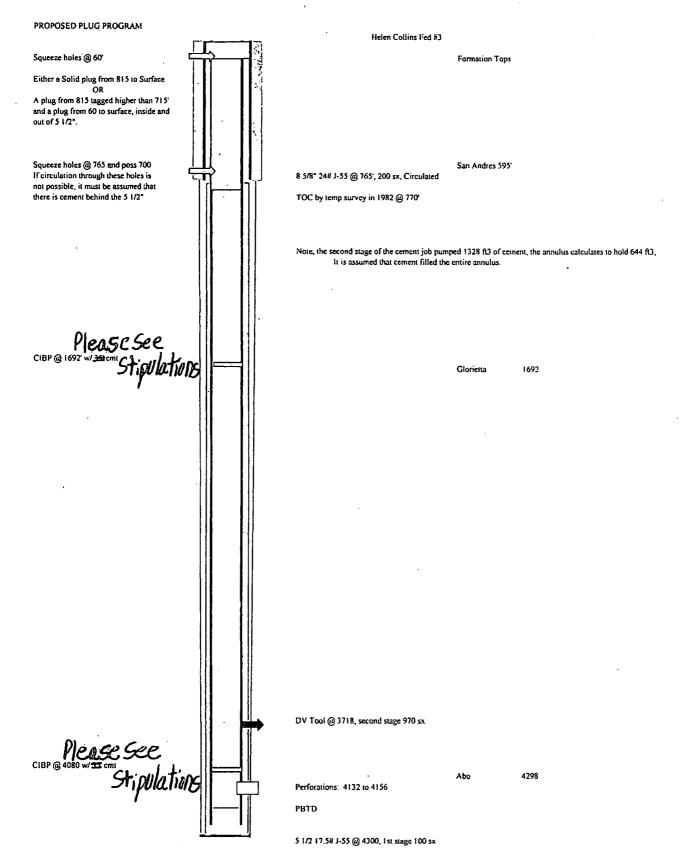

Helen Collins Federal 3 30-005-62072 Pecos River Operating, Inc. December 10, 2018 Conditions of Approval

Work to be completed by March 10, 2018.

- 1. Operator shall place CIBP at 4,080' (50-100' above top most perf) and place Class C cement on top as proposed. WOC and tag NO LESS than 3660' to seal the top of the <u>Abo</u> and the <u>DV tool</u>.
- 2. Operator shall place a balanced Class C cement plug from 1,762'-1,592' to seal the Glorieta formation. WOC and tag.
- 3. Perf and squeeze as proposed.
- 4. Operator shall set a balanced Class C cement plug from 815'-surface to seal the 8-5/8''shoe and salt formation. WOC and tag.
- 5. See Attached for general plugging stipulations.

JAM 121018

BUREAU OF LAND MANAGEMENT Roswell Field Office 2909 W. Second Street Roswell, New Mexico 88201 575-627-0272

General Requirements for Plug Backs

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within **<u>ninety (90)</u>** days from this approval.

If you are unable to plug back the well by the 90th day provide this office, prior to the 90th day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged back. Failure to do so will result in enforcement action.

2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plug back operations. Call 575-627-0205.

3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.

4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.

5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. Before pumping cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. <u>Subsequent Plug back Reporting</u>: Within 30 days after plug back work is completed, file one original and three copies of the Subsequent Report, Form 3160-5 to BLM. The report should give in detail the manner in which the plug back work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. <u>Show date work was completed</u>.

7. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.