
## **UNITED STATES** DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT


OCTEATER

FORM APPROVED OMB NO. 1004-0137 Expires: January 31, 2018

## 5. Lease Serial No. NMNM0544986

SUNDRY NOTICES AND REPORTS ON WELLS  Do not use this form for proposals to drill or to re-enter #10 2.5 2019  abandoned well. Use form 3160-3 (APD) for such proposals.					NMNM0544986  6. If Indian, Allottee or Tribe Name		
SUBMIT IN	TRIPLICATE - Other in:	structions on	ASSPACTII-AFI	TESIAO.C.	7. If Unit or CA/Agree	ement, Name and/or No.	
Type of Well     ☐ Gas Well ☐ Other					8. Well Name and No. TODD 25E FED 5		
2. Name of Operator Contact: ARMON RADFAR DEVON ENERGY PRODUCTION COME-Mail: Armon.Radfar@dvn.com					9. API Well No. 30-015-27383-00-S1		
3a. Address 333 WEST SHERIDAN AVEN OKLAHOMA, OK 73102	. (include area code) 2-5014	) .	10. Field and Pool or Exploratory Area INGLE WELLS				
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)  Sec 25 T23S R31E SWNW 1920FNL 660FWL					11. County or Parish, State EDDY COUNTY, NM		
12. CHECK THE A	PPROPRIATE BOX(ES	) TO INDICA	TE NATURE Ó	F NOTICE	, REPORT, OR OTH	IER DATA	
TYPE OF SUBMISSION			TYPE O	F ACTION			
<ul><li>☑ Notice of Intent</li><li>☑ Subsequent Report</li><li>☑ Final Abandonment Notice</li></ul>	☐ Alter Casing ☐ Hydraulic Fracturing ☐ Reclamation ☐ Casing Repair ☐ New Construction ☐ Recomplete				plete rarily Abandon	☐ Water Shut-Off ☐ Well Integrity ☐ Other	
Attach the Bond under which the wor following completion of the involved testing has been completed. Final Abdetermined that the site is ready for fill 1. MIRU P&A unit.  2. Pull rod pump and 2-7/8" & 3. Set CIBP @ 6700'. Tag. Cir 4. Spot 25 sx CI C from 5550'-5. Spot 175 sx CI C from 4475' 4245'; R-111P)  6. Perf at 2700'. Squeeze 410  7. Perf at 920'. Squeeze 25 sx 8. Perf @ 140'. Pump 35 sx C  9. Cut wellhead off 3' BGL. Se (Well inside R-111P boundary	operations. If the operation is andonment Notices must be a nal inspection.  3 3/8" production tubing c 10# salt gel. Spot 25 s 5300'. WOC & tag. (DV '-2700'. WOC & tag. (To sx CI C from 2700'-109 CI C from 920'-820'. WI C in/out to surface. t dry hole marker.  Salt section noted @ 1	results in a multip filed only after all R-111-1 I assembly from 6x CI C from 6; tool @ 5492') op Delaware @ 5'. WOC & tag OC & tag. (Sho	e completion or recoverequirements, include SOL III  n ~8,292'. "00'-6450'. (Perfs. 4475'; Shoe @ (T. Salt @ 1145)	s at @ 6758 4340'; B. S 5'; R-111P)	SEE ATTAC	0-4 must be filed once nd the operator has SecTion	
Commi Name (Printed/Typed) ARMON F	Electronic Submission For DEVON ENER tted to AFMSS for proces	GY PRODUCTION	ON ĆOM LP, sent RAH MCKINNEY (	t to the Carls on 05/28/201	bad		
Name (TrinearTypea) ARMON R			Title ENGINI	EER			
Signature (Electronic S	ubmission)		Date 05/23/2	019	·		
	THIS SPACE F	OR FEDERA	L OR STATE	OFFICE U	SE		
Approved By	a Clane		Title A	61		6-8-19 Date	
Conditions of approval, if any, are attached ertify that the applicant holds legal or equivalent would entitle the applicant to conductive the applicant to conductive the applicant to conductive the second second to the second	itable title to those rights in the ct operations thereon.	he subject lease	Office A	<u>// // // // // // // // // // // // // </u>			
itle 18/U.S.C. Section 1001 and Title 43 States any false, fictitious or fraudulent s	U.S.C. Section 1212, make it tatements or representations a	a crune for any pe	rson knowingly and thin its jurisdiction	willfully to in	ake to any department or	agency of the United	

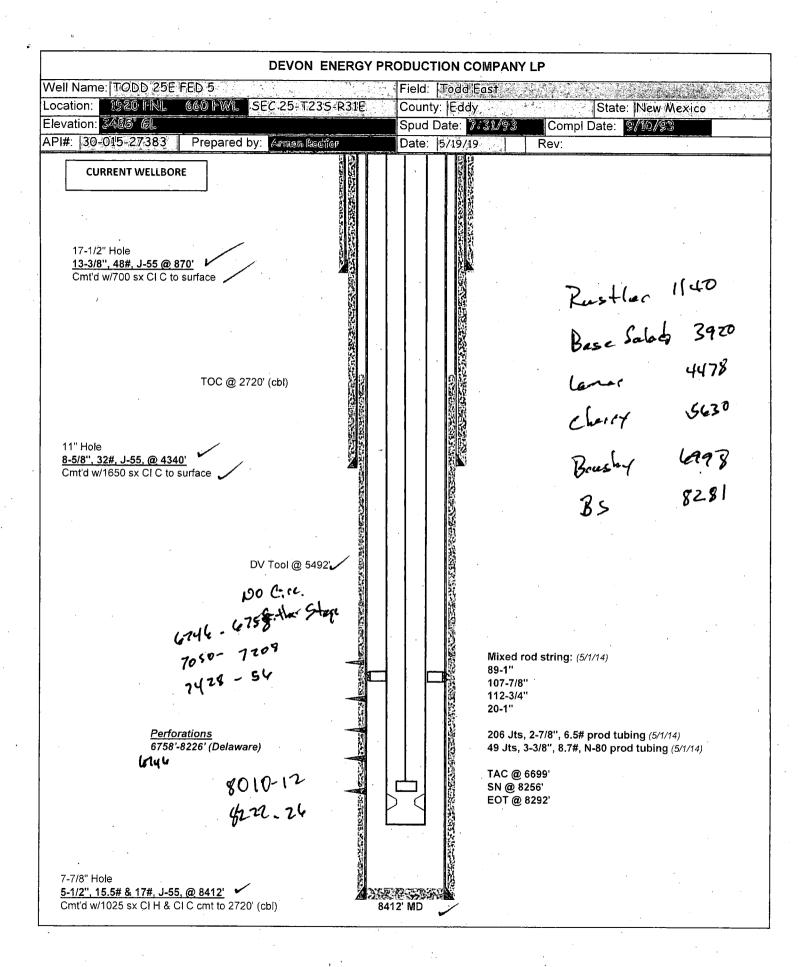

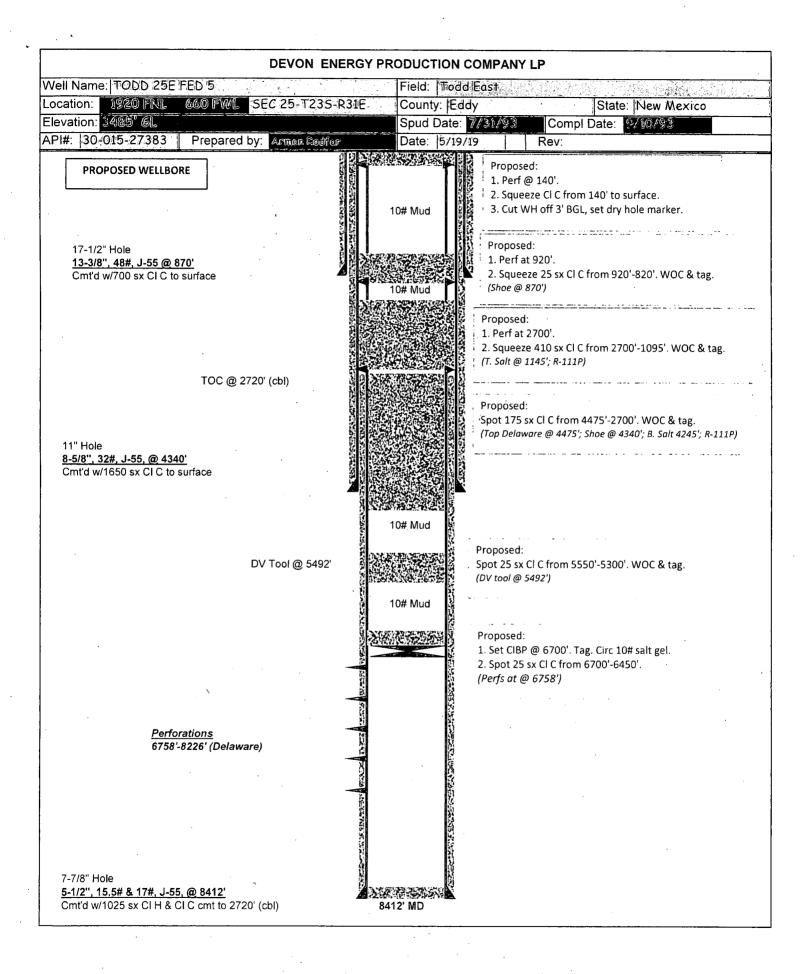

## BUREAU OF LAND MANAGEMENT Carlsbad Field Office 620 East Greene Street Carlsbad, New Mexico 88220 575-234-5972

## Permanent Abandonment of Federal Wells Conditions of Approval (LPC Habitat)

Failure to comply with the following Conditions of Approval may result in a Notice of Incidents of Noncompliance (INC) in accordance with 43 CFR 3163.1.

1. Plugging operations shall commence within <u>ninety (90)</u> days from the approval date of this Notice of Intent to Abandon.

If you are unable to plug the well by the 90<sup>th</sup> day provide this office, prior to the 90<sup>th</sup> day, with the reason for not meeting the deadline and a date when we can expect the well to be plugged. Failure to do so will result in enforcement action.

The rig used for the plugging procedure cannot be released and moved off without the prior approval of the authorized officer. Failure to do so may result in enforcement action.

- 2. <u>Notification:</u> Contact the appropriate BLM office at least 24 hours prior to the commencing of any plugging operations. For wells in Chaves and Roosevelt County, call 575-627-0272; Eddy County, call 575-361-2822; Lea County, call 575-393-3612.
- 3. <u>Blowout Preventers</u>: A blowout preventer (BOP), as appropriate, shall be installed before commencing any plugging operation. The BOP must be installed and maintained as per API and manufacturer recommendations. The minimum BOP requirement is a 2M system for a well not deeper than 9,090 feet; a 3M system for a well not deeper than 13,636 feet; and a 5M system for a well not deeper than 22,727 feet.
- 4. <u>Mud Requirement:</u> Mud shall be placed between all plugs. Minimum consistency of plugging mud shall be obtained by mixing at the rate of 25 sacks (50 pounds each) of gel per 100 barrels of **brine** water. Minimum nine (9) pounds per gallon.
- 5. <u>Cement Requirement</u>: Sufficient cement shall be used to bring any required plug to the specified depth and length. Any given cement volumes on the proposed plugging procedure are merely estimates and are not final. Unless specific approval is received, no plug except the surface plug shall be less than 25 sacks of cement. Any plug that requires a tag will have a minimum WOC time of 4 hours.

In lieu of a cement plug across perforations in a cased hole (not for any other plugs), a bridge plug set within 50 feet to 100 feet above the perforations shall be capped with 25 sacks of cement. If a bailer is used to cap this plug, 35 feet of cement shall be sufficient. Before pumping or bailing cement on top of CIBP, tag will be required to verify depth. Based on depth, a tag of the cement may be deemed necessary.

Unless otherwise specified in the approved procedure, the cement plug shall consist of either Neat Class "C", for up to 7,500 feet of depth or Neat Class "H", for deeper than 7,500 feet plugs.

6. Below Ground Level Cap (Lesser Prairie-Chicken Habitat): All casing shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The BLM is to be notified a minimum of 4 hours prior to the wellhead being cut off to verify that cement is to surface in the casing and all annuluses. Wellhead cut off shall commence within ten (10) calendar days of the well being plugged. If the cut off cannot be done by the 10<sup>th</sup> day, the BLM is to be contacted with justification to receive an extension for completing the cut off. Upon the plugging and subsequent abandonment of wells that are located in lesser prairie-chicken habitat, the casings shall be cut-off at the base of the cellar or 3 feet below final restored ground level (whichever is deeper). The well bore shall then be covered with a metal plate at least ¼ inch thick and welded in place. A weep hole shall be left in the plate and/or casing.

NMOCD also requires the operator to notify NMOCD when this type of dry hole marker is used. This can be done on the subsequent report of abandonment which is submitted to the BLM after the well is plugged. State that a below ground cap was installed as required in the COA's from the BLM.

- 7. <u>Subsequent Plugging Reporting:</u> Within 30 days after plugging work is completed, file one original and three copies of the Subsequent Report of Abandonment, Form 3160-5 to BLM. The report should give in detail the manner in which the plugging work was carried out, the extent (by depths) of cement plugs placed, and the size and location (by depths) of casing left in the well. **Show date well was plugged.**
- 8. <u>Trash</u>: All trash, junk and other waste material shall be contained in trash cages or bins to prevent scattering and will be removed and deposited in an approved sanitary landfill. Burial on site is not permitted.

Following the submission and approval of the Subsequent Report of Abandonment, surface restoration will be required. See attached reclamation objectives.

<u>Timing Limitation Stipulation/ Condition of Approval for Lesser Prairie-Chicken:</u>
From March 1<sup>st</sup> through June 15<sup>th</sup> annually, abandonment activities will be allowed except between the hours from 3:00 am and 9:00 am. Normal vehicle use on existing roads will not be restricted