

Submit 3 Copies To Appropriate District Office
District I
 1625 N. French Dr., Hobbs, NM 88240
District II
 1301 W. Grand Ave., Artesia, NM 88210
District III
 1000 Rio Brazos Rd., Aztec, NM 87410
District IV
 1220 S. St. Francis Dr., Santa Fe, NM 87505

State of New Mexico
 Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
 1220 South St. Francis Dr.
 Santa Fe, NM 87505

Form C-103
 Revised June 10, 2003

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30.015.22804
1. Type of Well: Oil Well ☒ Gas Well ☐ Other ☐		5. Indicate Type of Lease STATE ☒ ☐ ☐ ☐
2. Name of Operator BP America Production Company		6. State Oil & Gas Lease No.
3. Address of Operator P.O. Box 1089, Eunice, NM 88231		7. Lease Name or Unit Agreement Name Empire Abo Unit "E"
4. Well Location Unit Letter <u>A</u> : <u>650</u> feet from the <u>N</u> line and <u>120</u> feet from the <u>E</u> line Section <u>34</u> Township <u>17S</u> Range <u>28E</u> NMPM Eddy County		8. Well Number 363
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 3673.5' GR		9. OGRD Number 000778
		10. Pool name or Unit Empire Abo

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data			
NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK ☒	PLUG AND ABANDON ☐	REMEDIAL WORK ☐	ALTERING CASING ☐
TEMPORARILY ABANDON ☐	CHANGE PLANS ☐	COMMENCE DRILLING OPNS. ☐	PLUG AND ABANDONMENT ☐
PULL OR ALTER CASING ☐	MULTIPLE COMPLETION ☐	CASING TEST AND CEMENT JOB ☐	
OTHER: ☐		OTHER: ☐	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 1103. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

TD: 6350' PBD: 6293' PERFS: 6030-6039'

MIRUPU. NDWH. NUBOP.

Rls plr @ 5973'. POH w/tbg & plr.

RIH w/bit & scraper to 6030'. POH. RUWL. RIH w/CIBP. Set @ 6025'. POH.

RU bailer. RIH & dump 10' cmt on top of CIBP. POH.

RIH & perf w/2 JSPF 5886-9', 5915-20', 5941-32', 5980-98'. POH.

RIH w/treating plr & 2-3/8" tbg. Spot 128 gals 15% HCL NEFE 5/5998-5870'.

PU & set treating plr @ 5860'. Acidize perfs f/5998-5886' w/2050 gals 15% HCL NEFE acid dropping 2 ball sealers every 50 gals.

Displace w/23 bbls 2% KCL wr.

Rls plr. RIH & wipe off balls. POH.

RIH w/prod. assy & 2-3/8" tbg. Land SN @ 5975'.

NDBOP. NUWH. Swab for test. RDP. RTP.

I hereby certify that the information above is true and complete to the best of my knowledge and belief.


SIGNATURE Kellie D. Murrih TITLE Sr. Admin. Asst. DATE 08.26.03

Type or print name Kellie D. Murrih E-mail address: murrikd@bp.com Telephone No. 505.394.1649
 (This space for State use)

APPROVED BY [Signature] TITLE Field Rep ID DATE 8-27-03
 Conditions of approval, if any:

Empire Abo Unit 'E' 363

Potential
Perforation
Zones

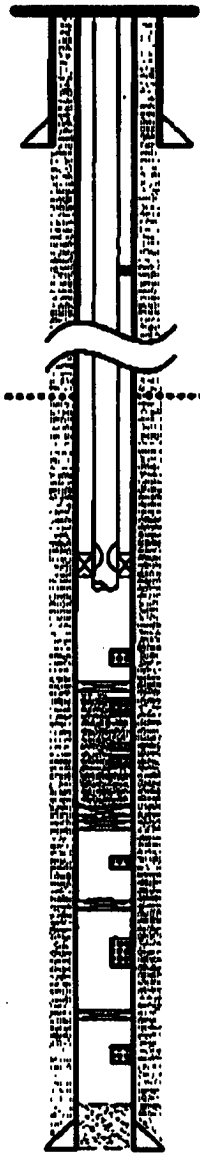

- KB at 3884' above sea level (Used as the Datum)
- Well is currently shut in
- Top of Cement at surface
- 8-5/8" - 24# casing set at 800' (11' hole)
- 4 Squeeze holes at 1544', Squeezed off
- Top of Abo at 5882'
- FR set at 5973', SN set at 5968'
- Tubing: 186jts (5957'), 2 3/8", 4.7#, EUE 8rd, J-55
- Perforations 6030' - 6039' w/ 2 JSFF
- CR set at 6050'
- Perforations 6058' - 6068' Squeezed off
- Perforations 6083' - 6088' Squeezed off
- Perforations 6090' - 6096' Squeezed off
- OBP pushed to top of CR at 6130'
- CR set at 6130', Not Squeezed
- Perforations 6150' - 6156' Closed off w/ CR
- OBP set at 6178'
- Perforations 6198' - 6214' Closed off w/ OBP
- OBP set at 6240'
- Perforations 6260' - 6270' Closed off w/ OBP
- PBTD at 6293'
- 5-1/2" - 15.5# casing set at 6350' (7 7/8" hole)

