Form 3160-5 (August 2007)

UNITED STATES DEPARTMENT OF THE INTERIOR

BUREAU OF LAND MANAGEMENT

3a. Addres 801 CHERRY STREET, SUITE 1500 | 3b. Phone No. (include area code)

UNIT #9 FORT WORTH, TX. 76102-6881

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

FORM APPROVED

	OWR N	o. IC	04-	013
	Expires:	July	31,	201
•			_	_

10. Field and Pool, or Exploratory Area

11. County or Parish, State, M. Eddy County, N.M.

LOCO HILLS GLORIETA YESO

Ĺ	Expires: July 31,
5.	Lease Serial No.

SUNDRY NOTICES AND REPORTS ON WELLS Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.	NMNM 2748 6. If Indian, Allotte (2) Lab (Nare
SUBMIT IN TRIPLICATE – Other instructions on page 2	7. If Unit or CA/Agreemen Filame
1. Type of Well Gas Well Other	8. Well Name and NAVIOCD
2. Name of Operator BURNETT OIL CO., INC. 3a. Addres@01 CHERRY STREET SHITE 1500. [3b. Phone No. (include area code)]	9. API Well No. 30-015-36783 S1


OCD-ARTESIA

UNIT L. 1650' FSL. 9	Eddy County, N.M.			
12. CHECK A	PPROPRIATE BOX(E	S) TO INDICATE NA	ATURE OF NOTICE, REPO	ORT, OR OTHER DATA
TYPE OF SUBMISSION	TYPE OF ACTION			
	Acidize	Deepen	Production (Start/Resume)	Water Shut-Off
Notice of Intent	Alter Casing	Fracture Treat	Reclamantion	Well Integrity
Subsequent Report	Casing Repair	New Construction	Recomplete	Other
First Ahandanmant Matica	Change Plans	Plug and Abandon	Temporarily Abandon	
Final Abandonment Notice	Convert to Injection	Plug Back	Water Disposal	

(817) 332-5108

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamantion, have been completed, and the operator has determined that the site is ready for final inspection.)

12/02/2009 MIRU Comp rig, NU BOP, POOH w/tbg & Sub pump. 12/03/09 GIH w/bit, drill collars and tubing to 4613'. 12/6/2009 RIH, tag fill @ 4773', clean out to 4950'(CIBP) and drill out CIBP, circulate hole clean, RIH & tag at 5625'. POOH with all. 12/7/2009 GIH w/139 jts(4489') 2-7/8" 6.50# J55 R2 EUE tubing & sub pump. Return well to pumping to Gissler B 3-3 lease Tank Battery from perforations 4551' to 4813' and 5026' to 5296'. 12/08/2009 Production testing (24 hours) from all perforations 213 BO, 962 BW, 397 MCFG.

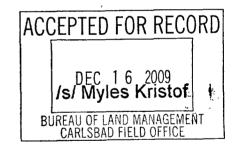

•							
14. I hereby certify that the foregoing is true and correct.)							
Name (Printed/Typed)							
MARK A. JACOBY Title	ENGINEERING MANAGER						
Signature Mark a. Suroley Date	12/09/20	09					
THE SPACE FOR FEDERAL OR STATE OFFICE USE							
Approved by	Title	Date					
Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.	Office						
Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.							
(Instructions on page 2)		-W					