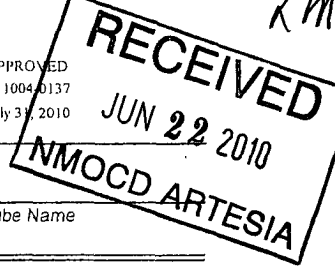


UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OPERATOR'S COPY

FORM APPROVED
OMB No. 1004-0137
Expires July 31, 2010

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5 Lease Serial No
NM-0436256 If Indian, Allottee or Tribe Name
NA

SUBMIT IN TRIPLICATE - Other instructions on page 2.

7 If Unit or CAI Agreement, Name and/or No

NMNM84622

8 Well Name and No

Saguaro AGS Federal Com #6

9 API Well No

30-015-26494

10 Field and Pool or Exploratory Area

North Dagger Draw Upper Penn

11 County or Parish, State

Eddy County, New Mexico

1 Type of Well

☐

Oil Well

☐

Gas Well

☒

Other P&A

2 Name of Operator

Yates Petroleum Corporation

3a Address

105 S. 4th Str., Artesia, NM 88210

3b Phone No (include area code)

575-748-1471

4 Location of Well (Footage, Sec, T, R, M, OR Survey Description)

1980'FNL & 1980'FEL of Section 11-T20S-R24E (Unit G, SWNE)

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

TYPE OF ACTION

☐

Notice of Intent

☒

Subsequent Report

☐

Final Abandonment Notice

☐

Acidize

☐

Alter Casing

☐

Casing Repair

☐

Change Plans

☐

Convert to Injection

☐

Deepen

☐

Fracture Treat

☐

New Construction

☒

Plug and Abandon

☐

Plug Back

☐

Production (Start/Resume)

☐

Reclamation

☐

Recomplete

☐

Temporarily Abandon

☐

Water Disposal

☐

Water Shut-Off

☐

Well Integrity

☐

Other

13 Describe Proposed or Completed Operation. Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recompleat horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompleat in a new interval, a Form 3160-4 must be filed once testing has been completed. Final Abandonment Notices must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

5/26/10 Set a CIBP at 7640' with 35' cement on top. Circulated hole with plugging mud. Spotted a 330' cement plug from 5030'-5370'.

5/27/10 Tagged plug at 5274'. Re-spotted a 50 sx cement plug across the DV tool WOC 4 hrs. Tagged plug at 5049' (TOC). BLM rep said plug was sufficient to cover DV tool. Spotted a 140' cement plug from 3242'-3382'. Did not tag. Spotted a 120' cement plug from 2024'-2144'. Did not tag. Spotted a 150' cement plug from 1104'-1254'.

5/28/10 Tagged plug at 1029'. Spotted a 400' cement surface plug. Cut off wellhead. Installed dry hole marker. Cleaned location as per regulated. **WELL IS PLUGGED AND ABANDONED.**Accepted as to plugging of the well bore.
Liability under bond is retained until
surface restoration is completed.14 I hereby certify that the foregoing is true and correct
Name (Printed/Typed)

Tina Huerta

Title Regulatory Compliance Supervisor

Signature

Date

June 1, 2010

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title

Office

JUN 5 2010

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any Department or Agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.