

UNITED STATES
DEPARTMENT OF THE INTERIOR
BUREAU OF LAND MANAGEMENT

OCDA Artesia

FORM APPROVED
OMB No. 1004-0137
Expires July 31, 2010

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an abandoned well. Use Form 3160-3 (APD) for such proposals.

5. Lease Serial No.
LC-064488-E

6. If Indian, Allottee or Tribe Name
NA

7. If Unit or CA/Agreement, Name and/or No.
NA

8. Well Name and No.
Arco 10 Federal #2

9. API Well No.
30-015-20692

10. Field and Pool or Exploratory Area
Dagger Draw, Upper Penn, North

11. County or Parish, State
Eddy County, New Mexico

SUBMIT IN TRIPLICATE - Other instructions on page 2.

1. Type of Well
☐ Oil Well ☐ Gas Well ☒ Other P&A

2. Name of Operator
Yates Petroleum Corporation


3a. Address
105 S. 4th Str., Artesia, NM 88210

3b. Phone No. (include area code)
575-748-1471

4. Location of Well (Footage, Sec., T., R., M., OR Survey Description)
1980'FNL & 1980'FEL of Section 10-T19S-R25E (Unit G, SWNE)

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION	TYPE OF ACTION			
<input type="checkbox"/> Notice of Intent	<input type="checkbox"/> Acidize	<input type="checkbox"/> Deepen	<input type="checkbox"/> Production (Start/Resume)	<input type="checkbox"/> Water Shut-Off
<input checked="" type="checkbox"/> Subsequent Report	<input type="checkbox"/> Alter Casing	<input type="checkbox"/> Fracture Treat	<input type="checkbox"/> Reclamation	<input type="checkbox"/> Well Integrity
<input type="checkbox"/> Final Abandonment Notice	<input type="checkbox"/> Casing Repair	<input type="checkbox"/> New Construction	<input type="checkbox"/> Recomplete	<input type="checkbox"/> Other
	<input type="checkbox"/> Change Plans	<input checked="" type="checkbox"/> Plug and Abandon	<input type="checkbox"/> Temporarily Abandon	
	<input type="checkbox"/> Convert to Injection	<input type="checkbox"/> Plug Back	<input type="checkbox"/> Water Disposal	

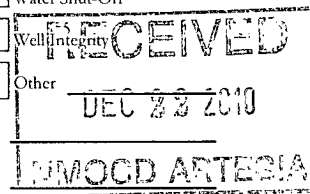

13. Describe Proposed or Completed Operation: Clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports must be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a final abandonment notice must be filed only after all requirements, including reclamation, have been completed and the operator has determined that the site is ready for final inspection.

Accepted as to plugging of the well bore. Liability under bond is retained until Surface restoration is completed.

- 11/18/10 NU BOP.
- 11/19/10 Tagged CIBP at 8590'. Spotted 25 sx Class "H" Neat cement. Calc TOC at 8259'. Set a 4-1/2" CIBP at 7590'.
- 11/22/10 Circulated hole with salt gel. Spotted 25 sx Class "H" Neat cement. Calc TOC at 7259'. Perforated at 5760'. Squeezed 50 sx Class "C" Neat cement. Displaced to 5552'. Started circulating out 4-1/2" x 8-5/8".
- 11/23/10 Tagged plug at 5603'. Perforated at 5175'. Established circulation out 4-1/2" x 8-5/8" and pumped 50 sx Class "C" Neat cement. Displaced to 4967'. WOC 4 hrs. Tagged at 4908'. Perforated 4 holes at 3400'. Circulated out 4-1/2" x 8-5/8" and pumped 50 sx Class "C" Neat cement. Displaced to 3192'.
- 11/24/10 Tagged plug at 3143'. Perforated at 2360'. Established circulation out 4-1/2" x 8-5/8" and pumped 50 sx Class "C" Neat cement. Displaced to 2152'.
- 11/29/10 Tagged plug at 2146'. Perforated at 1210'. Circulated out 4-1/2" x 8-5/8" and pumped 50 sx Class "C" Neat cement. Displaced to 1002'. WOC. Tagged at 964'. Perforated at 478' and pumped 50 sx Class "C" Neat cement. Displaced to 282'. WOC.
- 11/30/10 Tagged plug at 243'. Perforated at 150'. Established circulation out 4-1/2" x 8-5/8" and 8-5/8" x 13-3/8" and pumped 100 sx Class "C" Neat cement. Circulated out 4-1/2 x 8-5/8", shut 4-1/2" and circulated cement out 8-5/8" x 13-3/8". Cement to surface. Dug out cellar and cut off wellhead. Installed dry hole marker as per BLM, witnessed. Filled cellar and cut anchors. Cleaned location. **WELL IS PLUGGED AND ABANDONED.**

Reclamation Due 5-29-11

14. I hereby certify that the foregoing is true and correct

Name (Printed/Typed) Tina Huerta

Signature *Tina Huerta*

Title Regulatory Compliance Supervisor

Date December 1, 2010

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by _____ Title _____

Conditions of approval, if any, are attached. Approval of this notice does not warrant or certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction

DEC 17 2010

BUREAU OF LAND MANAGEMENT
CARLSBAD FIELD OFFICE

cat