

N. M. O. C. C. Co.
UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY
SUBMIT IN LICATE*
(Other instructions on re-verse side)Form approved.
Budget Bureau No. 42-R1424.
5. LEASE DESIGNATION AND SERIAL NO.

LC-055264

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

Jackson "B"

9. WELL NO.

26

10. FIELD AND POOL, OR WILDCAT

Grayburg-Jackson

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 24-17-30

12. COUNTY OR PARISH 13. STATE

Eddy

New Mexico

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)1. OIL WELL ☐ GAS WELL ☐ OTHER ☒ Water Injection

2. NAME OF OPERATOR

NASH, WINDFOHR & BROWN ✓

3. ADDRESS OF OPERATOR

1202 First National Bank Building, Fort Worth, Texas 76102

4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface660' from South and 1980' from West lines of
Sec. 24-17S-30E.

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐FRACTURE TREAT ☐SHOOT OR ACIDIZE ☐REPAIR WELL ☐(Other) ☐PULL OR ALTER CASING ☐MULTIPLE COMPLETE ☐ABANDON* ☐CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☐FRACTURE TREATMENT ☐SHOOTING OR ACIDIZING ☒(Other) ☐REPAIRING WELL ☐ALTERING CASING ☐ABANDONMENT* ☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

On April 27, 1966, the following work was performed:

"C" ZONE - Pressured to 1100 psi. Held O.K. Sand jettted 3209 and 3211 for 15 minutes. Reversed out sand. Pressured to 1,000 psi. Pressure held. Acidized with 250 gals. 15% acid. Broke at 1,400 psi. Took acid at 1 1/4 BPM at 850 psi. In 5 minutes lost only 100 psi.

"B" ZONE - Sand jettted 3191 and 3193 for 15 minutes. Reversed out sand. Tagged bottom at 3200'. Pressured to 1,000 psi. Taking fluid at .2 BPM at 1,000 psi. Acidized with 500 gals., took 1/2 BPM at 1,000 psi. and 1-1/4 BPM at 1200 psi. Final rate 2 1/4 BPM at 850 psi.

"A" ZONE - Sand jettted 3163 and 3165. Reversed out sand. Tagged bottom at 3176'. Pressured to 1100 psi. Fell off slowly. Acidized with 500 gals. Started in very slowly at 1200 psi. Completed at 3-1/4 BPM at 600 psi. Reversed out sand to bottom.

RECEIVED

MAY 3 1966

O. C. C.

ARTESIA, OFFICE

DATE April 28, 1966

18. I hereby certify that the foregoing is true and correct


SIGNED

Ralph L Gray

TITLE

Consulting Engineer.

(This space for Federal or State office use)

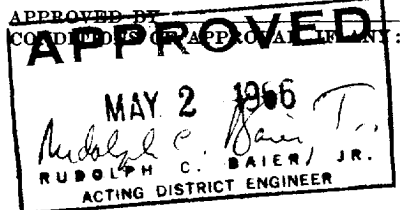

TITLE

DATE

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

