

Submit 1 Copy To Appropriate District
Office

District I
1625 N. French Dr., Hobbs, NM 88240
District II
1301 W. Grand Ave., Artesia, NM 88210
District III
1000 Rio Brazos Rd., Aztec, NM 87410
District IV
1220 S. St. Francis Dr., Santa Fe, NM
87505

State of New Mexico
Energy, Minerals and Natural Resources

OIL CONSERVATION DIVISION
1220 South St. Francis Dr.
Santa Fe, NM 87505

Form C-103
October 13, 2009

SUNDRY NOTICES AND REPORTS ON WELLS (DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT" (FORM C-101) FOR SUCH PROPOSALS.)		WELL API NO. 30-031-20248
1. Type of Well: Oil Well <input checked="" type="checkbox"/> Gas Well <input type="checkbox"/> Other <input type="checkbox"/>		5. Indicate Type of Lease STATE <input type="checkbox"/> FEE <input checked="" type="checkbox"/>
2. Name of Operator Nacogdoches Oil & Gas Inc.		6. State Oil & Gas Lease No.
3. Address of Operator 816 North Street, Nacogdoches Tx. 75963		7. Lease Name or Unit Agreement Name Hospah Sand Unit
4. Well Location Unit Letter <u>F</u> : <u>1425'</u> feet from the <u>North</u> line and <u>2600'</u> feet from the <u>West</u> line Section <u>1</u> Township <u>17N</u> Range <u>9W</u> NMPM McKinley County		8. Well Number #84
11. Elevation (Show whether DR, RKB, RT, GR, etc.) 6954'		9. OGRID Number 256689
		10. Pool name or Wildcat Hospah

12. Check Appropriate Box to Indicate Nature of Notice, Report or Other Data


NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	P AND A <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	MULTIPLE COMPL <input type="checkbox"/>	CASING/CEMENT JOB <input type="checkbox"/>	
DOWNHOLE COMMINGLE <input type="checkbox"/>			
OTHER: <input type="checkbox"/>		OTHER: <input type="checkbox"/>	

13. Describe proposed or completed operations. (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work). SEE RULE 19.15.7.14 NMAC. For Multiple Completions: Attach wellbore diagram of proposed completion or recompletion.

2-28-11- RIH with 2 3/8" WS to 1565', tag bottom. Mix and pump 24 sks of Portland @ 15.2 ppg, pull pipe.
3-14-11- MIRU Perforators, shoot squeeze holes from 440', 200' & 110'.
3-17-11- RIH with 390' WS with packer, set packer, mix and pump 18 sks @ 15.3 ppg through squeeze holes @440'. Mix 14 Sk @ 15.3 ppg for inside plug.
3-18-11- Tag cement at 324', RIH with WS, Packer, set packer @ 156'. Mix and Pump 18 sks @ 15.3 ppg through squeeze holes At 200'. Mix and pump 14 sks @ 15.3 ppg for inside plug. Pull pipe.
3-21-11- Tag cement at 125'. Mix and pump 18 sks @ 15.6 ppg, bullhead squeeze through squeeze holes at 110' to surface. Mix and pump 13 sks @ 15.4 ppg, fill to top.
3-22-11- Tag cement at 2' from surface. Will cut off, place plug marker and level location as soon as possible.

Spud Date:

Rig Release Date:

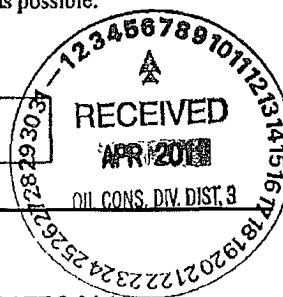

I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNATURE [Signature] TITLE VP E&P DATE 3-04-11

Type or print name Mike Allen E-mail address: mike.allen@nogtx.com PHONE: 918-260-7620
For State Use Only

APPROVED BY: [Signature] TITLE Deputy Oil & Gas Inspector,
Conditions of Approval (if any): District #3 DATE 3/9/11

A