

UNITED STATES  
DEPARTMENT OF THE INTERIOR  
BUREAU OF LAND MANAGEMENT

SUNDRY NOTICES AND REPORTS ON WELLS

Do not use this form for proposals to drill or to re-enter an  
Abandoned well. Use Form 3160-3 (APD) for such proposals.

FORM APPROVED  
OMB No. 1004-0135  
Expires November 30, 2000

5. Lease Serial No.

SF - 078499

6. If Indian, Name of tribe

SUBMIT IN TRIPLICATE - Other instructions on reverse side

1. Type of Well

☐

Oil Well

☒

Gas Well

☐

Other

2. Name of Operator

BP America Production Company Attn: Cherry Hlava

8. Well Name and No.

Tapp LS 3

3a. Address

P.O. Box 3092 Houston, TX 77253

3b. Phone No. (include area code)

281-366-4081

9. API Well No.

30-045-07425

10. Field and Pool, or Exploratory Area

Otero Chacra

4. Location of Well (Footage, Sec., T., R., M., or Survey Description)

990' FWL & 1650' FSL SEC 15 T28N R08W

11. County or Parish, State

San Juan County, New Mexico

12. CHECK APPROPRIATE BOX(ES) TO INDICATE NATURE OR NOTICE, REPORT, OR OTHER DATA

TYPE OF SUBMISSION

☐

Notice of Intent

☒

Subsequent Report

☐

Final Abandonment Notice

TYPE OF ACTION

☐

Acidize

☐

Deepen

☐

Production (Start/Resume)

☐

Water shut-Off

☐

Alter Casing

☐

Fracture Treat

☐

Reclamation

☐

Well Integrity

☐

Casing Repair

☐

New Construction

☒

Recomplete

☐

Other

☐

Change Plans

☐

Plug and Abandon

☐

Water Disposal

☐

Convert to Injection

☐

Plug Back

13. Describe Proposed or Completed Operation (clearly state all pertinent details, including estimated starting date of any proposed work and approximate duration thereof. If the proposal is to deepen directionally or recomplete horizontally, give subsurface locations and measured and true vertical depths of all pertinent markers and zones. Attach the Bond under which the work will be performed or provide the Bond No. on file with BLM/BIA. Required subsequent reports shall be filed within 30 days following completion of the involved operations. If the operation results in a multiple completion or recompletion in a new interval, a Form 3160-4 shall be filed once testing has been completed. Final Abandonment Notices shall be filed only after all requirements, including reclamation, have been completed, and the operator has determined that the site is ready for final inspection.

4/27/07 TIH set Composite BP @3600' . RUN CBL 3600' - 2400' & RST 3600' - 2350'. Press tst liner using tandem RBP & PKR; Tst CSG 2995' - 3152' 2000 psi. TST CSG 2995' - 2455' @1000 psi OK.

5/2/07 TIH w/3.5" gun & perf Chacra 3256' - 3276'; 3300' - 3315'; 3378' - 3418'; 3435' - 3450' @4 JSPF. Frac w/ 153,250 lbs 16/30 sand@4538 psi. 17.1 bbls 15% acid followed by 10.7 bbls 2% KCL wtr.

5/10/07 TIH & set PKR @2560'

5/11/07 TIH & land 2 3/8" 4.7# J-55 @3200' ND BOP. RD Move off Location. Turn over to production

Should you have questions please call Richard Pomrenke @281-366-5023


14. I hereby certify that the foregoing is true and correct  
Name (Printed/typed)

Cherry Hlava

Title Regulatory Analyst

Signature *Cherry Hlava*

Date 05/11/07

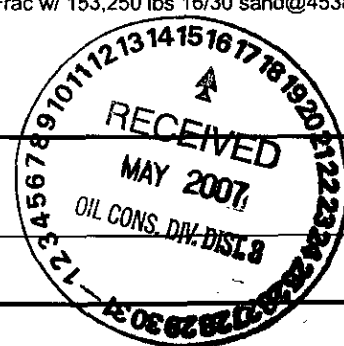

THIS SPACE FOR FEDERAL OR STATE OFFICE USE

Approved by

Title

Date

Conditions of approval, if any, are attached. Approval of this notice does not warrant or Certify that the applicant holds legal or equitable title to those rights in the subject lease which would entitle the applicant to conduct operations thereon.

Office

Title 18 U.S.C. Section 1001 and Title 43 U.S.C. Section 1212, make it a crime for any person knowingly and willfully to make to any federal or state official any false, fictitious or fraudulent statements or representations as to any matter within its jurisdiction.

ACCEPTED FOR RECORD

MAY 15 2007

FARMINGTON FIELD OFFICE

NMOCD