Form	3	160	-3
(Anr	iľ	200	14

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM	APPROVED
OMB N	o. 1004-0137
Expires 1	March 31, 200'

5. Lease Serial No.

NO-G-0402-1710				
6.	If Indian, Allotee	or Tribe Na		

APPLICATION FOR PERMIT TO	DRILL OR REENTER 3	0 60	NAVAJO NATION	
la. Type of work: DRILL REENT	er RE	CEIVE	7 If Unit or CA Agreement	, Name and No.
,, <u> </u>	070 FAS	BERCT	N/A	
lb. Type of Well: ✓Oil Well ☐Gas Well ☐Other ☐Single Zone ✓ Multiple Zone			8. Lease Name and Well N ATSE 36 F	О.
NAVAJO NATION OIL & GAS CO., 1	INC.		9. API Well No. 30-045- 34046	/
Va. Address P. O. BOX 4439 WINDOW ROCK, AZ 86515	3b. Phone No. (include area code) (928) 871-4880		10. Field and Pool, or Explored We 32N 20W36; Pa	hodex oil
Location of Well (Report location clearly and in accordance with an	ry State requirements.*)		11. Sec., T. R. M. or Blk. and	Survey or Area
At surface 2460' FNL & 1799' FWL At proposed prod. zone SAME			F 36-32N-20W NMPM	Ī
4. Distance in miles and direction from nearest town or post office*			12. County or Parish	13. State
16 AIR MILES NW OF SHIPROCK, NM			SAN JUAN	NM
5. Distance from proposed* location to nearest property or lease line, ft.	16. No. of acres in lease		ng Unit dedicated to this well	1600
(Also to nearest drig, unit line, if any) 7,740'	12,160		W (Des. Creek & Is.) & al l Sec. 36 (Lea d.)	
8. Distance from proposed location* to nearest well, drilling, completed, applied for, on this lease, ft. 1,664' (Atse 36 E)	19. Proposed Depth 7,200 °		BIA Bond No. on file RLB0006712	
Elevations (Show whether DF, KDB, RT, GL, etc.) 4,930' GL	22. Approximate date work will sta	rt*	23. Estimated duration 5 WEEKS	
4,530 GD			3 WEDRS	
	24. Attachments			
e following, completed in accordance with the requirements of Onshor	e Oil and Gas Order No.1, shall be a	ttached to th	is form:	
Well plat certified by a registered surveyor. A Drilling Plan.	4. Bond to cover the litem 20 above).	he operation	ns unless covered by an existing	g bond on file (see
A Surface Use Plan (if the location is on National Forest System I				
SUPO shall be filed with the appropriate Forest Service Office).	6. Such other site authorized offic	specific info er.	ormation and/or plans as may be	required by the
Signature / 2 /	Name (Printed/Typed)		Date	
2000	BRIAN WOOD		10	0/24/2006
CONSULTANT	PHONE: (505) 466-8120	FAX	ζ: (505) 466-9682	
proved by (Signature)	Name (Printed/Typed)		Date	124/6
le AFU_	Office		(
plication approval does not warrant or certify that the applicant holds	legal or equitable title to those right	s in the subj	ect lease which would entitle the	applicant to

HOLD G104 FOR NSL paradoX

*(Instructions on page 2)

NOTIFY AZTEC OCD 24 HRS PRIOR TO CASING & CEMENT

This action is subject to technical and procedural review pursuant to 43 CFR 3165,3 and appeal pursuant to 43 CFR 3165.4

DRILLING OPERATIONS AUTHORIZED ARE SUBJECT TO COMPLIANCE WITH ATTACHED "GENERAL REQUIREMENTS".




State of New Mexico Energy. Minerals & Mining Resources Department OIL CONSERVATION DIVISION 2040 South Pacheco

Santa [fiè]; N[M] 87505[M 6 48

MENDED REPORT

WELL LOCATION AND ACREAGE DEDICATION PLAT APA Number Pool Code 34044 WC32N20W36 Paradoxon WC32N20W36 30-045-Property Code 36 F 365*20* **ATSE** OGRID No. **Heyation** Operator Name 242841 NAVAJO NATION OIL & GAS CO., INC. 4930 Surface Location County UL or Lot Tep. Rgo. Lot lon Feet Iron> North/South Feet from> East/West F 36 32 N. UØC 24601 **NORTH** 1799 WEST 20 W. SAN JUAN Bottom Hole Location If Different From Surface Feet from> North/South | Feet From> UL or Lot Rge. Lot lon East/West County Sec Typ. Order No. Joint ? Consolidation NO ALLOWABLE WILL ASSIGNED TO THIS COMPLETION UNTIL ALL INTERESTS HAVE BEEN CONSOLIDATED OR A NON-STANDARD UNIT HAS BEEN APPROVED BY THE DIVISION 5282`** West** OPERATOR CERTIFICATION I hereby certify that the information contained herein is true and complete ead vil to the best of my knowledge and betef. Signature Printed Name BRIAN WOOD Z Title CONSULTANT 0 \bigcirc section Date OCT. 24, 2006 ≨ 1799 SURVEYOR CERTIFICATION I hereby certify that the well location on this plat was plotted from field notes of actual surveys made by me **NAD 83** NAD 27 NM West decimal of degree or under my supervision, and that the same is true and correct to the best 2627282930 36.944928° N 2.164.998 N of my belief. 108.910705 W 185.350 E Date of Survey RECEIVED 06/01/06 MAY 2007 Signature and Seat of Professional Sarveyor OIL CONS. DIV. DIST 3 4 HEM West* 5280'*

Submit 3 Copies To Appropriate District Office	State of New Mex Energy, Minerals and Natura		Form C-103 May 27, 2004	
<u>District I</u> 1625 N. French Dr., Hobbs, NM 88240		WELL API	WELL API NO.	
<u>District II</u> 1301 W. Grand Ave., Artesia, NM 88210	OIL CONSERVATION I	DIVISION 30-045-	ype of Lease	
District III 1000 Rio Brazos Rd., Aztec, NM 87410	1220 South St. Franc	or Stat		
<u>District IV</u> 1220 S. St. Francis Dr., Santa Fe, NM	Santa Fe, NM 875	60. State-Oil NO-G-0402-	& Gas Lease No. 1710	
(DO NOT USE THIS FORM FOR PROPO	TICES AND REPORTS ON WELLS OSALS TO DRILL OR TO DEEPEN OR PLUG	BACK TO A	ne or Unit Agreement Name	
PROPOSALS.)	ICATION FOR PERMIT" (FORM C-101) FOR	AISE		
1. Type of Well: Oil Well 🗹	Gas Well Other	8. Well Num		
2. Name of Operator NAVAJO NATION OIL & GAS O	CO., INC.	9. OGRID N 242841		
3. Address of Operator P. O. BOX 4439, WINDOW ROC	K, AZ 86515	10. Pool nam WC DESERT C	ne or Wildcat REEK, ISMAY, & LEADVILLE	
4. Well Location				
Unit Letter: F	2460' FNL & 1799' FW	L		
Section 36	Township 32 N	Range 20 W NMPM	SAN JUAN County	
	11. Elevation (Show whether DR, R. 4.930' GL	(B, RT, GR, etc.)		
Pit or Below-grade Tank Application		in the second se		
<i></i>	 ater: <u>>100'</u> Distance from nearest fresh water	well: 1,361' Distance from nearest sur	face water: >3	
Pit Liner Thickness: 12 mil	Below-Grade Tank: Volume	bbls; Construction Material		
12. Che	ck Appropriate Box to Indicate 1	Nature of Notice, Report or	Other Data	
NOTICE OF IN	ITENTION TO:	SUBSEQUENT	REPORT OF:	
PERFORM REMEDIAL WORK	· · · · · · · · · · · · · · · · · · ·	REMEDIAL WORK] ALTERING CASING □	
TEMPORARILY ABANDON		COMMENCE DRILLING OPNS.		
PULL OR ALTER CASING	MULTIPLE COMPL	ASING/CEMENT JOB	1	
OTHER: DRILLING PIT	r la	OTHER:		
13. Describe proposed or comp	leted operations. (Clearly state all perti			
V ,). SEE RULE 1103. For Multiple Com	pletions: Attach wellbore diagra	m of proposed completion or	
recompletion.				
			v	
I hereby certify that the information a has been/will be constructed or closed according	bove is true and complete to the best of ding to NMOCD guidelines 3, a general perm	my knowledge and belief. I furt nit or an (attached) alternative OC	her certify that any pit or below-grade tank D-approved plan □.	
SIGNATURE CO	TITLE: CONS	ULTANT DATE: (OCTOBER 24, 2006	
Type or print name: BRIAN WOOD	/ E-mail address: brian@permits	west.com Telephone	No.: (505) 466-8120	
For State Use Only	$1 \triangle a$			
APPROVED BY: Conditions of Approval (if any):	TITLE	DIL & GAS INSPECTOR, DIST.	DATE JUN 0 7 2007	
conditions of reprioral (if any):	" /			

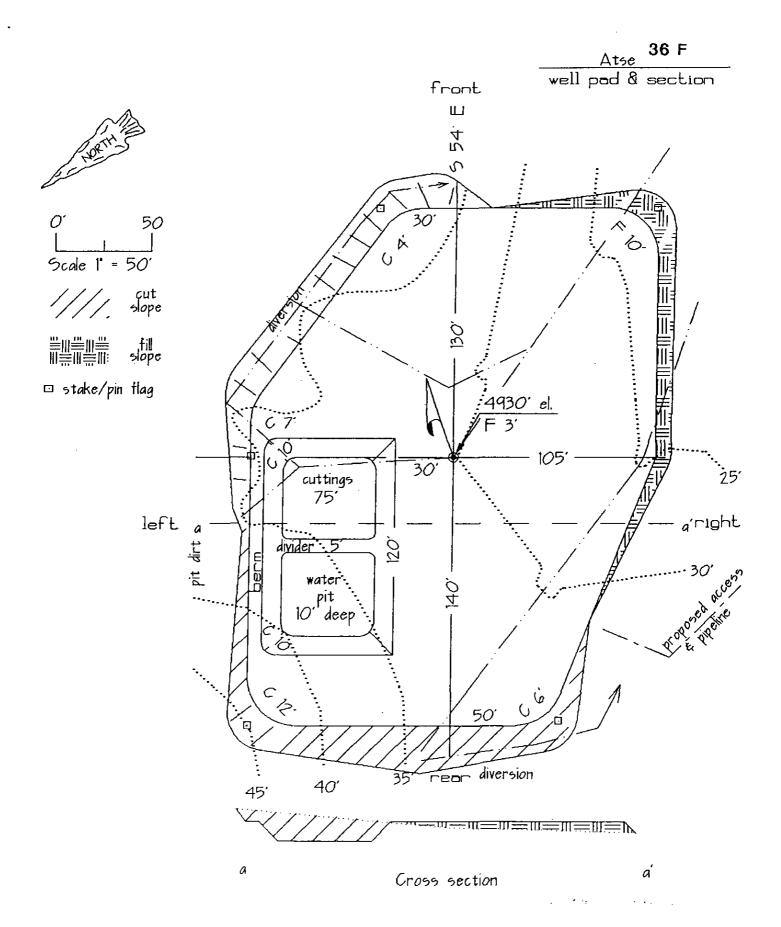

Navajo Nation Oil & Gas Co., Inc. Atse 36 F 2460' FNL & 1799' FWL Sec. 36, T. 32 N., R. 20 W. San Juan County, New Mexico

Drilling Program

1. FORMATION TOPS

The estimated tops of important geologic markers are:

Formation Name	GL Depth	KB Depth	<u>Elevation</u>
Mancos Shale	0'	15'	+4,930'
Dakota Sandstone	445'	460'	+4,485'
Morrison Burro Canyon	510'	525'	+4,420'
Chinle Shale	2,505'	2,520'	+2,425'
DeChelly	3,390'	3,405'	+1,540'
Organ Rock	3,655'	3,670'	+1,275'
Cutler Formation	4,088'	4,103'	+842'
Honaker Trail	5,122'	5,137'	-192'
Paradox	5,584'	5,599'	-654'
Ismay	5,935'	5,950'	-1,005'
Desert Creek	6,080'	6,095'	-1,150'
Akah	6,258'	6,273'	-1,328'
Barker Creek	6,403'	6,418'	-1,473'
Pinkerton Trail	6,656'	6,671'	-1,726'
Molas	6,892'	6,907'	-1,962'
Leadville	6,960'	6,975'	-2,030'
Total Depth (TD)	7,200'	7,215'	-2,270'

2. NOTABLE ZONES

Desert Creek and Ismay oil production is the primary goal. Leadville gas production is the secondary goal. Oil and gas shows which appear to the well site geologist to be commercial will be tested. All fresh water and prospectively valuable minerals will be recorded by depth and protected with casing and cement.



Navajo Nation Oil & Gas Co., Inc. Atse 36 F 2460' FNL & 1799' FWL Sec. 36, T. 32 N., R. 20 W. San Juan County, New Mexico

3. PRESSURE CONTROL

The drilling contract has not yet been awarded, thus the exact BOP model to be used is not yet known. A typical 3,000 psi model is on PAGE 3. An 8-5/8" x 11" 3,000 psi double ram BOP system with a choke manifold and mud cross will be tested to 300 psi and then to 3,000 psi. Upper and lower Kelly cocks with valve handle and subs to fit all drill string connections which are in use will be available on the rig floor.

Tests will be run when:

- 1) installed
- 2) anytime a pressure seal is broken (test only affected equipment)
- 3) at least once every 20 days
- 4) blind & pipe rams will be activated each trip, but no more than daily


BOP systems will be consistent with API RP 53. Blowout preventers will be installed and tested before drilling surface casing plug and will remain in use until the well is completed or abandoned. Preventers will be inspected and operated daily to ensure good mechanical working order and this inspection recorded on the daily drilling report. Preventers and casing will be pressure tested before drilling casing cement plugs. Maximum expected bottom hole pressure will be $\approx 3,000$ psi.

4. CASING & CEMENT

Hole Size	<u>O. D.</u>	Pounds/Foot	<u>Grade</u>	<u>Age</u>	Connections	Depth Set
12-1/4"	8-5/8"	24	K-55	New	ST&C	500'
7~7/8"	5-1/2"	15.5	K-55	New	ST&C	7,200'


Surface casing will be cemented to the surface with ≈ 371 sacks (≈ 427 cubic feet) Class G with 2% CaCl₂ + 1/4 pound per sack cello flake. Weight = 15.8 pounds per gallon. Yield = 1.15 cubic feet per sack. Volume calculated at 10% excess over annular volume.



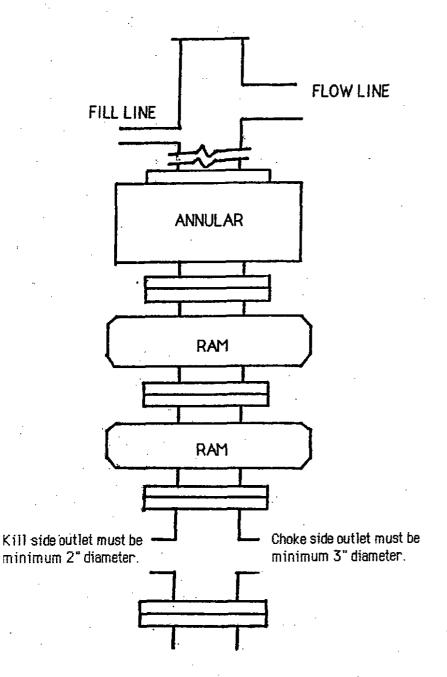

TYPICAL BOP STACK & CHOKE MANIFOLD

There will be at least 2 chokes and 2 choke line valves (3" minimum). The choke line will be 3" in diameter. There will be a pressure gauge on the choke manifold.

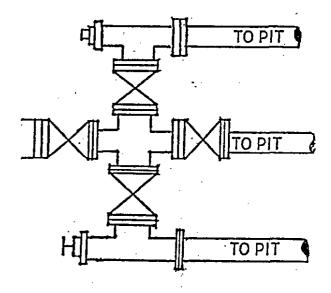

Kill line will be minimum 2" diameter and have 2 valves, one of which shall be a minimum 2" check valve.

Upper kelly cock will have handle available.

Safety valve and subs will fit all drill string connections in use.

All BOPE connections subjected to well pressure will be flanged, welded, or clamped.



Navajo Nation Oil & Gas Co., Inc. Atse 36 F 2460' FNL & 1799' FWL Sec. 36, T. 32 N., R. 20 W. San Juan County, New Mexico

A stage collar will be set at $\approx 3,500$ '. Weight on cement at least four hours between stages.

First stage of the production casing will be cemented from TD to $\approx 3,500$ '. Lead with ≈ 285 sacks (≈ 527 cubic feet) Class G 65:35 poz with 6% gel + 1/4 pound per sack cello flake. Weight = 12.7 pounds per gallon. Yield = 1.85 cubic feet per sack. Tail with ≈ 250 sacks (≈ 287 cubic feet) Class G cement with 2% CaCl₂. Weight = 15.8 pounds per gallon. Yield = 1.15 cubic feet per sack. Total first stage cement = 814 cubic feet ($\ge 25\%$ excess in open hole).

Second stage will be cemented from $\approx 3,500$ ' to the surface. Lead with ≈ 355 sacks (≈ 657 cubic feet) Class G 65:35 poz with 6% gel + 1/4 pound per sack cello flake. Weight = 12.7 pounds per gallon. yield = 1.85 cubic feet per sack. Tail with ≈ 100 sacks (≈ 115 cubic feet) Class G with 2% CaCl₂. Weight = 15.8 pounds per gallon. Yield = 1.15 cubic feet per sack. Total second stage cement = 772 cubic feet ($\geq 25\%$ excess in open hole).

5. MUD PROGRAM

Fresh water, gel, lime, and native solids with a weight of 8.3 pounds per gallon will be used from the surface to $\approx 3,000$ '. Gel/lime sweeps will be used as necessary for hole cleaning.

A low solids, non-dispersed polymer system will be used from $\approx 3,000$ ' to TD. Weight = 8.6 to 9.5 pounds per gallon. Gel/lime sweeps will be used as needed to clean the hole. Fluid loss will be maintained at 15 - 20 cc. Fluid loss will be reduced to ≤ 15 cc before coring, logging or drill stem tests.

A two person mud logging unit will be on site from \approx 4,000' to TD. Cuttings will be collected every \approx 30' to the top of the Paradox or \approx 5,500'. After that point, cuttings will be collected every \approx 10' to TD.



Navajo Nation Oil & Gas Co., Inc. Atse 36 F 2460' FNL & 1799' FWL Sec. 36, T. 32 N., R. 20 W. San Juan County, New Mexico

6. CORES, LOGS, & TESTS

A conventional core may be cut in the Desert Creek or at strong shows. Side wall cores may also be cut. GR - Sonic and DLL-Micro-SFL log suites will be run from TD to the surface. FDC-CNL logs will be run from TD to $\approx 4,000$ '. No drill stem tests are currently planned.

7. DOWN HOLE CONDITIONS

No abnormal temperatures or abnormal pressures are expected. No hydrogen sulfide is expected.

8. OTHER INFORMATION

The anticipated spud date is December 1, 2006. It is expected it will take 3 weeks to drill and 2 weeks to complete the well.

The Atse 36 F well was previously known as the Atse #1.

The Eagle 1-G #1 well was formerly know as the Eagle #1.



HYDROGEN SULFIDE CONTINGENCY PLAN

NAVAJO NATION OIL & GAS CO., INC. LEASE NO-G-0402-1710 ATSE 36 F 36-32N-20W SAN JUAN COUNTY, NM

> Hydrogen Sulfide Contingency Plan Page 1

Valid Only at Time of Printing. Dated 10/10/2006

Company Operation Manager

- 1. The Company Operation Manager will be responsible for notifying and maintaining contact with company managers and supervisory personnel.
- 2. Maintain communication with the location supervisor to proceed with any other assistance that might be required.
- 3. Travel to well location is appropriate.
- 4. Assist location supervisor with all other notifications-both company and regulatory.

Well Specialist (Location Supervisor)

- 1. The location supervisor will confirm that all personnel on location at any time are trained in Hydrogen Sulfide Safety Awareness, are clean shaven and are familiar with safety equipment on-site and have personal Hydrogen Sulfide monitor for their protection.
- 2. Ensure that all safety and emergency procedures are observed by all personnel.
- 3. Make an effort to keep the number of personnel on location to a minimum and to ensure that only essential personnel are on location during critical operations.
- 4. Conduct weekly hydrogen sulfide emergency mock drill.
- 5. Should extreme danger condition exist, the location supervisor will:
 - a. Assess the situation and advise all personnel by appropriate means of communication.
 - b. Be responsible for determining that the extreme danger condition is warranted and the red flag shall be posted at location entrance.
 - c. Go to safe briefing area and give clear instructions relative to hazard on location, and actions for personnel to follow.
 - d. Notify company and regulatory groups of current situation as outlined in company protocol. Follow appropriate emergency procedures for emergency services notification.
 - e. Proceed to rig floor and supervise operations with rig supervisor. Take action to control and reduce the hydrogen sulfide hazard.
 - f. Ensure that essential personnel are properly protected with supplied air breathing equipment and that non-essential personnel are in a muster station free hydrogen sulfide.
 - g. Be responsible for authorizing evacuation of persons/residents in area surrounding the drilling location.

Rig Supervisor-Tool Pusher

- 1. If the Location Supervisor is unable to perform his/her duties, and the alternate representative is also unable or unavailable to perform his/her duties, the rig supervisor-tool pusher will assume command of well site operations and all responsibilities listed above for rig personnel.
- 2.Ensure that all rig personnel are properly trained to work in Hydrogen Sulfide environment and fully understand the purpose of hydrogen sulfide monitors and alarms, and the action to take when alarms visual/audible initiate. Ensure that all crew members that all crew personnel understand the buddy system, safe briefing areas, muster stations, emergency evacuation procedures and individual duties.
- 3. Should an extreme danger operational condition arise, the rig supervisor-tool pusher shall assist the Location Supervisor by:
 - a. Proceeding to the rig floor and assist in supervising rig operations.
 - b. Ensure that only essential personnel remain in the hazardous areas.
 - c. Ensure that all personnel that remain in hazardous area, wear supplied air breathing equipment until notified all is "CLEAR" of any toxic gases.
 - d. Assign rig crew member or other service representative to block entrance to location. No unauthorized personnel will be allowed entry to location.
 - e. Help to determine hazardous "danger zones" on location using portable detection equipment.
 - f. Position electric fans to move gas in any high concentration areas with Continuous monitoring of the area.

SAFETY CONSULTANT

- 1. During NORMAL operations (no hydrogen sulfide present), the safety consultant will be responsible for the following:
 - a. Ensure that all well site safety equipment is in place and operational.
 - b. Ensure that all well site personnel are familiar with location safety layout and operation of all safety equipment.
 - c. Ensure that all well site personnel are adequately trained in Hydrogen Sulfide Safety Awareness and are cleaned shaven.
 - c. Assist location supervisor with weekly hydrogen sulfide emergency mock drill.
- 2. When an operational condition is classified as extreme danger, the safety consultant will be responsible for the following:
 - a. Account for all well site personnel.
 - b. Assess any injuries and direct first aid measure.

Hydrogen Sulfide Contingency Plan Page 3

- c. Ensure that all safety and monitoring equipment is functioning properly and available.
- d. Monitor the safety of well site personnel.
- e. Maintain a close communication with the location supervisor.
- f. Be prepared to assist location supervisor with support of rig crew or other personnel using supplied air breathing equipment.
- g. Be prepared to assist location supervisor with emergency procedures.
- h. Be prepared to assist with evacuation of any area residents or other personnel working in the immediate area.

All Personnel

- 1. Always be alert for possible Hydrogen Sulfide visual/audible alarms.
- 2. Be familiar with location of Safe Briefing Areas and Muster Stations.
- 3. Be familiar with location of and operation of all air supplied breathing equipment.
- 4. Familiarize yourself with nearest escape routes for safe evacuation
- 5. Be aware of prevailing wind direction, any changes in wind direction, or absence of wind by checking the wind socks placed around location, and be aware of uphill direction.
- 6. If hydrogen sulfide lights and/or siren initiates "STAY CALM" don escape breathing systems and follow directions of person in charge and proceed to briefing area/muster station. Do not initiate rescue until directed by person in charge.
- 7. Essential personnel shall don Self-Contained Breathing Apparatus (SCBA) and work using the "BUDDY SYSTEM" will rescue any victims and work to control Hydrogen Sulfide Release.
- 8. Non-essential personnel shall evacuate to the appropriate safe briefing area using escape breathing systems. Wait there for further instructions from person in charge.

HYDROGEN SULFIDE SAFETY EQUIPMENT

QUANITY	DESCRIPTION
1	Safety trailer with cascade system consisting of (8) 347 cu.ft. compressed air tanks with high-pressure regulators. certificate available.
1	1000 ft. low pressure airline hose with Hanson locking fittings, rigged-up with manifolds to supply breathing air to the personnel on the rig floor, substructure, derrick, shale shaker area, and mud mixing areas.
6	Self-contained breathing apparatus (SCBA)
6	Emergency Escape Breathing Apparatus (EEBA)
1	4-channel continuous electronic hydrogen sulfide monitor with visual/audible alarm. Span and set at 10-15 ppm by a certified technician and calibration sheet available as well as sticker on unit.
1	Gastec and/or detection pump unit with tubes to test for hydrogen sulfide and sulfur dioxide.
1	First aid kit
1	Backboard with straps and headblocks, C-collar and tape
2	Windsocks with poles
1	Well condition sign with 3 flag system
2	Safe briefing area/muster station signs
1	Fire blanket
2	20# fire extinguishers
1	LEL/O2 handheld monitor calibration sheet available as well as sticker on unit.
1	Eyewash station
1 .	Microsheild/resesitation pocket mask/bag-valve mask with O2 inlet
2	Tanks oxygen with tubing and adult nasal cannulas, adult non-rebreathers.
	Local emergency phone numbers for police/fire/ems with township and range, longitude and latitude posted inside the trailer on the wall in plain view.
1	Bloodborne pathogen kit