
UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT



APR 2 2 2008

Sundry Notices and Reports on Wells					- Bureau of Land Managemen	
					Farmington Field Office	
				5.	Lease Number SF-078007	
1. Type	Type of Well			6.	If Indian, All. or	
C	GAS				Tribe Name	
				7.	Unit Agreement Name	
	e of Operator					
BURLINGTON RESCURCES OIL & GAS COMPANY LP					Huerfano Unit	
				 8.	Well Name & Number	
3. Address & Phone No. of Operator				O.	wen wante & rumber	
PO Box 4289, Farmington, NM 87499 (505) 326-9700				9.	Huerfano Unit 144 API Well No.	
4. Location of Well, Footage, Sec., T, R, M Sec., T—N, R—W, NMPM Unit P (SESE), 1150' FSL & 850' FEL, Sec. 31, T27N, R9W NMPM				_	30-045-11559	
				10.	Field and Pool	
				11.	Basin FC/ Ballard PC County and State San Juan, NM	
12 CHE	CIZ ADDDADDIATE D		PIDE OF NOTICE DEPORT		DATA	
			TURE OF NOTICE, REPORT, (JIDEK	μ ΑΙ Α	
	f Submission:	Type of Action:	[] Observed (D)	57.0	011	
☐ Motice	Notice of Intent ☐ Abandonment ☐ Change of Plans ☐ Recompletion ☐ New Construction			☑ Other: Commingle		
⊠ Subs	Subsequent Report □ Plugging □ Non-Routine Fracturing			RCVD APR 24 '08		
☐ Final	Abandonment	☐ Casing Repair ☐ Altering Casing	Conversion to Injection		OIL CONS. DIV.	
13. Describe Proposed or Completed Operations					DIST. 3	
See attach	ned	,				
14. I here	eby certify that the for	regoing is true and correc	et.		. ,	
Signed e	Miling WMU	Mer Tracey N.	Monroe Title Regulator	y Techn	<u>ician</u> Date <u>4/21/08</u>	
	·					
	ce for Federal or State C				D .	
APPROV	APPROVED BYTitle CONDITION OF APPROVAL, if any:				Date	
Title 18 U S.C. S	Section 1001, makes it a crime for any j	person knowingly and willfully to make any ments or representations as to any matter wi				
	•	-	Ade ALSO EOT.			
ان معر	mac 105 51	e, aciqui	- 1.220 20 [.			

NMOCD

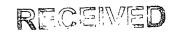

APR 2 3 2008



Huerfano Unit 144 API# 30-045-11559 Sec. 31, T27N, R9W

2/19/08 MIRU Basic 1524. ND master valve, NU BOP, floor, tongs, accumulator. PU tbg hanger, RIH tbg, tag up @ 6705'. PU EOT to 6594'.

2/20/08 NOI submitted on 8/3/07 for permission to squeeze, approved by BLM and OCD. RU to cement. Pumped 7sx (10cf-2bbls) Type III Neat Cement. Displaced w/25.5 bbls H2O. Balanced plug. RD cement. POOH w/tbg.

2/21/08 MIRU Wireline. RIH w/logging tool, tag up @ 6184'. Log well from 6184' to surface. Good cement. RD MO.

2/22/08 Called Steve Mason (BLM) and Henry Villanueva (OCD) to request two plugs be set. Requested to spot plug to isolate Gallup top@ 5810', plug 100' cement on top. 2nd Found split in casing @ 4134'. Requested to spot 10 bbls cement across & PT @ 1000# - if test is good move up to CIBP @ 2910' and place 7 sx of cement on top and proceed. Verbal approval given by BLM and OCD. MIRU BJ services. Pumped pre-flush 5 bbls FW. Pumped 1.5 bbls cement. Displaced w/22 bbls water. POOH w/tbg. RD BJ.

2/25/05 RIH w/tbg, tag up cement @ 5686'. 124' top of Gallup formation top. POOH w/tbg, EOT @ 4136'.

2/26/08 Notified BLM & OCD of the following: Plan was to spot 10 bbls of cmnt from 4184' to 3557' now we would like to: Spot cmnt plug at 4184' to 3557' (approx). We are not going to proceed with the two cmnt plugs. We would like to do one continuous that would address the csg leak and isolate the MV. Approval by Steve Mason (BLM) and Henry Villanueva (OCD) to proceed. Spot in BJ services. Pumped pre-flush of 10 bbls FW. Pumped 10 bbls Type III Neat Cement. Displaced w/13 bbls FW. RD BJ. WOC.

2/27/08 RIH w/tbg, tag up plug @ 3762'. Pump displace csg w/new KCL 60 bbls. TOP off csg w/KCL. PT csg to 1000# 30/min-Good test.

3/6/08 RIH w/csg saver. RU Frac valve. PT csg to 4100# 15/min – good test. ND csg saver. RU Basin Perforators. Perf PC 2339' – 2393' @1SPF = 22 .32" holes. Frac PC pumped 14910 gal 20# Linear 70% N2 foam w/100000# 20/40 Brady Sand & 100000 SCF N2. Perf FC 2154' – 2267' @1SPF = 25 .32" holes. RU Basin Perforators to set CFP. CFP set @ 2300',

Frac FC Bullhead 12 bbls 10% Formic Acid. Pump 2000 gal 25# X-Link Pre-Pad, followed by 32928 gal 25# Linear 75% N2 Foam w/110000# 20/40 Brady Sand & 1466537 SCF N2. Flow back well.

3/10/08 RU Basin Perforators to set composite BP @ 2100'. Run gague ring to 2150'. RD Basin. Blow well down.

4/10/08 PT pipe, blind rams, 1500# - good test. PU and RIH w/3 7/8" mill. RIH w/tbg. RU swivel, RU air. Unload and EST Cir/mist. D/O CBP @ 2100'. Unload well.

4/15/08 Blow well down. RIH w/tbg, tag up CBP @ 2300'. RU swivel, RU air. Est circ w/mist .D/O CBP @ 2300'.

4/16/08Blow well down. RIH w/tbg, tag up PBTD @ 3800'. POOH w/tbg. RIH w/packer, set @ 2308'. EOT @ 2338'.

4/17/08 Release packer, POOH w/tbg, packer. Lay down, Kill well with 15 bbls 2% KCL. RIH w/expendable check, SN & tbg. PU tbg hanger. Land tbg, secure lock downs, RD tongs, floor, BOP. Circ tbg w/air. Drop ball, pump out check @ 1100# press to Pump out. Circ thru unload well.

4/18/08 RD. Turn well over to production.

This well will be producing as a Fruitland Coal/Ballard Pictured Cliff being DHC per order #2824 AZ.