

NO. OF COPIES RECEIVED	3
DISTRIBUTION	
SANTA FE	1
FILE	
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

# NEW MEXICO OIL CONSERVATION COMMISSION

Form C-103  
Supersedes Old  
C-102 and C-103  
Effective 1-1-65

5a. Indicate Type of Lease	
State <input type="checkbox"/>	Fee <input checked="" type="checkbox"/>
5. State Oil & Gas Lease No.	
7. Unit Agreement Name	
8. Farm or Lease Name	
Santa Fe Pacific	
9. Well No.	
42	
10. Field and Pool, or Wildcat	
Red Mountain MV	
12. County	
McKinley	

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR. USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. ☒ OIL WELL ☐ GAS WELL ☐ OTHER-

2. Name of Operator  
Colorado Plateau Geological Services, Inc.

3. Address of Operator  
P.O. Box 537, Farmington, New Mexico 87401

4. Location of Well  
UNIT LETTER B 105 FEET FROM THE North LINE AND 1610 FEET FROM  
THE East LINE, SECTION 29 TOWNSHIP 20N RANGE 9W NMPM.

15. Elevation (Show whether DF, RT, GR, etc.)  
6488 GR

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input checked="" type="checkbox"/>	OTHER <u>Plug back &amp; put on pump</u> <input checked="" type="checkbox"/>

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1703.

4-4-79 Spotted 50 ft. cement plug. @ 540' estimated top 490'. WOC 24 hours.  
Ran in open ended and found plug top @ 510'. Spotted 5 sx cement plug @ 474'.  
WOC 24 hrs. Found top plug @ 480'.


4-6-79 Ran 17 joints 4-1/2", 10.50#, R<sub>1</sub> & R<sub>2</sub> casing, total string 438'. Cemented  
w/40 sx regular cement. WOC 48 hrs. Pressure tested casing to 500 psi for 30 min.  
held okay.

4-8-79 Drilled out 10' cement & shoe and worked down to cement plug @ 480'. Open  
hole 438'-480'.

4-9-79 Rigged up and casing swabbed hole.

4-10-79 Swabbing water w/some oil.

4-11-79 Ran 14 joints 2-3/8" EUE tubing to 449.75'. Ran insert pump on rods. Set  
pump jack and put on pump. Will take I.P. test next week.

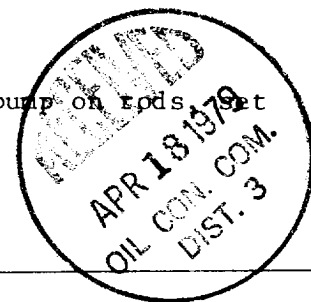

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Mark E. Wendt TITLE Vice President DATE 4/13/79

Original Signed by A. R. Kendrick  
APPROVED BY \_\_\_\_\_ TITLE \_\_\_\_\_ DATE APR 16 1979  
CONDITIONS OF APPROVAL, IF ANY: