Form 3160-5 (June 1990)

UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT


FORM APPROVED Budget Bureau No. 1004-0135 Expires: March 31, 1993

SUNDRY NOTICES AND R Do not use this form for proposals to drill or to de Use "APPLICATION FOR PERMIT	epen or reentry to a different reservoir.	5. Lease Designation and Serial No. JICARILLA CONTRACT 148 6. If Indian, Allottee or Tribe Name 7. If Unit or CA, Agreement Designation
Type of Well		7. If Unit of CA. Agreement Designation
Oil Gas Other		8. Well Name and No.
2. Name of Operator	Attention:	JICARILLA CONT 148 #35
AMOCO PRODUCTION COMPANY	WAYNE BRANAM, RM 1220	9. API Well No.
3. Address and Telephone No.	(303) 830-4912	3003923679
P.O. Box 800, Denver, Colorado 80201	(555) 555 1512	10. Field and Pool, or Exploratory Area
4. Location of Well (Footage, Sec., T., R., M., or Survey Description)		WEST LINFRETH GALLUP DAKOTA 11. County or Parish, State
770 FSL 880 FEL Sec.	14 T 25N R 5W UNIT P	11. County or Parish, State
770132 000122 000.		RIO ARRIBA NM
CUTCK APPROPRIATE POY(c) TO	INDICATE NATURE OF NOTICE, RE	PORT OR OTHER DATA
	TYPE OF ACTION	
TYPE OF SUBMISSION	TIPE OF ACTION	
Notice of Intent Subsequent Report Final Abandonment Notice		Change of Plans New Construction Non-Routine Fracturing Water Shut-Off Conversion to Injection Dispose Water aport results of multiple completion on Well Completion or second processors.
AMOCO PROPOSES TO REPAIR THIS WELL PE	R THE ATTACHED.	
		OIL COME DIVE
		USIC BILL
14. I hereby certify that the foregoing is true and correct	Title BUSINESS A	NALYST Date 12-21-1994
Signed (This space for Federal or State office use) Approved by Conditions of approval, if any:	Chief, Lands and M	lingral Resources JAN 2 4 1995

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States any false, ficticious, or fraudulent statements or

JICARILLA CONTRACT 148 - 35 SEC 14 - T25N - R5W RIO ARRIBA COUNTY, NM REPAIR WELL PROCEDURE

- 1. TOOH with the 2-3/8" production tbg.
- 2. TIH with bit and scraper for 5-1/2" csg to 7500'. .
- 3. Wireline set a CIBP at 7456'.
- 4. Cap the CIBP with 10' of sand/barite mixture. Bring the mixture up to 7440'. The mixture should be 33% barite and 67% 20/40 sand.
- 5. TIH with muleshoe, SN, and 2-3/8" tbg and land intake at 7400'. Check with Ralph Montoya before running the tbg in the well. Ralph may want to run 2-1/16" tbg rather than the 2-3/8" tbg.
- 6. Swab the well in and RTP.

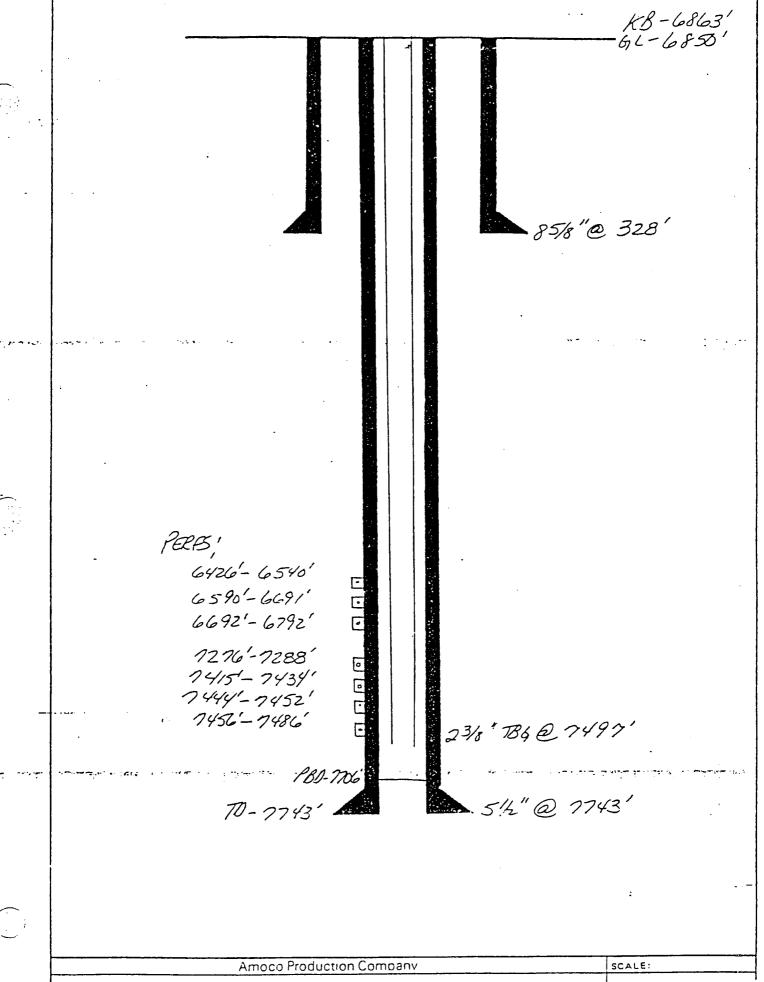

SICARILLA CONTRACT 148-35

DRG.

NO

