Form 9-331 (May 1963)

## UNITED STATES DEPARTMENT OF THE INTERIOR (Other instructions on reverse side)

GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE.

Form approved. Budget Bureau No. 42-R1424. 5. LEASE DESIGNATION AND SERIAL NO.

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

(111	70000	

SUNDRY	NOTICES	AND	REPORTS	ON	WELLS
 		.7 - 23 1	A common and a discount	. baala e	a a distribute management

(Do not use this form for proposals to drill or to deepen or plug back to a Use "APPLICATION FOR PERMIT—" for such proposals.) 7. UNIT AGREEMENT NAME WELL OTHER East Distil Unit WELL 8. FARM OR LEASE NAME 2. NAME OF OPERATOR Shelly Cil Cormany 9. WELL NO. 3. ADDRESS OF OPERATOR 112 1860 Lincoln Street, Domes, Colomado 80203 LOCATION OF WELL (Report location clearly and in accordance with any State requirements.\* See also space 17 below.) 10. FIELD AND POOL, OR WILDCAT At surface

1980' FML and 2003' FML Section 7-24M-9M

<u>Bisti Lover Callun</u> 11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA

Section 7-241-91 12. COUNTY OR PARISH | 13. STATE

15. ELEVATIONS (Show whether DF, RT, GR, etc.) 14. PERMIT NO. 6852 1 GR

16.

## Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTE	CE OF INTE	NTION TO:	SUB	SEQUENT 1	REPORT OF:		-
TEST WATER SHUT-OFF		PULL OR ALTER CASING	WATER SHUT-OFF		REPAIRING	WELL	
FRACTURE TREAT		MULTIPLE COMPLETE	FRACTURE TREATMENT	1	ALTERING		
SHOOT OR ACIDIZE		ABANDON*	 SHOOTING OR ACIDIZING		ABANDONMI	ENT*	
REPAIR WELL		CHANGE PLANS	 (Other)		<u> </u>		
(Other)			(Note: Report res Completion or Reco	ompletion	Report and Log for	orm.)	


17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)\*

All depths shown are from ground level. 6-21-71 - MT & RU Aztec Well Service Unit.

Spotted coment plug from 5487' to 5387'. Dulled 2" tubing. Worked 5-1/2"; casing to find free point. Ran 2" tubing and spotted cement plug from 1347'sto 1597'. Spotted cement plug from 1067' to 967'. Shot 5-1/2" casing off at 843' and pulled 20 joints of 5-1/2" casing (331'). Dan 2" tubing and spotted cementaring from 893' to 793'.

50' irreide caping stub and 50' above esg. stub.

Spotted 10' cement plug in surface casing. Installed dry hole marker: Completed P & A 6-21-71.

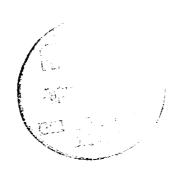

18. I hereby certify that the foregoing is true and correct

TITLE . SIGNED

Lead Cloub

10-10-71 DATE

(This space for Federal or State office use)

APPROVED BY \_ CONDITIONS OF APPROVAL, IF ANY:

DATE .