

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE
TO THE BUREAU OF LAND MANAGEMENT
OR TO THE STATE OFFICE

Form approved
Bureau of Land Management, No. 42-11124
5. LEASE DESIGNATION AND SERIAL NO.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for a well that is to be plugged or shut back to a different reservoir.
Use "APPLICATION FOR PLUGGING" for such purposes.)

1. OIL WELL ☒ GAS WELL ☐ OTHER ☐		6. IF INDIAN, ALLEGEE OR TRIBE NAME	
2. NAME OF OPERATOR Skelly Oil Company		7. UNIT AGREEMENT NAME East Bisti Unit	
3. ADDRESS OF OPERATOR 1860 Lincoln Street - Denver, Colorado 80203		8. FARM OR LEASE NAME	
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements. See also space 17 below.) At surface 660' FSL and 1973' FEL Section 24-25N-11W		9. WELL NO. 26	
11. PERMIT NO.		10. FIELD AND POOL, OR WILDCAT Bisti Lower Gallup	
13. ELEVATIONS (Show whether DF, RT, GR, etc.) 6560' GR		11. SEC. T., R., M., OR BLM, AND SURVEY OR AREA Section 24 - 25N-11W	
		12. COUNTY OR PARISH San Juan	
		13. STATE New Mexico	

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

SUBSEQUENT REPORT OF:

TEST WATER SHUT-OFF ☐

PULL OR ALTER CASING ☐

WATER SHUT-OFF ☐

REPAIRING WELL ☐

FRACTURE TREAT ☐

MULTIPLE COMPLETE ☐

FRACTURE TREATMENT ☐

ALTERING CASING ☐

SHOOT OR ACIDIZE ☐

ABANDON* ☐

SHOOTING OR ACIDIZING ☐

ABANDONMENT* ☒

REPAIR WELL ☐

CHANGE PLANS ☐


(Other) ☐

(NOTE: Report results of multiple completion on Well Completion or Reg completion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

All depths shown are from Ground Level.

8/4/71 - MI&RU Aztec Well Service Unit. Pulled rods.
Spotted cement plug from 5142' to 5042'. Pulled 2" tubing.
Worked 5 1/2" casing to free same. Rigged up Blue Jet, shot casing off at 1485'.
Spotted cement plug from 1535' to 1335', 50' inside casing stub and 150' above 5 1/2" casing stub. Pulled up the hole. Spotted cement plug from 710' to 610'.
Pulled total of 45 joints 1498' of 5 1/2" casing.
Spotted 10' cement plug in surface casing. Installed dry hole marker.
Completed P&A 8/12/71.

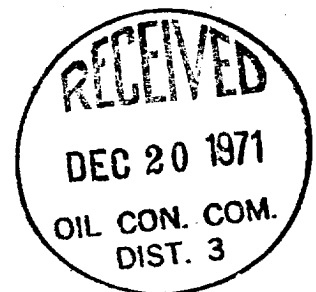

18. I hereby certify that the foregoing is true and correct

SIGNED

6 L. Biles

TITLE

Lead Clerk

DATE

December 15, 1971

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY: