

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPPLICATE*
(Other instructions on re-
verse side)

Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.
E. W. Mudge No. 3
SF 078064

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input type="checkbox"/> OTHER <input checked="" type="checkbox"/> Water Injector	7. UNIT AGREEMENT NAME Carson Unit
2. NAME OF OPERATOR Shell Oil Company	8. FARM OR LEASE NAME Unit
3. ADDRESS OF OPERATOR 1700 Broadway, Denver, Colorado 80290	9. WELL NO. 13-12
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1980' FSL & 660' FWL Section 12	10. FIELD AND POOL, OR WILDCAT Bisti
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA Section 12-T25N-R12W	12. COUNTY OR PARISH San Juan
13. STATE New Mexico	
14. PERMIT NO.	15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6369.8' KB

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
TEST WATER SHUT-OFF <input type="checkbox"/>	FULL OR ALTER CASING <input type="checkbox"/>	WATER SHUT-OFF <input type="checkbox"/>	REPAIRING WELL <input type="checkbox"/>
FRACTURE TREAT <input type="checkbox"/>	MULTIPLE COMPLETE <input type="checkbox"/>	FRACTURE TREATMENT <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
SHOOT OR ACIDIZE <input type="checkbox"/>	ABANDON* <input type="checkbox"/>	SHOOTING OR ACIDIZING <input type="checkbox"/>	ABANDONMENT* <input checked="" type="checkbox"/>
REPAIR WELL <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	(Other) <input type="checkbox"/>	(Other) <input type="checkbox"/>


(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

See attachment

WILL SEND FINAL SUNDRY WHEN LOCATION
CLEANED AND READY FOR INSPECTION

RECEIVED

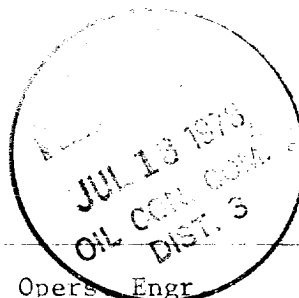

18. I hereby certify that the foregoing is true and correct

SIGNED R. Flaudy TITLE Div. Opers Engr DATE 7/13/77

(This space for Federal or State office use)

APPROVED BY _____ TITLE NEW MEXICO OIL CONSERVATION COMM. DATE _____

CONDITIONS OF APPROVAL, IF ANY:

cc: New Mexico O&GCC w/attachment

1000 RIO BRAZOS RD.
AZTEC, NEW ME 87410
*See Instructions on Reverse Side

PLUG & ABANDON WELL

SHELL OIL COMPANY

FROM: 5/24-26/77

LEASE

CARSON UNIT

DIVISION

WESTERN

COUNTY

SAN JUAN

WELL NO.

ELEV

STATE

BISTI

13-12

6369.8 KB

NEW MEXICO

NEW MEXICOBISTI FIELDCarson Unit 13-12
(P&A)

"FR" TD 5055. PB 5041. AFE #527936 provides funds to plug and abandon well. 5/23 RU Bedford Inc. & unseated Bkr Mdl R pkr. Pulled & LD 156 jts tbg. Started back in hole w/workstring. SD overnight.

MAY 24 1977

Carson Unit 13-12
(P&A)

TD 5055. PB 5041. Fin'd run'g tbg. Found fill @ 4935. Loaded hole w/mud. Spt'd 25 sx mixed w/1# flocele/sx @ perfs. Pulled & LD tbg. RU hyd jacks to stretch csg.

MAY 25 1977

Carson Unit 13-12
(P&A)

TD 5055. PB 5041. Shot off 4-1/2 @ 1846. Spt'd 35 sx cmt across 4-1/2 csg stub. Pulled csg & spt'd 50 sx cmt @ Fruitland Coal Frm. Pulled csg to Ojo Alamo & spt'd 35 sx cmt. Pulled csg to base of 8-5/8 & spt'd 25 sx cmt. Fin'd pulling csg & spt'd 10 sx cmt plug @ sfc. Installed abandonment marker 5/25/77. RD Bedford Inc. 5/25/77.

FINAL REPORT

MAY 26 1977