

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

SF 079192

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME

San Juan 28-6 Unit

8. FARM OR LEASE NAME

San Juan 28-6 Unit

9. WELL NO.

1 (OWFO)

10. FIELD AND POOL, OR WILDCAT

Elanco Mesa Verde

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREASec. 17, T-28-N, R-6-W
N. M. P. M.

12. COUNTY OR PARISH

Rio Arriba

13. STATE

New Mexico

1. ☐ OIL WELL ☐ GAS WELL ☒ OTHER
2. NAME OF OPERATOR
El Paso Natural Gas Company
3. ADDRESS OF OPERATOR
Box 990, Farmington, New Mexico 37401
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.*
See also space 17 below.)
At surface
1500'N, 1650'E

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

6782' GL

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

PULL OR ALTER CASING

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

Squeeze

REPAIRING WELL

ALTERING CASING

ABANDONMENT*


(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) *

On 7-19-70 pulled tubing, set cement retainer at 5230', squeezed open hole w/150 sacks of cement.
Perf. 2 squeeze holes at 2938'. Set cement retainer at 2829', squeezed thru perfs w/125 sacks
of cement.

On 7-24-70 T. D. 6048'. Ran 185 joints 4 1/2", 10.5#, K-55 production casing (6036') set at
6048' w/125 sacks of cement. V. O. C. 18 hours.

On 7-25-70 P. B. T. D. 6034'. Perf. 5820-32', 5848-60', 5870-74', 5900-12', 5941-47', KX 5964-70'
w/12 30X SPZ. Frac w/70,000# 20/40 sand, 70,000 gal. water, dropped 5 sets of 12 balls, flushed
w/4200 gal. water. Pumped bridging ball to baffle at 5675', tested to 3500 psi. O. K. Perf.
5384-88', 5400-08' w/15 SPZ. Frac w/30,000 # 20/40 sand, 31,920 gal. water, dropped 1 set
of 16 balls, flushed w/3760 gal. water.

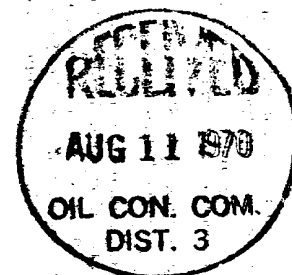

18. I hereby certify that the foregoing is true and correct

SIGNED Original Signed F. H. WOODTITLE Petroleum EngineerDATE August 6, 1970

(This space for Federal or State office use)

APPROVED BY _____
CONDITIONS OF APPROVAL, IF ANY:

TITLE _____

DATE _____

*See Instructions on Reverse Side

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.