

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil ☐ well gas ☒ well other ☐
2. NAME OF OPERATOR
Data Development Co.
3. ADDRESS OF OPERATOR
125 Petroleum Plaza Farmington, N.M. 87401
4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1450' FSL x 1800' FSL
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:


16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:

- TEST WATER SHUT-OFF ☐
FRACTURE TREAT ☐
SHOOT OR ACIDIZE ☐
REPAIR WELL ☐
PULL OR ALTER CASING ☐
MULTIPLE COMPLETE ☐
CHANGE ZONES ☐
ABANDON* ☒
(other) ☐

SUBSEQUENT REPORT OF:

- ☐
☐
☐
☐
☐
☐
☐
☒

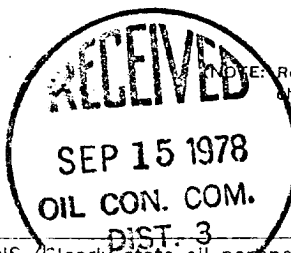

5. LEASE
SF-079116
6. IF INDIAN, ALLOTTEE OR TRIBE NAME
7. UNIT AGREEMENT NAME
8. FARM OR LEASE NAME
Edgar Federal
9. WELL NO.
4
10. FIELD OR WILDCAT NAME
Darin Dakota
11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 15 27N-12W 18E4M
12. COUNTY OR PARISH
San Juan
13. STATE
New Mexico
14. API NO.
15. ELEVATIONS (SHOW DF, KDB, AND WD)
5901' - G.R.

NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

July 19 to 21.

Pull tubing check for leaks run to 6100' squeeze 40 sacks into formation spot 35 sacks plug over perforation from 6038 to 56' and 6077 to 65' pull to 4300' and spot 60 sacks plug at base of Mesa Verde section lay down tubing work casing and shoot at 2154' pull and lay down 5 1/2" 15.5# casing run 2250' 2" tubing, spot 60 sacks plug 100' in and 100' out of casing stub at top of Mesa Verde section pull to 1800' spot 60 sacks at base of Pictured Cliffs pull to 465' spot 40 sacks plug pull and spot 10 sacks surface plug. All connection cut 4' below ground level, no dry hole marker required (Agriculture area).

SEP 13 1978

Subsurface Safety Valve: Manu. and Type

Set @ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED D. E. Bayless TITLE Superintendent DATE Sept. 7, 1978

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY

NMOCC