Form 3160-5 (June 1990)

Conditions of approval, if any:

representations as to any matter within its jurisdiction.

# UNITED STATES DEPARTMENT OF THE INTERIOR BUREAU OF LAND MANAGEMENT

FORM APPROVED						
Budget Bureau No. 1004-0135						
Expires: March 31, 1993						

5. Lease Designation and Serial No.

CHAIDDY	NOTICES	AND	DEDODTE	ON WEI	10

SF 047039 B Do not use this form for proposals to drill or to deepen or reentry to a different reservoir. 6. If Indian, Allottee or Tribe Name Use "APPLICATION FOR PERMIT - " for such proposals 7. If Unit or CA, Agreement Designation 1. Type of Well Oil Well X Gas 8. Well Name and No. Day Gas Com A 2. Name of Operator Attention: 9. API Well No. Amoco Production Company Lois Raeburn 3. Address and Telephone No. 3004523774 (303) 830-5294 P.O. Box 800, Denver, Colorado 80201 10. Field and Pool, or Exploratory Area Flucher Kutz Pictured Cliff 4. Location of Well (Footage, Sec., T., R., M., or Survey Description) 11. County or Parish, State 1600 FSL Sec. 18 T 28N R 10W 1520 FEL San Juan **New Mexico** CHECK APPROPRIATE BOX(s) TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA TYPE OF SUBMISSION TYPE OF ACTION Change of Plans Notice of Intent **New Construction** Plugging Back Non-Routine Fracturing Subsequent Report Casing Repair Water Shut-Off Altering Casing Conversion to Injection Final Abandonment Notice Dispose Water (Note: Report results of multiple completion on Well Completion or Recompletion Report and Log form.) 13. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work . If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.) Amoco Production Company request permission to Plug and Abandon the above mentioned well. See attached procedures. If you should have any questions please contact Lois Raeburn @ (303) 830-5294 SEE ATTACHED FOR **CONDITIONS OF APPROVAL** OIL CON. DIV. 08-08-1994 **Business Assistant** Date (This space for Federal or State office use) Approved by


\* See Instructions on Reverse Side NMOCD

Title 18 U.S.C. Section 1001, makes it a crime for any person knowingly and willfully to make to any department or agency of the United States

### PXA Procedure Day Gas Com A #1

- 1. Check location for anchors. Install if necessary. Test anchors.
- 2. MIRUSU. Blow down well. Kill if necessary with fresh water. NDWH. NDBOP.
- 3. POOH with 2 3/8" tbg. RIH with 2 3/8" tbg and cement retainer, set retainer at 1900'. Test casing integrity to 500#. Squeeze perfs from 1958' to 1996' with 53.426 cuft cement. Pull out of retainer and spot cement plug to 1550' with 46.988 cuft cement.
- 4. RIH with short string CBL and determine TOC. Depending on TOC run in hole with perf gun and shoot squeeze holes and attempt to circulate to surface making sure the following formation has 100' inside and outside casing, Ojo Alamo at 832 and 377' to surface is covered inside and outside casing. (est. from 832 outside is 401.839 and inside is 118.409 cuft)
- 5. NDBOP. Cut off casing and wellhead. Install PXA marker according to BLM or state requirements.
- 6. Turn over to John Schwartz for reclamation.
- 7. Rehabilitate location according to BLM or state requirements.

# DAY GAS COM A #1 LOCATION - 18J - 28N- 10W SINGLE PC ORIG.COMPLETION - 12/79 LAST FILE UPDATE - 1/90 BY RFD

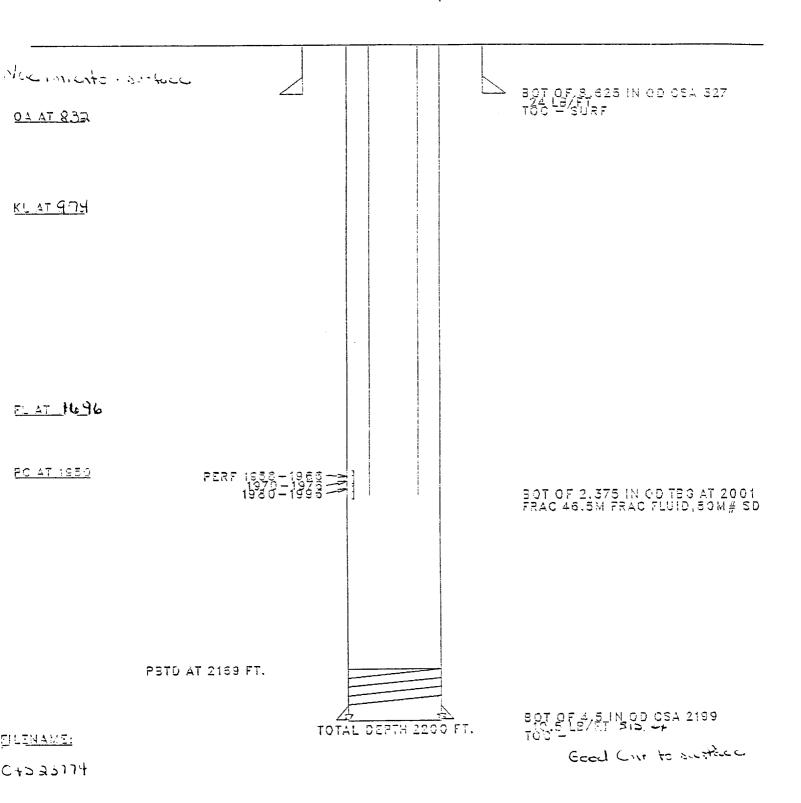

#### UNITED STATES DEPARTMENT OF THE INTERIOR

## BUREAU OF LAND MANAGEMENT FARMINGTON DISTRICT OFFICE

1235 La Plata Highway Farmington, New Mexico 87401

Attachment to Notice of

Re: Permanent Abandonment

Intention to Abandon

Well: 1 Day Gas Com A

#### **CONDITIONS OF APPROVAL**

- 1. Plugging operations authorized are subject to the attached "General Requirements for Permanent Abandonment of Wells on Federal and Indian Leases."
- 2. Mike Flaniken with the Farmington Office is to be notified at least 24 hours before the plugging operations commence (505) 599-8907.
- 3. The following modifications to your plugging program are to be made (when applicable):

At a minimum!

1) Oso Alamo cement plug is to be from 1,024'
to 782' inside 2 outside the caseis.

Office Hours: 7:45 a.m. to 4:30 p.m.