

**UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY**

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir. Use Form 9-331-C for such proposals.)

1. oil well gas well other

2. NAME OF OPERATOR
EL PASO NATURAL GAS CO.

3. ADDRESS OF OPERATOR
BOX 990, FARMINGTON, NEW MEXICO

4. LOCATION OF WELL (REPORT LOCATION CLEARLY. See space 17 below.)
AT SURFACE: 1190'N, 990'E
AT TOP PROD. INTERVAL:
AT TOTAL DEPTH:

5. LEASE
SF 078423

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

7. UNIT AGREEMENT NAME
San Juan 29-7 Unit

8. FARM OR LEASE NAME
San Juan 29-7 Unit

9. WELL NO.
44 (OWWO)

10. FIELD OR WILDCAT NAME
Blanco M.V.

11. SEC., T., R., M., OR BLK. AND SURVEY OR AREA
Sec. 17, T-29-N, R-7-W
NMPM

12. COUNTY OR PARISH
Rio Arriba

13. STATE
New Mexico

14. API NO.

15. ELEVATIONS (SHOW DF, KDB, AND WD)
6666' GL

16. CHECK APPROPRIATE BOX TO INDICATE NATURE OF NOTICE, REPORT, OR OTHER DATA

REQUEST FOR APPROVAL TO:		SUBSEQUENT REPORT OF:
TEST WATER SHUT-OFF	<input type="checkbox"/>	<input checked="" type="checkbox"/>
FRACTURE TREAT	<input type="checkbox"/>	<input checked="" type="checkbox"/>
SHOOT OR ACIDIZE	<input type="checkbox"/>	<input type="checkbox"/>
REPAIR WELL	<input type="checkbox"/>	<input type="checkbox"/>
PULL OR ALTER CASING	<input type="checkbox"/>	<input type="checkbox"/>
MULTIPLE COMPLETE	<input type="checkbox"/>	<input type="checkbox"/>
CHANGE ZONES	<input type="checkbox"/>	<input type="checkbox"/>
ABANDON*	<input type="checkbox"/>	<input type="checkbox"/>
(other) Squeeze, cement & side track		

(NOTE: Report results of multiple completion or zone change on Form 9-330.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

6/18/78: Cut off tubing at 5307'. Set retainer at 5070'. Tested 7" to 1000#, OK. Squeezed w/150 sks cement.

6/19/78: Shot squeeze hole at 2600'. Set retainer at 2503' and squeezed w/125 sks cement. Tested to 3500#, OK. Started side tracking at 5158'.

6/24/78: T.D. 6089'. Ran 189 joints 4 1/2", 10.5# K-55 production casing, 6079' set at 6089'. Float collar at 6072'. Cemented w/246 cu. ft. cement. WOC 18 hours.


6/25/78: PBTD 6072'. Tested casing to 3500#, OK. Perfed C.H. and Men. 5204, 5219, 5235, 5244, 5252, 5273, 5380, 5318, 5333, 5344, 5350, 5397, 5437, 5460, 5471, 5482, 5488, 5531, 5540 with 1 SPZ. Fraced w/67,000# 20/40 sand and 126,000 gal. water. (OVER)
Subsurface Safety Valve: Manu. and Type _____ Set @ _____ Ft.

18. I hereby certify that the foregoing is true and correct

SIGNED *A. P. Duaco* TITLE Drilling Clerk DATE 6/30/78

(This space for Federal or State office use)

APPROVED BY _____ TITLE _____ DATE _____
CONDITIONS OF APPROVAL, IF ANY:

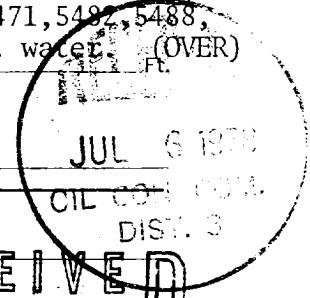

RECEIVED

JUL 5 1978

*See Instructions on Reverse Side

U. S. GEOLOGICAL SURVEY
DURANGO, COLO.

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

GPO : 1976 O - 214-149

Flushed w/3700 gal. water. Perfed Massive and P.L.
5648, 5654, 5661, 5667, 5673, 5680, 5686, 5695, 5700, 5710,
5717, 5730, 5742, 5754, 5762, 5776, 5799, 5814, 5824, 5853,
5873, 5925, 5939, 5946, 6009 w. I-SPZ. Fraced w/82,000#
20/40 sand and 150,300 gal. water. Flushed with
4000 gal. water.