

NEW MEXICO OIL CONSERVATION COMMISSION

NO. OF COPIES RECEIVED	3
DISTRIBUTION	
SANTA FE	1
FILE	1
U.S.G.S.	
LAND OFFICE	
OPERATOR	1

5a. Indicate Type of Lease  
State  Federal  Fee   
5. State Oil & Gas Lease No.

**SUNDRY NOTICES AND REPORTS ON WELLS**  
(DO NOT USE THIS FORM FOR PROPOSALS TO DRILL OR TO DEEPEN OR PLUG BACK TO A DIFFERENT RESERVOIR.  
USE "APPLICATION FOR PERMIT -" (FORM C-101) FOR SUCH PROPOSALS.)

1. OIL WELL <input type="checkbox"/> GAS WELL <input checked="" type="checkbox"/> OTHER- 2. Name of Operator <b>El Paso Natural Gas Company</b>	7. Unit Agreement Name
3. Address of Operator <b>Box 990, Farmington, New Mexico - 87401</b>	8. Farm or Lease Name <b>Hardie A</b>
4. Location of Well UNIT LETTER <b>M</b> . <b>990</b> FEET FROM THE <b>South</b> LINE AND <b>990</b> FEET FROM THE <b>West</b> LINE, SECTION <b>24</b> TOWNSHIP <b>29N</b> RANGE <b>8W</b> NMPM.	9. Well No. <b>2 (P&amp;A)</b>
15. Elevation (Show whether DF, RT, GR, etc.) <b>6352' GL</b>	10. Field and Pool, or Wildcat <b>Blanco Mesa Verde</b>
	12. County <b>San Juan</b>

16. Check Appropriate Box To Indicate Nature of Notice, Report or Other Data

NOTICE OF INTENTION TO:		SUBSEQUENT REPORT OF:	
PERFORM REMEDIAL WORK <input type="checkbox"/>	PLUG AND ABANDON <input type="checkbox"/>	REMEDIAL WORK <input type="checkbox"/>	ALTERING CASING <input type="checkbox"/>
TEMPORARILY ABANDON <input type="checkbox"/>	CHANGE PLANS <input type="checkbox"/>	COMMENCE DRILLING OPNS. <input type="checkbox"/>	PLUG AND ABANDONMENT <input checked="" type="checkbox"/>
PULL OR ALTER CASING <input type="checkbox"/>	OTHER <input type="checkbox"/>	CASING TEST AND CEMENT JOB <input type="checkbox"/>	
		OTHER _____ <input type="checkbox"/>	

17. Describe Proposed or Completed Operations (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work) SEE RULE 1103.

**This well has been plugged and abandoned as follows:**

The uncemented liner (4490-k 5275') and open hole (5275-5347') were squeezed thru a cement retainer set at 4437' w/400 sacks of cement during a ~~working~~ workover attempt.


Spotted a 10 sack cement plug at the base of the Ojo Alamo inside casing at 2158'.

Shot 7" casing off at 706', pulled casing. Ran tubing to 706' and spotted a 50 sack cement plug over casing stub at 706'.

Spotted a 25 sack cement plug at the base of surface casing.

Placed a 15 sack cement plug at surface w/a 4' x 4" P & A marker.

P & A completed on 10-23-69.

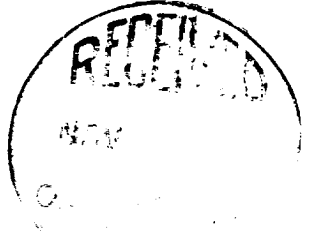

18. I hereby certify that the information above is true and complete to the best of my knowledge and belief.

SIGNED Original Signed F. H. WOOD TITLE Petroleum Engineer DATE 11-18-69

APPROVED BY [Signature] TITLE SUPERVISOR DIST. #3 DATE 11-24-1969

CONDITIONS OF APPROVAL, IF ANY: