

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEY

SUBMIT IN TRIPLICATE*
(Other instructions on reverse side)

Form approved.
Budget Bureau No. 42-R1424.

SUNDRY NOTICES AND REPORTS ON WELLS

(Do not use this form for proposals to drill or to deepen or plug back to a different reservoir.
Use "APPLICATION FOR PERMIT—" for such proposals.)

1. OIL WELL ☐ GAS WELL ☒ OTHER ☐	5. LEASE DESIGNATION AND SERIAL NO. SANJA RE 077648
2. NAME OF OPERATOR AZTEC OIL & GAS COMPANY	6. IF INDIAN, ALLOTTEE OR TRIBE NAME
3. ADDRESS OF OPERATOR DRAWER #570, FARMINGTON, NEW MEXICO	7. UNIT AGREEMENT NAME
4. LOCATION OF WELL (Report location clearly and in accordance with any State requirements.* See also space 17 below.) At surface 1650' FEL 1650' FEL Section 12-T31E-R12N SAN JUAN COUNTY, NEW MEXICO	8. FARM OR LEASE NAME DAVE
14. PERMIT NO.	9. WELL NO. 9-8
15. ELEVATIONS (Show whether DF, RT, GR, etc.) 6264 Ground	10. FIELD AND POOL, OR WILDCAT NORTH DAKOTA
	11. SEC., T., R., M., OR B.L. AND SURVEY OR AREA 1650' FEL 1650' FEL Sec. 12-T31E-R12N
	12. COUNTY OR PARISH 13. STATE SAN JUAN NEW MEXICO

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF ☐

FRACTURE TREAT ☐

SHOOT OR ACIDIZE ☐

REPAIR WELL ☐

(Other) ☐

PULL OR ALTER CASING ☐

MULTIPLE COMPLETE ☐

ABANDON* ☐

CHANGE PLANS ☐

SUBSEQUENT REPORT OF:

WATER SHUT-OFF ☒

FRACTURE TREATMENT ☐

SHOOTING OR ACIDIZING ☐

(Other) ☐

REPAIRING WELL ☐

ALTERING CASING ☐

ABANDONMENT* ☐

(NOTE: Report results of multiple completion on Well Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Total Depth 7549'

Run 4 1/2" casing 234 joints 9.5 and 11.6 f casing 7523', landed at 7533 BCD.


Cemented first stage w/250 sacks 50-50 pozzol. Cemented second stage w/250 sacks 50-50 pozzol 8% gal & 12% per sack of gilsonite.

Fractured well w/30,000# 20-40 sand & 20,000# 10-20 sand 15 C C in all water & 5# per 1000 gals. J-111 Breakdown 1600#; Min Press. 3300#; avg. treating pressure 3200#

AIR 35 BPM BHP 1900#; SI after 10 min 980#

Logs: Pictured Cliffs 2850; Cliff House 4455; Point Lookout 5079; Gallup 6447;

Greenhorn 7147; Graneros 7802; Dakota 7338;

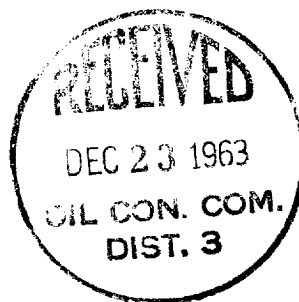

RECEIVED

DEC 20 1963

U. S. GEOLOGICAL SURVEY
FARMINGTON, NEW MEXICO

18. I hereby certify that the foregoing is true and correct
ORIGINAL SIGNED BY JOE C. SALMON

SIGNED

JOE C. SALMON

TITLE

DISTRICT SUPERINTENDENT

DATE

12-19-63

(This space for Federal or State office use)

APPROVED BY

TITLE

DATE

CONDITIONS OF APPROVAL, IF ANY:

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and, if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below, between and above plugs; amount, size, method of parting of any casing, liner or tubing pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.