

UNITED STATES
DEPARTMENT OF THE INTERIOR
GEOLOGICAL SURVEYSUBMIT IN TRIPLICATE*
(Other instructions on re-
verse side)Form approved.
Budget Bureau No. 42-R1424.

5. LEASE DESIGNATION AND SERIAL NO.

MOO-C-1420-1935

6. IF INDIAN, ALLOTTEE OR TRIBE NAME

UTE

7. UNIT AGREEMENT NAME

8. FARM OR LEASE NAME

CHACE UTE

9. WELL NO.

2

10. FIELD AND POOL, OR WILDCAT

Wildcat

11. SEC., T., R., M., OR BLK. AND
SURVEY OR AREA

Sec. 23, T31N, R16W

12. COUNTY OR PARISH

San Juan

13. STATE

NM

14. PERMIT NO.

15. ELEVATIONS (Show whether DF, RT, GR, etc.)

5636 GR

16. Check Appropriate Box To Indicate Nature of Notice, Report, or Other Data

NOTICE OF INTENTION TO:

TEST WATER SHUT-OFF

☐
☐
☐
☐

PULL OR ALTER CASING

☐
☐
☐
☐

FRACTURE TREAT

MULTIPLE COMPLETE

SHOOT OR ACIDIZE

ABANDON*

REPAIR WELL

CHANGE PLANS

(Other)

SUBSEQUENT REPORT OF:

WATER SHUT-OFF

☐
☐
☐
☐

FRACTURE TREATMENT

SHOOTING OR ACIDIZING

(Other)

REPAIRING WELL

ALTERING CASING


ABANDONMENT*

☐
☐
☒
☐(NOTE: Report results of multiple completion on Well
Completion or Recompletion Report and Log form.)

17. DESCRIBE PROPOSED OR COMPLETED OPERATIONS (Clearly state all pertinent details, and give pertinent dates, including estimated date of starting any proposed work. If well is directionally drilled, give subsurface locations and measured and true vertical depths for all markers and zones pertinent to this work.)*

Spud date: 5-17-78 9-7/8" hole, rotary mud drilled to 560'. 6-10-78 set 557' of 20# - 7" surface casing at 559' (below ground level) and cemented with 220 sacks of Class "B" cement with 2% CaCl and 1/4# of Flocele per sack. Cement circulated to the surface. 6-12-78 Drilled out from under surface (air drilling) with a 6 1/2" hole and continued air drilling to a depth of 2323' (measured from ground level) on 6-13-78 @ 8:31pm converted to mud drilling and on 6-14-78 commenced mud drilling a 6 1/2" hole on down to the total depth of 2580'. TD reached 12:38am 6-17-78. 6-17-78 ran logs: induction-electric & compensated neutron-formation density. Air drilling, sample analysis and log data were all interpreted as being unfavorable for a productive well.

Formation Tops (log tops) Log Datum 5' above G.L.
Point Lookout (Mesaverde) Surface
Mancas Sh (top not definite) 450' ±
Gallup sd zone 1652
Sanastee 1830
Dakota 2312
Morrison 2580
T.D. 2580

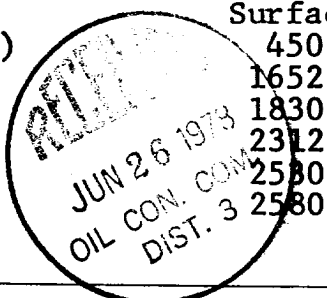

RECEIVED

JUN 23 1978

Continued on back

18. I hereby certify that the foregoing is true and correct

SIGNED

Raymond M. Cary

TITLE

President

DATE 6-20-78

(This space for Federal or State office use)

APPROVED BY

CONDITIONS OF APPROVAL, IF ANY:

TITLE

DATE

Instructions

General: This form is designed for submitting proposals to perform certain well operations, and reports of such operations when completed, as indicated, on Federal and Indian lands pursuant to applicable Federal law and regulations, and; if approved or accepted by any State, on all lands in such State, pursuant to applicable State law and regulations. Any necessary special instructions concerning the use of this form and the number of copies to be submitted, particularly with regard to local, area, or regional procedures and practices, either are shown below or will be issued by, or may be obtained from, the local Federal and/or State office.

Item 4: If there are no applicable State requirements, locations on Federal or Indian land should be described in accordance with Federal requirements. Consult local State or Federal office for specific instructions.

Item 17: Proposals to abandon a well and subsequent reports of abandonment should include such special information as is required by local Federal and/or State offices. In addition, such proposals and reports should include reasons for the abandonment; data on any former or present productive zones, or other zones with present significant fluid contents not sealed off by cement or otherwise; depths (top and bottom) and method of placement of cement plugs; mud or other material placed below; between and above plugs; amount, size, method of parting of any casing, liner or tubing, pulled and the depth to top of any left in the hole; method of closing top of well; and date well site conditioned for final inspection looking to approval of the abandonment.

U.S. GOVERNMENT PRINTING OFFICE: 1963-O-685229
GPO 8 37-499 887-831

6-17-78 Well was plugged according to oral approval from Ed Schmidt, USGS Engineer, Durango office. 6-15-78

Across Dakota 100' plug 2360-2260 18 sxs
Across Gallup 150' plug 1760-1610 27 sxs
Across base of surface 50' plug 585-535 9 sxs
30' plug and standard marker at top of surface casing 6 sxs. Dakota sand carries water.

313 Washington S.E. Albuquerque, N.M.

DATE MAY 1981 BY 7801

Log data for well 6-17-78. The well was plugged according to oral approval from Ed Schmidt, USGS Engineer, Durango office. 6-15-78. The well was plugged with 100' of cement plug across Dakota, 150' of cement plug across Gallup, 50' of cement plug across base of surface, and 30' of cement plug and standard marker at top of surface casing. The well is now abandoned and the site is conditioned for final inspection looking to approval of the abandonment.

Formation Top (not top)
Point Lookout (not top)
Karni 25 (not top)
Karni 25 (not top)
Karni 25 (not top)
Karni 25 (not top)
Karni 25 (not top)
Karni 25 (not top)